

SEPT 1982

E83-10263

HS 36-0019-1679
NASA CR-17052

THEMATIC MAPPER

THEMATIC MAPPER

THEMATIC MA



(E83-10263) THEMATIC MAPPER FLIGHT MODEL
PRESHIPMENT REVIEW DATA PACKAGE. VOLUME 3,
PART C: SYSTEM DATA Final Report (Santa
Barbara Research Center) 213 p
HC A10/MF A01

N83-26132

CSCL 14B G3/43

Unclas
00263

THEMATIC MAPPER


Prepared for
GODDARD SPACE FLIGHT CENTER
Greenbelt, Maryland 20771
CONTRACT NAS 5-24200

FLIGHT MODEL
PRESHIPMENT REVIEW
DATA PACKAGE
VOLUME III - SYSTEM DATA
PART C

Article IV -3A

HUGHES

HUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP

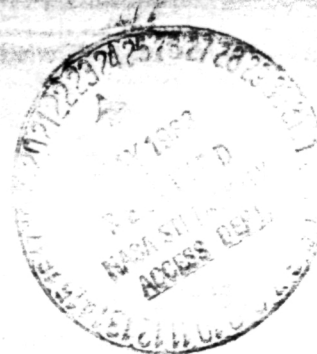

BEST AVAILABLE COPY

"Made available under NASA sponsorship
in the interest of early and wide dis-
semination of Earth Resources Survey
Program information and without liability
for any use made thereby."



Prepared for
GODDARD SPACE FLIGHT CENTER
Greenbelt, Maryland 20771
CONTRACT NAS 5-24200

SEPT 1982

FLIGHT MODEL
PRESHIPMENT REVIEW
DATA PACKAGE
VOLUME III - SYSTEM DATA
PART C

Article IV -3A

HUGHES

HUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP

Hughes Ref No. D4598-

ORIGINAL PAGE IS
OF POOR QUALITY

4.0 SUMMARY OF LIENS

Data contained in this section summarizes the Failure Report and Request for Deviation/Waiver data presented in each of the subsystem sections of Volume II. Copies of liens written against the system (complete instrument) are also included herein.

ORIGINAL PAGE IS
OF POOR QUALITY

4.1 FAILURE REPORTS

The following pages list each Failure Report associated with the Flight Model Thematic Mapper, with the symptom and cause of the failure, and corrective action taken. Each Failure Report listed is keyed to the major subsystem against which the failure occurred.

Copies of Failure Reports for failures occurring at the subsystem level are included in Volume II of this data package. Copies of reports for failures occurring at the system level follow the listing in this section.

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F0372	Multiplexer	003	Serial Data output pattern has wrong format	Operator error	Reworked/retested unit Operator instructed to check alternate wiring.	C
FL	F0373	Multiplexer	003	A/D reference voltages of Band 1&5 were low.	Operator error	Reworked/retested unit Operator instructed to verify wiring to blue print.	C
FL	F0374	Multiplexer	003	At input buffer DC response test, output readings of all sensors are wrong.	Workmanship	Reworked/Retested. Straightened all pins. Operator cautioned to use more care when working with hardware.	C
FL	F0381	Multiplexer	003	After incorporating SMA EO. No backup SMA clock output	Rough Handling	Test operator and rework operator were cautioned to use more care.	C
FL (ALL)	F0527	Prime Focal Plane	ALL	High resistance backside contact at interface between silicon detector and Quartz substrate.	Design	New detectors will be fabricated for Protoflight using Waldon 3020 conductive epoxy.	C
FL	F0530	Telescope/ Main Frame	002	Out-of-Flatness condition (less than 0.001 inch) between Telescope Mounting Flange and Main Frame mounting surface.	MFG Procedure	Assembly technique has been changed to bond the mirror after the telescope has been bolted to its interface.	C
FL	F0552	Telescope/Main Frame	002	Specification Requirements were higher than required for operation within system specifications.	Test Procedure	MTF acceptable per Waiver W-136.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F0553	Relay Optics Assy.	003	Inchworm No. 2 command on test box (using Flight IPS) Yields no motion in "down" (retract) direction.	Test Equip.	Engr. erroneously marked up drawing. He was instructed to use more caution when making up future drawings.	C
FL	F0554	Aft Optics Assy.	003	SLC functional test, AHR 51512 operation 173,001 P/N 3 to 11, 4 to 12.	MGF Procedure	All parties concerned have been advised of the importance of cross-checking assembly P/N's and S/N's against the ABCTR's.	C
FL	F0555	Relay Optics Assembly	003	Inchworm No. 2 and on test box yields low MV readings perstep during first steps in either direction, subsequent steps in "down" direction are small approx. 1 to 2 MV.	Test Equipment	Engr. erroneously marked up drawing. He was instructed to use more caution when marking up future drawings.	C
FL	F0560	Prime Focal Plane	203	Ch. 1 and 7 were pegged at -25V. Ch's 2,3,5 and 8 exceed wide band noise spec.	Defective parts	Fets replaced and retested successfully. Corrected action for defective FETS not required.	C
FL	F0581	Prime Focal Plane	201- 207	Led Current used for test to low.	Test. Proc.	Test Procedure changed to increase LED drive current to 35%. See ECR 1237101 to Rev. Box 16660.	C
FL	F0591	Cold Focal Plane	003	Coating witness sample failed scotch tape test after humidity test at SBRC.	Design	Witness samples were tested above design limits. Rev. D of drawing 50825 adds tolerances for temp. and humidity.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F0606	Electronic Module	201	Test spec. 16368 in error	No failure	Test Procedure error. EO9732 corrects spec. 16368.	C
FL	F0620	Prime Focal Plane	201	Crosstalk shields not adjusted correctly.	Workmanship	Oper. instructed to make sure proper adjustments are made before final testing.	C
FL	F0622	Prime Focal Plane	201	All 16 channels out of spec.	Test Proc.	EO 9897 corrects spec.	C
FL	F1035	Power Supply	002	Drawing error in 51619 (REV F)	Design	Drawing error. EO 2042A corrects drawing 51619.	C
FL	F1036	Power Supply	002	Component not installed per print	Assy/ Fab error	Instructed operator to follow component orientation as indicated on drawing and specification.	C
FL	F1302	SMA		Terminals E5, E1, E4, E8, are not marked as per drawing 3568902	Workman- ship	Technicians instructed to use caution when using terminals.	C
FL	F1305	SMA	5	Improper Cleaning by Vendor	No Failure	Vendor error. SCAR 63891 sent to vendor.	C
FL	F1306	SMA	007	Drawing was not clear	Design	Dwg. error ECR 873583 corrects drawing 3568985.	C
FL	F1307	SMA	--	Harness continuity failure	Work- manship	Assembler cautioned to use extreme care when performing the wiring operation.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F1308	SMA	008	Part was installed backward during assembly.	Assy/Fab error	Assembler cautioned to use extreme care	C
FL	F1322	SMA	005	BRDF testing showed on average total integrated scatter of 0.5%	Test Procedure	EO 64392 corrects drawing 3568899	C
FL	F1325	SMA	004	DAS internal component failure	Test Equipment	HS 236-7830 directs that DAS be red tagged to flag discrepancy and assure repair prior to next use.	C
FL	F1327	SMA	004	Frame to data station fixture shim out of spec.	Test Procedure	ECR 864797 correct problem	C
FL	F1328	SMA	004	TFE S,L,N,SME2; Rev. 2 Rev Scan out of spec	Test Procedure	Test personnel cautioned about sensitivity of shims. ECR 864799 clarifies shim procedure.	C
FL	F1329	SMA	004	Cross Scan RMS exceeded Spec.	Test Equipment	ECR 864796 and EO 13111 corrects test procedure 32015-1004	C
FL	F1330	SMA	004	Unit level out of spec.	Test Procedure	W-121 corrects problem	C
FL	F1342	SMA	004	Improper use of assy. tooling.	Assy/Fab error	Assembly personnel instructed in proper use of Assy. tooling.	C
FL	F1352	SMA	005	Inadequate polishing	Workmanship	Scattering tests to be performed prior to mirror. Acceptance from vendor.	C
FL	F1353	SMA	005	When "scotch clad" stripable protective coating per HMS 16-1768 was stripped from front mirror surface coating was damaged.	Cause unknown	Vendor error SCAR 63891 sent to vendor	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F1439	Power Supply	003	At initial application of voltage, input current was approaching limit set by TS 16518.	Assy/Fab error	Instructed operator to follow component orientation as indicated on drawing.	C
FL	F1666	Electronic Module	401	All channels on band 3 failed to meet transient frequency response req.	test set up	GAS Flow (N2) increased on FPA.	C
FL	F1667	Harness Assembly	101	Adjusted model 2005 voltage ref. to -1 500V, output was: +5.628V and should be 0.00 $\pm$ 0.3V.	Assy/Fab error	Personnel cautioned to review dwgs and EO to make sure hardware is correct.	C
FL	F1668	Electronic Module	101	Mean resistance of values determined in 4.3.2. and 4.3.3 not within spec.	Assy/Fab error	Technicians have been cautioned to use extreme care when installing components.	C
FL	F1669	Relay Optics	003	Left bank LVDT does not reverse right bank does not respond.	Work-manship	Technicians and Quality personnel instructed to use greater care when assy and inspecting hardware.	C
FL	F1717	Prime Focal Plane	103	Requirements of Para. 4.6 (frequency response) and para. 4.7 (wide band noise) are out of tolerance in 8 places.	Work-manship	Design and tooling has been changed to reduced stress in substrates due to handling.	C
FL	F1742	Telescope Assy.	001	Discoloration (reddish hue) observed on mirror surface.	Cancelled	MRB for disposition NCMR 280985	C
FL	F1744	Relay Optics	201	Transformer (T1) measures open at secondary circuit.	Unknown	Parts now sent to MRB for disposition.	C
FL	F1747 Spare	Relay Optics	--	Units would not meet spec (16072) holding	Design	Inchworm translators are now stored in dry nitrogen EO	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F1748 Spare	Relay Optics	--	Unit would not meet spec. (16072)	Test equip.	Tooling to be redesigned to prevent damage on future units.	C
FL	F1761	Prime Focal Plane	101	Offset limits out of spec. on eleven channels	Mfg. procedure	FL PostAmp board (P/N 5094-1A) was used for PF due to schedule considerations. Selects for current PWB had to be redetermined to be compatible with FL Band 1 PreAmp.	C
FL 1764 See Page 30							
FL	F1769	Electronic Module	201	Ch. 7 single ended output linearity defect.	Defective part	Due to tolerance buildup Hybrid had to be changed.	C
FL	F1774	Electronic Module	201	All 16 channels exceed max. gain of 20 DB for max. boost above the 100Hz gain.	Test Procedure	EO 9897 changes requirements and item is within spec.	C
FL	F1776	Electronic Module	201	All 16 channels exceed max gain of 20DB for max boost above the 100 HZ gain.	Test Procedure	EO 9897 changes requirements and item is within spec.	C
FL	F1781	Electronic Module	102	Pins 2,6 and 10 on U35 shorted together.	Assy/Fab error	Parts disposition on thru MRB ref NCMR #290489	C
FL	F1783	Electronic Module	102	No clock input to U8 (pin ~~2~~) ⁷ and U7 (Pin 1)	Design	EO 9902 corrects design	C
FL	F2240	Prime Focal Plane	102	Channels 7 and 1 wide band noise exceeds limit of 2.4 PA is approximately 3.5 PA.	Workman-ship	Band level Assy redesigned and operator cautioned to use greater care during Assy. operation.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F2241	Prime Focal Plane	203	Channels 1,2,8 wide-band noise exceeds limits of 2.4 PA.	Workmanship	Band Level(Assy. redesigned and oper. cautioned to use greater care during assy. operation.)	C
FL	F2387	Cold Focal Plane	201	Band 5 Ch 13 offset. No response to INI frequency.	Mfg. procedure	Improved static discharge precautions initiated.	C
FL	F2662	Prime Focal Plane	208	Channel 8 noise out of spec.	Test equipment	The test detector should have been changed. Personnel have been instructed to do so in the future.	C
FL	F2663	Prime Focal Plane	203	Ch. 7 transient response is out of spec.	Defective part	Replaced resistor for channel 7.	C
FL	F2664	Cold Focal Plane	201	Band 7 had 0.0 drain current and signal Ref. channels have the same voltage for all channels.	Test equipment	Defective meter replaced. Precautions initiated.	C
FL	F2665	Cold Focal Plane Assy.	201	Response output voltage out of spec.	Defective part	Defective detector replaced.	C
FL	F2666	Prime Focal Plane	208	Noise from channel 6 out of spec.	Unknown	Defective FET and associated substrate were replaced.	C
FL	F2667	Cold Focal Plane	201	No signal out of Band 5 Ch 3&8	Mfg. procedure	Improved static discharge	C
FL	F2668	Prime Focal Plane	401	Large amount of crosstalk observed on channels 14 and 15	Workmanship	Operator cautioned to use more care.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F2669	Prime Focal Plane	207-1	Ch 3 transient resp. is 1.25% @ bou sec S/B $\leq$ 1% @ 60, μ sec.	Design	Design problem unit accepted per W-119.	C
FL	F2722	Electronic Module	201	Observed improper waveform during test 16238 para. 3.3.4.	Workmanship	Operator instructed to use greater care when performing rework.	C
FL	F2723	Electronic Module	201	Observed improper current peak amplitude.	Mfg. Procedure	Planner instructed to use greater care and assure he has all applicable EO's, incorporated into his planning.	C
FL	F2724	Electronic Module	201	Phase offset unable to add properly.	Workmanship	Operator and inspector instructed to review planning more carefully to assure that they read all supplements.	C
FL	F2808	Multiplexer	15	Channels 11&12 shorted together	Workmanship	Operator cautioned to use more care in future.	C
FL	F2812	Multiplexer	17	Channel 4 DC restore, DC level changes.	Defective parts	Replaced hydrid,	C
FL	F2813	Multiplexer	16	Channels 9-17 no output	Defective parts	Replaced hydrid.	C
FL	F2814	Multiplexer	003	R1(MX11) overheating	Assv/FAB Error	Operator cautioned to use greater care.	C
FL	F2815	Multiplexer	003	B34 of connector is connected to U24-8 (MX11)	Wiring error	Operator cautioned to use greater care in assembly.	C
FL	F2816	Multiplexer	14	Channel 9 buffer has excessive gain.	Defective parts	Replaced Hydrid,	C
FL	F2817	Multiplexer	003	Conv. MSB output (52) has excessive fall time.	Test Procedure	Test operator instructed to ensure select components are temp. installed before test begins.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F2818	Multiplexer	003	Band Sel Bit 1 (C34) wave form incorrect.	Wiring error	Operator instructed to use greater care when performing rework.	C
FL	F2819	Multiplexer	003	Minor Frame sync. signal (C29) improper.	Workmanship	Operator and inspector cautioned to use greater care in future.	C
FL	F2820	Multiplexer	003	Ret on (C10) timing incorrect (MX08).	Assy/Fab error	Operator and inspector cautioned to use greater care in future.	C
FL	F2821	Multiplexer	003	Excessive common mode noise on buffer output ch.B .	Defective parts	Replaced hydrid	C
FL	F2822	Multiplexer	13 to 18	Rail voltage "B" test reads in excess of specs tolerance.	Test procedure	TP3569224/SCN 1 Test Procedure modified to relax limits.	C
FL	F2823	Multiplexer	14 to 18	Rail voltage "A" test point reads lower of spec.	Test procedure	Test Procedure modified to relax limits.	C
FL	F2824	Multiplexer	13,14	Rail voltage "A" test point reads in excess of spec.	Test procedure	Test Procedure modified to relax limits.	C
FL	F2825	Multiplexer	16	Sensor 2 input buffer has excessive droop in DC restore mode.	No failure	Passes higher assy. which has C tighter requirements.	C
FL	F3557	Multiplexer	003	J6 (back-up NRZ) output only .25 "P-P looking differentially across J6 pin 1 and 2	Defective parts	Defective IC replaced.	C
FL	F3660	Multiplexer	003	Band 1 sensor 8 fails DC response test.	Test set-up	Operator instructed to use greater care when mating connectors.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F3864	Power Supply	002	Incorrect lead indexing observed on redundant relay K-3.	Assy/ Fab error	Instructed operator to follow component orientation as indicated on drawing.	C
FL	F3865	Power Supply	004	During Eng. evaluation side using an external pulse generator, mini-inverter failed in high input current mode. Smoke was observed.	Test setup	No further requirement to use an external pulse generator on this or any other Power Supply.	C
FL	F3866	Power Supply	004	Unit demonstrated greater than 375 watts input during pre-vib, short form test.	Test Proce- dure	Remove maximum input Power requirement per SCN -3 to ts. spec. 16603.	C
FL	F3867	Power Supply	004	Unit failed post vibration short form test.	Def- ective parts	Replace all 908307-2 relays in Flight Supply with Relays tested to CDU-0702.	C
FI	F4253	Mutliplexer	003	Band 1 sensor 7 fails no threshold test.	Test equip- ment	Relay replaced and successful retest conducted.	C
FL	F4254	Multiplexer	003	Numerous X talk errors.	Design	Hardware was accepted per W-124.	C
FL	F4255	Multiplexer	003	Band 1 sensor 13 and Band 5 sensor 6 fails input buffer droop test	Design	Hardware was accepted per W-124.	C
FL	F4256	Mutliplexer	003	Band 1 sensor 7 failed input buffer A/C	Test equip- ment	Relay replaced and successful retest.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F4257	Multiplexer	003	Numerous X talk failures.	Design	Hardware was accepted per W-124.	C
FL	F4265	Multiplexer	003	Band 6 sensor fails A/D conversing test	Design	Hardware was accepted per W-124.	C
FL	F4266	Multiplexer	003	Band 1 sensor 1 and Band 6 sensor failed A/D threshold test.	Design	Hardware was accepted per W-124.	C
FL	F4267	Multiplexer	003	Band 6 sensor 1 failed A/D threshold test	Design	Hardware was accepted per W-124.	C
FL	F4268	Multiplexer	003	Numerous crosstalk failures.	Design	Hardware was accepted per W-124.	C
FL	F4831	Power Supply	004	Center tap current in mini primary winding of XFMR indicates 1 amp of pulsed current.	Wiring error	Operator and wire checker instructed to physically trace wire to termination point.	C
FL	F4832	Power Supply	002	Sync. pulse not observed on MAXI-BRD,	Wiring error	Instructed assembler and wire check inspector to follow wire to termination.	C
FL	F4833	Power Supply	002	During attempt to phase up pulse width on maxi-PWB no load condition.	Test-set-up	Instructed technician to have second technician verify test set-up before voltage applied.	C
FL	F4834	Power Supply	004	Center tap current in the maxi is exceeding 15 amps with no load on maxi redundant.	Workman-ship	Operator instructed to follow normal workmanship standards to avoid hazardous wire routing.	C
FL	F4835	Power Supply	002	Try to turn maxi up but it only turns "on" a little.	Assy/ Fab Error	Assembler and inspector instructed to follow drawing carefully and verify correct part.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F4836	Power Supply	004	While unit was operating at 35V bus in outgas mode it shut off after about four minutes and could not be commanded on.	Design	E02046A correct problem.	C
FL	F4837	Power Supply	004	When sync was turned "on", unit would not sync.	Rough Handling	Responsible mfg. supervisor has been informed by the REA as to the proper workmanship methods to use.	C
FL	F7295	Multiplexer	003	Band 2 sensors 4 and 13 failed crosstalk.	Design	Hardware was accepted per W-124.	C
FL	F7296	Multiplexer	003	Band 1 sensors 10 and 14. Band 2 sensors 4 and 14 failed cross talk.	Design	Hardware was accepted per W-124.	C
FL	F7299	Multiplexer	003	Band 2 sensors 4,5 and 14 fail X talk.	Design	Hardware was accepted per W-124.	C
FL	S8014	Electronic Module	201	Jumpers not to print	Workman-ship/Fab	Personnel cautioned to use extreme care when installing jumper wires.	C
FL	S8018	CFPA	201	Feedback loop Band 5 ch 13 measured open circuit when tested per supplement 1 ope. 1300 step 3.	Workman-ship	Operator was cautioned to use more care in applying and cleaning up epoxy.	C
FL	S8049	Electronic Module	201	Observed improper waveform during test.	Test set-up	Technicians cautioned to check test set-up prior to test.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8050	Electronic Module	201	Observed improper linearity data over temperature per spec.	Defective parts	Defective part replaced. PB informed of problem.	C
FL	S8051	Electronics Module	201	Phase Ramp; unable to adjust correctly.	Mfg. Proc./ Assy/ Fab	Operator instructed to use greater care to insure proper installation of value parts.	C
FL	S8058	Prime Focal Plane	102-1	Channel no. 1 output pegged at -25 VDC.	Workmanship	Tooling has been redesigned to prevent damage to substrate.	C
FL	S8084	Telescope Assy.	001	Sections of the inside diameter of the mirror broke during mounting of registration surface reference plate onto Primary Mirror.	Test Equipment	New tooling has been provided that does not clamp to primary mirror.	C
FL	S8101	Elec. Module and SMA	201	Partial system connected to TM Elec. Mod. Test set attempts at turning system resulted.	Test Equipment	Test Equipment Repaired.	C
FL	S8106	Radiative Cooler	003	Cooler Intermediate stage Platinum Resistance Temp. Sensor circuit at connector J-2 pin 29 to pin 31 shows open.	Unknown	Future models will be spot bonded to strengthen solder pad area per EO 04269A.	C
FL	S8108	Elec-tronic Module	003	This discrepancy was transferred to S8112 because of error. Wrong pins were			C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
L	S8117	Rad Cooler	003	Transfer to S8136 and consolidate with S8370.			C
L	S8118	Rad Cooler	003	No failure test eng. misread data.			C
L	S8125	Elec- tronic Module	003	J35 Pin F4 (signal ground Band 1 ch 10) open	Test set- up	Test technicians have been alerted to check mating of connectors more thoroughly.	C
L	S8126	Electronic Module	003	J30 Pin K4 (signal ground band 1 ch 15) open	Test set- up	Test technicians have been alerted to check mating of connectors more thoroughly.	C
L	S8134	Thematic Mapper	003	SMA heater and sun- shade sensor cable harness impedance measurement at P28 Pin 1 to Pin 5 is open S/B 31Ω, Pin 34 to Pin 36 is 13.9Ω S/b 25Ω.	Wiring error	Assembly technicians have been instructed to use proper test equipment.	C
L	S8140	Thematic Mapper		SMA +6.8V Power Supply #2 telemetry read 0V when Power Supply #2 was turned on.	Test set- up	Test technicians were cautioned to review test equipment configuration more carefully, especially switch positions, prior to filing Failure Reports.	C
FL	S8201	Prime Focal Plane	401	Diagnostic testing revealed that ground plane on even channel half band substrate (S/N 102-1) was not connected to signal return.	Unknown	Cross talk for channel 2 acceptable per Waiver W-123.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8202 Spare	Prime Focal Plane	201	Ch 6 wide band noise out of spec.	Unknown	Replaced Ch 6 FETS and adjusted crosstalk are within spec pretest data.	C
FL	S8205	Optical Assy.	201	During recheck of select rsistors and capacitors found ch #3 Band 5 to have oscillations.	Workman-ship	Nonrequired. Infrequently there are small differences in capacitors between having parts during selection and after part has been soldered to the basis.	C
FL	S8206 Spare	Prime Focal Plane	212	J1-16 to J1-1, J1-5, J1-23 out of spec.	Test equipment	Defected test lead was replaced.	C
FL	S8207	CFPA	201	No output Band 7 Ch 7	Workman-ship	Personnel instructed as to proper installation at PWB in housing.	C
FL	S8208	CFPA	201	Band 5 out of spec.	Design	Hardware accepted per W-135.	C
FL	S8225	CFPA	201	Band 5 Ch 9 input short to ground, Ch 11 no output signal.	Workman-ship	The arrays were destroyed during removal from FPA and no further analysis was possible.	C
FL	S8226	CFPA	201	Band 5, Ch.10, 12 difference between signal and Ref. off-set measured > ± 10 MV.	Unknown	Repaired with Ag epoxy per MRCO 393239.	C
FL	S8227	Electronic Module	201	Ch 4 failed to meet the pre-gain resistor (R90) selection requirements without using a component outside the select range	Test procedure	EO 3442A increases select range.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8228 Spare	Prime Focal Plane	210	Channel 7 out of spec.	Unknown	Tooling has been modified with insulating tape to prevent static damage.	C
FL	S8230	CFPA	201	Band 7 even detectors all have low output at 10HZ.	Mfg. procedure	Replaced detector	C
FL	S8283	Electronic Module	201	Ch 13 failed to meet pre-gain resistor (R87) selection requirement without using an out-of-selection component.	Test procedure	EO 3442A broadens select range.	C
FL	S8309	Electronic Module	201	Solder bridge between traces to U31 Pin 7 and U31 Pin 8.	Workmanship	Inspection personnel instructed to use greater care when inspecting solder operations.	C
FL	S8310	Electronic Module	201	TS16234 Para. 3.3.2.2 No -12V output.	Workmanship	Assembly Technician has been cautioned to review orientation device prior to solder.	C
FL	S8311	Electronic Module	202	Test PGM T12 records 5 failures in 2 (10 ⁶) cycles at 50°C.	Unknown	U17 (shift register) replaced.	C
FL	S8312	Electronic Module	201	Test PGM 8 fails word F output - RD7	Assy/Fab error	Mfg. and Quality personnel have been cautioned to use more care.	C
FL	S8313	Electronic Module	201	Failed para. 3.3.2.3 SBRC 12634 (AR-5) have excessive offset.	Workmanship	MFG and inspection personnel instructed to review drawings more carefully.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8314	Electronic Module	201	Fails to develop proper signal at U3-6 due to bad solder connection at U3-14.	Assy/Fab error	The responsible inspector has been notified and cautioned to exercise more care.	C
FL	S8315	Electronic Module	201	The all lamps on LED failed to turn on at the proper time in the CALL lamp seq.	Assy/Fab error	Inspection personnel instructed to use more care when inspecting parts prior to shipment.	C
FL	S8316	Electronic Module	102	'Crosstalk' AR 2-8 to AR 2-10.	No failure	FR open in error.	C
FL	S8317	Prime Focal Plane	201	Channel 4 noise is 2.6 PA; channel 9 noise is 2.9PA.	Unknown	Hardware accepted per W-116.	C
FL	S8318	Prime Focal Plane	401	Ch's 1,5,9,13 exhibit out of spec transient/frequency response and high.	Unknown	Hardware accepted per W-123.	C
FL	S8319	CFPA	101	Ch.10 exhibits no response to injected signal ch. 12	Workmanship	Assy. personnel instructed to use greater care when doing rework with epoxy.	C
FL	S8320	Electronic Module -	201	Output low of Channel 11 (Hybrid U4) short circuited (~8 ohms) to signal ground.	Workmanship	Mfg. personnel have been cautioned to use greater care when solder components.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8321	Electronic Module	201	AT S2KHZ Frequency response was: 2.24 db (should be -2.50 to -3.01) ch 6 only	Workman- ship	Hardware accepted per W-120, Oper. cautioned to use greater care.	C
FL	S8322	Prime Focal Plane	201	Ch. 5,13,14,15 and 16 exceeds transient response.	Work- man- ship	Hardware accepted per W117, Oper. cautioned to use greater care in assembly.	C
FL	S8323	Prime Focal Plane	201	No continuity between J2-16 and J2-10 on evenside of preamp Assy.	Assy/ Fab/ Error	Test procedure had been changed to check contin- uity between all grounds Ret. Pins.	C
FL	S8324	Prime Focal Plane	401	Ch's 1,5,9 and 13 Frequency Response out of spec.	Work- man- ship	W-115 accepts hardware. Oper. cautioned to use more care when performing Assembly operations.	C
FL	S8325	Electronics Module	201	Ch's 1,7,8,13, 15 DC offset out of spec.	Test Pro- cedure	ECR #TM 2512/01R1 corrects TS 16597.	C
FL	S8326	Electronics Module	201	Ch 6,8 out of spec.	Test Pro- cedure	ECR #TM 2512/01R1 corrects TS 16597	C
FL	S8327	Electronics Module	201	Ch 5,8,12,13 out of spec	Test Pro- cedure	ECR #TM 2512/01R1 corrects TS 16597.	C
FL	S8328	Cold Focal Spare Plane	301	Pins 15,16 show 16.6 Ω and .5 Ω shorts respectively - should be open.	Test Equip- ment	Text Box was rewired per switch legend. Drawing #77514.	C
FL	S8329	Electronics Module	201	Ch's. 1,7,8 out of spec. on offset	Test Proce-	ECR #TM 2512/01R1 corrects TS 16597.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed	19
FL	S8340	CFPA	201	Band 7, Ch 8 & 16 unable to set bias adjust per 16192 para 4.10.	Unknown	Wirebond puller was at fault. Wire bond puller has been repaired to prevent static discharge.	C	
FL	S8341	Electronic Module	101	Resistors R72 and R88 are reversed.	Work- man- ship	Personnel advised to use care when removing and reinstalling components.	C	
FL	S8342	Prime Focal Plane	201	Band 4, ch.16 wide band noise is 2.8, PA should be $\leq$ 2.4 pA.	Unknown	Hardware accepted per W-118.	C	
FL	S8343	Electronic Module	201	SMA voltages out of spec.	Test Proce- dure	EO 4180A and 4199A correct 16704.	C	
FL	S8361	Aft Optics Assembly	003	Shutter natural period has changed is presently out of spec.	Mfg. proce- dure	Planning changed on AHR	C	
FL	S8362	Aft Optics Assembly	003	Shutter natural period has changed is presently out of spec.	Work- man- ship	Operator cautioned to use more care.	C	
FL	S8363	Electronic Module	201	Channels R81 thru R96 out of spec.	Test Proce- dure	EO4059A corrects TP 16704.	C	
FL	S8364	Electronic Module	201	When main shutter on (CMD13) issued. The redundant shutter driver was not commanded off.	Assy/ Fab error	Mfg. Eng. supervisor informed of the error and has agreed to exercise greater care during future planning operations.	C	

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8363	Electronic Module	201	Kleeburger, Chs 1, 9,10	Work- man- ship	Assembly technician cautioned to check all wirings and connections thoroughly.	C
FL	S8367	Electronic Module	201	Shutter taps stops on turn on at 0°C Ref. per 139.5µs.	Work- man- ship	Test personnel instructed to be more careful when selecting resistors values.	C
FL	S8368	Electronic Module	101	J-24-5 to chassis read approx. 1.6m with slowcharge like a capacitor leading DV.M.	Torn In- sul- ation	Unable to determine cause of torn insulation.	C
FL	S8370	CFPA	202	FR transferred to FR 8136 and con- solidate with S8117.	Can- celled		
FL	S8371	Relay Optics	?	Inchworm would not respond to move command.	Test Equip- ment	Wearsaver in question was red tagged and will not be used until repaired inspected.	C
FL	S8378	Aft Optics Assy.	003	Resistance measurements per spec. 17068 were too high in some cases.	Mfg. Proce- dure	Inspect, personnel have been instructed to assure torque has been adjusted for drag allow- ance prior to torque operations.	C
FL	S8384	Electronic Module	201	Redundant Shutter Phase Lock Tele- metry word G Bit 6 reads incorrectly "Hi" when the re- dundant shutter function is com- manded off (CMO "of")	Assy/ Fab Error	Supervisor, assemblers and inspectors cautioned to use more care.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8387	Aft Optics Bulkhead	003	All 10K thermistor readings do not agree with spec.	Test Procedure	EO 4146A corrects TP 17068.	C
FL	S8390	Electronic Module	201	SMA + 28V out of spec.	Test Procedure	EO 4159A corrects TP 16704	C
FL	S8392	SMA	003	Power to SMA applied, per TP 32015-301; SMA did not operate.	Design	EO 4160 corrects test set design. problem.	C
FL	S8394	CFPA	201	Electrical shorts between FPW cables and radiative cooling structure.	Design	EO4173 corrects tolerance built up between FPW cable shields and cooler structure.	C
FL	S8395	TM		Attempt was made to bring TM up to full mode the TM FSI appeared to go into full current.	Test Set UP	Test personnel have been cautioned to use extreme care when working with test equipment and assure they leave test equipment in proper configuration after completed troubleshooting.	C
FL	S8405	See Page 30					
FL	S8407	Electronic Module	201	Ch. 5 R83 is out of spec.	Workman-ship	Mfg. personnel instructed to use greater care when removing and reinstating select resistors.	C
FL	S8438	Cold FPA	201	Band 5, ch's 10 and 12 exhibit excessively high out put during injected signal test.	Workman-ship	Operator to use greater care when making epoxy repairs.	C
FL	S8439	Cold FPA Spare	401	Pin 3 and Pin 13 do not meet spec.	Workman-ship	Operator cautioned to use more care in trimming of cable.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8440	Cold FPA	401	Chs 1,2,4,5,7,9,10 11,13, out of spec. for transient response; ch's 4,5,6,7,8,10,12, 14,16 out of frequency spec.	Defect- ive Parts	Waiver W-123 allows use of this assy.	C
FL	S8443	CFPA	201	Band 5, ch. 12 out of spec.	Test Equip.	Wire bond puller was found to be defective. Pull tester was replaced.	C
FL	S8446	Electronic Module	201	Channel 8 pegged	Work- man- ship	Inspection personnel have been instructed to use greater care.	C
FL	S8447	Electronic Module	401	Ch's 2,3,4,5,6 7,8,10,11,12,14, 15, and 16 fail to meet specs.	Test set- up	Gas Flow (N2) increased on FPA. Insp. Personnel instructed to use greater care when inspecting solder operations.	C
FL	S8456	Electronic Module	201	Word G failed once during data cycling A+0°C.	Work- man- ship	Insp. personnel in- structed to use greater care when inspecting solder operations.	C
FL	S8460	Electronic Module	?	Signal was inverted at Pins 177,178,175, 176,179,180,173 and 174	Assy/ Fab error	Mfg & Insp. personnel instructed to review drawings with greater care to assure proper installation of components.	C
FL	S8469	RAD Cooler	003	Excess 60 HZ noise on band 5&7 channels.	Test set-up	Test personnel instructed in proper techniques to be employed in grounding low level circuitry.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F0170	SMA	5	Signal Return shorted	Workmanship	Tech. cautioned to use greater care in the positioning & utilization of heatshrink sleeving.	C
FL	F3658	Multiplexer 19		Fails skps 128-131. Threshold doesn't change. All other skips okay.			
FL	F3868	Power Supply	004	Unit failed Thermal cycle performance test.			0
FL	F4252	Multiplexer	19	No A/O conversion			0
FL	F5771	TM		Band/Channel 9 is dead. Band 4 odd channels have coherent noise which is observable on video display.	Test Set-Up	Coherent noise problem was due to coupling between unused LED's and Band 4. This condition was corrected by grounding unused LED's.	C
FL	F5772	Rad. Cooler Assy.	003	Bands, DET 9 Video signal appears inverted at SIU.	Test Set-Up	Test equip.cable had two terminations reversed. If this were discovered prior to two hours after test initiation no Failure Report would be required.	C
FL	S8102	Elect. Mod. & SMA	201	Using redundant Power Supply w/partial mode loads (8.3 Amps Avg) after 2 hours operation @ 28 VDC input. A shutdown and subsequent restart occurred.			0
FL	S810/	Elect. Module	003	J24 Pins 5&6 +1-20V return reads .66 ohms to chassis ground.	Design	ECA 272 2/01 lengthens sleeving and hat covers screws.	C

ORIGINAL PAGE IS
OF POOR QUALITY

24

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
----------------	---------	-----------	----------	---------------------	-------	-------------------	-----------------------

FL	S8109	Electronic Module	003	Pin P1 on J10 and J13 should read approx. .7 ohms between them. They read open.	Test Set Up	Configuration not appropriate for test. Engineers are cognizant of the problem and will review set up more carefully.	C
----	-------	-------------------	-----	---	-------------	---	---

FL	S8110	Electronic Module	003	Pin 14 on J26 should read 1 ohm max. and it reads 38.7K ohms.	Defective parts	ECA 2722101 will standarize mounting procedure and will prevent similar discrepancies.	C
----	-------	-------------------	-----	---	-----------------	--	---

FL	S8112	Electronic Module	003	J24 Pins 11,12, 29,30,31,32 read 86.35K ohms to chassis ground and should read > 10 mag ohms.	Unknown	ECA 2722 will standize this mounting procedure and will prevent future occurence.	C
----	-------	-------------------	-----	---	---------	---	---

FL	S8116	SM Electronics	003	Chassis ground shorted to unipoint -P26 Pins 13 and 14 reads. 4.5 ohms to chassis ground.	Workman-ship	Supervisor was instructed to inspect for this condition and stagger shield terminations.	C
----	-------	----------------	-----	---	--------------	--	---

FL	S8124	Rad Cooler Assy	201	Cold Stage heater does not control. Power remains applied to heater regardless of PRT resistance no +1-20 On +1 -18V on output of cable W5061 and safhold heater 1 was 11.3V instead of 28.V J24 filter started getting warm. Kepco drew	Test Set-up	Eng. was cautioned to review test set-up prior to application of power.	C
----	-------	-----------------	-----	--	-------------	---	---

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8128	Electronic Module		Zero degree Ref. to (Q5 Q0 turn- around) should be 5.30 +/- .50 sec. and it read 7.8 m.sec.			0
FL	S8129	Prime Focal Plane		Zero degree Ref. to Q5 (Q5 Q0 turn- around) should be 5.30 +/- .50 sec and it read 7.8 m sec.			0
FL	S8130	Prime Focal Plane		Cal Lamp 2 is drawing 109.4 mas and should draw 108 mas and Cal Lamp 3 is drawing 110.1 mrs and it should draw 108 mas.	Test Set- Up	ECR 972732 will update data base.	C
FL	S8131	TM		One bit is not operating properly when putting telemetry in the data stream.	Test Equip- ment	No failure, test personnel informed to trouble shoot Test Equipment before initiating FR.	C
FL	S8133	Elec. Module		After fusible links switches have been closed and 2.3 volts are read on test box (which is ok) and then all switches are opened at 16 to 20 volt remains and slowly decrease to zero (3 min. period)	Test Set- Up	Shorting the leads together just prior to connection to the item under test zeroed the DVM and produced acceptable readings.	C
FL	S8136	Rad Cooler Assy	003	Band 5 ch 9,10,12 have 1.17mV 1.44mV, 0.605mV wide band noise. Noise is approx. 200 KHz oscillation with popcorn noise on Ch 9&10.			0

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8139	Electronic Module	202	Control temp. voltage out of spec.	Test	EO 4365A changes tolerances so that previous readings are now within spec.	C
FL	S8143	Rad Cooler Door Assy	003	Motor when electrically activated will not move door open or closed.	Assy. Fab./ Error	Removed motor 51258 S/N 004. Installed motor 51258 S/N 001. Retested per 16912. Vendor will take precautions to prevent similar problems from reoccurring.	C
FL	S8180	Electronic Module	202	"Temp Error" voltage out of tolerance.	Test Pro- cedure	EO 4366A changes tolerances so that previous readings are now within spec.	C
FL	S8209	Cold Focal Plane	301	Band 7 ch. 6 feed- back cap appears shorted - does not respond by rolling off at high frequencies.	Work- man- ship	Technicians were cautioned to use extreme care.	C
FL	S8211	Prime Spare Focal Plane	501	Ch 15 no response DC offset is adjust- able, high noise with 1/f noise evident.	Unknown	Waiver W-154 will correct problem.	C
FL	S8212	Prime Spare Focal Plane	501	Ch 1,5,7,15 out of spec. Ch 9,13 out of spec.	Work- man- ship	Waiver W-155 will correct problem.	C
FL	S8218	Cold Spare Focal Plane	301	Drain currents for bands 5&7 out of spec.			
FL	S8229	Prime Focal Plane	212-1	Channels 1&2 exhibit excessive noise after repeated changes of FETS.			0

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8231	Prime Focal Plane	211-1	Ch. 1 fails to meet transient response requirements.	Design	Waiver W-157 will correct problem.	C
FL	S8372	Electronic Module		Redundant shutter would not phase-lock.			0
FL	S8401	Prime Focal Plane	101-1	Frequency response is +.6dB at 20 KHZ should be +.1 to -0.9 dB	Design	Waiver W-158 will correct problem.	C
FL	S8461	Cold Focal Plane	301	Band 7, ch. 7 shows 10 M ohm short to ground at Fet Gate.	Workman-ship	Assembly Technicians were cautioned to check for this type of discrepancy during manufacturing operations.	C
FL	S8369	Scan Mirror Assy.	004	Looking into SMA P2 M break-out box, pin 13 reads 84K Ω to chassis w/SME J2/SAM P1 de-mated.	Test set-up	No Failure - readings were found during trouble-shooting operations.	C
FL	S8127	TM	TM		Workman-ship	Caused by Failure to install insert in cable connector. The technicians have been advised of this discrepancy and cautioned to prevent a reoccurrence of this problem.	C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8213 Spare	CFPA	301	Band 7 Ch 7+15 out of Spec.			0
FL	F5774	TM	003	IFOU sizes too large and response to line source 2 IFOU's from center of detector exceeds 1%.			0
FL	F5776	TM	003	Bands 1 and 2 show secondary peaks in sensitivity well away from the nominal channel centers. (Largest second peak in Band 1 Det. 1 about 10% of peak signal + 13 IFOU's away).			0
FL Spare	S8219	Cold Focal Plane	301	Band 7 Ch 10 no response to injected signal @ all frequency.	Design	Removed crosstalk shield and insulated parts per 4464A.	C
FL	F5777	TM	003	Bands 5&7 are 26.25 IFOU's apart spec. is 26.0 ± .2 IFOU's (This FR is a result of Post-Test Examination of test data).			0
FL	F5778	TM 51065	003	Band 1 videosignals from detectors 8,10,11,14&16 shows large offsets. (Band 4, DET 16 has same problem) in the dark vidver collects.			
FL	F5779	TM 51065	003	Band 1 video exhibits unacceptable coherent noise levels.			
FL	S8464	Elec. Module 50904-1		Band 1 offsets out of spec. Should be -4.00 ± 0, 20UDC. Are Ch: 3-426U, no failure 4 -4.46, 6 -4.34, 10 -717, 14 - 4.23, 15 -4.55.	No New select resistors Failure were installed. Retested successfully on 6-28-82		C

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8150	Rad Cooler Door Assy.		SHC screw, was noticeably loose. After X-Axis vibration, 2 FL. These screws fasten the electromagnet brackets to the door assy. There are also 4 other fasteners for these brackets.	Design	Spot bonding screws after torquing to prevent loosening. Washer was changed from small pattern to large pattern to increase rigidity. EO 4528A.	C
FL	S8021	Elec. Module	202	When switching from one serial receiver to the other, a move command is sent to actually move the door also when a close command (TM:134) is first sent in the redundant configuration, the cooler door moves.			
FL	S8145	Rad Cooler Door Assy.	003	Outgas position cannot be adjusted to meet Para. 3,2,4.4 Spec. 16912. Rev. C.	Design	EO 4457A caused resistor value in timing circuit to match motor speed and gearing/backlash characteristics.	C
FL	S8158	TM 51065	003	Change in noise level in band 3, channel 12. Value changed from approximately .5 counts RMS noise to 1.0 counts RMS noise.			
FL	S8160	TM	003	Excess noise band 5 ch 7-9.3 KHZ coherent noise. Should be no observable coherent noise.			
FL	S8162	TM	003	Greater than 0.5% variation between channels in spectral matching test. Band 1 0.65%, Band 4 1.07%.			
FL	S8163	TM	003	Band 3 Detector 4 low output; during set-up for 8L07.(intermittant)			

ORIGINAL PAGE IS
OF POOR QUALITY

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
.	S8167	TM	003	When the Mapper is turned on with the SME and shutter on at the same time the shutter bangs.			
.	S8168	TM	003	Lowgrain in Band 6: channel 11, 28% low; channel 3, -2% low (channel 2, 9% high; channel 4, 7% high)			
.	F1764	Electronic Module	201	All 16 channels exceed Max. gain of 20DB for Max Boost above the 100 Hz gain.	Test Procedure	EO 9897 changes require- ments and item is within spec.	C
.	S8405	Rad Cooler	201	Hi noise Ch. 8	Unknown	Hybrid replaced.	

ORIGINAL PAGE IS
OF POOR QUALITY

FAILURE REPORT ANALYSIS

(Addendum for Pre-Shipment Review Meeting)

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	F2369	TM	003	During Post Z Axis SRT, LVDT 3 indicated inchworm motion.	No Discre- pancy	Failure Report was opened to document LVDT motion. Inch- worm repositioned optics.	0
FL	F1787	TM	003	No readings for cold preamp (TLM) tempera- ture and the isolated -19 volts (TLM).	Work- man- ship	Bent connector Pin was straightened and technicians cautioned to use care when mating/demating connectors.	C
FL	F2717	TM	003	Square wave response is low. Approx. 0.34 to 0.36 after rework. Prior to rework the values were approx. 0.40 to 0.42.	Work- man- ship	Loosening and re- torquing of bolts combined with lapping of surfaces to relieve stresses, allowed successful realignment.	C
FL	F2718	TM	003	No readings for TM baseplate telemetry at J15.	Un- known	Cause is unknown. W173 authorizes use as is.	C
FL	F2719	TM	003	Relay Optics Tele- metry channel appears to have a short circuit to ground.			0
FL	F5780	TM	003	Signal (video) output of Band 5, detector 10 is approx. 50-60% of all other Band 5 detectors. Band 5, Det. 10 noise level appears high.			0
FL	S8149	TM	003	When door is commanded to open from closed position, it sporadically will require two commands instead of one to the outage position.	Mfg.	Limit switch was readjusted. Technicians now understand adjustment procedure.	C

ORIGINAL PAGE IS
OF POOR QUALITY

FAILURE REPORT ANALYSIS

Model Level	FR #	Unit Name	Unit S/N	Symptom/Description	Cause	Corrective Action	Status Open/Closed
FL	S8159	TM	003	MUX 1 data does not arrive at Demux.	Test Equip-ment	Replaced defective cable W4004/P8. Discrepant cable repaired.	C
FL	S8161	TM	003	Shutter data is dark. S/B 2 to 5 count range, is from 28 to 255 for channel 9 of Bands 3,4,5 and 7.			0
FL	S8169	Optical Assembly	003	Resistance between mounting foot #2 and Aft Optics Bulk-head is 62.0 milliohms, S/B $\leq$ 15 milliohms.	Test Set-Up	Planning has been changed to show reconnection of ground straps prior to performing resistance checks.	C
FL	F2375	TM	003	Band 6, Channel 1, low signal from calibrator in gain linearity test.			0
FL	F2370	TM	003	Band 6 output constant at 85 counts for all four detectors.	Drawing Error	EO 4686A corrects dwg. error.	0
FL	F2385	TM	003	U3 $\pm$ 15V regulator The -15.0V output failed to current limit.	Drawing Error	EO 4686A corrects dwg. error.	0

ORIGINAL PAGE IS
OF POOR QUALITY

ORIGINAL PAGE IS
OF POOR QUALITY

TM

P/N 51065

FLIGHT Failure Report No.			PROTOFLIGHT Failure Report No.		ENGINEER Failure Report No.	
Open	Closed		Open	Closed	Open	Closed
	F2375	F1787		F0544		F0504
F2369	F2385	F5777		F0551		F0505
F2370	F2718	F2717		F0573		F0508
F2369	F5771			F1739		F0510
F2370	F5772			F1740		F0511
	F5778			F2636		F0513
F5774	F5779			F2644		F0521
F5776	S8101			F2691		F0532
	S8107			F2709		F0533
S8167	S8127			F2765		F2714
	S8131			F2771		F2715
	S8134			F2772		F2745
	S8158			F2773		F2747
	S8160			F2774		F2748
	S8161			F2775		F2791
	S8163			F2776		F5170
	S8168			F2777		F5181
				F2793		F5184
				F2794		F5185
				F2795		S8009
				F2799		
				F5171		
				F5172		
				F5176		
				F5180		
				F5182		
				F5187		
				S8093		
				S8300		
				S8448		
				S8453		
				S8454		

SANTA BARBARA RESEARCH CENTER
A Subsidiary of Hughes Aircraft Company
INTERNAL MEMORANDUM

TO: D. E. Sauers
CC: W. D. Adams
L. Altman
DATE: 24 June 1982
REF: PE 137:82
FROM: L. O'Connell
SUBJECT: Corrective Action for
Failure Report No. P5772
BLDG. B11 MAIL STA. 39
EXT. 6357

Attached is a copy of subject Failure Report and QCHR ES 67093 for your information and files.

At this time contract quantities of Thematic Mapper hardware are complete and no follow-on is anticipated. However, test equipment and cable fabrication are common to all programs and Inspection/Test personnel should be alerted to make sure applicable hardware is fabricated and wrung-out per applicable drawings and schematics.

Please inform Inspection/Test personnel under your cognizance of subject discrepancy and review your workmanship standards with them so they understand the importance of assuring that cable terminations are per print.


L. O'Connell
Reliability Manager
Thematic Mapper Program

/1bg

ORIGINAL PAGE IS
OF POOR QUALITY

F 5772

1. PROGRAM NAME AND NUMBER THEMATIC MAPPER PL1102		2. GLA F1		3. 12002L 1111		4. TIME OBSERVED MO MAY DA 20 YR 82	
5. HARDWARE LEVEL WHEN FAILURE WAS OBSERVED ☐ SPACECRAFT ☐ SYSTEM		☐ SUBSYSTEM ☐ UNIT		☒ ASSEMBLY ☐ SUBASSEMBLY		☐ MODULE ☐ MICAM ☐ CARD ☐ PART	
6. EQUIPMENT IDENTIFICATION NAME RADIATIVE COOLER ASSY		PART NUMBER 52100		S/N		MANUFACTURER SPRC	
7. SUBSYSTEM RADIATIVE COOLER ASSY		PART NUMBER 52100		S/N		MANUFACTURER SPRC	
8. UNIT CPPA PREAMP ASSY		PART NUMBER		S/N		MANUFACTURER SPRC	
9. ☐ ASSEMBLY ☐ SUBASSEMBLY		10. ☐ MODULE ☐ MICAM ☐ CARD		11. OTHER		12. TEST WHEN FAILURE WAS OBSERVED ☐ DEVELOPMENT ☐ IN-PROCESS ☐ QUALIFICATION ☐ ACCEPTANCE ☒ INTEGRATION ☐ SYSTEM ☐ LAUNCH OPERATIONS	
13. ENVIRONMENT WHEN FAILURE WAS OBSERVED ☒ AMBIENT ☐ EMI/RF		☐ RADIATION ☐ VIBRATION		☐ TEST ☐ THERMAL VAC		14. DESCRIPTION OF FAILURE BANDS DET 9 VIDEO SIGNAL APPEARS INVERTED AT SIU, SEEM LIKE 141/4 DIFFERENTIAL SIGNAL INVERSION SOMEWHERE IN SIGNAL PATH. RADI-COOLER PRE AMP; AOTS; SIU FRONT END.	
15. TEST PROCEDURE TP32C15-504		16. ORIGINATOR SIS		17. ORG G. PLANS		18. DATE 22-42-82	
19. VERIFICATION AND FAILURE ANALYSIS The input to AOTS was correct polarity and the input to the SIU was inverted. The output of the rate was checked and it was correct. This left the cable to be checked. The cable had pins K4 and K5 reversed.		20. FOLLOWING REWORK/RETEST REQUIRED ☐ REWORK/RETEST NOT REQUIRED BECAUSE		21. FAILED ITEM NAME AND PART NUMBER cable 45533 between AOTS		22. CONTINUATION SHEET USED ☐	
23. REWORK/RETEST ACTION TAKEN PINS K4 & K5 EXTRACTED AT PIIL (SIU END) AND REINSERTED TO PROVIDE PIN TO PIN RINGING		24. LIST ALL PARTS REPLACED PART NUMBER		25. CKT SYM		26. PART LOT NUMBER	
27. DATE CODE		28. MANUFACTURER		29. PROBABLE DEFECT		30. ANALYSIS NUMBER	
31. REWORK BY		32. ORG		33. DATE		34. RETESTED BY	
35. ORG		36. DATE		37. CONTINUATION SHEET USED ☐		38. CAUSE AND CORRECTIVE ACTION TEST EQUIPMENT CABLE HAD TWO TERMINATIONS REVERSED. THESE WERE PREVIOUSLY REVERSED FOR A PRELIM TEST AND WERE NOT REVERSED TO ORIGINAL POSITIONS AFTER COMPLETION. IF THIS WERE DISCOVERED PRIOR TO TWO HOURS AFTER TEST INITIATION, NO FAILURE REPORT WOULD BE REQUIRED. TEST PERSONNEL HAVE BEEN ADVISED TO	
39. DOCUMENT IMPLEMENTING CORRECTIVE ACTION		40. BASIC CAUSE OF VERIFIED FAILURE ☐ DESIGN ☐ ENVIRONMENTAL ☐ DEFECTIVE PARTS ☒ PRIMARY INDUCED		41. TEST EQUIPMENT ☐ TEST PROCEDURE ☐ TEST SET-UP ☐ UNKNOWN ☐ NO FAILURE		42. MFG PROCEDURE ☐ ASSY/FAB ERROR ☐ WORKMANSHIP ☐ FAILURE CLASSIFICATION ☐ CRITICAL ☐ MAJOR	
43. RESPONSIBLE ENGINEER D. J. S. J.		44. ORG 22-42		45. DATE 22-42-82		46. CONTINUATION SHEET USED ☐	
47. RELIABILITY		48. ORG 22-42		49. DATE 22-42-82		50. CONTINUATION SHEET USED ☐	

ORIGINAL PAGE IS
OF POOR QUALITY

HUGHES

HUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIA

SPACE AND COMMUNICATIONS GROUP

**FAILURE REPORT
CONTINUATION SHEET**

PR SERIAL NO.

F5772

CONTINUATION SHEET LETTER

*LABEL FIRST CONTINUATION SHEET USED 'A', SECOND 'D', AND SO ON

IDENTIFY ENTRIES BY REFERENCING PR BLOCK NUMBER IN COLUMN, DATE EACH ENTRY.

ADDITIONAL PR
CONTINUATION
SHEET(S) USED

☐

30 RING CABLES OUT AS PART OF THEIR TROUBLESHOOTING
MODE PRIOR TO INITIATING FAILURE REPORT.

This is the first occurrence of subject discrepancy. In addition, contract
quantities of subject test cables have been fabricated and no follow-on test
cables are scheduled for fabrication. Therefore further corrective action
will not be taken at this time. *William J. Williams 6-17-81*

ADDITIONAL CORRECTIVE ACTION HAS BEEN TAKEN
VIA EDC No. PE 137:82, DATED 6/24/82. (COPY
ATTACHED) *William J. Williams 6/24/82*

HUGHES

QUALITY CONTROL HISTORY RECORD

5712

CLA	ACT DETAIL	PART NUMBER	PART SER NO	PART NAME	NEXT ASSY	PROJLT/MODEL	H R SER NO.
5330	GMB-131	3569497-21	082	CABLE W5036	—	H9236/PRG	ES 67093
EV 10.5 NO	ENGINEERING CHANGE DOCUMENTS				QTY.	WORK AUTHORIZATION NO	PLANNER/REQUESTER
N/C REA					10 1	11 —	E.H. Sackleben
DATE	OPN NO	QUALITY HISTORY			DATE	ACC	INSPECTION
10/17/79	10	QA Screen Planning			10/17/79		
	11						
	12						
	13						
	14						
	15						
	16						
10/17/79	30	Snap. of op. 220 complete			10/17/79		
	31						
	32						
	33						
	34						
	35						
	36						
	37						
	38						
	39						
	40						
	41						
	42						
	43						
	44						
	45						
	46						
	47						
	48						

ORIGINAL PAGE IS
OF FOUR QUALITY

HUGHES

QUALITY CONTROL HISTORY RECORD

5772

10-1-80
110

ES 67093

SLA E330	ACC'T DETAIL	PART NUMBER 3569497	PART SER NO 002	PART NAME 5036	NEXT ASSY	PROJECT/MODEL TM	W.R. SER. NO. ES 80000
REV / C S NO	ENGINEERING CHANGE DOCUMENTS				QTY 1	WORK AUTHORIZATION NO	PLANNER/REQUESTER CONNER
INSR RY	DATE	OPN NO	QUALITY HISTORY		DATE	ACC BY	INSR RY
14	15	16	17	18	19	20	21
			1				25
1/27/80		1	2				26
			3				27
			4				28
			5				29
			6				30
			7				31
			8				32
			9				33
			10				34
			11				35
1/23/80		2	12				36
			13				37
			14				38
			15				39
			16				40
			17				41
			18				42
			19				43
			20				44
			21				45
			22				46
			23				47
			24				48

ORIGINAL PAGE IS
OF POOR QUALITY

OPERATION INSTRUCTION SHEET A

S'XS, 11 0 of 2

C/I NO

S/N 002

MODEL		CONTROL ITEM		NEXT ASSEMBLY		PART NAME		CHG. LTR.		PART NO.	
						CABLE W5036		REA (-)		3569497-24	
MATERIAL REQUIRED PER ONE PIECE						EFFECTIVE EO'S					
(SEE KIT REQUISITION)											
WORK ORDER INFORMATION						O.I.S. REVISIONS					
MII/WO NO		CA NO E330-GMB-131				REV. NO		REASON FOR REVISION		DATE	
O.A. CUST. ACCT. NO		E330-JBB-N2									
		INVENTORY CODE									
ORG CODE	PURE	ATT	TOTAL	ATT CD	STORE	PROJECT	ACCT				
QUALITY CONTROL SCREEN			START	ACCEPT.	PCS						
QC IIR NO ES 67093						PLANNER: E.H. SACHTLERSEN		DATE: 1 OCT 79			
OP N NO	REV NO	WORK STA	OPERATION INSTRUCTION					OPERATOR		INSPECTOR	
								DATE	PR NO.	DATE	STAMP
10		46-32	Q/A Screen Planning							10/1/79	
20		45-26	Assemble Cable per Print. Leave crimped pins exposed for inspection.					10-17-79	ES 67		
30		46-32	Inspect pins for workmanship.							10/1/79	
40		USAF	MCI.							10/1/79	
50		45-26	Reassemble connector.					10-22-79	ES 67		
60		41-23	Wirecheck.					10-12-79	ES 67		
70		46-32	Final inspect completed cable for workmanship.					10-12-79	ES 67		

ORIGINAL PAGE IS OF POOR QUALITY

57.72 Syst II

2 of 2
002

ORIGINAL PAGE IS
OF POOR QUALITY

HUGHES

QUALITY CONTROL HISTORY RECORD

5772

GLA	ACCT DETAIL	PART NUMBER	PART SER NO	PART NAME	NEXT ASSY	PROJECT/MODEL	H.R. SER NO
E330	GMB-131	3569497	092	CABLE W5036	—	H3236/PRG	ES 67093
RLV / C.S. NO N/C REA	ENGINEERING CHANGE DOCUMENTS				QTY	WORK AUTHORIZATION NO	PLANNER/REQUESTER
					10 1	11 —	E.H. Sackfelter
INSP BY	DATE	OPN NO	QUALITY HISTORY		DATE	ACC BY	INSP BY
10/17/79	10	1	QA Screen Planning		10/17/79		10
		2					25
		3					26
		4					27
		5					28
		6					29
10/17/79	30	1	Snap. of ep. 220 complete		10/17/79		30
		8					31
		9					32
		10					33
		11					34
7/2	70	12	fending formal release		10/17/79		35
10/17/79		13	of Desg 3569497				36
		14	open lgtk transferred				37
		15	to incomplete status by				38
		16					39
		17					40
		18					41
		19					42
		20					43
		21					44
		22					45
		23					46
		24					47
							48

ORIGINAL PAGE IS
OF POOR QUALITY

Final inspection complete

Per REA Desg 3569497-

24 Rev MC 24/100 EO

fending formal release

of Desg 3569497 open

lgtk transferred to incomplete

status by

INSPECTED FOR WORKMANSHIP,

CONFIGURATION, AND CONTINUITY

PER REV. A & E.O. 2627A (50/2/79)

MCI

Hardware matches PIC of 3/4/79

81-20-80 and REV A, EO, 2627A

2331A, 65631

MCI / 120-2722 A

REPLACED CONNECTORS (BROKEN)

CONT WORKMANSHIP 3/20/81

MCI

3/20/81

QUALITY CONTROL HISTORY RECORD

5772

10-1-80



ES 67093

GLA E330		ACC 1 DETAIL		PART NUMBER 3569497	PART SER NO .002	PART NAME W 5036	NEXT ASSY	PROJECT/MODEL TM	H R SER NO. ES-00000 ES-00000		
REV / C S NG				ENGINEERING CHANGE DOCUMENTS				QTY 1	WORK AUTHORIZATION NO	PLANNER/REQUESTER CONNER	SHEET ① OF ①
INSP BY 18	DATE 19	OPN NO 10	QUALITY HISTORY	DATE 18	ACC BY 19	INSP BY 20	DATE 18	OPN NO 10	QUALITY HISTORY	DATE 18	ACC BY 19
			1 INSPECTED FOR WORKMANSHIP & CONFIGURATION TO REA					25			
			2 RELEASE DWG, DATED					26			
			3 8/2/79. A.E. BUVOGE					27			
			4 IN G/S I SHIPPED TO S.B.					28			
			5 REFER TO ATTACH'D QUALITY HISTORY.					29			
			6 SEE ATTACHED MCI					30			
			7					31			
			8					32			
			9					33			
			10					34			
			11					35			
			12 S/N 002 W 5036 TO BE					36			
			13 INSTALLED IN RTCE #2 AS					37			
			14 TEMPORARY DX (S/N 001 TO					38			
			15 BE REMOVED).					39			
			16					40			
			17					41			
			18					42			
			19					43			
			20					44			
			21					45			
			22					46			
			23					47			
			24					48			

ORIGINAL PAGE IS
OF POOR QUALITY

OPERATION INSTRUCTION SHEET A

5712 S'XS, -11 0 of 2

C/I NO

S/N 002

MODEL		CONTROL ITEM		NEXT ASSEMBLY		PART NAME		CHG LTR.		PART NO.	
						CABLE W5036		REA (-)		3569497-24	
MATERIAL REQUIRED PER ONE PIECE						EFFECTIVE EO'S					
(SEE KIT REQUISITION)											
WORK ORDER INFORMATION						OIS REVISIONS					
MII/WO NO		CA NO E330-GM8-131				REV NO		REASON FOR REVISION		DATE	
Q/A CONSTRUCTION		E330-IBB-N2									
ORG CODE		PURE	ATT	TOTAL	ATT CD	STORE	PROJECT	ACCT			
QUALITY CONTROL SCREEN		START	ACCEPT.	PCS							
QC IIR NO ES67093					PLANNER		E.H. SACHTLEREN		DATE: 1 OCT 79		
OP N NO	REV NO	WORK STA	OPERATION INSTRUCTION					OPERATOR		INSPECTOR	
								DATE	PR NO.	DATE	STAMP
10		46-32	Q/A Screen Planning							10/1/79	
20		45-26	Assemble Cable per Print. Leave crimped pins exposed for inspection.								
30		46-32	Inspect pins for workmanship.							10/10/79	
40		USAF	MCI.							10/26/79	
50		45-26	Reassemble connector.							10-29-79	
60		41-23	Wirecheck.							10/17/79	
70		46-32	Final inspect completed cable for workmanship.							20162	

ORIGINAL PAGE IS OF POOR QUALITY

5772545T II

2 of 2
002

ORIGINAL PAGE IS
OF POOR QUALITY

ORIGINAL PAGE IS
OF POOR QUALITY

SPACE AND COMMUNICATIONS GROUP FAILURE REPORT

F 5778

[illegible]

**ORIGINAL PAGE IS
OF POOR QUALITY**

SPACE AND COMMUNICATIONS GROUP FAILURE REPORT

5
8101

ENGINEERING/RELIABILITY		MANUFACTURING AND TEST		ENGINEERING EVALUATION		ORIGINATOR	
1. THEMATIC MAPPER		2. PART NUMBER		3. DATE RECEIVED		4. DATE DESIGNED	
1.1 THEMATIC MAPPER		2.1 PART NUMBER		3.1 DATE RECEIVED		4.1 DATE DESIGNED	
1.2 THEMATIC MAPPER		2.2 PART NUMBER		3.2 DATE RECEIVED		4.2 DATE DESIGNED	
1.3 THEMATIC MAPPER		2.3 PART NUMBER		3.3 DATE RECEIVED		4.3 DATE DESIGNED	
1.4 THEMATIC MAPPER		2.4 PART NUMBER		3.4 DATE RECEIVED		4.4 DATE DESIGNED	
1.5 THEMATIC MAPPER		2.5 PART NUMBER		3.5 DATE RECEIVED		4.5 DATE DESIGNED	
1.6 THEMATIC MAPPER		2.6 PART NUMBER		3.6 DATE RECEIVED		4.6 DATE DESIGNED	
1.7 THEMATIC MAPPER		2.7 PART NUMBER		3.7 DATE RECEIVED		4.7 DATE DESIGNED	
1.8 THEMATIC MAPPER		2.8 PART NUMBER		3.8 DATE RECEIVED		4.8 DATE DESIGNED	
1.9 THEMATIC MAPPER		2.9 PART NUMBER		3.9 DATE RECEIVED		4.9 DATE DESIGNED	
1.10 THEMATIC MAPPER		2.10 PART NUMBER		3.10 DATE RECEIVED		4.10 DATE DESIGNED	
1.11 THEMATIC MAPPER		2.11 PART NUMBER		3.11 DATE RECEIVED		4.11 DATE DESIGNED	
1.12 THEMATIC MAPPER		2.12 PART NUMBER		3.12 DATE RECEIVED		4.12 DATE DESIGNED	
1.13 THEMATIC MAPPER		2.13 PART NUMBER		3.13 DATE RECEIVED		4.13 DATE DESIGNED	
1.14 THEMATIC MAPPER		2.14 PART NUMBER		3.14 DATE RECEIVED		4.14 DATE DESIGNED	
1.15 THEMATIC MAPPER		2.15 PART NUMBER		3.15 DATE RECEIVED		4.15 DATE DESIGNED	
1.16 THEMATIC MAPPER		2.16 PART NUMBER		3.16 DATE RECEIVED		4.16 DATE DESIGNED	
1.17 THEMATIC MAPPER		2.17 PART NUMBER		3.17 DATE RECEIVED		4.17 DATE DESIGNED	
1.18 THEMATIC MAPPER		2.18 PART NUMBER		3.18 DATE RECEIVED		4.18 DATE DESIGNED	
1.19 THEMATIC MAPPER		2.19 PART NUMBER		3.19 DATE RECEIVED		4.19 DATE DESIGNED	
1.20 THEMATIC MAPPER		2.20 PART NUMBER		3.20 DATE RECEIVED		4.20 DATE DESIGNED	
1.21 THEMATIC MAPPER		2.21 PART NUMBER		3.21 DATE RECEIVED		4.21 DATE DESIGNED	
1.22 THEMATIC MAPPER		2.22 PART NUMBER		3.22 DATE RECEIVED		4.22 DATE DESIGNED	
1.23 THEMATIC MAPPER		2.23 PART NUMBER		3.23 DATE RECEIVED		4.23 DATE DESIGNED	
1.24 THEMATIC MAPPER		2.24 PART NUMBER		3.24 DATE RECEIVED		4.24 DATE DESIGNED	
1.25 THEMATIC MAPPER		2.25 PART NUMBER		3.25 DATE RECEIVED		4.25 DATE DESIGNED	
1.26 THEMATIC MAPPER		2.26 PART NUMBER		3.26 DATE RECEIVED		4.26 DATE DESIGNED	
1.27 THEMATIC MAPPER		2.27 PART NUMBER		3.27 DATE RECEIVED		4.27 DATE DESIGNED	
1.28 THEMATIC MAPPER		2.28 PART NUMBER		3.28 DATE RECEIVED		4.28 DATE DESIGNED	
1.29 THEMATIC MAPPER		2.29 PART NUMBER		3.29 DATE RECEIVED		4.29 DATE DESIGNED	
1.30 THEMATIC MAPPER		2.30 PART NUMBER		3.30 DATE RECEIVED		4.30 DATE DESIGNED	
1.31 THEMATIC MAPPER		2.31 PART NUMBER		3.31 DATE RECEIVED		4.31 DATE DESIGNED	
1.32 THEMATIC MAPPER		2.32 PART NUMBER		3.32 DATE RECEIVED		4.32 DATE DESIGNED	
1.33 THEMATIC MAPPER		2.33 PART NUMBER		3.33 DATE RECEIVED		4.33 DATE DESIGNED	
1.34 THEMATIC MAPPER		2.34 PART NUMBER		3.34 DATE RECEIVED		4.34 DATE DESIGNED	
1.35 THEMATIC MAPPER		2.35 PART NUMBER		3.35 DATE RECEIVED		4.35 DATE DESIGNED	
1.36 THEMATIC MAPPER		2.36 PART NUMBER		3.36 DATE RECEIVED		4.36 DATE DESIGNED	
1.37 THEMATIC MAPPER		2.37 PART NUMBER		3.37 DATE RECEIVED		4.37 DATE DESIGNED	
1.38 THEMATIC MAPPER		2.38 PART NUMBER		3.38 DATE RECEIVED		4.38 DATE DESIGNED	
1.39 THEMATIC MAPPER		2.39 PART NUMBER		3.39 DATE RECEIVED		4.39 DATE DESIGNED	
1.40 THEMATIC MAPPER		2.40 PART NUMBER		3.40 DATE RECEIVED		4.40 DATE DESIGNED	
1.41 THEMATIC MAPPER		2.41 PART NUMBER		3.41 DATE RECEIVED		4.41 DATE DESIGNED	
1.42 THEMATIC MAPPER		2.42 PART NUMBER		3.42 DATE RECEIVED		4.42 DATE DESIGNED	
1.43 THEMATIC MAPPER		2.43 PART NUMBER		3.43 DATE RECEIVED		4.43 DATE DESIGNED	
1.44 THEMATIC MAPPER		2.44 PART NUMBER		3.44 DATE RECEIVED		4.44 DATE DESIGNED	
1.45 THEMATIC MAPPER		2.45 PART NUMBER		3.45 DATE RECEIVED		4.45 DATE DESIGNED	
1.46 THEMATIC MAPPER		2.46 PART NUMBER		3.46 DATE RECEIVED		4.46 DATE DESIGNED	
1.47 THEMATIC MAPPER		2.47 PART NUMBER		3.47 DATE RECEIVED		4.47 DATE DESIGNED	
1.48 THEMATIC MAPPER		2.48 PART NUMBER		3.48 DATE RECEIVED		4.48 DATE DESIGNED	
1.49 THEMATIC MAPPER		2.49 PART NUMBER		3.49 DATE RECEIVED		4.49 DATE DESIGNED	
1.50 THEMATIC MAPPER		2.50 PART NUMBER		3.50 DATE RECEIVED		4.50 DATE DESIGNED	
1.51 THEMATIC MAPPER		2.51 PART NUMBER		3.51 DATE RECEIVED		4.51 DATE DESIGNED	
1.52 THEMATIC MAPPER		2.52 PART NUMBER		3.52 DATE RECEIVED		4.52 DATE DESIGNED	
1.53 THEMATIC MAPPER		2.53 PART NUMBER		3.53 DATE RECEIVED		4.53 DATE DESIGNED	
1.54 THEMATIC MAPPER		2.54 PART NUMBER		3.54 DATE RECEIVED		4.54 DATE DESIGNED	
1.55 THEMATIC MAPPER		2.55 PART NUMBER		3.55 DATE RECEIVED		4.55 DATE DESIGNED	
1.56 THEMATIC MAPPER		2.56 PART NUMBER		3.56 DATE RECEIVED		4.56 DATE DESIGNED	
1.57 THEMATIC							

HUGHES

HUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIA

SPACE AND COMMUNICATIONS GROUP

FAILURE REPORT
CONTINUATION SHEET

FORM 100-1
58101

CONTINUATION SHEET LETTER

A

TABLE FIRST CONTINUATION SHEET USED A, B, C, D, E, F, G, H, I, J, K, L, M, N, O, P, Q, R, S, T, U, V, W, X, Y, Z, AA, AB, AC, AD, AE, AF, AG, AH, AI, AJ, AK, AL, AM, AN, AO, AP, AQ, AR, AS, AT, AU, AV, AW, AX, AY, AZ, BA, BB, BC, BD, BE, BF, BG, BH, BI, BJ, BK, BL, BM, BN, BO, BP, BQ, BR, BS, BT, BU, BV, BW, BX, BY, BZ, CA, CB, CC, CD, CE, CF, CG, CH, CI, CJ, CK, CL, CM, CN, CO, CP, CQ, CR, CS, CT, CU, CV, CW, CX, CY, CZ, DA, DB, DC, DD, DE, DF, DG, DH, DI, DJ, DK, DL, DM, DN, DO, DP, DQ, DR, DS, DT, DU, DV, DW, DX, DY, DZ, EA, EB, EC, ED, EE, EF, EG, EH, EI, EJ, EK, EL, EM, EN, EO, EP, EQ, ER, ES, ET, EU, EV, EW, EX, EY, EZ, FA, FB, FC, FD, FE, FF, FG, FH, FI, FJ, FK, FL, FM, FN, FO, FP, FQ, FR, FS, FT, FU, FV, FW, FX, FY, FZ, GA, GB, GC, GD, GE, GF, GG, GH, GI, GJ, GK, GL, GM, GN, GO, GP, GQ, GR, GS, GT, GU, GV, GW, GX, GY, GZ, HA, HB, HC, HD, HE, HF, HG, HH, HI, HJ, HK, HL, HM, HN, HO, HP, HQ, HR, HS, HT, HU, HV, HW, HX, HY, HZ, IA, IB, IC, ID, IE, IF, IG, IH, II, IJ, IK, IL, IM, IN, IO, IP, IQ, IR, IS, IT, IU, IV, IW, IX, IY, IZ, JA, JB, JC, JD, JE, JF, JG, JH, JI, JJ, JK, JL, JM, JN, JO, JP, JQ, JR, JS, JT, JU, JV, JW, JX, JY, JZ, KA, KB, KC, KD, KE, KF, KG, KH, KI, KJ, KK, KL, KM, KN, KO, KP, KQ, KR, KS, KT, KU, KV, KW, KX, KY, KZ, LA, LB, LC, LD, LE, LF, LG, LH, LI, LJ, LK, LL, LM, LN, LO, LP, LQ, LR, LS, LT, LU, LV, LW, LX, LY, LZ, MA, MB, MC, MD, ME, MF, MG, MH, MI, MJ, MK, ML, MM, MN, MO, MP, MQ, MR, MS, MT, MU, MV, MW, MX, MY, MZ, NA, NB, NC, ND, NE, NF, NG, NH, NI, NJ, NK, NL, NM, NN, NO, NP, NQ, NR, NS, NT, NU, NV, NW, NX, NY, NZ, OA, OB, OC, OD, OE, OF, OG, OH, OI, OJ, OK, OL, OM, ON, OO, OP, OQ, OR, OS, OT, OU, OV, OW, OX, OY, OZ, PA, PB, PC, PD, PE, PF, PG, PH, PI, PJ, PK, PL, PM, PN, PO, PP, PQ, PR, PS, PT, PU, PV, PW, PX, PY, PZ, QA, QB, QC, QD, QE, QF, QG, QH, QI, QJ, QK, QL, QM, QN, QO, QP, QQ, QR, QS, QT, QU, QV, QW, QX, QY, QZ, RA, RB, RC, RD, RE, RF, RG, RH, RI, RJ, RK, RL, RM, RN, RO, RP, RQ, RR, RS, RT, RU, RV, RW, RX, RY, RZ, SA, SB, SC, SD, SE, SF, SG, SH, SI, SJ, SK, SL, SM, SN, SO, SP, SQ, SR, SS, ST, SU, SV, SW, SX, SY, SZ, TA, TB, TC, TD, TE, TF, TG, TH, TI, TJ, TK, TL, TM, TN, TO, TP, TQ, TR, TS, TT, TU, TV, TW, TX, TY, TZ, UA, UB, UC, UD, UE, UF, UG, UH, UI, UJ, UK, UL, UM, UN, UO, UP, UQ, UR, US, UT, UU, UV, UW, UX, UY, UZ, VA, VB, VC, VD, VE, VF, VG, VH, VI, VJ, VK, VL, VM, VN, VO, VP, VQ, VR, VS, VT, VU, VV, VW, VX, VY, VZ, WA, WB, WC, WD, WE, WF, WG, WH, WI, WJ, WK, WL, WM, WN, WO, WP, WQ, WR, WS, WT, WU, WV, WW, WX, WY, WZ, XA, XB, XC, XD, XE, XF, XG, XH, XI, XJ, XK, XL, XM, XN, XO, XP, XQ, XR, XS, XT, XU, XV, XW, XX, XY, XZ, YA, YB, YC, YD, YE, YF, YG, YH, YI, YJ, YK, YL, YM, YN, YO, YP, YQ, YR, YS, YT, YU, YV, YW, YX, YY, YZ, ZA, ZB, ZC, ZD, ZE, ZF, ZG, ZH, ZI, ZJ, ZK, ZL, ZM, ZN, ZO, ZP, ZQ, ZR, ZS, ZT, ZU, ZV, ZW, ZX, ZY, ZZ

TABLE FIRST CONTINUATION SHEET USED A, B, C, D, E, F, G, H, I, J, K, L, M, N, O, P, Q, R, S, T, U, V, W, X, Y, Z, AA, AB, AC, AD, AE, AF, AG, AH, AI, AJ, AK, AL, AM, AN, AO, AP, AQ, AR, AS, AT, AU, AV, AW, AX, AY, AZ, BA, BB, BC, BD, BE, BF, BG, BH, BI, BJ, BK, BL, BM, BN, BO, BP, BQ, BR, BS, BT, BU, BV, BW, BX, BY, BZ, CA, CB, CC, CD, CE, CF, CG, CH, CI, CJ, CK, CL, CM, CN, CO, CP, CQ, CR, CS, CT, CU, CV, CW, CX, CY, CZ, DA, DB, DC, DD, DE, DF, DG, DH, DI, DJ, DK, DL, DM, DN, DO, DP, DQ, DR, DS, DT, DU, DV, DW, DX, DY, DZ, EA, EB, EC, ED, EE, EF, EG, EH, EI, EJ, EK, EL, EM, EN, EO, EP, EQ, ER, ES, ET, EU, EV, EW, EX, EY, EZ, FA, FB, FC, FD, FE, FF, FG, FH, FI, FJ, FK, FL, FM, FN, FO, FP, FQ, FR, FS, FT, FU, FV, FW, FX, FY, FZ, GA, GB, GC, GD, GE, GF, GG, GH, GI, GJ, GK, GL, GM, GN, GO, GP, GQ, GR, GS, GT, GU, GV, GW, GX, GY, GZ, HA, HB, HC, HD, HE, HF, HG, HH, HI, HJ, HK, HL, HM, HN, HO, HP, HQ, HR, HS, HT, HU, HV, HW, HX, HY, HZ, IA, IB, IC, ID, IE, IF, IG, IH, II, IJ, IK, IL, IM, IN, IO, IP, IQ, IR, IS, IT, IU, IV, IW, IX, IY, IZ, JA, JB, JC, JD, JE, JF, JG, JH, JI, JJ, JK, JL, JM, JN, JO, JP, JQ, JR, JS, JT, JU, JV, JW, JX, JY, JZ, KA, KB, KC, KD, KE, KF, KG, KH, KI, KJ, KK, KL, KM, KN, KO, KP, KQ, KR, KS, KT, KU, KV, KW, KX, KY, KZ, LA, LB, LC, LD, LE, LF, LG, LH, LI, LJ, LK, LL, LM, LN, LO, LP, LQ, LR, LS, LT, LU, LV, LW, LX, LY, LZ, MA, MB, MC, MD, ME, MF, MG, MH, MI, MJ, MK, ML, MM, MN, MO, MP, MQ, MR, MS, MT, MU, MV, MW, MX, MY, MZ, NA, NB, NC, ND, NE, NF, NG, NH, NI, NJ, NK, NL, NM, NN, NO, NP, NQ, NR, NS, NT, NU, NV, NW, NX, NY, NZ, OA, OB, OC, OD, OE, OF, OG, OH, OI, OJ, OK, OL, OM, ON, OO, OP, OQ, OR, OS, OT, OU, OV, OW, OX, OY, OZ, PA, PB, PC, PD, PE, PF, PG, PH, PI, PJ, PK, PL, PM, PN, PO, PP, PQ, PR, PS, PT, PU, PV, PW, PX, PY, PZ, QA, QB, QC, QD, QE, QF, QG, QH, QI, QJ, QK, QL, QM, QN, QO, QP, QQ, QR, QS, QT, QU, QV, QW, QX, QY, QZ, RA, RB, RC, RD, RE, RF, RG, RH, RI, RJ, RK, RL, RM, RN, RO, RP, RQ, RR, RS, RT, RU, RV, RW, RX, RY, RZ, SA, SB, SC, SD, SE, SF, SG, SH, SI, SJ, SK, SL, SM, SN, SO, SP, SQ, SR, SS, ST, SU, SV, SW, SX, SY, SZ, TA, TB, TC, TD, TE, TF, TG, TH, TI, TJ, TK, TL, TM, TN, TO, TP, TQ, TR, TS, TT, TU, TV, TW, TX, TY, TZ, UA, UB, UC, UD, UE, UF, UG, UH, UI, UJ, UK, UL, UM, UN, UO, UP, UQ, UR, US, UT, UU, UV, UW, UX, UY, UZ, VA, VB, VC, VD, VE, VF, VG, VH, VI, VJ, VK, VL, VM, VN, VO, VP, VQ, VR, VS, VT, VU, VV, VW, VX, VY, VZ, WA, WB, WC, WD, WE, WF, WG, WH, WI, WJ, WK, WL, WM, WN, WO, WP, WQ, WR, WS, WT, WU, WV, WW, WX, WY, WZ, XA, XB, XC, XD, XE, XF, XG, XH, XI, XJ, XK, XL, XM, XN, XO, XP, XQ, XR, XS, XT, XU, XV, XW, XX, XY, XZ, YA, YB, YC, YD, YE, YF, YG, YH, YI, YJ, YK, YL, YM, YN, YO, YP, YQ, YR, YS, YT, YU, YV, YW, YX, YY, YZ, ZA, ZB, ZC, ZD, ZE, ZF, ZG, ZH, ZI, ZJ, ZK, ZL, ZM, ZN, ZO, ZP, ZQ, ZR, ZS, ZT, ZU, ZV, ZW, ZX, ZY, ZZ

ADDITIONAL FIRST CONTINUATION SHEET USED ☐

14 in blowing the circuit breaker in the Radio power supply in the first set. Replaced of connections of an oscilloscope, cleared the problem and hardware seemed to function normally. The scope probes were grounded to braint box connections at J20 pin 51 and J4 pin 41. On 3/9/68 12.65V was measured between these points. On 3/10/68 13.15V was measured with wiper at positive with respect to source set return. The voltage goes to 15V when Radio supply is ON and the radio meter is OFF. The source impedance is approximately 40 ohms.

ORIGINAL PAGE IS
OF POOR QUALITY

ORIGINAL PAGE IS
OF POOR QUALITY

**MUMUKS AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP**

SPACE AND COMMUNICATIONS GROUP FAILURE REPORT

5
8127

[illegible]

THE NEW YORK PUBLIC LIBRARY

6/29/82

HUGHES

(SEE REVERSE SIDE FOR COMPLETION INSTRUCTION)

1. DATE OF REQUEST: 4/20/82

4. AUTHORIZED SIGNATURE: [Signature]

6. GLA/Asset No. (F264-A15110000

16. R.R. No.

Please perform the following Acceptance Tests per Para. 4.3 (Table 5) of TS 32015-034

9. Stock Xfr. No.

54578 J24 Filter

5.2.5

5.2.3

5.2.4

Please return copy of test data sheets and this form to L. O'Connell, B11/MS 39.

10. Credit Reg. No.

11. Fork Order No.

12. NCMB No. _____

13. Order FR 58127

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

QUALITY CONTROL HISTORY RECORD (CONTINUATION SHEET)

8714 69 01 1 14

ORIGINAL PAGE IS
OF POOR QUALITY

TS 32C15-035
Rev. -
16 November 1981



J24 FILTER (54578)

APR 22 1982

10.2.2 Redundant Lead Test Data

8127

S/N: 1.

Testing Phase: FINAL REDUNDANT LEAD

Verify with a check that the red "LED" comes on with each function below:

<u>Para.</u>	<u>Switch</u>	<u>Positions</u>	<u>Verify</u>
5.2.3.1	S5	S6	
	-1	-1	<u>✓</u> (Check)
	-2	-2	<u>✓</u> (Check)
	-3	-3	<u>✓</u> (Check)
	-3	-4	<u>✓</u> (Check)
	-3	-5	<u>✓</u> (Check)
	-4	-6	<u>✓</u> (Check)
	-5	-7	<u>✓</u> (Check)
	-5	-8	<u>✓</u> (Check)
	-5	-9	<u>✓</u> (Check)

Stafford OB
Tester(s)

4/21/82
Date

ORIGINAL PAGE IS
OF POOR QUALITY

TS 32015-034
Rev. -
16 November 1981



024 FILTER (54578)

8127

APR 23 1982

10.2.3 Hi-pot Test Data

S/N: 1

Testing Phase: FINAL HIGH POT

<u>REF. PARA</u>	<u>DESCRIPTION</u>	<u>LIMITS</u>	<u>MEASUREMENT</u>
5.2.4.2	Resistance	Shall be $> 1M \Omega$	<u>20MΩ</u>
5.2.4.3	Resistance	Shall be $> 1M \Omega$	<u>5MΩ</u>

Steffebach EB
Tester(s)

4/21/82
Date

ORIGINAL PAGE IS
OF POOR QUALITY

TS 32015-034
Rev. -
16 November 1981

J24 FILTER (54578)

8127



APR 22 1982

1G.2.4 Capacitor Test Data

S/N: 1 Temperature: AMB

Testing Phase: FINAL PERFORMANCE

<u>REF. PARA</u>	<u>DESCRIPTION</u>	<u>LIMITS</u>	<u>MEASUREMENT</u>
5.2.5.1.2	Capacitance Measurement	$7 \pm 2 \text{ uF}$	<u>7</u> uF
5.2.5.1.3	Capacitance Measurement	$7 \pm 2 \text{ uF}$	<u>7</u> uF

Glafferbach GB
Tester(s)

4/21/82
Date

ORIGINAL PAGE IS
OF POOR QUALITY

TS 32015-034
Rev. -
76 November 1981



APR 42 1982

8127

J24 FILTER (54578)

10.2.5 Diode Test Data

S/N: 1

Temperature: AMB

Testing Phase: FINAL PERFORMANCE TEST

<u>REF. PARA.</u>	<u>DESCRIPTION</u>	<u>LIMITS</u>	<u>MEASUREMENT</u>
5.2.5.2.2	Diode Voltage Drop	1.7 (+.2 -.3)V	<u>1.7</u> V
5.2.5.2.3	Diode Voltage Drop	1.7 (+.2 -.3)V	<u>1.7</u> V

Steffelbach GB
Tester(s)

4/21/82
Date

ORIGINAL PAGE IS
OF POOR QUALITY

8127

TS 32015-034
Rev. -
16 November 1981



APR 22 1982

J24 FILTER (54578)

10.2.6 Inductor Test Data

S/N: 1 Temperature: AMB

Testing Phase: FINAL PERFORMANCE

<u>REF. PARA.</u>	<u>DESCRIPTION</u>	<u>LIMITS</u>	<u>MEASUREMENT</u>
5.2.5.3.2	Resonance Measurement	1800 $\pm$ 400 Hz	<u>1923</u> Hz
	$\frac{1}{T} = f$	(455uSec < T < 714uSec)	<u>520uSec</u>
5.2.5.3.3	Resonance Measurement	1800 $\pm$ 400 Hz	<u>2000</u> Hz
	$\frac{1}{T} = f$	(455uSec < T < 714uSec)	<u>500uSec</u>

Staffelbach 653
Tester(s)

4/21/82
Date

ORIGINAL PAGE IS
OF POOR QUALITY

TS 32015-034
Rev. -
16 November 1981



APR 22 1982

8127

J24 FILTER (54578)

10.2.7 Attenuation Characteristics Test Data

S/N: 1 Temperature: AMB

Testing Phase: FINAL PERFORMANCE

<u>REF. PARA.</u>	<u>DESCRIPTION</u>	<u>LIMITS</u>	<u>MEASUREMENT</u>
5.2.5.4.1	Record Voltage for Following Frequencies		
	100 Hz	1.0 $\pm$.1V P-P	<u>1.0</u> V P-P
	450 Hz	1.0 $\pm$.3V P-P	<u>1.1</u> V P-P
	6.3 KHz	.1 $\pm$.05V P-P	<u>.09</u> V P-P
	20 KHz	10mV $\pm$ 3mV mV P-P	<u>10</u> mV P-P

Asst. Tech CS
Tester(s)

4/21/82
Date

ORIGINAL PAGE IS
OF POOR QUALITY

SANTA BARBARA RESEARCH CENTER
A Subsidiary of Hughes Aircraft Company
INTERNAL MEMORANDUM

TO: F.R. Phillips
SUBJECT: EMI Filter
(P/N 54583 S/N 001)

CC: Distribution

DATE: 26 April 1982

REF: HS 236-7956
PE 96:82

FROM: L. O'Connell

BLDG. B-11 MAIL STA. 39
EXT. 6357

8127

Subject Filter was subjected to extreme internal temperatures during the running of STR FLT 1 007 as the result of a short circuit in a breakout cable (This anomaly was reported on FR S8127, copy attached).

This office has investigated the problem to determine what effect the overheating has on the long term Reliability of the filter. The results of this study are documented in IDC's PE 86:82 and PE 88:82 (copies attached).

In addition to the above investigation, the undersigned has discussed the problem with G. Benson (Power Supply REA) and he recommended that all of the components be removed and replaced because the excessive heat degraded the Reliability of the components.

CONCLUSIONS

Based on the Thermal Analysis conducted by Reliability, the opinions of the REA (G. Benson) and the undersigned, it has been concluded that the internal components of subject filter have been overstressed and their longevity is suspect. Even though the filter passed re-test, the ability of the device to perform over an extended period of time is too uncertain to warrant certification as Flight hardware.

RECOMMENDATIONS

The following options are offered for your consideration:

1. Use EMI Filter (S/N 001) for test purposes only while a new EMI filter is being fabricated at El Segundo.
2. Rework EMI Filter (S/N 001) by removing and replacing all components.



L. O'Connell
Reliability Manager
Thematic Mapper Program

LOC:jc

ORIGINAL PAGE IS
OF POOR QUALITY

SANTA BARBARA RESEARCH CENTER

A Subsidiary of Hughes Aircraft Company

INTERNAL MEMORANDUM

TO: L. O'Connell

CC:

DATE: 16 April 1982

REF: PE 88:82

SUBJECT: Reliability Analysis of
Discrepancy recorded on
Failure Report S8127

FROM: A. Perline

BLDG. B-11 MAIL STA-39
EXT. 6106

- Reference: 1. Internal Memo PE 86:82 of 13 April 1982
2. HS 236-7783
3. Failure Report S8127

Subject Failure Report was reviewed from a Reliability viewpoint to provide an estimate of the effects of overheating that occurred at the time of the failure. The manufacturer of the inductor was contacted and he advised us that 23 gage HP magnet wire could withstand a 200°C temperature for a very short period and that 170°C was its maximum operating temperature.

 
These temperature constraints agree closely with the estimated 180°C operating temperature for 30,000 hours of life quoted by SESC materials personnel.

The analysis in reference 1 is repeated in attachment 1 to this memo. It shows that the inductor temperature will reach at least 260°C.

Another approach is presented in attachment 2 as a crosscheck. The calculations show that temperature at the inductor will exceed 266°C.

Loss of the inductor to an open circuit would impose a loss of SMA heater function. A short circuit would degrade the low frequency filtering capability of the unit.

Considering the fact that the wire should not be subjected to temperatures above 200°C, it is my position that the Reliability of this unit has been degraded and the filter should not be used in the Flight Unit.


A. Perline

AP:jc

TEMPERATURE CALCULATIONS FOR J-24 FILTER INDUCTOR

Current through Inductor

6 Amps

Inductor Resistance

.360 ohms

Temperature rise (from HS 236-7783)

18° C/W

Power Dissipated:

$$I^2 R = (6^2) (.360) = 12.96$$

Temperature Change:

$$\text{Power} \times \text{Temperature Rise} = (12.96) (18) = 233^\circ\text{C}$$

Inductor Temperature:

$$\text{Ambient} + \text{Temperature Change} = 25^\circ\text{C} + 233^\circ\text{C} = \underline{261^\circ\text{C}} \text{ Inductor Temperature}$$

ORIGINAL PAGE IS
OF POOR QUALITY

8121

ALTERNATE TEMPERATURE CALCULATIONS FOR J24 FILTER INDUCTOR

Current Through Inductor (I)

6 Amps

Inductor Resistance (R)

.360 ohms

Coefficient of Thermal
conductivity of Foamed Urthane (k) $\frac{6 (10^{-3}) W}{cm^2 C}$ Theoretical donut surrounding
inductor1.9 cm I.D. X 3.81 cm O.D.
X 2.54 cm Thick

Conductivity:

$$C = \frac{2 \pi k t}{\ln(r_2/r_1)} = 0.544$$

$$\Delta T = \frac{Q}{C}$$

$$\Delta T = \frac{12.96}{.0544} = 238^\circ$$

Inductor Temperature: Ambient + Temperature Change = $28^\circ C + 238^\circ C = 266^\circ C$ Where: r_2 is the O.D. r_1 is the I.D. t is the thickness

$$Q = I^2 R = 12.96$$

 ΔT = Temperature changeORIGINAL PAGE IS
OF POOR QUALITY

HUGHES

HUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIA

SPACE AND COMMUNICATIONS GROUP

FAILURE REPORT

ORIGINAL PAGE IS
OF POOR QUALITY

S 8134

1. EQUIPMENT NAME AND NUMBER THEMATIC MAPPER-415		2. GLA FLIGHT	3. MODEL 1100	4. TIME OBSERVED MO 5 DA 5 YR 82	5. DATE OBSERVED MO 5 DA 5 YR 82
6. HAZARD/HAZARD LEVEL WHEN FAILURE WAS OBSERVED ☐ SPACECRAFT ☐ SYSTEM		☐ SUBSYSTEM ☐ UNIT		☐ ASSEMBLY ☐ SUBASSEMBLY	☐ MODULE ☐ MECAM ☐ CARD ☐ PART
EQUIPMENT IDENTIFICATION		NAME		PART NUMBER	S/N
7. SUBSYSTEM THEMATIC MAPPER		51065		003	SBRC
8. UNIT					
9. ☐ ASSEMBLY ☐ SUBASSEMBLY					
10. ☐ MODULE ☐ MECAM ☐ CARD					
11. OTHER					
12. TEST WHEN FAILURE WAS OBSERVED ☐ DEVELOPMENT ☐ IN-PROCESS ☐ QUALIFICATION ☐ ACCEPTANCE		☒ INTEGRATION ☐ SYSTEM		☐ LAUNCH OPERATIONS	
13. ENVIRONMENT WHEN FAILURE WAS OBSERVED ☒ AMBIENT ☐ RADIATION ☐ VIBRATION		☐ TEMP ☐ THERMAL VAC		HRS AT ☐ OTHER	
14. DESCRIPTION OF FAILURE SMA HEATER & SUNSHADE SENSOR CARLA HARNETT INSISTENCE					
15. TEST PROCEDURE MEASUREMENT - AT REG PIN 1 TO PINS 15 OPEN S/R 31.0V, PIN 34 TO PIN 36 IS 13.9 OH S/R 2.5 OH					
16. VERIFICATION AND FAILURE ANALYSIS VISUAL INSPECTION REVEALED SMA-2 SAFEHOLD HEATER (1")		17. CONTINUATION SHEET USED ☐			
18. REWORK/RETEST NOT REQUIRED BECAUSE REWORK SMA-2 SAFEHOLD HEATER (1")		19. REWORK/RETEST NOT REQUIRED BECAUSE REWORK SMA-2 SAFEHOLD HEATER (1")			
20. CAUSE AND CORRECTIVE ACTION CAUSED BY WIRING ERROR. NO OVERSTRESS OF PARTS OCCURRED AS TEST IS AN UNPOWERED PROCEDURE USING AN OHMMETER		21. AUTHORIZATION CURRENT		22. CONTINUATION SHEET USED ☐	
23. LIST ALL PARTS REPLACED NONE		24. CONTINUATION SHEET USED ☐			
25. DOCUMENT IMPLEMENTING CORRECTIVE ACTION ASSEMBLY TECHNICIANS HAVE BEEN ADVISED OF DISCREPANCY, AND THEY HAVE BEEN CAUTIONED AGAINST REPETITION		26. CONTINUATION SHEET USED ☐			
27. BASIC CAUSE OF VERIFIED FAILURE ☐ DESIGN ☐ ENVIRONMENTAL ☐ DEFECTIVE PARTS		28. TEST EQUIPMENT ☐ TEST PROCEDURE ☐ TEST SET UP		29. MFG PROCEDURE ☐ ASSEMBLY ERROR ☐ WORKMANSHIP	
30. FAILURE TYPE ☒ PRIMARY ☐ SECONDARY		31. FAILURE CLASSIFICATION ☐ UNKNOWN ☐ NO FAILURE		32. FAILURE CLASSIFICATION ☐ CRITICAL ☐ MAJOR ☐ MINOR	
33. RESPONSIBLE ENGINEER CHAMANT		34. SPACECRAFT/SYSTEMS ENGINEER CHAMANT		35. CONTINUATION SHEET USED ☐	

TEST EQUIPMENT

ORIGINAL PAGE IS
OF POOR QUALITY

Failure Reports

Closed

F0553

F0555

F1325

F1329

F1748

F2662

F2664

F4253

F4256

S8101

S8206

S8328

S8371

S8378

S8443

Open

None

Deviations

D-160

Waivers

None

Program Instruction 010

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-883A OR -81 FOR INSTRUCTIONS)

DATE PREPARED

07-08-82

PROCURING ACTIVITY NO

1 ORIGINATOR NAME AND ADDRESS SBRC 75 Coromar Drive Goleta, CA 93117				2 ☒ DEVIATION ☐ WAIVER 3 ☒ MINOR ☐ MAJOR ☐ CRITICAL	
4 DESIGNATION FOR DEVIATION/WAIVER MODEL/TYPE: TM Calibrator MFR CODE: 11323 SYS DESIG: TM DEV/WAIVER NO: D-160				5 BASE LINE AFFECTED ☐ FUNC-TIONAL ☐ ALLG-CATED ☒ PROD-UCT	
6 OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO					
7 SPECIFICATIONS AFFECTED-TEST PLAN				8 DRAWINGS AFFECTED	
MFR CODE SPEC /DOC. NO. SN				MFR CODE NUMBER REV. NO. NO. NO.	
9 SYSTEM				11323 72611 D	
10 ITEM					
11 TEST PLAN					
12 TITLE OF DEVIATION/WAIVER T.M. CALIBRATOR ASSEMBLY--SHIM RETICLE, SPACER RETAINER				13 CONTRACT NO. & LINE ITEM NAS-5-24200	
14 IDENTIFICATION ITEM NOMENCLATURE T.M. CALIBRATOR ASSEMBLY				15 CLASSIFICATION OF DEFECT 16 CD NO: II 17 DEFECT NO: 18 DEFECT CLASSIFICATION ☒ MINOR ☐ MAJOR ☐ CRITICAL	
19 SPACER RETAINER SHIM, RETICLE 20 EFFECT ON COST/PRICE NONE				21 LOT NO: 8 ea 22 QTY: 2 ea 23 RECURRING DEVIATION/WAIVER ☐ YES ☒ NO	
24 EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. NONE				25 EFFECT ON DELIVERY SCHEDULE	
26 DESCRIPTION OF DEVIATION/WAIVER USE OF NON-RELEASE DRAWING FOR FABRICATING THE FOLLOWING ITEMS: 1) SK10779 SPACER, RETAINER 8 ea. 2) SK10793 SHIM, RETICLE 2 ea. NOTE: ITEMS 1 AND 2 TO BE USED DURING THERMAL VACUUM TESTING. SHIMS AND SPACERS TO BE REMOVED PRIOR TO DELIVERING CALIBRATOR.					

27 NEED FOR DEVIATION/WAIVER

THE ABOVE ITEMS WILL BE USED ON THE T.M. CALIBRATOR. THIS DEVIATION WILL AUTHORIZE ITS USE WITHOUT RELEASE DRAWINGS. ASSEMBLY OF THE ITEMS WILL BE INCORPORATED BY FORMAL SUPPLEMENTAL PLANNING AGAINST THE T.M. CALIBRATOR SERNO 002, P/N 72611.

28 REA <u>W. Balinski</u> SYS ENGR <u>J. Engel</u>		29 QA <u>W. Balinski</u> 7-12-82 PE <u>W. Balinski</u> 7-15-82 CMO <u>W. Balinski</u> 7-15-82	
30 PRODUCTION EFFECTIVITY BY SERIAL NUMBER 72611 SERNO 002 ONLY		31 Minor - System Engineering Major/Critical - Program Manager	
32 AUTHORITY AUTHORIZING SIGNATURE <u>J. Engel</u>		33 APPROVAL/DISAPPROVAL 34 ☐ APPROVAL RECOMMENDED ☐ APPROVED ☐ DISAPPROVED	
35 GOVERNMENT ACCTY		36 SIGNATURE <u>J. Engel</u> DATE <u>7-15-82</u>	

DD FORM 1694

HUGHESHUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIASPACE AND COMMUNICATIONS GROUP
FAILURE REPORTORIGINAL PAGE IS
OF POOR QUALITY**S 8371**

ORIGINATOR	1. PROGRAM NAME AND NUMBER TM PL 1162	2. GLA V414	3. MODEL FLT	4. TIME OBSERVED 2:30	5. DATE OBSERVED MO 4 DA 7 YR 82	
	6. HARDWARE LEVEL WHEN FAILURE WAS OBSERVED ☐ SPACECRAFT ☐ SUBSYSTEM ☐ ASSEMBLY ☐ MODULE ☐ CARD ☐ SYSTEM ☐ UNIT ☒ SUBASSEMBLY ☐ NCAM ☐ PART					
	EQUIPMENT IDENTIFICATION					
	7. SUBSYSTEM					
	8. UNIT					
	9. ☐ ASSEMBLY ☒ SUBASSEMBLY 53650 Gble 53650 SBRC					
	10. ☐ MODULE ☐ NCAM ☐ CARD					
	11. OTHER					
	12. TEST WHEN FAILURE WAS OBSERVED ☐ DEVELOPMENT ☐ QUALIFICATION ☒ INTEGRATION ☐ LAUNCH OPERATIONS ☐ IN-PROCESS ☐ ACCEPTANCE ☐ SYSTEM					
	13. ENVIRONMENT WHEN FAILURE WAS OBSERVED ☒ AMBIENT ☐ RADIATION ☐ TEMP ☐ THERMAL VAC ☐ HRS AT ☐ OTHER ☐ EMC/RF ☐ VIBRATION ☐ AXIS FOR ☐ M21 TYPE					
ENGINEERING EVALUATION	14. DESCRIPTION OF FAILURE Inchworm would NOT respond to move command					
	15. TEST PROCEDURE Ap67 optics AHR Sep. 15 NO 400 Erana 32-13 4/9/82 ☐ CONTINUATION SHEET USED					
	16. VERIFICATION AND FAILURE ANALYSIS Found problem to be in wearcover, wearcover removed					
	17. FAILED ITEM NAME AND PART NUMBER Wearcover 76440-3					
	18. ☐ FOLLOWING Rework/Retest REQUIRED ☐ Rework/Retest NOT REQUIRED BECAUSE Retest with wearcover out					
	19. AUTHORIZATION Erana 32-13 4/8/82 ☐ CONTINUATION SHEET USED					
	20. REWORK/RETEST ACTION TAKEN Retested with wearcover out, Tested OK, Red Tagged Wearcover sent for repair					
	21. ☐ REWORK/RETEST					
	22. ☐ QA TEST					
	23. ☐ ANALYSIS					
MANUFACTURING AND TEST	24. LIST ALL PARTS REPLACED PART NUMBER CMT SYM PART LOT NUMBER DATE CODE MANUFACTURER PROBABLE DEFECT ANALYSIS NUMBER					
	25. Rework BY ORG DATE 22-13 4/9/82 ☐ CONTINUATION SHEET USED					
	26. CAUSE AND CORRECTIVE ACTION TEST EQUIPMENT DISCREPANCY - WEAR COVER IN QUESTION WAS RED TAGGED AND WILL NOT BE USED UNTIL REPAIRED AND INSPECTED.					
	27. FRB CLOSURE 4-9-82					
	28. CONTINUATION SHEET USED					
	29. DOCUMENT IMPLEMENTING CORRECTIVE ACTION					
	30. BASIC CAUSE OF VERIFIED FAILURE ☐ DESIGN ENVIRONMENTAL DEFECTIVE PARTS ☒ TEST EQUIPMENT TEST PROCEDURE TEST SET UP ☐ MFG PROCEDURE ASSY/FAB ERROR WORKMANSHIP ☐ WIRING ERROR ROUGH HANDLING WEAR/OUT ☐ UNKNOWN					
	31. FAILURE TYPE ☐ PRIMARY ☒ INDUCED ☐ UNKNOWN ☐ NO FAILURE					
	32. RESPONSIBLE ENGINEER W. Belmont 22-35 82-4-B 2241 4/9/82					
	33. RELIABILITY 111 11-0 2241 4/9/82					

4.2 REQUESTS FOR DEVIATION/WAIVER

The following pages list the Requests for Deviation or Requests for Waiver submitted for the Flight Model Thematic Mapper, by number, description, and current status.

Copies of Requests for Deviation/Waiver that were submitted for particular subsystems are included in the Appropriate subsection of Volume II of this report. Copies of Requests for Deviation/Waiver submitted against the instrument are included herein.

DEVIATION NUMBERDESCRIPTIONSTATUS

D-128 PROCEDURE	AUTHORIZATION TO MODIFY WIRE BOND CONNECTION	APPROVED
D-129 DRAWING	USE OF ALTERNATE TERMINAL ASSY.	APPROVED
D-130 HARDWARE/PROCEDURE	ALTERNATE COMP. PLACEMENT	APPROVED
D-131 HARDWARE/PROCEDURE	ALTERNATE COMP. PLACEMENT	APPROVED
D-133 HARDWARE/DRAWING	ALTERNATE WIRING, CAL SHUTTER BACK	APPROVED
D-134 PROCEDURE	REDUNDANT SHUTTER CABLE SUPPORT PIN	APPROVED
D-135 PROCEDURE/HARDWARE	ALTERNATE WIRING - POSTAMP BAND 3	APPROVED
D-136 HARDWARE/PROCEDURE/ DRAWING	BAND -6, VOLTAGE REGULATOR, SERIES RESISTOR CHANGE.	APPROVED
D-137 PROCEDURE/HARDWARE DRAWING	CAL SHUTTER BACKUP - TIMING JITTER CORRECTION	APPROVED
D-138 PROCEDURE	DOCUMENTATION DEFICIENCY OF TELESCOPE THERMISTORES.	APPROVED
D-139 PROCEDURE	SPLICED INCHWORM LEADS - REYLAY OPTICS	CANCELLED
D-141 (SPARE) PROCEDURE/HARDWARE	PERMISSION TO USE COOLER CABLES OF PREVIOUS DESIGN	APPROVED

ORIGINAL PAGE IS
OF POOR
QUALITY

<u>DEVIATION NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
D-142 (SPARE) PROCEDURE/HARDWARE	PERMISSION TO USE AG EPOXY BONDS	APPROVED
D-143 PROCEDURE	TM CONFIGURATION FOR STARTING IA-07 TEST	APPROVED
D-144 PROCEDURE	TEST WITH OPEN 208 KHZ SYNC LINES	APPROVED
D-145 PROCEDURE	EMI TEST TEST DELETIONS	PENDING
D-146 PROCEDURE	TM CONFIGURATION FOR STARTING IA-07 TEST	APPROVED
D-147 HARDWARE/PROCEDURE	SOLDERING OF TWO RESISTORS TO R130 PADS	APPROVED
D-148 PROCEDURE	PERMISSION TO USE EM TM 32015-618 INSTEAD OF TP 32015-626 FOR MASS PROPERTIES DETERMINATION	PENDING
D-150 HARDWARE/ PROCEDURE/ DRAWING	ALTERNATE WIRING	APPROVED
D-154 PROCEDURE	USE OPTIONAL AC07 TEST CONFIGURATION FOR AC07 TESTING.	APPROVED
D-155 PROCEDURE	USE BAND 4 DETECTOR 7 TO CONDUCT IA04 TEST	APPROVED
D-156 PROCEDURE	CALCULATE BAND 6 IGFOVS FROM COMPONENT LEVEL SPOT SCAN MEASUREMENTS	APPROVED

ORIGINAL PAGE IS
OF POOR QUALITY

<u>DEVIATION NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
D-157 PROCEDURE	USE OF MOTOR FROM UNCONTROLLED STORAGE	PENDING
D-158 PROCEDURE	EMI/EMC TESTS DELTION	APPROVED
D-159 DRAWING/HARDWARE/ PROCEDURAL	ALTERNATE WIRING	APPROVED
D-160 PROCEDURAL	USE OF NON-RELEASE DRAWING FOR FABRICATING THE FOLLOWING ITEMS: 1) SK10779 SPACER, RETAINER 2) SK10793 SHIM, RETICLE	APPROVED 8 EA 2 EA
D-161 PROCEDURAL	ALLOW DEVIATION FROM FLIGHT CONFIGURATION FOR AC02, AC22 + S-T: F1-015.	APPROVED
D-162 PROCEDURAL	CONTINUE AC TESTS AND DO BL TESTS WITH PARTIAL TM CONFIGURATION.	APPROVED
D-163 PROCEDURAL	MANUAL OPERATION OF CALIBRATOR CONTROL CONSOLE (CCC)	APPROVED
D-164 PROCEDURAL	MANUAL OPERATION OF CALIBRATOR CONTROL CONSOLE (CCC).	APPROVED
D-165 PROCEDUAL	PERMISSION TO PERFORM BL07, BL12, BL16 AND BL19/20 TESTS WITH PARTIAL TM CONFIGURATION.	APPROVED

SUMMARIZE AS OF 7-26-82

ORIGINAL PAGE IS
OF POOR QUALITY

<u>WAIVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W109 HARDWARE	PERMISSION TO ASSEMBLE B7 DETECTOR WITH DISCREPANT BAND 5 DETECTOR.	APPROVED
W110 HARDWARE	PERMISSION TO TEST AND REPAIR DISCREPANT BAND 7 DETECTOR.	APPROVED
W111 HARDWARE	PERMISSION TO CONTINUE DISCREPANT BAND 5 & 7 DETECTORS.	APPROVED
W112 HARDWARE	PERMISSION TO CONTINUE THRU FPA ASSY. 50795 W/BAND 3, CH 9 WIDE BAND NOISE OF 2.9 pA.	APPROVED
W113 HARDWARE	PERMISSION TO USE NONCONFORMING INSB DETECTORS.	APPROVED
W114 HARDWARE	PERMISSION TO PROCEED W/BAND 4 CH 21 NOISE OF 2.8 pA.	APPROVED
W115 PROCEDURE/ HARDWARE	PERMISSION TO USE BAND 2 BAND LEVEL ASSY. S/N 401.	APPROVED
W116 HARDWARE/ PROCEDURE	PERMISSION TO USE BAND 3 BAND LEVEL ASSY. S/N 201.	APPROVED
W117 HARDWARE/ PROCEDURE	PERMISSION TO USE BAND 4 BAND LEVEL ASSY. S/N 201.	APPROVED

ORIGINAL PAGE IS
OF POOR QUALITY

<u>WAIVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W118 HARDWARE/PROCEDURE	PERMISSION TO USE PFPA W/BAND AND CH. 16 NOISE OF 2.8 PA.	APPROVED
W119 HARDWARE/PROCEDURE	PERMISSION TO USE HALF-BAND 207-1	APPROVED
W120 HARDWARE/PROCEDURE	PERMISSION TO USE BAND 4 POSTAMP S/N 201.	APPROVED
W121 HARDWARE/PROCEDURE (SCAN MIRROR)	TO RUNAROUND TIME EXCEEDS SPECIFICATION.	APPROVED
W122 PROCEDURE	PERMISSION TO REPAIR BAND 7 INSB DETECTOR.	APPROVED
W123 PROCEDURE	PERMISSION TO USE BAND 1 BAND LEVEL ASSY. S/N 401	APPROVED
W124 HARDWARE/ PROCEDURE	MINOR PERFORMANCE DISCREPANCIES S/N 003 MUX	APPROVED
W125 HARDWARE (MULTIPLEXER)	BROKEN SCREW IN ONE MUX MOUNTING HOLE.	APPROVED
W126 HARDWARE	PERMISSION TO USE PFPA W/BAND 1 MISALIGNMENT	APPROVED
W129	HARDWARE TELESCOPE HOUSING. BLACK PAINT FLAKING.	CANCELLED

ORIGINAL PAGE IS
OF POOR QUALITY

<u>WAIVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W130 (SPARE) HARDWARE	PERMISSION TO USE SPARE CFPA WITH DAMAGED TRACES.	APPROVED
W132 HARDWARE	PERMISSION TO USE INSB DETECTOR ARRAYS	APPROVED
W133 HARDWARE	PERMISSION TO USE NON-CONFORMING INSB DETECTORS.	APPROVED
W134 HARDWARE	PERMISSION TO USE CFPA W/VOID IN CIRCUIT TRACE.	APPROVED
W135 HARDWARE/ PROCEDURE	PERMISSION TO USE FLCFPA W/DISC REP PER FR 8208.	APPROVED
W136 HARDWARE/ PROCEDURE	LOW VALUE FOR TELESCOPE MTF	APPROVED
W137 PROCEDURE/ HARDWARE	REFLECTANCE OF TELESCOPE OPTICS	APPROVED
W138 HARDWARE/PROCEDURE (PF/FL)	STRESS LEVEL OF PULSE-WIDTH MODULATOR (90997-2)	APPROVED
W139 HARDWARE	SOLITHANE CONFORMAL COATING	APPROVED
W140 PROCEDURE	MISSING PLANNING FOR 51787 THERMISTOR BLACK ASSY.	APPROVED

ORIGINAL PAGE IS
OF POOR QUALITY

<u>WAIVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W141 PROCEDURE	MISSING PLANNING FOR SCREW TRIM OPERATION.	APPROVED
W142 HARDWARE/ PROCEDURE	PERMISSION TO USE F-J CFPA WITH DISCREPANT SUBSTRATE	APPROVED
W143 PROCEDURE	NO PLANNING FOR EO 8842 - BAFFLE ASSY.	APPROVED
W144 PROCEDURE	DEVIATION FOR RADIATIVE COOLER TEST PLAN	APPROVED
W145 PROCEDURE	WAIVER FOR IANIK TEST PROCEDURE	APPROVED
W146 PROCEDURE (PF-F-S)	PERMISSION TO USE HCT DETECTORS MADE WITHOUT RELEASE PLANNING.	APPROVED
W-147 PROCEDURE	DEVIATION FROM RAD COOLER TEST PLAN	APPROVED
W-148 PROCEDURE	WAIVER ON TOLERANCE OF PFP TO SCAN DIRECTION ALIGNMENT.	APPROVED
W-149 HARDWARE	WAIVER FOR RADIATIVE COOLER CIRCUIT DIAGRAM.	APPROVED
W-150 PROCEDURE/HARDWARE	SPLICE EBTCE CABLES	APPROVED
W-151 PROCEDURE	PERMISSION TO SHORTEN TEMPERATURE CONTROL TEST	APPROVED

ORIGINAL PAGE IS
OF POOR QUALITY

<u>WALVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W-152 (SPARE) HARDWARE	PERMISSION TO USE NON-CONFORMING INSB DETECTORS.	APPROVED
W-153 (SPARE) PROCEDURE/ HARDWARE	PERMISSION TO USE INSB DETECTORS FROM LOT 24 WAFER 21.	PENDING
W-154 (SPARE) HARDWARE/PROCEDURE	PERMISSION TO USE BAND LEVEL ASSY. S/N 501-2	PENDING
W-155 (SPARE) HARDWARE/PROCEDURE	PERMISSION TO USE BAND LEVEL ASSY S/N 501-1	PENDING
W-156 HARDWARE	TERMINAL BOARD TO REPLACE SPLICED COOLER DOOR MOTOR LEAD	APPROVED
W-157 (SPARE) HARDWARE/PROCEDURE	PERMISSION TO USE HALF BAND S/N 211-1	PENDING
W-158 (SPARE) HARDWARE/PROCEDURE	PERMISSION TO USE HALF BAND S/N 101-1	PENDING
W-160	PERFORM AC-2 TEST UTILIZING UNDOCUMENTED TELEMETRY SYNCHRONIZER.	APPROVED

ORIGINAL PAGE IS
OF POOR QUALITY

<u>WAIVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W-161 HARDWARE	PERMISSION TO USE CFPA WITH A BAND 5 DETECTOR THAT DOES NOT MEET SYSTEM SPECTRAL FLATNESS SPECIFICATION.	PENDING
W-162 HARDWARE	PERMISSION TO PROCEED WITH F-1 SYSTEM BAND 5 TO BAND 7 REGISTRATION.	PENDING
W-163 HARDWARE	PERMISSION TO USE CFPA WITH FET OFFSETS >10mV BAND -7 CH 7+15.	PENDING
W-164 PROCEDURAL	PERMISSION TO USE SPARE CFPA WITHOUT PERFORMING NON-DESTRUCTIVE PULL TEST.	PENDING
W-165 HARDWARE	PERMISSION TO USE AS-IS WITH FOLLOWING DISCREPANCIES: THE SPECTRAL MATCHING VARIATION BETWEEN CHANNELS IS A MAXIMUM OF .065% IN BAND 1+1.07% IN BAND 4.	PENDING
W-166 PROCEDURAL	A WAIVER IS REQUESTED TO DELETE CS06 PORTION OF EMI/EMC TESTS. SUMMARIZE AS OF 7-23-82.	APPROVED

ORIGINAL PAGE IS
OF POOR QUALITY

ADDENDUM FOR PRE-SHIPMENT REVIEW

<u>WAIVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W167 HARDWARE/PROCEDURE	PERMISSION TO CUT TRACES AND USE ALTERNATE WIRING TO INSTALL 16 RESISTORS.	APPROVED
W168 HARDWARE	PERMISSION TO USE BAND 5, CHANNEL 7 WITH COHERENT NOISE.	APPROVED
W169 HARDWARE	PERMISSION TO USE BANDS 1 AND 4 WITH SPECTRAL MATCHING VARIATIONS GREATER THAN 0.5%.	APPROVED
W170 HARDWARE	PERMISSION TO USE BANDS 1 AND 4 WITH IFOV SIZES GREATER THAN 43.2 AND 46.35.	APPROVED
W171 PROCEDURE	CHANGED FLIGHT ACCEPTANCE SINE VIBRATION LEVELS IN THRUST AXIS.	APPROVED
W172 HARDWARE	PERMISSION TO USE SPARE MULTIPLEXER HYBRID MICRO-CIRCUIT WITH SETTTLING TIME OF 26 NANOSECONDS INSTEAD OF 20 NANOSECONDS MAX.	APPROVED
W173 PROCEDURE	PERMISSION TO DELETE REQUIREMENT TO PROVIDE A TELESCOPE BASEPLATE TEMPERATURE TELEMETRY CHANNEL.	APPROVED
W174 HARDWARE	PERMISSION TO USE WITH OUT-OF-FIELD RESPONSE. SHOULD BE LESS THAN 1%, IS 3.4%.	APPROVED.

ORIGINAL PAGE IS
OF POOR QUALITY

ADDENDUM FOR PRE-SHIPMENT REVIEW

<u>WAIVER NUMBER</u>	<u>DESCRIPTION</u>	<u>STATUS</u>
W175 PROCEDURE	PERMISSION TO ACCEPT TEST SEGMENT 2 OF TP 32015-625 THAT WAS CONDUCTED AT A BUS VOLTAGE OF 28V INSTEAD OF 23V.	APPROVED
W176 PROCEDURE	PERMISSION TO RUN STR F-1 029 AND F-1 033 IN LIEU OF BL 19/20 MINI 3B AND BL 19/20 MINI 4B.	APPROVED
W177 PROCEDURE	PERMISSION TO DELETE TVS 6 ORBIT 8 AND RESEQUENCE TV TS 6 ORBIT 12, ORBIT 13 AND 14 TO FOLLOW TVTS 6 ORBIT 7.	APPROVED

ORIGINAL PAGE IS
OF POOR QUALITY

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-480 OR 481 FOR INSTRUCTIONS)

DATE PREPARED

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coronar Dr., Goleta, CA 93117				2. ☒ DEVIATION ☐ WAIVER	
				3. ☒ MINOR ☐ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
a. MODEL/TYPE FLT 1	b. MFR CODE 11323	c. SYS. DESIG. TM	d. DEV/WAIVER NO. D-143	☐ FUNCTIONAL ☐ ALLOCATED	☒ PRODUCTION
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED	
a. SYSTEM				b. YES ☐ NO ☒	
b. ITEM				c. YES ☐ NO ☒	
c. TEST PLAN				d. YES ☐ NO ☒	
9. TITLE OF DEVIATION/WAIVER Thematic Mapper Configuration for Starting IA-07 Test				10. CONTRACT NO. & LINE ITEM NAS5-24200	
11. CONFIGURATION ITEM NOMENCLATURE TM 51065				12. CL NO.	
13. DEFECT NO.				14. DEFECT CLASSIFICATION	
15. NAME OF PART OR LATEST ASSEMBLY AFFECTED Test Procedure				16. PART NO OR TYPE DESIGN.	
17. LOT NO.				18. QTY	
19. EFFECT ON COST/PRICE NONE				20. EFFECT ON DEL VERY SCHEDULE None, if deviation is approved	
21. EFFECT ON INTEGRATED LOGISTIC SUPPORT INTERFACE, ETC. NONE				22. EFFECT ON DEL VERY SCHEDULE None, if deviation is approved	
23. DESCRIPTION OF DEVIATION/WAIVER Request authorization to start IA-07 531 (Power and Grounding) without the following items assembled on TM (51065): 1. Radiative Cooler 51200 2. Circuit Boards: 50920 Temp.Controller and dc Restore 50942 Temp.Control 50912 Band 6 Buffer 50908-1 Band 5 Buffer 50908-2 Band 7 Buffer					
24. NEED FOR DEVIATION/WAIVER To proceed with IA-07 testing until the assemblies are available for proper configuration for IA-07 Test. After installation of the Radiative Cooler and the Bands 5, 6, 7 Buffers, Sections 5.3.4 and 5.3.5.23 through 5.3.5.27 of TP 32015-531 will be conducted.					
25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER					
26. SIGNATURE AND AUTHORIZING SIGNATURE					
27. APPROVAL/DISAPPROVAL					
28. APPROVAL/DISAPPROVAL					
29. APPROVAL/DISAPPROVAL					
30. APPROVAL/DISAPPROVAL					
31. APPROVAL/DISAPPROVAL					
32. APPROVAL/DISAPPROVAL					
33. APPROVAL/DISAPPROVAL					
34. APPROVAL/DISAPPROVAL					
35. APPROVAL/DISAPPROVAL					
36. APPROVAL/DISAPPROVAL					
37. APPROVAL/DISAPPROVAL					
38. APPROVAL/DISAPPROVAL					
39. APPROVAL/DISAPPROVAL					
40. APPROVAL/DISAPPROVAL					
41. APPROVAL/DISAPPROVAL					
42. APPROVAL/DISAPPROVAL					
43. APPROVAL/DISAPPROVAL					
44. APPROVAL/DISAPPROVAL					
45. APPROVAL/DISAPPROVAL					
46. APPROVAL/DISAPPROVAL					
47. APPROVAL/DISAPPROVAL					
48. APPROVAL/DISAPPROVAL					
49. APPROVAL/DISAPPROVAL					
50. APPROVAL/DISAPPROVAL					
51. APPROVAL/DISAPPROVAL					
52. APPROVAL/DISAPPROVAL					
53. APPROVAL/DISAPPROVAL					
54. APPROVAL/DISAPPROVAL					
55. APPROVAL/DISAPPROVAL					
56. APPROVAL/DISAPPROVAL					
57. APPROVAL/DISAPPROVAL					
58. APPROVAL/DISAPPROVAL					
59. APPROVAL/DISAPPROVAL					
60. APPROVAL/DISAPPROVAL					
61. APPROVAL/DISAPPROVAL					
62. APPROVAL/DISAPPROVAL					
63. APPROVAL/DISAPPROVAL					
64. APPROVAL/DISAPPROVAL					
65. APPROVAL/DISAPPROVAL					
66. APPROVAL/DISAPPROVAL					
67. APPROVAL/DISAPPROVAL					
68. APPROVAL/DISAPPROVAL					
69. APPROVAL/DISAPPROVAL					
70. APPROVAL/DISAPPROVAL					
71. APPROVAL/DISAPPROVAL					
72. APPROVAL/DISAPPROVAL					
73. APPROVAL/DISAPPROVAL					
74. APPROVAL/DISAPPROVAL					
75. APPROVAL/DISAPPROVAL					
76. APPROVAL/DISAPPROVAL					
77. APPROVAL/DISAPPROVAL					
78. APPROVAL/DISAPPROVAL					
79. APPROVAL/DISAPPROVAL					
80. APPROVAL/DISAPPROVAL					
81. APPROVAL/DISAPPROVAL					
82. APPROVAL/DISAPPROVAL					
83. APPROVAL/DISAPPROVAL					
84. APPROVAL/DISAPPROVAL					
85. APPROVAL/DISAPPROVAL					
86. APPROVAL/DISAPPROVAL					
87. APPROVAL/DISAPPROVAL					
88. APPROVAL/DISAPPROVAL					
89. APPROVAL/DISAPPROVAL					
90. APPROVAL/DISAPPROVAL					
91. APPROVAL/DISAPPROVAL					
92. APPROVAL/DISAPPROVAL					
93. APPROVAL/DISAPPROVAL					
94. APPROVAL/DISAPPROVAL					
95. APPROVAL/DISAPPROVAL					
96. APPROVAL/DISAPPROVAL					
97. APPROVAL/DISAPPROVAL					
98. APPROVAL/DISAPPROVAL					
99. APPROVAL/DISAPPROVAL					
100. APPROVAL/DISAPPROVAL					

DD FORM 1694

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE AIL-STD-440 OR 441 FOR INSTRUCTIONS)

DATE PREPARED
4-1-82

PROCURING ACTIVITY NO. **P**

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Concomar Drive, Goleta, CA 93117				2. ☒ DEVIATION ☐ WAIVER ☒ MINOR ☐ MAJOR ☐ CRITICAL			
3. DESIGNATION FOR DEVIATION/WAIVER				4. BASE LINE AFFECTED		5. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED	
a. MODEL/TYPE F1	b. MFR CODE 11323	c. SYS. DESIG. TM	d. DEV/WAIVER NO. D-164	☐ FUNCTIONAL	☐ ALLOCATED	☒ PRODUCT	☐ YES ☒ NO
6. SPECIFICATIONS AFFECTED-TEST PLAN				7. DRAWINGS AFFECTED			
a. SYSTEM				b. MFR. CODE			
c. TEST PLAN				d. NUMBER			
e. TITLE OF DEVIATION/WAIVER Test with Open 208 kHz Sync Lines				f. CONTRACT NO. & LINE ITEM NAS5-24200			
8. CONFIGURATION ITEM IDENTIFICATION F1 Thematic Mapper Assy				9. CLASSIFICATION OF SYSTEM			
10. NAME OF PART OR LOWEST ASSEMBLY AFFECTED F1 Thematic Mapper Assy				11. DEFECT CLASSIFICATION			
12. PART NO. OR TYPE DESIGN 51065-E				☐ MINOR ☐ MAJOR ☐ CRITICAL			
13. LOT NO. N/A				14. QTY 1			
15. EFFECT ON COST/PRICE				16. RECURRING DEVIATION/WAIVER			
17. EFFECT ON DELIVERY SCHEDULE				☐ YES ☒ NO			
18. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.							

19. DESCRIPTION OF DEVIATION/WAIVER

1. Perform Electronics-Module Integration Tests (TPs-531, -532, -533) with 208 kHz sync lines to PS1 and PS2 opened up via B.O.B. (P46:R5;S5:U5;V5:T5; and W5) switches. During IA07 Part III (TP-533), perform video-verification test collects (VIDVER) with B.O.B. switches closed and open to achieve comparison.

2. At conclusion of AC02, the sync-line contacts will be removed from connector A1-P46, insulated and tied back per class 1 ECP ** to be written at that time. (Item 23, Statement 1. cont.)

Also, during AC02 test phase, expose the instrument to a low-to-moderate, 48"-SIS, radiance and sequentially fill the COMPTAL CRT with video data from one detector in each band and critique each display for periodic artifacts.

* or by extracting, and labelling, the 6 contacts at the P46 Wear Conn.

20. REASONS FOR DEVIATION/WAIVER

Spurious power-supply shutdowns occur with the sync lines normally connected. When 208 kHz sync to the power supplies is disabled, the shutdown problems are avoided. No change in System Performance is anticipated, based on previous testing (PF).

** GSFC Spec #400.8-D-210, Rev B, p23, Par 3.3.4.4.3 states: "...dc converters of the power supply shall be synchronized to the multiplexer."

REA <i>[Signature]</i>	SYS ENGR <i>[Signature]</i>	RE <i>[Signature]</i> 4/2/82
QA <i>[Signature]</i> 4/2/82	PS <i>[Signature]</i> 4-2-82	CMO <i>[Signature]</i> 4-26-82
21. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 51065 Serial No. 3 ONLY		
22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE <i>[Signature]</i> 2 Apr 82		
23. APPROVAL/DISAPPROVAL		
24. APPROVAL RECOMMENDED ☐ APPROVED ☒ DISAPPROVED ☐		
25. GOVERNMENT ACTIVITY NASA GSFC		
26. SIGNATURE <i>[Signature]</i> 4/6/82		
27. DATE		

DD FORM 1694

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction J10

REQUEST FOR DEVIATION/VAIYER
(SEE H16-STD-440 OR A11 FOR INSTRUCTIONS)

DATE PREPARED
4-1-82

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coronar Drive, Coleta, CA 93117				2. ☒ DEVIATION ☐ VAIYER	
3. DESIGNATION FOR DEVIATION/VAIYER				4. BASE LINE AFFECTED	
a. MODEL/TYPE F1	b. MFR. CODE 11323	c. SYS. DESIG. TM	d. DEV/VAIYER NO. D-144	5. ☐ FUNC. TIONAL ☐ ALLG. CATED ☒ PROG. UCT	
6. SPECIFICATIONS AFFECTED-TEST PLAN				7. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED	
a. SYSTEM				b. DRAWINGS AFFECTED	
c. ITEM				d. YES ☐ NO ☒	
e. TEST PLAN				f. YES ☐ NO ☒	
8. TITLE OF DEVIATION/VAIYER Test with Open 208 kHz Sync Lines				9. CONTRACT NO. & LINE ITEM NAS5-24200	
10. CONFIGURATION ITEM IDENTIFICATION F1 Thematic Mapper Assy				11. CERTIFICATION OF EFFECT	
12. NAME OF PART OR LATEST ASSEMBLY AFFECTED F1 Thematic Mapper Assy				13. DEFECT NO.	
14. PART NO. OR TYPE DESIG. 51065				15. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL	
16. LOT NO. N/A				17. QTY 1	
18. EFFECT ON COST/PRICE				19. REQUESTING DEVIATION/VAIYER ☐ YES ☒ NO	
20. EFFECT ON DELIVERY SCHEDULE				21. EFFECT ON DELIVERY SCHEDULE	
22. EFFECT ON INTERMEDIATE LOGISTIC SUPPORT, INTERFACES, ETC.					

23. DESCRIPTION OF DEVIATION/VAIYER 1. Perform Electronics-Module Integration Tests (TPs-531, -532, -533) with 208 kHz sync lines to PS1 and PS2 opened up via B.O.B. (P46:R5;S5:U5;V5:T5; and W5) switches. During IA07 Part III (TP-533), perform video-verification test collects (VIDVER) with B.O.B. switches closed and open to achieve comparison.
2. At conclusion of AC02, the sync-line contacts will be removed from connector Al-P46, insulated and tied back per class 1 ECP ** to be written at that time.
(Item 23, Statement 1. cont.)

Also, during AC02 test phase, expose the instrument to a low-to-moderate, 48"-SIS, radiance and sequentially fill the COMPTAL CRT with video data from one detector in each band and critique each display for periodic artifacts.

* or by extracting, and labelling, the 6 contacts at the P46 Wear Conn.

24. NEED FOR DEVIATION/VAIYER
Spurious power-supply shutdowns occur with the sync lines normally connected. When 208 kHz sync to the power supplies is disabled, the shutdown problems are avoided. No change in System Performance is anticipated, based on previous testing (PF).

** GSFC Spec #400.8-D-210, Rev B, p23, Par 3.3.4.4.3 states: "...dc converters of the power supply shall be synchronized to the multiplexer."

REA <i>[Signature]</i>	SYS ENGR <i>[Signature]</i>	RE <i>[Signature]</i> 4/2/82
		QA <i>[Signature]</i> 4/2/82
		PE <i>[Signature]</i> 4-2-82
25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER Serial No. 3		
26. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE <i>[Signature]</i> 2 APR 82		
27. APPROVAL/DISAPPROVAL		
a. ☐ APPROVAL RECOMMENDED		
b. ☒ APPROVED ☐ DISAPPROVED		
c. GOVERNMENT ACTIVITY NASA GSFC		
d. SIGNATURE <i>[Signature]</i> 4/6/82		
DD FORM 1694		

6 April 82

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Concomar Drive, Goleta, CA 93117				2. ☒ DEVIATION ☐ WAIVER	
				3. ☐ MINOR ☒ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
6. MODEL/TYPE Flight	7. MFR. CODE 11323	8. SYS. DESIG. TM	9. DEV/WAIVER NO. D-145	☒ FUNCTIONAL ☐ ALLOCATED ☐ PRODUCT ☐ YES ☒ NO	
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED	
MFR. CODE SPEC./DOC. NO. SN				MFR. CODE NUMBER REV. NO. NO.	
9. TEST PLAN 11323 GSFC 400.8-D-201				10. CONTRACT NO. & LINE ITEM NAS5-24200	
11. CONFIGURATION ITEM NOMENCLATURE Thematic Mapper Instrument				12. CO NO.	
13. NAME OF PART OR LARGEST ASSEMBLY AFFECTED F-1 Thematic Mapper Instrument				14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL	
15. PART NO. OR TYPE DESIGNATION 51065				16. DEFECT NO. S/N003	
17. LOT NO.				18. QTY 1	
19. EFFECT ON COST/PRICE				20. EFFECT ON DELIVERY SCHEDULE	
21. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.					

22. DESCRIPTION OF DEVIATION/WAIVER

Waive the following test requirements of GSFC 400.8-D-201, GSFC specification - Thematic Mapper Interface Control Document, paragraph 4.2:

- a) Radiated Emission RE02 (Electric Field)
- b) Radiated Emission RE04 (Magnetic Field)
- c) Radiated Susceptibility RS03 (E Field)
- d) Conducted Emission CE01 and CE03 (Powerline)

It is requested that the EMC Test Requirements for F-1 are CS01, CS02, and CS06 only.

ORIGINAL PAGE IS
OF POOR QUALITY

23. REFD FOR DEVIATION/WAIVER

EMC tests of the Engineering Model and Protoflight Model Thematic Mapper instruments showed no significant susceptibility to radiated fields; this has been confirmed by Landsat-D Spacecraft EMC tests. Landsat-D tests have also demonstrated that the spacecraft is not susceptible to radiated or conducted emissions from the Protoflight Model Thematic Mapper.

Deletion of the above tests would eliminate the necessity of transporting the Thematic Mapper and test equipment to an EMC test facility.

Rel Donna Williams for C. Council
QA Donna Williams
PE Donna Williams 4-7-82

24. PRODUCTION EFFECTIVITY BY SERIAL NUMBER

25. AUTHORIZING ACTIVITY AUTHORIZING SIGNATURE FR Hillman 4-6-82		TITLE Manager, Quality Control - Program Manager	
26. APPROVAL/DISAPPROVAL		27. APPROVAL/DISAPPROVAL	
☐ APPROVAL RECOMMENDED ☐ DISAPPROVED		☐ APPROVED ☐ DISAPPROVED SIGNATURE DATE	
28. GOVERNMENT ACTIVITY			

ORIGINAL PAGE 18
OF POOR QUALITY

HUGHES

INTERDEPARTMENTAL CORRESPONDENCE



TO: J. Engel
ORG:

CC: Distribution

DATE: Sept. 14, 1981
REF. HS236-2237

SUBJECT: EMI/EMC Retest (Engineering Model Mapper)

FROM: Y. Ben
ORG.

BLDG. S1
LOC. SC

MAIL STA. D339
EXT. 5-8811

INTRODUCTION:

In the initial EMI/EMC test of the Engineering Model Thematic Mapper, it was found that the Mapper was susceptible in specific frequency ranges to conducted interference. In particular, during the conduct of tests CS01 and CS02, the Mapper exhibited general susceptibility throughout the frequency range of 6 KHz to 80 KHz. The susceptibility peaks occurred in the frequency range from 20 KHz to 45 KHz.

Throughout the remainder of the EMI/EMC test, i.e., radiated susceptibility and tests which examined the Mapper's immunity to spikes on the power line, only two marginal performance inquiries were noted.

1. The Mapper radiated a 10 Mhz interference in the vicinity of J-18, J-19 and J-24.
2. Inserting a 28 V negative spike in the 28 V return line resulted in the shutter losing "phase lock". Retesting, briefly, with a reduced negative spike of 26 V on the 28 V return line resulted in no anomalous shutter behavior.

SUBJECT:

1. Retests conducted to ascertain the correlation between susceptibility signatures to specific changes in BTCE/Mapper grounding configurations provided little or no conclusive data relevant to "improved" performance. All tests run with the intent of achieving an acceptable mapper susceptibility profile through a variation in the system grounding scheme resulted in susceptibility signatures which similarly characterized the Mapper during the initial EMI/EMC tests.

Noteworthy, in the analysis of retest results is the fact that although apparent improvements were observed with certain grounding configurations, these improvements were:

1. The result of monitoring channels with lower gain.
2. The result of CS01/CS02 test configurations which also exhibited higher Mapper immunity during the initial test.
3. The result of the "subjective" determination of when a particular recovery threshold occurs.

For the most part if performance improvements could not be categorized in the aforementioned, these improvements were not significant in frequency range or magnitude to be worthy of note.

ORIGINAL PAGE IS
OF POOR QUALITY

II. Retests conducted to evaluate the Engineering Model Mapper's susceptibility signatures to conducted interference with 8 KHz filters inserted between the interference source and the Mapper are depicted in graphs 1 and 2.

The RF source injection method for the frequency range of 20 Htz to 50 KHz was inductive and for the frequency range 50 KHz to 150 KHz was capacitive. The two different injection methods created noise signatures to vary in curve continuity, i.e., for the range from 11 to 50 KHz, no noise was visible/discernable on the Comptel and the Demux D/A output, whereas noise was definitely visible, although in low counts, at the beginning of CS02 (50 KHz). (Example graph 1).

The upper trace of the graphs depict the values at which noise recovery was exhibited, labeled threshold voltage P.P. and the lower trace shows recognizable interference as a function of injected RF frequency.

A. Graph 1 depicts the interference signatures with the RF source inserted into the 28 V line. The graph is a composite of a variety of tests run:

1. With the source swept from 20 Htz to 150 KHz.
2. With the Kepco power at 25 V and 28 V.
3. With the Mapper in "Picture Mode" via Power Supply 1 or 2.
4. With the source inserted first in J-18 then J-19.
5. With the count's recorded monitoring Band 1 Detector 1 or 2 (high gain channels).
6. With a second filter in and out of the return line.

In the above discussed configurations and variations the interference signatures were essentially identical. Peaks and nodes where recognizable noise patterns were observed were at 11 KHz and 55 KHz.

B. Graph 2 shows the noise signatures observed with the RF source inserted into the 28 V return line. Again the graph is a composite of a variety of tests run with the configurations and variations discussed in II-A-(1-6) with the exception of item 6 where the second filter was inserted and removed from the 28 V line. All combinations exhibited similar if not identical interference signatures.

At 2.75 KHz a Mapper noise susceptibility pattern occurred with a peak count of approximately 22. No susceptibility was evidenced in the frequency range greater than 50 KHz. A possible accounting of this disparity, since interference was observed in a test with insertion in the 28 V line at 55 KHz, could be due to the fact that the EMI instrument could only drive the load with 0.3 VPP at 50 KHz, as shown on the upper trace of graph 2.

C. Filters were inserted into the 28 V return and 28 V line for J-24. Again the variations of test configurations discussed in II-A-(1-6) were run with RF injected in first the 28 V line then the 28 V return. No discernable noise was detected throughout the range of 20 Htz. to 150 KHz.

ORIGINAL PAGE IS
OF POOR QUALITY


SUMMARY

With filters in all 28 V power (hot and return) to the Mapper, and observing a higher gain channel, noise was observed at 2.75 KHz (22 counts), 11 KHz (8 counts), and from 50 KHz to 75 KHz (Peak noise count of 15). The signatures depicted on Graphs 1 and 2 show marked improvement in the Mappers conducted susceptibility with the addition of input filters when compared with the "prefilter" graphs 3 and 4. Also graphs 3 and 4 are composites of noise signatures exhibited during the initial tests observing Band 4 Detector 9 (one of the lower gain channels). Also of particular relevance is the lack of susceptibility with filters in the range of 20 KHz to 30 KHz, a frequency region the spacecraft is suspected of inserting interference into the 28 V power bus.

1/1/11 in 6.4h 88 in 174.1 line
 RF intent. $\omega = 28V$ line
 Kerco at 28V and 28V

Time:
 hold
 ypp

1.5
 1.4
 1.2
 1.0
 0.8
 0.6
 0.4
 0.2

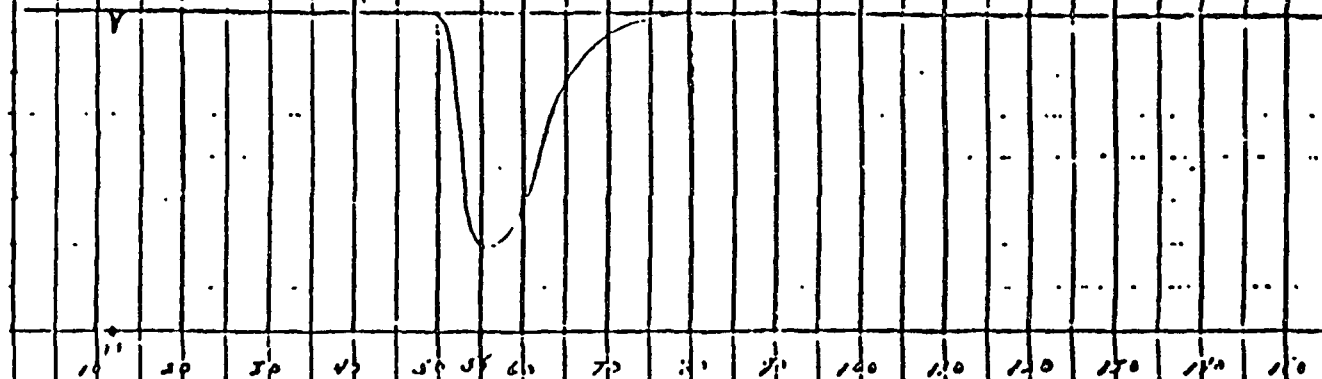

Noise
 Count

5.0
 4.0
 3.0
 2.0
 1.0
 0.0

10 20 30 40 50 60 70 80 90 100 110 120 130 140 150


Invert. RF t. (KHz)

ORIGINAL PAGE IS
 OF POOR QUALITY

RF insertion in Return line
 level of 25V and 25V

Inc.
 held
 VPP


1.5
 1.4
 1.2
 1.0
 0.8
 0.6
 0.4
 0.2

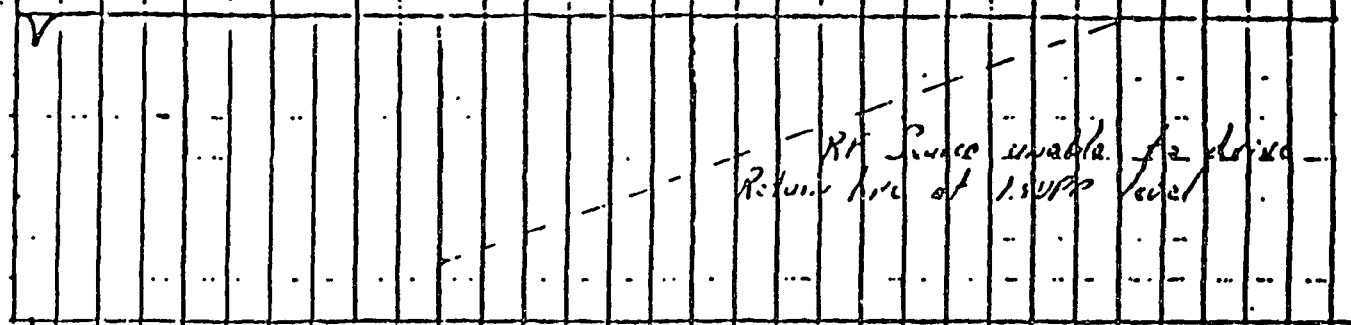

20 10 20 30 40 50 60 70 80 90 100 110 120 130 140 150 160 170 180 190

Noise
 Count

25
 20
 15
 10
 5


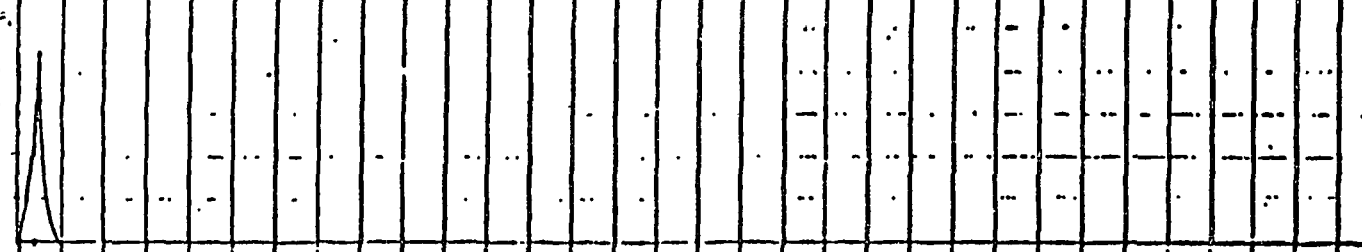


20 10 20 30 40 50 60 70 80 90 100 110 120 130 140 150 160 170 180 190

Inverted RF for (KATZ)

Graph

ORIGINAL PAGE IS
 OF POOR QUALITY

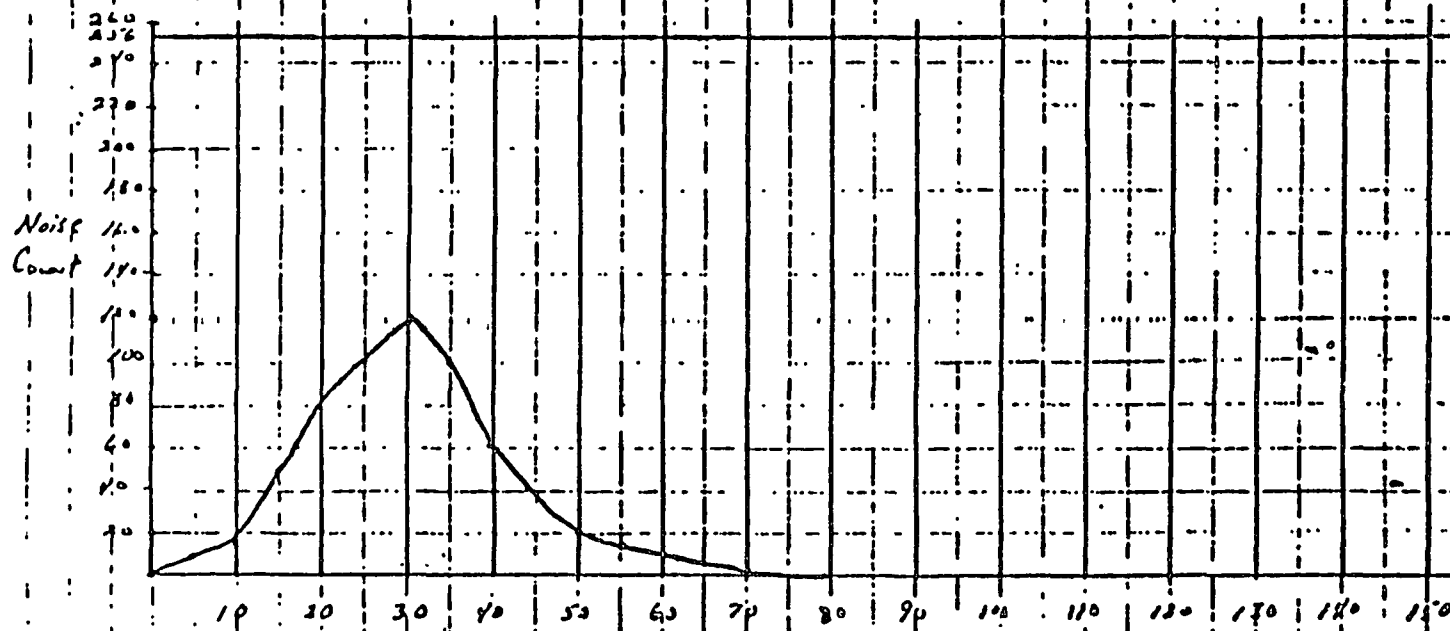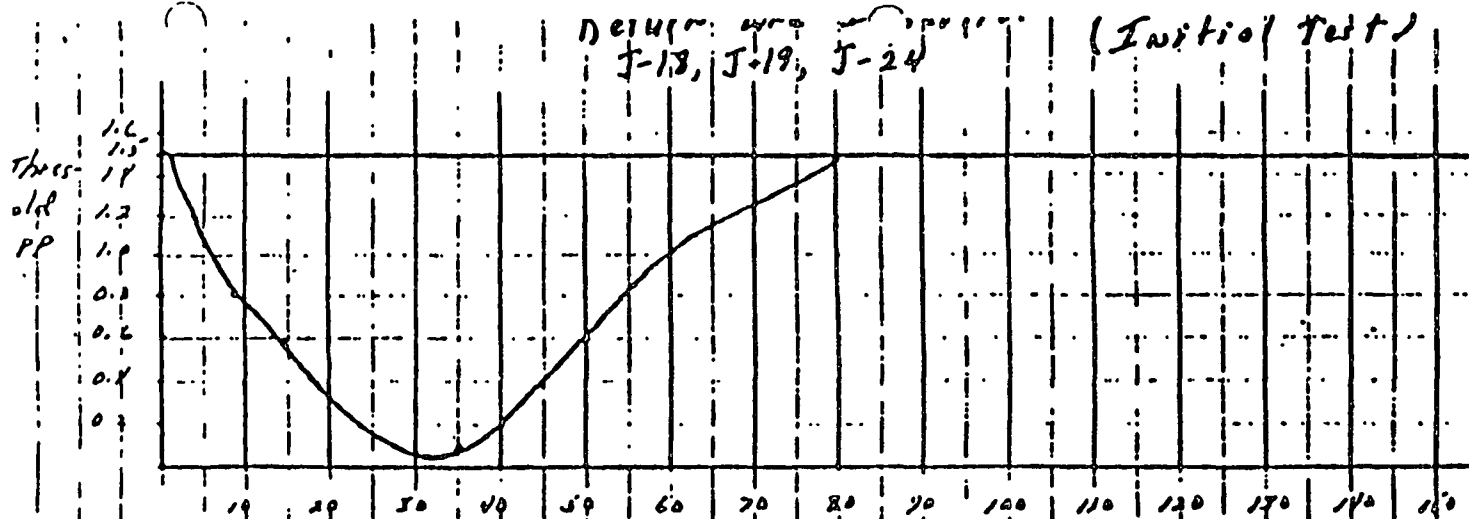


Inverted RF Frequency (KHz)

Graph 1


ORIGINAL PAGE IS
OF POOR QUALITY

J-18, J-19, J-24 (Initial Test)

Thres
hold
VPP

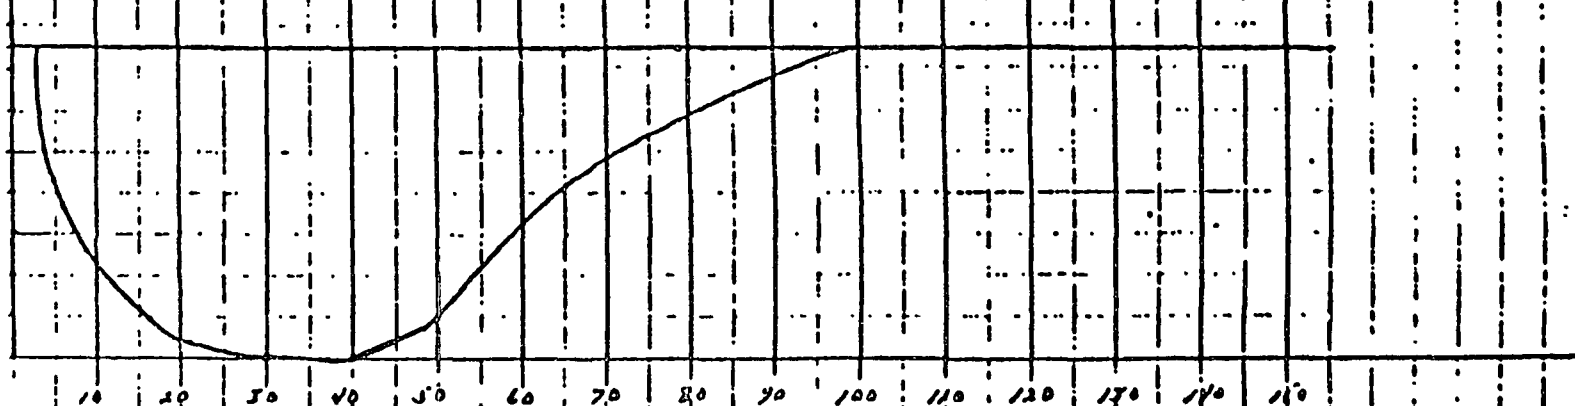

Noise
Count

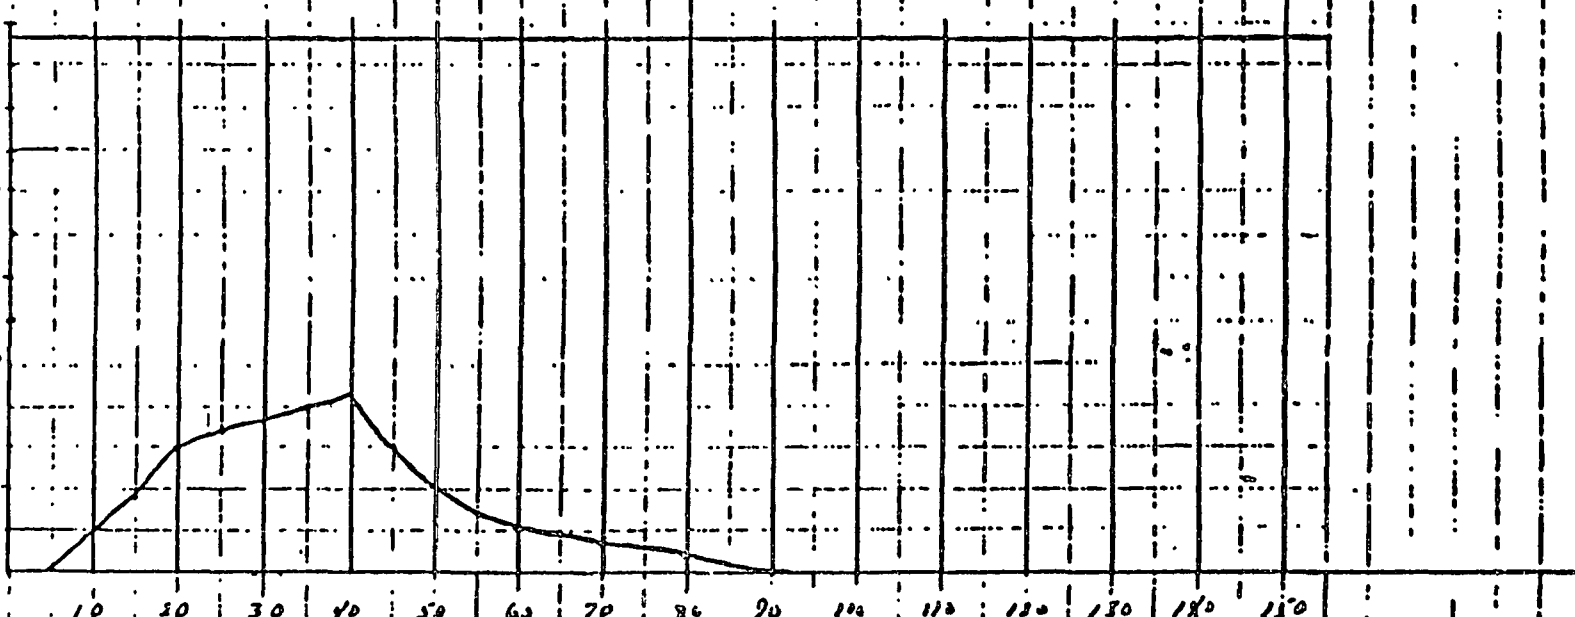

Inserted RF frequency (kHz)

Graph 4

ORIGINAL PAGE 13
OF POOR QUALITY

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/VAIVER
(SEE MIL-STD-461 OR 461 FOR INSTRUCTIONS)

DATE PREPARED
08 April 82

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coronar Dr., Goleta, CA 93117				2. ☒ DEVIATION ☐ VAIVER	
3. ☒ MINOR ☐ MAJOR ☐ CRITICAL				4. ☒ MINOR ☐ MAJOR ☐ CRITICAL	
5. DESIGNATION FOR DEVIATION/VAIVER a. MODEL/TYPE: FLT 1 b. MFR. CODE: TM c. SYS. DESIG.: D-146 d. DEV/VAIVER NO.: D-146				6. BASE LINE AFFECTED ☐ REC-TIONAL ☐ ALLO-CATED ☒ PROD-UCT	
7. SPECIFICATIONS AFFECTED-TEST PLAN a. SYSTEM: 11323 b. ITEM: TP32015-532, -533 c. TEST PLAN: None				8. OTHER SYSTEM/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO	
9. TITLE OF DEVIATION/VAIVER Thematic Mapper Configuration for Starting IA-07 Test				10. CONTRACT NO. & LINE ITEM NAS5-24200	
11. AUTHORIZING AGENCY NUMBER/VAIVER TM51065				12. CD NO. 13. CAPSIT NO. 14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL	
15. NAME OF PART OR LARGEST ASSEMBLY AFFECTED Test Procedure				16. PART NO. & TYPE DESIGN 51065-E	
17. LOT NO. 18. QTY. 19. EXCLUDING DEVIATION/VAIVER ☐ YES ☒ NO				20. EFFECT ON DELIVERY SCHEDULE None, if deviation is approved	
21. EFFECT ON INTEGRATED COSTS/TYPE SUPPORT, INTERFACE, ETC. None					
22. DESCRIPTION OF DEVIATION/VAIVER Request authorization to start IA-07 -532 (Commands and Tele-metry) and -533 (Video/Syst.Timing) without the following items assembled on TM(51065): 1. Radiative Cooler 51200 2. Circuit Boards: 50920 Temp.Controller and dc Restore 50942 Temp.Control 50912 Band 6 Buffer 50908-1 Band 5 Buffer 50908-2 Band 7 Buffer 3. R/C Door Assembly 51740 4. Relay Optics Assy 52534 5. One of the two SMA Heater Assys (52566-2,-3) will be simulated by similar value fixed resistors until replacement heaters are mounted.					
23. REASON FOR DEVIATION/VAIVER To proceed with IA-07 testing until the assemblies are available for proper configuration for IA-07 test. After installation of the Radiative Cooler and the Bands 5, 6, 7 Buffers, appropriate sections, list attached, will be conducted to completed the IA-07 test sequence. The Relay Optics Assy will be mounted as soon as it is available (expect this to occur during -532), allowing IW & LVDT interfacing to be checked. The R/C Door Assembly electricals will be checked with the assembly connected alongside, not integrated to, the 51065 TM assy.					
24. REASON FOR DEVIATION/VAIVER To proceed with IA-07 testing until the assemblies are available for proper configuration for IA-07 test. After installation of the Radiative Cooler and the Bands 5, 6, 7 Buffers, appropriate sections, list attached, will be conducted to completed the IA-07 test sequence. The Relay Optics Assy will be mounted as soon as it is available (expect this to occur during -532), allowing IW & LVDT interfacing to be checked. The R/C Door Assembly electricals will be checked with the assembly connected alongside, not integrated to, the 51065 TM assy.					
25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 51065 SN 003 Flight Model ONLY					
26. AUTHORIZING ACTIVITY AUTHORIZING SIGNATURE R. Wengler 4/12/82					
27. APPROVAL/DISAPPROVAL a. ☐ APPROVAL RECOMMENDED b. ☒ APPROVED ☐ DISAPPROVED					
28. GOVERNMENT ACTIVITY NASA					
DD FORM 1694					

ORIGINAL PAGE IS
OF POOR QUALITY

ATTACHMENT TO DEVIATION D-146

TP 32015-532

5.1.2.16-26 CFPA Heater, BB Heater, SMA Heater command
5.1.2.52-54 Cooler Door Commands
5.1.2.73-79 Fusible Link Commands
5.1.2.84-89 Intern. Stage Heater Commands
5.1.2.100-111 Cooler Door Commands
5.2.4 Frame DC Restore
5.2-6 Thermal Tests
5.2.7 Cooler Door Test
5.2.8 Fusible Link Test
5.2.11 Power Profile
5.2.12.5 Bank 5 and 7 Video only

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR 481 FOR INSTRUCTIONS)

DATE PREPARED

19 April 1982

REQUIRING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS

SANTA BARBARA RESEARCH CENTER
75 Coronar Drive, Goleta, CA 93117

2. ☒ DEVIATION ☐ WAIVER
3. ☐ MINOR ☒ MAJOR ☐ CRITICAL

4. DESIGNATION FOR DEVIATION/WAIVER

5. MODEL/TYPE T.M. S/N 003
6. UFR. CODE 11323
7. SYS. DESIG. D-148

8. PAGE LINE AFFECTED

9. ☐ PRE-
TYPICAL ☐ ALLO-
CATED ☒ PRO-
DUCT

10. OTHER SYSTEMS/COMPON-
ENT ITEMS AFFECTED

☐ YES ☒ NO

11. SPECIFICATIONS AFFECTED-TEST PLAN

12. UFR. CODE 11323
13. DEC./DOC. NO. TP32015-626
14. CON. NO. 003

15. DRAWINGS AFFECTED

16. UFR. CODE
17. DRAWING NO.
18. REV. NO.

19. TEST PLAN
20. TITLE OF DEVIATION/WAIVER
Permission to use Engineering Model TP 32015-618 instead of TP 32015-626 for Mass Properties Determination.

21. CONFIGURATION TYPE IDENTIFICATION
THEMATIC MAPPER

22. CLASSIFICATION OF DEFECT

23. ☐ MINOR ☐ MAJOR ☐ CRITICAL

24. NAME OF PART OR LARGEST ASSEMBLY AFFECTED
T.M. TOP ASSEMBLY

25. PART NO. OR TYPE DESIGNATION
51065, E

26. LOT NO. 003
27. QTY 1
28. REQUIRES DEVIATION/WAIVER
☒ YES ☐ NO

29. EFFECT ON COST/PRICE
May save cost up to 15K.

30. EFFECT ON DELIVERY SCHEDULE
May save up to 6 days of schedule.

31. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.

32. DESCRIPTION OF DEVIATION/WAIVER
For T.H. Mass Properties determination, instead of performing TP32015-626 Mass Properties determination, TP32015-618 Mass Properties Test Procedure--Engineering Model will be performed.

It is anticipated that Mass Properties determination as specified on TP32015-618, will be conducted at SBRC.

33. REASON FOR DEVIATION/WAIVER
T.M. Mass Properties determination for P/F SN002 was performed per TP32015-626. This procedure yielded the following data: Weight, CG-X,Y,Z, MOI-Ixx, Iyy, Izz, POI-Ixx, Iyz, Ixy.

This deviation to perform TP32015-618 for F1 SN003 is necessary to determine only the weight and two point CG-Y,Z.

Proto flight SN002 MOI, POI and CGX data will be used as references. Per attached data, worst case between CG of P/F SN002 and E/M SN001 was 2% difference. Weight difference is less than .1%.

RE: *[Signature]* 020420 SYS ENGR *[Signature]* *[Signature]* 4/20/82
QA *[Signature]* 4-20-82
PE *[Signature]* 4/20/82

34. PRODUCTION EFFECTIVITY BY SERIAL NUMBER
003

35. SIGNATURE AUTHORIZING SIGNATURE
[Signature]

36. TITLE
Minor - System Engineering
Major/Critical - Program Manager

37. APPROVAL/DISAPPROVAL
☐ APPROVAL RECOMMENDED ☐ APPROVED ☐ DISAPPROVED

38. GOVERNMENT ACTIVITY
SIGNATURE DATE

DD FORM 1694

SANTA BARBARA RESEARCH CENTER
A Subsidiary of Hughes Aircraft Company
INTERNAL MEMORANDUM

ORIGINAL PAGE IS
OF POOR QUALITY

TO: Distribution

CC: Data Bank (8)

DATE: 11 June 1981

REP: HS236-7492

SUBJECT: Thematic Mapper Engineering Model
Weight and Center-of-Gravity

FROM: F. D. McLaughlin

BLDG. 774 MAIL STA. 79
EXT. 4351

The Thematic Mapper Engineering Model (EM) weight and center-of-gravity were measured at SBRC on 1 June 1981 per test procedure TP32015-618, Rev. A. The results of this test are as follows:

A. EM Uncorrected Gross Weight (pounds/Kg)	<u>528.51/239.73</u>
B. Instrument Configuration Items Missing	<u>15.06/6.83</u>
1. Thermal Louvers	2.09 pounds
2. Thermal Blankets and Supports	11.37 pounds
3. Side Panel	1.60 pounds
C. Excess Configuration Items	<u>4.95/2.25</u>
1. Miscellaneous Instrumentation	4.75 pounds
2. Miscellaneous connector protectors	0.1 pounds
3. Ground wires	0.1 pounds
D. EM Corrected Gross Weight (pounds/Kg) (A + B - C = D)	<u>538.62/244.32</u>
E. Corrections Required to Project Protoflight Weight	<u>-1.15/-0.52</u>
1. Conformal Coating of PWB's	+3.08 pounds
2. Radiation Plate Material	-6.02 pounds
(EM weight, 17.70 pounds, Aluminum)	
(PF weight, 11.68 pounds, Beryllium)	
3. SMA - EM vs. PF (24.49 vs. 24.89)	+0.40 pounds
4. MIX - EM vs. PF (26.45 vs. 27.44)	+0.99 pounds
5. PS - EM vs. PF (22.99 vs. 23.39)	+0.40 pounds

ORIGINAL PAGE IS
OF POOR QUALITY

F. D. McLaughlin to Distribution
HS236-7492

11 June 1981
Page 2

F. Projected Weight of Protoflight Model

537.47/243.79

G. Center-of-Gravity

$\bar{Y}$ = 11.64 inches

$\bar{Z}$ = 11.51 inches


$\bar{X}$ = -13.5 inches*

* $\bar{X}$ not measured in this test

H. Comparison to Predicted Values

	Measured Value	Predicted Value	Difference
Engineering Model Weight (pounds)	538.62	None	—
PF Model Projected Weight (pounds)	537.47	542.16	-4.69 (0.87%)
$\bar{Y}$	11.64	10.72*	0.92 inches toward Radiative Cooler
$\bar{Z}$	11.91	11.24*	0.67 inches toward nadir

 *Values obtained in November 1979 from computer run.


F. D. McLaughlin,
Systems Engineering

/lbq

HUGHES

ORIGINAL PAGE IS
OF POOR QUALITY

INTERDEPARTMENTAL CORRESPONDENCE



TO: A.H. Connor
ORG: 44-29

cc: Distribution

DATE: 4 November 1981
REF. 4131.12/1/146

SUBJECT: Measured Mass Properties
Thematic Mapper Proto-
flight Model

FROM: D.C. Leamon
ORG. 41-31-10

BLDG. S12 MAIL STA. W303
LOC. SC EXT. 88608

- REF. 1: Thematic Mapper Interface Control Drawing 3533000-400 Rev C
REF. 2: Internal Memo HS236-1202-8, "Thematic Mapper Mass Properties Summary", F.D. McLaughlin to Distribution, Dtd. 19 Feb 1981.
REF. 3: Internal Memo HS236-7492, "Thematic Mapper Engineering Model Weight and Center-of-Gravity", F.D. McLaughlin to Distribution, Dtd. 11 Jun 1981.
Ref. 4: IDC HS236-2249, "Mass Properties Tare Items for Thematic Mapper Protoflight Model", F.D. McLaughlin to A.M. Carter, Dtd. 1 Oct 1981.

The attached tables present the mass properties of the thematic mapper (Protoflight Model) derived from mass properties testing.

Table I contains the predicted flight properties. The test data has been corrected for non-flight items included in the test configuration and flight items that were not included in the test configuration as listed in Ref. 4.

Table 2 depicts the reference coordinate system for center-of-gravity and moment of inertia data.

Table 3 compares measured mass properties data with drawing requirements and previous predictions. The "Y" and "Z" C.G. data compares favorably to data measured on the engineering model at SBRC (Ref. 3).

The predicted weight is 29.92 pounds less than the maximum allowable weight.

D.C. Leamon
D.C. Leamon

W.T. Griffiths
W.T. Griffiths
Mass Properties Engineering

THEMATIC MAPPER

ORIGINAL PAGE IS
OF POOR QUALITYMEASURED MASS PROPERTY DATA

PFH


	<u>U.S. Customary Units</u>		<u>SI (Metric Units)</u>	
Height:	538.87	Pounds	244.43	Kilograms
Centers of Gravity:				
X:	12.935	Inches	32.85	Centimeters
Y:	11.405	Inches	28.97	Centimeters
Z:	11.957	Inches	30.37	Centimeters
Moments of Inertia:				
I _{xx} :	274239	lb-in ²		
	59.19	sl-ft ²	80.25	Kilogram-meter ²
I _{yy} :	94195	lb-in ²		
	20.33	sl-ft ²	27.57	Kilogram-meter ²
I _{zz} :	237492	lb-in ²		
	51.26	sl-ft ²	59.50	Kilogram-meter ²
Products of Inertia:				
I _{xy} :	2715	lb-in ²		
	0.59	sl-ft ²	0.79	Kilogram-meter ²
I _{xz} :	-518	lb-in ²		
	-0.11	sl-ft ²	-0.15	Kilogram-meter ²
I _{yz} :	20218	lb-in ²		
	4.36	sl-ft ²	5.92	Kilogram-meter ²

TABLE 1

ORIGINAL PAGE IS
OF POOR QUALITY

46 0703

10 X 10 TO THE INCHES
10 X 10 TO THE INCHES

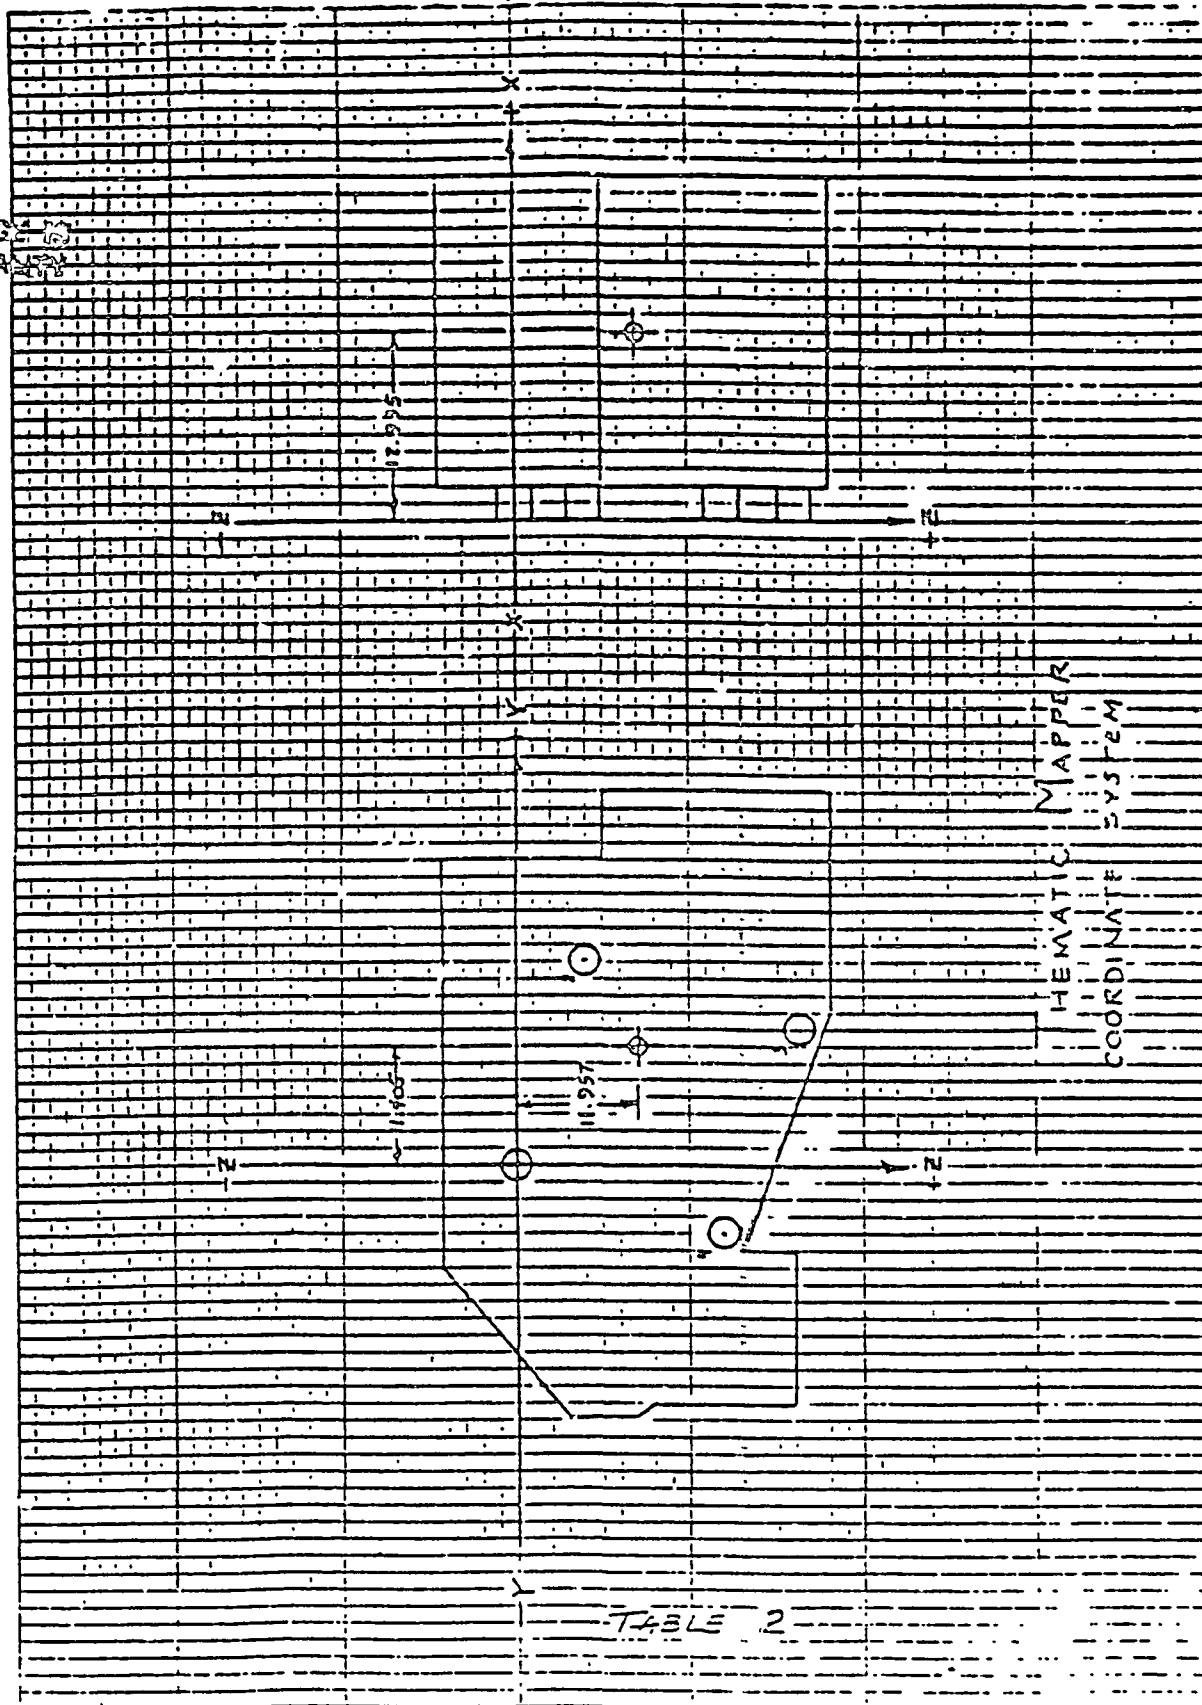

ORIGINAL PAGE IS
OF POOR QUALITY

ORIGINAL PAGE IS
OF POOR QUALITY

THEMATIC MAPPER

MASS PROPERTIES STATUS

REFERENCE PARAMETER	AS TESTED	REF 1 ICD 353300-400	REF 2 HS 236- 1202-8	REF 3 HS 236- 7492
WEIGHT	538.87	568.79*	534.10	537.47
X	12.935	13.0	13.12	-
Y	11.405	11.2	10.72	11.64
Z	11.957	12.4	11.16	11.91
Ix	59.19	-	57.4	-
Iy	20.33	-	20.2	-
Iz	51.26	-	47.1	-
Ixy	0.59	-	-0.51	-
Ixz	-0.11	-	0.41	-
Iyz	4.36	-	3.48	-

*Maximum allowable weight per A Connor

TABLE 3

28 May 1982

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coronar Drive, Goleta, CA 93117				2. ☒ DEVIATION ☐ WAIVER	
				3. ☒ MINOR ☐ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
a. MODEL/TYPE Flight 1	b. IFR. CODE 11323	c. SYS. DESIG. TH	d. DEV/WAIVER NO. D-155	☐ FUNC. TYPICAL ☐ ALD-CATED ☒ PROD-UCT ☐ YES ☒ NO	
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED	
a. SYSTEM	b. IFR. CODE	c. SPEC./DOC. NO.	d. SCH	e. IFR. CODE	f. NUMBER
	11323	TP32015-504*			
9. TEST PLAN				10. CONTRACT NO. & LINE ITEM	
Permission to Substitute Data Bases and Use Band 4 Detector 7 to Conduct IA04 Test				NAS5-24200	
11. CONFIGURATION TYPE/DESCRIPTION Thematic Mapper				12. CD NO.	
13. EFFECT NO.				14. DEFECT CLASSIFICATION	
				☒ MINOR ☐ MAJOR ☐ CRITICAL	
15. NAME OF PART OR LATEST ASSEMBLY AFFECTED Test Procedure		16. PART NO. OR TYPE DESIG. 51065 - G		17. LOT NO.	
				18. QTY 1	
19. EFFECT ON COST/PRICE NONE				20. EFFECT ON DELIVERY SCHEDULE None, If Deviation Is Approved	
21. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. NONE					

22. DESCRIPTION OF DEVIATION/WAIVER
Permission to change Data=Bases and use Band 4 Detector 7. This will have the impact of creating a bad version of CHNCTR.IVF (For Detector 9 data since there is no signal) when it is called by CMD File.

* TM11A6IA4.DAB;5
IA04BSL.DAB;2

NOTE(added on 820604) Band 4 Det 9 is the usual x=0, y=0 reference center for all detector center calculations. The B5D9 signal was not usable due to a SIU-cable problem. The set of det.9s were replaced by det.7s (BL 4,5,7). The loss of file CHNCTR.IVF is of no concern because the file is not used to do BBR.

23. RECD FOR DEVIATION/WAIVER

Detector 9, in Band 5, signal is not getting through SIU. Present Data Bases are set up to Ref. Band 4 Detector 9 signal as ORIGNXON IA04BBR. A fix may require a substantial amount of time and will necessitate demating most of the connectors.

REA <i>[Signature]</i>	SYS ENGR <i>[Signature]</i>	PE <i>[Signature]</i>	6/1/82
25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 51065 S/N 003 ONLY			
26. AUTHORIZING ACTIVITY AUTHORIZING SIGNATURE <i>[Signature]</i>		TITLE Systems Engineering	
27. APPROVAL/DISAPPROVAL			
☐ APPROVAL RECOMMENDED		☒ APPROVED ☐ DISAPPROVED	
28. GOVERNMENT ACTIVITY NASA GSEC		SIGNATURE George B. Smith	
		DATE 6/4/82	

DD FORM 1694

28 MAY 82

ORIGINAL PAGE IS
OF POOR QUALITY

1. ORIGINATOR NAME AND ADDRESS SANTA BARBARA RESEARCH CENTER 75 COROMAR DR., GOLETA CA 93117				2. ☒ DEVIATION ☐ WAIVER	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
6. MODEL/TYPE FLT 1	7. MFR. CODE	8. SYS. DESIG. TM	9. DEV/WAIVER NO. DIS	☐ FUNCTIONAL ☐ ALLOCATED ☒ PRODUCT	10. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED	
MFR. CODE		SPEC./DOC. NO.		MFR. CODE	NUMBER
11323		TP32015504*			
9. TEST PLAN				10. CONTRACT NO. & LINE ITEM NAS 5-24200	
11. TITLE OF DEVIATION/WAIVER PERMISSION TO SUBSTITUTE DATA BASES AND USE BAND 4 DETECTOR 7 TO CONDUCT IA04 TEST.				12. CD NO.	
13. CONFIGURATION ITEM IDENTIFICATION THEMATIC MAPPER				14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL	
15. NAME OF PART OR LOWEST ASSEMBLY AFFECTED TEST PROCEDURE		16. PART NO. OR TYPE DESIGN 51065-G		17. LOT NO.	
18. EFFECT ON COST/PRICE NONE		19. PART NO. OR TYPE DESIGN		20. QTY 1	
21. EFFECT ON DELIVERY SCHEDULE NONE, IF DEVIATION IS APPROVED				22. RECURRING DEVIATION/WAIVER ☐ YES ☒ NO	
23. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. NONE					
24. DESCRIPTION OF DEVIATION/WAIVER PERMISSION TO CHANGE DATA BASES AND USE BAND 4 DETECTOR 7. THIS WILL HAVE THE IMPACT OF CREATING A BAD VERSION OF CHNCTR.IVF (FOR DETECTOR 9 DATA SINCE THERE IS NO SIGNAL) WHEN IT IS CALLED BY CMD FILE.					

-{TMIIAGIA4.DAB;5
*IA04 BSL.DAB;2

25. NEED FOR DEVIATION/WAIVER

DETECTOR 9, IN BAND 4, SIGNAL IS NOT GETTING THROUGH SIU. PRESENT DATA BASES ARE SET UP TO REF. BAND 4 DETECTOR 9 SIGNAL AS ORIGIN K0N IA04 BBR. A FIX MAY REQUIRE A SUBSTANTIAL AMOUNT OF TIME AND WILL NECESSITATE DEMATING MOST OF THE CONNECTORS.

26. PRODUCTION EFFECTIVITY BY SERIAL NUMBER

51065/S/N003 ONLY

27. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

TITLE

27. APPROVAL/DISAPPROVAL

☐ APPROVAL RECOMMENDED

☐ APPROVED

☐ DISAPPROVED

C. GOVERNMENT ACTIVITY

SIGNATURE

DATE

DD FORM 1694

8-11627

SOFTWARE ENGINEERING CHANGE REQUEST	HUGHES CODE IDENT 82877	ECR NO. - 972731 SHEET 1 OF 1 SHEETS
--	----------------------------	---

REQUEST			
PROGRAM THEMATIC MAPPER 1162	SYS/EQUIP NAME OR DES IAØ4 BAND TO BAND REGISTRATION	CONTROL ITEM NAME & NO. TP 32015-504 -C	SPECIFICATION/DWG NO.(S) TMITA6IA4.DAB IAØ4 BSL.DAB;

DESCRIPTION OF PROBLEM
DETECTOR 9, IN BAND 4, SIGNAL IS NOT GETTING THROUGH S.I.U. A FIX MAY REQUIRE A SUBSTANTIAL AMOUNT OF TIME AND WILL NECESSITATE REMOVING MOST OF THE CONNECTORS. DATA BASES ARE SET UP TO REF. BAND 4 DETECTOR 9 SIGNAL AS ORIGIN ON IAØ4 BBR.

PROPOSED SOLUTION
CHANGE DATA BASES AND USE BAND 4 DET. 7 THIS WILL HAVE ~~THE~~ THE IMPACT OF CREATING A BAD VERSION OF CHNCTR.IVF (FOR DETECTOR 9 DATA SINCE THERE IS NO SIGNAL) WHEN IT IS CALLED BY CMD FILE.

WHEN IAØ4 TEST IS COMPLETE, RESTORE OLD FILES TO BE CURRENT VERSIONS. THE CHNCTR.IVF FILE CREATED DURING TEST SHOULD BE DELETED

REQUESTED BY C.J. KENT	EXT 6268	BLOG, M/S B-11/78	ORG CODE 22-21	DATE 5/17/82	URGENCY URGENT
APPROVED <i>[Signature]</i>	6155	B11/101	22-42	820517	RECM EFF
APPROVED <i>[Signature]</i>	6132	B11/29	2203	5/24/82	SIN 003 ONLY

DISPOSITION		REASON FOR REJECTION	DATE RECD IN ECC	SCH REPLY DATE	ADVA
☒ ACCEPTED		Tom: Deviation form should be used since this a temporary condition.			
☐ REJECTED					

CHANGE CLASS	☐ I	☐ IIA	☐ IIB	SPECIFICATION OR CONTROL ITEM	RESP SPEC ACT. OR RESP ENGRG ACT.	ECA NUMBER
DOCUMENT NO.(S) FOR IIB CHANGE						

ORG CODE	DATE	ORG CODE	DATE	RESP ENGRG ACT.	ORG CODE	DA
CLASS IIB RELEASE AUTHORIZATION				PROGRAM MGMT		
CHANGE EFFECTIVITY		CONTRACT NO		MANUFACTURING		DA
DISPOSITION OF ITEMS		CUSTOMER		DATE		ENGRG CHANGE CTR
						DA

OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/VAIVER
(SEE MIL-STD-460 OR MIL FOR INSTRUCTIONS)

DATE PREPARED
7 June 1982

PROCESSING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive, Goleta, CA. 93117				2. ☐ DEVIATION ☐ REQUEST			
3. ☐ MINOR ☒ MAJOR ☐ CRITICAL				4. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED			
5. DESIGNATION FOR DEVIATION/VAIVER		6. MODEL TYPE		7. BASE LINE AFFECTED		8. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED	
Flight (F1)		11323		TH		D-158	
9. MODEL TYPE		10. UFR. CODE		11. SPEC. DESIG.		12. DEV/VAIVER NO.	
Flight (F1)		11323		TH		D-158	
13. SPECIFICATIONS AFFECTED-TEST PLAN				14. DRAWINGS AFFECTED			
15. UFR. CODE				16. SPEC. NO.			
17. SYSTEM				18. TEST PLAN			
19. TEST PLAN				20. TEST PLAN			
21. TEST PLAN				22. TEST PLAN			
23. FILE OF DEVIATION/VAIVER				24. CONTRACT NO. & LINE ITEM			
EMI/EMC Tests Deletion				NAS5-24200			
25. DESCRIPTION OF DEVIATION/VAIVER				26. CLASSIFICATION OF DEFECT			
Thematic Mapper				27. DEFECT NO.			
28. NAME OF PART OR LATEST ASSEMBLY AFFECTED				29. DEFECT NO.			
F-1 Thematic Mapper Instru.				51065-85			
30. EFFECT ON COST/PRICE				31. EFFECT ON DELIVERY SCHEDULE			
May save cost associated with schedule.				May save up to 1 week of schedule			
32. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.				33. EFFECT ON DELIVERY SCHEDULE			
None				May save up to 1 week of schedule			

23. DESCRIPTION OF DEVIATION/VAIVER
This deviation is requested to supersede D145 as originally submitted. Deviation is requested to waive the following test requirements of GSFC 400.8-D-201, GSFC specification - Thematic Mapper Interface Control Document
a) Radiated Emission RE02 (Electric Field)
b) Radiated Emission RE04 (Magnetic Field)
c) Radiated Susceptibility RS03 (E Field)

It is requested that the EMC test requirements for F-1 are CS01, CS02, CS06, CE01, and CE03.

24. NEED FOR DEVIATION/VAIVER
EMC tests of the Engineering Model and Protoflight Model Thematic Mapper instruments showed no significant susceptibility to radiated fields: this has been confirmed by Landsat-D Spacecraft EMC tests.

Deletion of the above tests would eliminate the necessity of transporting the Thematic Mapper and test equipment to an EMC test facility; allowing for testing to be conducted at SBRC.

25. APPROVAL/RECOMMENDATION		26. APPROVAL/RECOMMENDATION	
27. APPROVAL/RECOMMENDATION		28. APPROVAL/RECOMMENDATION	
29. APPROVAL/RECOMMENDATION		30. APPROVAL/RECOMMENDATION	
31. APPROVAL/RECOMMENDATION		32. APPROVAL/RECOMMENDATION	
33. APPROVAL/RECOMMENDATION		34. APPROVAL/RECOMMENDATION	
35. APPROVAL/RECOMMENDATION		36. APPROVAL/RECOMMENDATION	
37. APPROVAL/RECOMMENDATION		38. APPROVAL/RECOMMENDATION	
39. APPROVAL/RECOMMENDATION		40. APPROVAL/RECOMMENDATION	
41. APPROVAL/RECOMMENDATION		42. APPROVAL/RECOMMENDATION	
43. APPROVAL/RECOMMENDATION		44. APPROVAL/RECOMMENDATION	
45. APPROVAL/RECOMMENDATION		46. APPROVAL/RECOMMENDATION	
47. APPROVAL/RECOMMENDATION		48. APPROVAL/RECOMMENDATION	
49. APPROVAL/RECOMMENDATION		50. APPROVAL/RECOMMENDATION	
51. APPROVAL/RECOMMENDATION		52. APPROVAL/RECOMMENDATION	
53. APPROVAL/RECOMMENDATION		54. APPROVAL/RECOMMENDATION	
55. APPROVAL/RECOMMENDATION		56. APPROVAL/RECOMMENDATION	
57. APPROVAL/RECOMMENDATION		58. APPROVAL/RECOMMENDATION	
59. APPROVAL/RECOMMENDATION		60. APPROVAL/RECOMMENDATION	
61. APPROVAL/RECOMMENDATION		62. APPROVAL/RECOMMENDATION	
63. APPROVAL/RECOMMENDATION		64. APPROVAL/RECOMMENDATION	
65. APPROVAL/RECOMMENDATION		66. APPROVAL/RECOMMENDATION	
67. APPROVAL/RECOMMENDATION		68. APPROVAL/RECOMMENDATION	
69. APPROVAL/RECOMMENDATION		70. APPROVAL/RECOMMENDATION	
71. APPROVAL/RECOMMENDATION		72. APPROVAL/RECOMMENDATION	
73. APPROVAL/RECOMMENDATION		74. APPROVAL/RECOMMENDATION	
75. APPROVAL/RECOMMENDATION		76. APPROVAL/RECOMMENDATION	
77. APPROVAL/RECOMMENDATION		78. APPROVAL/RECOMMENDATION	
79. APPROVAL/RECOMMENDATION		80. APPROVAL/RECOMMENDATION	
81. APPROVAL/RECOMMENDATION		82. APPROVAL/RECOMMENDATION	
83. APPROVAL/RECOMMENDATION		84. APPROVAL/RECOMMENDATION	
85. APPROVAL/RECOMMENDATION		86. APPROVAL/RECOMMENDATION	
87. APPROVAL/RECOMMENDATION		88. APPROVAL/RECOMMENDATION	
89. APPROVAL/RECOMMENDATION		90. APPROVAL/RECOMMENDATION	
91. APPROVAL/RECOMMENDATION		92. APPROVAL/RECOMMENDATION	
93. APPROVAL/RECOMMENDATION		94. APPROVAL/RECOMMENDATION	
95. APPROVAL/RECOMMENDATION		96. APPROVAL/RECOMMENDATION	
97. APPROVAL/RECOMMENDATION		98. APPROVAL/RECOMMENDATION	
99. APPROVAL/RECOMMENDATION		100. APPROVAL/RECOMMENDATION	

DD FORM 1694 O.K. to proceed... pending board approval at GSFC

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-480 OR 481 FOR INSTRUCTIONS)

DATE PREPARED

13 JUL 1982

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive, Goleta, CA 92117				2. ☒ DEVIATION ☐ WAIVER	
3. ☒ MINOR ☐ MAJOR ☐ CRITICAL				4. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO	
5. MODEL TYPE F-1	6. MFR. CODE 11323	7. SYS. DESIG. 1M	8. DEV/WAIVER NO. D-161	9. BASE LINE AFFECTED ☒ FURTHER ☐ ALLOCATED ☐ PRODUCE	
10. SPECIFICATIONS AFFECTED-TEST PLAN				11. DRAWINGS AFFECTED	
12. MFR. CODE TP32015-512. -529				13. NUMBER ---	
14. TEST PLAN				15. REV. ---	
16. TITLE OF DEVIATION/WAIVER Allow deviation from Flight configuration for AC02, AC22, and S-T: F1-015				17. CONTRACT NO. & LINE ITEM	
18. CONFIGURATION ITEM DESCRIPTION Thematic Mapper Assembly				19. CLASSIFICATION OF EFFECT ☐ MINOR ☐ MAJOR ☐ CRITICAL	
20. NAME OF PART OR LOWEST ASSEMBLY AFFECTED				21. DEFECT NO. 14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL	
22. PART NO. OR TYPE DESIG. 51065-5				23. LOT NO. 19. REQUIRING DEVIATION/WAIVER ☐ YES ☒ NO	
24. EFFECT ON COST/PRICE				25. EFFECT ON DELIVERY SCHEDULE 1 day delay	
26. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.					

23. DESCRIPTION OF DEVIATION/WAIVER
1. Request acceptance of spec-test F1-015 data taken under conditions (1), (2), and (3) described in memo HS236-8072.
 2. Request approval to continue thru AC02 Radiometric Calibration data collects under conditions (1), (2), and (3) described in memo HS236-8072.
 3. Request approval to perform AC22 under conditions (1), (2), and (3) described in memo HS236-8072.

ORIGINAL PAGE IS
OF POOR QUALITY

26. NEED FOR DEVIATION/WAIVER

(See memo HS236-8072)

27. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 51065 SN 003 ONLY	28. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE <i>[Signature]</i> 7/13/82	29. TITLE Minor System Engineering Major Critical - Program Manager
30. APPROVAL/DISAPPROVAL ☐ APPROVAL RECOMMENDED	31. SIGNATURE <i>[Signature]</i>	32. DATE 7/15/82
33. GOVERNMENT ACTIVITY NASA	34. DD FORM 1694	

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR 401 FOR INSTRUCTIONS)

DATE PREPARED

16 July 1982

PROCURING ACTIVITY NO

1. ORIGINATOR NAME AND ADDRESS
Santa Barbara Research Center
75 Coronar Drive, Goleta, CA 93117

G.S. PIEWS

2. ☒ DEVIATION ☐ WAIVER
3. ☒ MINOR ☐ MAJOR ☐ CRIT

4. DESIGNATION FOR DEVIATION/WAIVER

a. MODEL/TYPE P-1 TM b. MFR. CODE 11323 c. SYS. DESIG. TM d. DESIG. NO. D-162

5. BASE LINE AFFECTED

☒ FUNCTIONAL ☐ CALIBRATED ☐ PRODUCE

6. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECT

☐ YES ☒ NO

7. SPECIFICATIONS AFFECTED-TEST PLAN

a. SYSTEM 11323 b. SPEC. NO. TP32015-529 c. TEST PLAN -517

8. DRAWINGS AFFECTED

a. MFR. CODE b. NUMBER c. REV. d. NO. NO.

9. TITLE OF DEVIATION/WAIVER

Continue AC tests and do BL tests with partial TM configuration

10. CONTRACT NO. NASS-24200 LINE

11. CONFIGURATION ITEM IDENTIFICATION

Thematic Mapper Assembly

12. CD NO.

13. DEFECT NO. 14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRIT

15. NAME OF PART OR LATEST ASSEMBLY AFFECTED

Thematic Mapper Assembly

16. PART NO. OR TYPE DESIG.

51065

17. LOT NO.

003

18. QTY

1

19. RECURRING DEVIATION/WAIVER

☐ YES ☒ NO

20. EFFECT ON COST/PRICE

21. EFFECT ON DELIVERY SCHEDULE

3 day delay if not approved

22. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.

23. DESCRIPTION OF DEVIATION/WAIVER

Allow AC and BL tests to proceed without full TM electronic configuration. Permit system engineering to determine permissible testing relative to what TM functions are disabled.

24. NEED FOR DEVIATION/WAIVER

- Band 6 gains must be re-scaled. Therefore the A1 A16 PWB must be removed for rework.
- The 50942 Temp. Control PWB must be removed to complete prior rework.

25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER

26. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

TITLE

☐ APPROVAL RECOMMENDED

☒ APPROVED

☐ DISAPPROVED

27. GOVERNMENT ACTIVITY

NASA GSFC

SIGNATURE

George R. Britt

DATE

DD FORM 1694

2 CPO 1980 - 343

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR 461 FOR INSTRUCTIONS)

DATE PREPARED

22 July 1982

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coronar Drive, Goleta, CA 93117				J. A. Walker		2. ☒ DEVIATION ☐ WAIVER	
4. DESIGNATION FOR DEVIATION/WAIVER				3. BASE LINE AFFECTED		6. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED	
a. MODEL/TYPE F1 TM	b. MFR. CODE 11323	c. SYS. DESIG. TM	d. DEV/WAIVER NO. D163	☒ RECURRING ☐ ALLOCATED ☐ PRODUCE		☐ YES ☒ NO	
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED			
a. SYSTEM	b. MFR. CODE	c. SPEC./DOC. NO.	d. SCH	e. MFR. CODE	f. NUMBER	g. REV.	h. MOD. NO.
	11323	TP32015-518	Rev. A				
9. TITLE OF DEVIATION/WAIVER Manual operation of Calibrator Control Console (CCC)				10. CONTRACT NO. & LINE ITEM NAS5-24200			
11. CONFIGURATION ITEM NOMENCLATURE Thematic Mapper Assembly				12. CD NO.			
13. NAME OF PART OR LOWEST ASSEMBLY AFFECTED Thematic Mapper Assembly				14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL			
15. PART NO. OR TYPE DESIG. 51065				16. LOT NO. 003			
17. QTY 1				18. RECURRING DEVIATION/WAIVER ☐ YES ☒ NO			
19. EFFECT ON COST/PRICE --				20. EFFECT ON DELIVERY SCHEDULE 2-day delay			
21. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. --				22. DESCRIPTION OF DEVIATION/WAIVER			

Perform BL10 tests with manual operation of the CCC. (Manual positioning of six-position mirrors.) The following paragraphs of TP32015-518 will be affected: 4.1, 4.4.1.6, 5.4 and 5.5.2.

ORIGINAL PAGE IS
OF POOR QUALITY

23. NEED FOR DEVIATION/WAIVER

Rotary stages of TM calibrator inoperative.

24. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE		25. APPROVAL/DISAPPROVAL	
REA: <i>[Signature]</i> 9/1/82 SYS ENGR <i>[Signature]</i> 7/22/82		TITLE Minor - System Engineering Major/Critical - Program Manager	
26. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 003		27. APPROVAL/DISAPPROVAL	
☐ APPROVAL RECOMMENDED / GOVERNMENT ACTIVITY NASA/GSFC		☒ APPROVED ☐ DISAPPROVED SIGNATURE <i>[Signature]</i> DATE 7/32/82	
DD FORM 1694			

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-440 OR 441 FOR INSTRUCTIONS)DATE PREPARED
23 July 1982

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS J. A. Walker Santa Barbara Research Center 75 Coromar Drive, Goleta, CA 93117				2. ☒ DEVIATION ☐ WAIVER	
				3. ☒ MINOR ☐ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
a. MODEL/TYPE F1 TM	b. MFR CODE 11323	c. SYS. DESIG. TM	d. DEV/WAIVER NO D-164	☒ FUNC-TIONAL ☐ ALLO-CATED ☐ PROD-UCT	6. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED	
a. SYSTEM 11323 TP 32015-520 Rev. -				b. MFR. CODE NUMBER REV. NOR. NO.	
c. ITEM					
d. TEST PLAN					
9. TITLE OF DEVIATION/WAIVER Manual operation of Calibrator Control Console (CCC)				10. CONTRACT NO. & LINE ITEM NAS5-24200	
11. CONFIGURATION ITEM NOMENCLATURE Thematic Mapper Assembly				12. CD NO.	
				13. DEFECT NO.	
				14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL	
15. NAME OF PART OR LOWEST ASSEMBLY AFFECTED Thematic Mapper Assembly				16. PART NO. OR TYPE DESIG. 51065	17. LOT NO. 003
				18. QTY 1	19. RECURRING DEVIATION/WAIVER ☐ YES ☒ NO
20. EFFECT ON COST/PRICE --				21. EFFECT ON DELIVERY SCHEDULE 2-day delay	
22. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. --					
23. DESCRIPTION OF DEVIATION/WAIVER					

Perform BL12 test with manual operation of the CCC. (Manual positioning of rotary stages.) The following paragraphs of TP 32015-520 will be affected: 4.1, 4.4.6, 4.4.8.1, 4.4.8.2, 5.2, 5.4.1.1, 5.4.1.2, and 5.4.2.

ORIGINAL PAGE IS
OF POOR QUALITY

24. NEED FOR DEVIATION/WAIVER

Rotary stages of TM calibrator inoperative.

25. PRODUCTION/EFFECTIVITY BY SERIAL NUMBER 003		26. SIGNATURE OF ACTIVITY AUTHORIZING SIGNATURE <i>[Signature]</i>		27. APPROVAL/DISAPPROVAL a. ☐ APPROVAL RECOMMENDED b. ☒ APPROVED ☐ DISAPPROVED	
28. GOVERNMENT ACTIVITY NASA/GSFC		29. SIGNATURE <i>[Signature]</i>		30. DATE 7/23/82	
DD FORM 1694					

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-480 OR 481 FOR INSTRUCTIONS)

DATE PREPARED

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive, Goleta CA 93117				2. ☒ DEVIATION ☐ WAIVER	
				3. ☒ MINOR ☐ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
a. MODEL/TYPE FL TM	b. MFR. CODE 11323	c. SYS. DESIG. TM	d. DEV/WAIVER NO. D165	☒ FUNC. TIONAL ☐ ALLO. CATED ☐ PROD. UCT	
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED	
a. SYSTEM 11323				b. DRAWINGS AFFECTED MFR. COOP. NUMBER REV. NOR. NO.	
c. TEST PLAN					
9. TITLE OF DEVIATION/WAIVER Permission to perform BL07, BL12, BL16 & BL19/20 tests with partial TM Configuration				10. CONTRACT NO. & LINE ITEM NAS 5-24200	
11. CONFIGURATION ITEM NOMENCLATURE Thematic Mapper Assembly				12. CO NO.	
				13. DEFECT NO.	
				14. DEFECT CLASSIFICATION ☐ MINOR ☐ MAJOR ☐ CRITICAL	
15. NAME OF PART OR LARGEST ASSEMBLY AFFECTED Thematic Mapper Assembly		16. PART NO. OR TYPE DESIG. 51065		17. LOT NO. 003	
				18. QTY 1	
19. EFFECT ON COST/PRICE None		20. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. None		21. RECURRING DEVIATION/WAIVER ☐ YES ☒ NO	
22. EFFECT ON DELIVERY SCHEDULE					
23. DESCRIPTION OF DEVIATION/WAIVER Perform BL07, ~~BL12~~ , BL16 & BL19/20 tests with TM Band 6 postamp board removed. No part of the test or the TP is affected by the lack of Band 6 board, since no Band 6 measurements are involved in the BL19/20 tests					

ORIGINAL PAGE IS
OF POOR QUALITY

24. NEED FOR DEVIATION/WAIVER

25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER		26. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE		27. APPROVAL/DISAPPROVAL	
		REA <i>[Signature]</i> SYS ENGR <i>[Signature]</i>		TITLE Minor - System Engineering Major/Critical - Program Manager	
☐ APPROVAL RECOMMENDED		☒ APPROVED		☐ DISAPPROVED	
c. GOVERNMENT ACTIVITY NASA GSFC		SIGNATURE George B. Britt		DATE 7/24/82	

DD FORM 1694

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-40 OR -81 FOR INSTRUCTIONS)

DATE PREPARED

PROCURING ACTIVITY NO.

8-6-82

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Dr., Goleta, CA 93117				2. ☐ DEVIATION ☐ WAIVER 3. ☐ MINOR ☒ MAJOR ☐ CRITICAL			
4. DESIGNATION FOR DEVIATION/WAIVER a. MODEL/TYPE F1 b. MFR CODE 11323 c. SYS. DESIG. TM d. DEV/WAIVER NO. W-167				5. BASE LINE AFFECTED ☒ FUNCTIONAL ☐ UNLOCATED ☐ PRODUCT		6. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO	
7. SPECIFICATIONS AFFECTED-TEST PLAN a. SYSTEM b. ITEM c. TEST PLAN				8. DRAWINGS AFFECTED a. MFR. CODE 11323 b. NUMBER 50904 c. REV. G d. MFR. NO. 4072A			
9. TITLE OF DEVIATION/WAIVER Resistor Incorporation				10. CONTRACT NO. & LINE ITEM NAS 5-24200 Item 3			
11. CONFIGURATION / BY NOMENCLATURE Electronics Module Assembly				12. 25 NO. 13. DEFECT NO. 14. EFFECT CLASSIFICATION ☐ MINOR ☒ MAJOR ☐ CRITICAL			
15. NAME OF PART OR LARGEST ASSEMBLY AFFECTED PWB Assy Postamp Band 1				16. PAGE NO. OR TYPE DESIGN 50904-1/G		17. LOT NO. 18. QTY 1 19. RECURRING DEVIATION/WAIVER ☐ YES ☒ NO	
20. EFFECT ON COST/PRICE None				21. EFFECT ON DELIVERY SCHEDULE 8 mos. schedule impact if disapproved			
22. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. None							
23. DESCRIPTION OF DEVIATION/WAIVER ***This waiver cancels and supersedes D-159*** This waiver authorizes the cancellation of EO 4515A against affected drawing number and the retraction of changes already incorporated into the "E" revision of schematic 50905. In addition, allow the cutting of traces of 16 resistors per sheets 2 thru 6 of this waiver and allow alternate wiring process per SP80165 to install 16 resistors on Band 1 PWB Assy to eliminate coherent noise per FR5779.							

24. NEED FOR DEVIATION/WAIVER

Redesign and reprourement of electronic circuit boards would be required in order to eliminate alternate wiring. Minimum 8 months schedule slip and considerable cost would be involved. Redesign is not considered cost effective at this time.

25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 51065 SN 003 only		26. SIGNATURE AND AUTHORITY OF AUTHORIZING SIGNATURE R. Phillips		27. APPROVAL/DISAPPROVAL Minor - System Engineering Major/Critical - Program Manager	
28. APPROVAL RECOMMENDED ☐		29. APPROVED ☒		30. DISAPPROVED ☐	
31. GOVERNMENT ACTIVITY NASA/GSEC		32. SIGNATURE C. Phillips		33. DATE 8/31/82	
DD FORM 1694					

Program Instruction 010

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/WAIVER
(SEE J16-STD-00 ON J41 FOR INSTRUCTIONS)

DATE PREPARED

9 August 1982

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive, Goleta, CA 93117				2. ☐ DEVIATION ☒ WAIVER	
				3. ☐ MINOR ☒ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
a. MODEL TYPE F-1	b. MFR CODE 11323	c. SYS. DESIG. TM	d. DEV/WRITER NO. W168	☒ FUNCTIONAL ☐ ALLO- CATED ☐ PROD- UCT	
6. OTHER SYSTEMS/CONFIG- URATION ITEMS AFFECTED				☐ YES ☒ NO	
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED	
a. SYSTEM	b. MFR CODE	c. SPEC./DOC. NO.	d. SCH	e. MFR CODE	f. NUMBER
	11323	SS32015-001			
9. TEST PLAN				10. CONTRACT NO. & LINE ITEM	
11. TITLE OF DEVIATION/WAIVER Coherent Noise Band 5 Channel 7				NASS-24200	
12. CONFIGURATION ITEM DESCRIPTION Thematic Mapper Assembly				13. CD NO.	
14. NAME OF PART OR LOWEST ASSEMBLY AFFECTED				15. DEFECT NO.	
16. PART NO. OR TYPE DESIGNATION 51065				17. LOT NO.	
18. EFFECT ON COST/PRICE				19. EFFECT ON DELIVERY SCHEDULE	
20. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.				21. EFFECT ON DELIVERY SCHEDULE	

None

22. DESCRIPTION OF DEVIATION/WAIVER
Per failure report S8160, Band 5 Channel 7 has approximately 1.7 counts of noise while the rest of the band averages below 1.3 counts. The noise has been determined to have a coherent component at approximately 9.3 kHz. The cause of the coherent component has not been determined but the level has been consistent.

23. NEED FOR DEVIATION/WAIVER
Though the specification SS53015-001 allows for no discernable coherent noise, the amount shown by Band 5 Channel 7 is low enough to allow excellent image quality. Investigations as to cause, beyond those already done, would be a hazard to the hardware.

24. APPROVAL		25. APPROVAL	
REA <i>M. Phillips</i> SYS ENGR <i>R. Wenger</i>	RE <i>J. Brown</i> 8/9/82 QA <i>M. V. 8-4-82</i> PE <i>J. Brown</i> 8-9-82 CMO <i>S. Jackson</i> 9/9/82		
26. APPROVAL		27. APPROVAL	
<i>M. Phillips</i> Minor - System Engineering Major/Critical - Program Manager			
28. APPROVAL		29. APPROVAL	
☐ APPROVAL RECOMMENDED DD FORM 1694		☒ APPROVED Elizabeth A. Austin 8/31/82	

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR 461 FOR INSTRUCTIONS)

DATE PREPARED

9 August 1982

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive, Goleta, CA 93117				2. ☐ DEVIATION ☒ WAIVER	
				3. ☐ MINOR ☒ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. CASE LINE AFFECTED	
6. MODEL/TYPE F-1	7. WPR CODE 11323	8. SYS. DESIG. TH	9. DEV/WAIVER NO. W169	☒ FUNCTIONAL ☐ ALLOCATED ☐ PRODUCT	10. OTHER SYSTEMS/CONFIG. AFFECTED ☐ YES ☒ NO
11. SPECIFICATIONS AFFECTED-TEST PLAN				12. DRAWINGS AFFECTED	
13. SYSTEM 11323 SS32015-001				14. DRAWING NO. W169	
15. ITEM				16. ITEM	
17. TEST PLAN				18. TEST PLAN	
19. TITLE OF DEVIATION/WAIVER Spectral Matching				20. CONTRACT NO. & LINE NAS5-24200	
21. SUBSYSTEM/COMPONENT Thematic Mapper Assembly				22. DEVIATION CLASSIFICATION ☒ MINOR ☐ MAJOR ☐ CRITICAL	
23. NAME OF PART OR LOCUS AFFECTED Thematic Mapper				24. PART NO. OR TYPE DESIGN 51065	25. LOT NO. 003
26. EFFECT ON SYSTEM/PRODUCT None				27. EFFECT ON SUB-ENVIRONMENT None	
28. EFFECT ON INTEGRATED LOGISTIC SUPPORT, MAINTENANCE, ETC. None				29. EFFECT ON SUB-ENVIRONMENT None	

23. DESCRIPTION OF DEVIATION/WAIVER The spectral matching test is conducted to determine that there is no greater variation than 0.5% from channel to channel within a band as the spectral content of the scene is changed. HS236-8084-1 shows that the test data for band 1 has a variation of 0.65% and band 4 has a variation of 1.35% as reported on failure report 58162.

24. REASONS FOR DEVIATION/WAIVER There have been significant improvements in testing technique and the data is close to being acceptable. However, the data exceeds the specification and a determination has not been made as to the cause of the discrepancy. The detectors and filters were fabricated using the latest technology so it is not known that any improvement could be made.

25. APPROVALS		26. APPROVALS	
REQA <i>[Signature]</i>	SYS ENGR <i>[Signature]</i>	RE <i>[Signature]</i> 8/9/82	QA <i>[Signature]</i> 8-9-82
27. PRODUCTION EFFECTIVITY OF SERIAL NUMBER		28. APPROVALS	
29. PRODUCTION EFFECTIVITY OF SERIAL NUMBER		30. APPROVALS	
31. APPROVALS		32. APPROVALS	
33. APPROVALS		34. APPROVALS	
35. APPROVALS		36. APPROVALS	
37. APPROVALS		38. APPROVALS	
39. APPROVALS		40. APPROVALS	
41. APPROVALS		42. APPROVALS	
43. APPROVALS		44. APPROVALS	
45. APPROVALS		46. APPROVALS	
47. APPROVALS		48. APPROVALS	
49. APPROVALS		50. APPROVALS	
51. APPROVALS		52. APPROVALS	
53. APPROVALS		54. APPROVALS	
55. APPROVALS		56. APPROVALS	
57. APPROVALS		58. APPROVALS	
59. APPROVALS		60. APPROVALS	
61. APPROVALS		62. APPROVALS	
63. APPROVALS		64. APPROVALS	
65. APPROVALS		66. APPROVALS	
67. APPROVALS		68. APPROVALS	
69. APPROVALS		70. APPROVALS	
71. APPROVALS		72. APPROVALS	
73. APPROVALS		74. APPROVALS	
75. APPROVALS		76. APPROVALS	
77. APPROVALS		78. APPROVALS	
79. APPROVALS		80. APPROVALS	
81. APPROVALS		82. APPROVALS	
83. APPROVALS		84. APPROVALS	
85. APPROVALS		86. APPROVALS	
87. APPROVALS		88. APPROVALS	
89. APPROVALS		90. APPROVALS	
91. APPROVALS		92. APPROVALS	
93. APPROVALS		94. APPROVALS	
95. APPROVALS		96. APPROVALS	
97. APPROVALS		98. APPROVALS	
99. APPROVALS		100. APPROVALS	

ORIGINAL PAGE IS
OF POOR QUALITY

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE VIL-STD-460 OR -81 FOR INSTRUCTIONS)

DATE PREPARED

10 August 1982

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive, Goleta, CA 93117				2. ☐ DEVIATION ☒ WAIVER																																					
				3. ☐ MINOR ☒ MAJOR ☐ CRITICAL																																					
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED																																					
6. MODEL/TYPE F-1	7. MFR. CODE 11323	8. SYS. DESIG. TM	9. DEV/WAIVER NO W170	☒ FUNCTIONAL ☐ ALLOCATED ☐ PRODUCTION	10. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☐ NO																																				
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED																																					
<table border="1"><thead><tr><th></th><th>MFR. CODE</th><th>SPEC./DOC. NO.</th><th>SN</th></tr></thead><tbody><tr><td>a. SYSTEM</td><td>GSFC</td><td>400.8-D210</td><td></td></tr><tr><td>b. ITEM</td><td></td><td></td><td></td></tr><tr><td>c. TEST PLAN</td><td></td><td></td><td></td></tr></tbody></table>					MFR. CODE	SPEC./DOC. NO.	SN	a. SYSTEM	GSFC	400.8-D210		b. ITEM				c. TEST PLAN				<table border="1"><thead><tr><th></th><th>MFR. CODE</th><th>NUMBER</th><th>REV.</th><th>NO. NO.</th></tr></thead><tbody><tr><td>a. SYSTEM</td><td></td><td></td><td></td><td></td></tr><tr><td>b. ITEM</td><td></td><td></td><td></td><td></td></tr><tr><td>c. TEST PLAN</td><td></td><td></td><td></td><td></td></tr></tbody></table>			MFR. CODE	NUMBER	REV.	NO. NO.	a. SYSTEM					b. ITEM					c. TEST PLAN				
	MFR. CODE	SPEC./DOC. NO.	SN																																						
a. SYSTEM	GSFC	400.8-D210																																							
b. ITEM																																									
c. TEST PLAN																																									
	MFR. CODE	NUMBER	REV.	NO. NO.																																					
a. SYSTEM																																									
b. ITEM																																									
c. TEST PLAN																																									
9. TITLE OF DEVIATION/WAIVER Spatial Coverage				10. CONTRACT NO. & LINE ITEM NAS5-24200																																					
11. CONFIGURATION FOR NOMENCLATURE Thematic Mapper Assembly				12. DEFECT CLASSIFICATION ☒ MINOR ☐ MAJOR ☐ CRITICAL																																					
13. NAME OF PART OR LOWEST ASSEMBLY AFFECTED Thematic Mapper		14. PART NO. OR TYPE DESIG. 51065		15. LOT NO. 003	16. QTY 1																																				
17. EFFECT ON COST/PRICE				18. EFFECT ON DELIVERY SCHEDULE																																					
19. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. None																																									

23. DESCRIPTION OF DEVIATION/WAIVER The IFOV sizes of all detectors in bands 1-5 & 7 measured in AC07R(spatial coverage, HS236-8043 attached) are larger than specified in GSFC 400.8-D210 paragraph 3.2.3 in the along track direction, the cross track direction or both. The measured and specified IFOV sizes are given below. All values in μ -radians.

	MIN.	AVG.	MAX.	SPEC.
Bands 1-4				
along track	42.70	44.12	45.92	± 43.2
cross track	43.58	44.74	46.29	± 43.2
Bands 5 & 7				
along track	46.44	48.69	51.35	± 46.35
cross track	44.45	44.99	45.79	± 46.35 (spec met)

(Reference: FR5774)

24. NEED FOR DEVIATION/WAIVER Correcting the IFOV dimensions to the current specification would require disassembly of the TM optical system and focal plane assemblies. The IFOV sizes are only slightly out of specification ($\sim 5\%$) and will not adversely affect system performance. The square wave response for all bands exceeds specifications (BL16/17 report to be published), proving that the dynamic response of the system is very good and meets the usage requirement for which it was designed. The uncertainty associated with the AC07 measurements is of the same magnitude as the deviation from the specification. The performance of the Protonlight Thematic Mapper was very similar to the performance of the Flight Model (See Waiver W-106 attached).

REQ. *[Signature]* SYS ENGR *[Signature]*

25. PRODUCTION EFFECTIVITY BY SERIAL NO.
51065 S/N 003

26. SIGNATURE OF ACTIVITY AUTHORIZING SIGNATURE
[Signature] Minor - System Engineering
Major/Critical - Program Manager

27. APPROVAL/DISAPPROVAL
☐ APPROVAL RECOMMENDED ☐ APPROVED ☐ DISAPPROVED
28. GOVERNMENT ACTIVITY SIGNATURE DATE

DD FORM 1694

Program Instruction 010

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR -41 FOR INSTRUCTIONS)

DATE PREPARED

11 August 1982

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS				2. ☒ DEVIATION ☐ WAIVER			
Raymond A. Amador B12 MS 28 X6251				3. ☐ MINOR ☒ MAJOR ☐ CRITICAL			
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED			
a. MODEL TYPE	b. MFR. CODE	c. SYS. DESIG.	d. DEV/WAIVER NO.	☒ FUNCTIONAL	☐ ALLOCATED	☐ PROD. UCT.	6. OTHER SYSTEMS/CONFIGURATIONS ITEMS AFFECTED
FL	11323	TM	W-171(R)				☐ YES ☒ NO
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED			
a. SYSTEM				b. MFR. CODE	c. SPEC. / DOC. NO.	d. CON.	e. MFR. CODE
TP32015-632 NG							
f. TEST PLAN				g. REV.			
g. TEST PLAN				h. REV.			
9. TITLE OF DEVIATION/WAIVER				10. CONTRACT NO. & LINE ITEM			
Change of Flight Acceptance Sine Vibration Levels In Thrust Axis							
11. CONFIGURATION OR ITEM IDENTIFICATION				12. CD NO.			
Radiometer				13. DEFECT NO.			
14. NAME OF PART OR LOWEST ASSEMBLY AFFECTED				15. DEFECT CLASSIFICATION			
Radiometer				☐ MINOR ☒ MAJOR ☐ CRITICAL			
16. PART NO. OR TYPE DESIGN				17. LOT NO.			
51065 - J				18. QTY			
19. EFFECT ON DELIVERY SCHEDULE				20. RECURRING DEVIATION/WAIVER			
NONE				☐ YES ☒ NO			
21. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC.				22. EFFECT ON DELIVERY SCHEDULE			
NONE				N/A			
23. DESCRIPTION OF DEVIATION/WAIVER							

Change Thrust Asix (X) Flight Acceptance Vibration Levels.

WAS:	Freq. (Hz)	g pk	IS:	Freq. (Hz)	g pk
	5 - 13.1	0.64 IN D.A.		5 - 11.1	0.64 IN D.A.
	13.1 - 50	5.6		11.1 - 50	4.0
	50 - 100	2.4		50 - 100	2.4

24. NEED FOR DEVIATION/WAIVER

Technical direction from GSFC per Telecon with O. Weinstein on 11 August 1982.

REA <i>[Signature]</i> SYS ENGR <i>[Signature]</i>	QA <i>[Signature]</i> 8/11/82
PE <i>[Signature]</i> 8-11-82	
25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER	26. APPROVAL DISAPPROVAL
51065 SERNO 003 only	☒ APPROVED ☐ DISAPPROVED
27. SIGNATURE OF AUTHORIZING OFFICIAL	28. SIGNATURE
<i>[Signature]</i>	<i>[Signature]</i>
29. DATE	30. DATE
11/24/82	11/24/82

DD FORM 1694

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/BAIVER
(SEE 436-STD-400 OR 401 FOR INSTRUCTIONS)

DATE PREPARED

8/9/82

PRECEDENCE ACTIVITY NO

1. ORIGINATOR NAME AND ADDRESS

Hughes Aircraft Co, El Segundo, CA

1. ☐ DEVIATION ☒ BAIVER
2. ☒ MINOR ☐ MAJOR ☐ CRITICAL

4. DESIGNATION FOR DEVIATION/BAIVER
a. MODEL/TYPE: SPARE
b. MFR. CODE:
c. SYS. DESIG.: T.M.
d. DEVIATION NO: W-172
5. BASE LINE AFFECTED
☐ PLAC. ☐ TYPICAL ☐ ALLOCATED ☐ PRE-
6. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED
☐ YES ☒ NO

7. SPECIFICATIONS AFFECTED-TEST PLAN
a. MFR. CODE: 82577
b. SPEC. NO.: TS 32015-031
c. TEST PLAN:
8. DRAWINGS AFFECTED
a. MFR. CODE:
b. DRAWING NO.:
c. REV. NO.:

9. TITLE OF DEVIATION/BAIVER
Hybrid 3905973 S/N 535 High Temperature Settling Time
10. CONTRACT NO. & LINE ITEM
NAS5-24200

11. DESCRIPTION OF DEVIATION/BAIVER
Multiplexer
12. MFR. CODE:
13. PART NO. OR TYPE DESIG.: 3905973
14. LOT NO.: S/N 535
15. QTY: 1
16. DEFECT CLASSIFICATION
☒ MINOR ☐ MAJOR ☐ CRITICAL
17. REASONING DEVIATION/BAIVER
☐ YES ☒ NO

18. EFFECT ON DELIVERY SCHEDULE
2 month schedule slip of spare hybrid if disa
19. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFAC, ETC.
None

20. DESCRIPTION OF DEVIATION/BAIVER
Analog Multiplexer hybrid microcircuit 3905973, S/N 535 only, fails paragraph 4.7 of test specification TP 3905973 at high temperature (80°C) only. This paragraph covers settling time, should be 20 Nanoseconds max, is 26 nanoseconds. S/N 535, which is a spare hybrid, passes all specifications at all other temperatures.

The effect of using this hybrid in a system would be a very slight increase in its crosstalk between some sensors in the band where the hybrid was used. The crosstalk increase would be a maximum of one quantum step for a scene of full scale contrast only when the hybrid was at a temperature of 80°C. Since edges of full scale contrast are rare or nonexistent in real scenes and since the hybrid never reaches 80°C, no real effect would be anticipated.

21. REASON FOR DEVIATION/BAIVER
Repair and retest of the hybrid to comply with the high temperature settling time specification would cost approx. \$2,000 and delay the delivery of the hybrid by 2 months. Since the settling time as is would not significantly affect instrument performance, a allowing use of the hybrid as is is requested.

22. PRODUCTION EFFECTIVITY BY SERIAL NUMBER
Hybrid 3905973 S/N 530 only. Spare hybrid.
23. IDENTIFYING ACTIVITY AND DATE
24. APPROVAL/DISAPPROVAL
a. ☐ APPROVAL RECOMMENDED
b. ☒ APPROVED ☐ DISAPPROVED
c. SIGNATURE: [Signature]
d. DATE: 8/13/82

25. GOVERNMENT ACTIVITY
NASA GSFC
DD FORM 1694
GPO 1969 - 545 100/018

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/WAIVER
(SEE MIL STD-883C FOR INSTRUCTIONS)

DATE PREPARED

20 Aug 82

PROCESSING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center/S. G. Oxley 75 Coronar Drive, Goleta, CA 93117				2. ☐ DEVIATION ☒ WAIVER			
3. DESIGNATION FOR DEVIATION/WAIVER				15. BASE LINE AFFECTED			
4. MODEL/TYPE F1	16. MFR CODE 11323	17. SYS DESIG. TM	18. REF/WAIVER NO. W13	19. ☐ FINE-TUNING ☐ ALLOCATED ☐ PROD-UCT		20. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO	
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. DRAWINGS AFFECTED			
9. SYSTEM				10. CONTRACT NO. & LINE			
11. CONFIGURATION ITEM IDENTIFICATION				12. CD NO.			
13. THEMATIC MAPPER				14. DEFECT CLASSIFICATION ☒ MINOR ☐ MAJOR ☐ CRITICAL			
15. NAME OF PART OR SUB-ASSEMBLY AFFECTED Thematic Mapper				16. PART NO. OR TYPE DESIGN 51065			
17. LOT NO.				18. QTY			
19. EFFECT ON COST/PRICE Approximately \$1 Million				20. EFFECT ON DELIVERY SCHEDULE 3-Month schedule impact if disapproved.			
21. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. None				22. DESCRIPTION OF DEVIATION/WAIVER Delete the requirement to provide a telescope baseplate temperature telemetry channel. (Reference Failure Report F2718.)			

24. NEED FOR DEVIATION/WAIVER

The telemetry channel is an open circuit; repair would entail unnecessary risk since the channel loss has no significant mission effect. Temperature of baseplate can be deduced from other temperatures such as the telescope housing and the cal lamp housing.

REA

SYS ENGR

25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER

51065, Semo 003 only

26. SUBMITTING ACTIVITY OR AUTHORIZING SIGNATURE

[Signature]

TITLE

Systems Engineering

27. APPROVAL/DISAPPROVAL

28. ☒ APPROVAL RECOMMENDED

29. ☒ APPROVED

☐ DISAPPROVED

30. GOVERNMENT ACTIVITY

LEONARD P.O.

SIGNATURE

[Signature] 9/18/82

DD FORM 1694 C.S. to forward for final approval by C.C.B. at Goddard.

B. B. Bitt
NASA R442

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR 481 FOR INSTRUCTIONS)

DATE PREPARED

8/31/82

PREPARING ACTIVITY NO.

ORIGINATOR NAME AND ADDRESS
Santa Barbara Research Center
75 Coromar Drive, Goleta, CA 93117

1. ☐ DEVIATION ☒ WAIVER
2. ☐ MINOR ☒ MAJOR ☐ CRITICAL

4. DESIGNATION FOR DEVIATION/WAIVER
a. MODEL/TYPE TM b. MFR. CODE 11323 c. SYS. DESIG. F-1 d. REVISION NO. W174
5. BASE LINE AFFECTED ☒ FUNC. TIONAL ☐ ALLO-CATED ☐ PROD-UCT
6. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO

7. SPECIFICATIONS AFFECTED-TEST PLAN
a. MFR. CODE GSFC b. SPEC./DOC. NO. 400.8-D-210 c. SEC. 1
8. DRAWINGS AFFECTED
a. MFR. CODE 11323 b. NUMBER 51065 c. REV. J d. COR. NO. 4257, 3035, 4497, 4679, 4537, 4643, 9

9. TITLE OF DEVIATION/WAIVER
Out-of-field response
10. CONTRACT NO. & LINE
NASS-24200

11. THE CLASSIFICATION TYPE & RELATIONSHIP
Thematic Mapper Assembly
12. DEF. NO. 13. EXCPT NO. 14. DEFECT CLASSIFICATION ☒ MINOR ☐ MAJOR ☐ CRITICAL

15. DES. OF PART OR LONEST ASSEMBLY AFFECTED
Thematic Mapper
16. PART NO. OR TYPE DESIG. 51065
17. LOT NO. 003
18. QTY 1
19. REQUIRING DEVIATION/WAIVER ☐ YES ☒ NO

20. EFFECT ON COST/PRICE
Greater than \$1,000,000.00
21. EFFECT ON DELIVERY SCHEDULE
One year

22. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACES, ETC.
None

23. DESCRIPTION OF DEVIATION/WAIVER

GSFC 400.8-D-210, Section 3.2.3, requires that the response to the same point source shall be less than 1% at angular distances equal to or greater than two IFOV's. A slit source was used instead of a point source and the observed response is between 0.8% and 3.4%, depending on the detector and direction of displacement (reference Failure Report F5774).

ORIGINAL PAGE IS
OF POOR QUALITY

24. REASON FOR DEVIATION/WAIVER

To correct the above out-of-specification condition would require changes to the FPA and possible changes to the TM Optical assembly, causing considerable schedule delay and program cost increases. Per Waiver 105, the protoflight data was similar.

REA [Signature] SYS ENG [Signature] 9/1/82
REL [Signature] 9/1/82
QA [Signature]
PE [Signature]

25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER
Thematic Mapper, P/N 51065, S/N 003

26. AUTHORIZING ACTIVITY AUTHORIZING SIGNATURE
F.R. Williams
TITLE
Program Manager

27. APPROVAL/DISAPPROVAL
a. ☐ APPROVAL RECORDED b. ☐ APPROVED ☐ DISAPPROVED

28. GOVERNMENT ACTIVITY
SIGNATURE DATE

DD FORM 1694

GPO: 1949-2481

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR 461 FOR INSTRUCTIONS)

DATE PREPARED

PROCURING ACTIVITY NO.

1 ORIGINATOR NAME AND ADDRESS

THEMATIC MAPPER, SINC

2. ☐ DEVIATION ☒ WAIVER
3. ☒ MINOR ☐ MAJOR ☐ CRITICAL

4 DESIGNATION FOR DEVIATION/WAIVER

a. MODEL/TYPE **F1** b. MFR CODE **11323** c. SYS DES'G. **TM** d. DEV/WAIVER NO. **W175**

5 BASE LINE AFFECTED

☐ FUNC. TIONAL ☐ ALLO- CATED ☐ PROD. UCT

6. OTHER SYSTEMS/CONFIG-
URATION ITEMS AFFECTED

☐ YES ☐ NO

7 SPECIFICATIONS AFFECTED-TEST PLAN

a. SYSTEM **11323** b. MFR CODE **TP32015-625** c. SPEC /DOC. NO. **REV. C**

8. DRAWINGS AFFECTED

a. MFR. CODE b. NUMBER c. REV. d. NOR. NO.

9. TITLE OF DEVIATION/WAIVER

TEST PROCEDURE CHANGE - BUS VOLTAGE

10 CONTRACT NO. & LINE ITEM

NA55-24200

11 CONFIGURATION ITEM NOMENCLATURE

THEMATIC MAPPER ASSEMBLY

12 CD NO. 13. DEFECT NO. 14. DEFECT CLASSIFICATION

☐ MINOR ☐ MAJOR ☐ CRITICAL

15 NAME OF PART OR LOWEST ASSEMBLY AFFECTED

THEMATIC MAPPER

16 PART NO OR TYPE DESIG.

S1065

17 LOT NO.

003

18 QTY

1

19 RECURRING DEVIATION/WAIVER

☐ YES ☒ NO

20 EFFECT ON COST/PRICE

NONE

21 EFFECT ON DELIVERY SCHEDULE

NONE

22. EFFECT ON INTEGRATED LOGISTIC SUPPORT INTERFACE, ETC.

NONE

23 DESCRIPTION OF DEVIATION/WAIVER

TEST SEGMENT 2 OF TP32015-625 WAS
CONDUCTED AT A BUS VOLTAGE OF 28 VOLTS; PROCEEDURE
REQUIRED 23 VOLTS. SUBSEQUENT TESTS WERE
SUCCESSFULLY CONDUCTED AT 23 VOLTS. SUCCESSFUL
COMMAND FILE WAS TVCP-XG.DSG @ ACTION ON 4 SEPTEMBER 1982.

24 NEED FOR DEVIATION/WAIVER

PROCEDURE NOT FOLLOWED,

REL Blomquist 9/4/82
QA Blomquist for W.B. Adams 9/4/82
PE Blomquist for L. Blomquist 9/4/82
COMO S. J. Johnson 9/15/82

REA FR Phiskin SYS. ENG. W. J. Wiley

25 PRODUCTION EFFECTIVITY BY SERIAL NUMBER

26 SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

TITLE

27 APPROVAL/DISAPPROVAL

☐ APPROVAL RECOMMENDED

☒ APPROVED

☐ DISAPPROVED

c. GOVERNMENT ACTIVITY

NA55 G5FC

SIGNATURE

George B. Smith

DATE

9/15/82

DD FORM 1694 Engineering Reliability Quality Production Test

Program Instruction 010

ORIGINAL PAGE IS
OF POOR QUALITY

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-480 OR 481 FOR INSTRUCTIONS)

DATE PREPARED
9/7/82

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive, Goleta, CA 93117				2. ☐ DEVIATION ☒ WAIVER	
				3. ☒ MINOR ☐ MAJOR ☐ CRITICAL	
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED	
a. MODEL/TYPE F-1	b. MFR CODE 11323	c. SYS. DESIG. TM	d. DEV/WAIVER NO. W176	☐ FUNC- TIONAL	☐ ALLO- CATED
				☒ PROD- UCT	
7. SPECIFICATIONS AFFECTED-TEST PLAN				8. OTHER SYSTEMS/CONFIG- URATION ITEMS AFFECTED	
a. SYSTEM				b. YES ☐ NO ☐	
b. ITEM					
c. TEST PLAN 11323 TP32015-625 Rev. C					
9. TITLE OF DEVIATION/WAIVER Test procedure change.				10. CONTRACT NO. & LINE ITEM NAS5-24200	
11. CONFIGURATION ITEM NOMENCLATURE F-1 Thematic Mapper				12. CD NO. 2	
				13. DEFECT NO.	
				14. DEFECT CLASSIFICATION ☒ MINOR ☐ MAJOR ☐ CRITICAL	
15. NAME OF PART OR SUBST. ASSEMBLY AFFECTED Thematic Mapper		16. PART NO. OR TYPE DESIG. 51065		17. LOT NO. 003	
				18. QTY 1	
19. EFFECT ON COST/PRICE None		20. EFFECT ON DELIVERY SCHEDULE None		21. RECURRING DEVIATION/WAIVER ☐ YES ☒ NO	
22. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. None					
23. DESCRIPTION OF DEVIATION/WAIVER					
1. TV TS5 ORB 07: BL 19/20 Mini 3B deleted.					
2. TV TS6 ORB 09: BL 19/20 Mini 4B deleted.					

24. NEED FOR DEVIATION/WAIVER

To conduct tests; requested by NASA GSFC, Within the normal timeline of the thermal vacuum orbital sequence. STR F1 029 Back-up Mode Cal Test (TVTS5), STR F-1 033 A/D Converter Test (TVTS6) to be run in lieu of TVTS5 ORB 07 and TVTS6 ORB 09

REF. <i>[Signature]</i>	SYS ENGR <i>[Signature]</i>	REA <i>[Signature]</i> 9/7/82
		QA <i>[Signature]</i> 9/7/82
		PE <i>[Signature]</i> 9/7/82
25. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 51065, S/N 003 only.		COMO <i>[Signature]</i> 9/7/82
26. AUTHORIZING SIGNATURE <i>[Signature]</i> 9/7/82		Minor - System Engineering Major/Critical - Program Manager
27. APPROVAL/DISAPPROVAL		
☐ APPROVAL RECOMMENDED ☒ APPROVED ☐ DISAPPROVED		
28. GOVERNMENT ACCT. NO. NASA GSFC		SIGNATURE <i>[Signature]</i> DATE 9/7/82
DD FORM 1694		

Program Instruction 010

REQUEST FOR DEVIATION/WAIVER
(SEE MIL-STD-460 OR 461 FOR INSTRUCTIONS)

DATE PREPARED

9.8.82

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Santa Barbara Research Center 75 Coromar Drive Goleta, CA. 93117				2. ☐ DEVIATION ☒ WAIVER			
				3. ☒ MINOR ☐ MAJOR ☐ CRITICAL			
4. DESIGNATION FOR DEVIATION/WAIVER				5. BASE LINE AFFECTED			
6. MODEL/TYPE F-1	7. MFR CODE 11323	8. SYS. DESIG. TM	9. DEV/WAIVER NO. W-177	☐ FUNCTIONAL	☐ ALLOCATED	☒ PRODUCT	10. OTHER SYSTEMS/CONFIGURATION ITEMS AFFECTED ☐ YES ☒ NO
11. SPECIFICATIONS AFFECTED-TEST PLAN				12. DRAWINGS AFFECTED			
MFR. CODE SPEC./DOC. NO. SCR				MFR. CODE NUMBER REV. NOR. NO.			
13. SYSTEM							
14. ITEM							
15. TEST PLAN 11323 T232015-625 Rev. C							
16. TITLE OF DEVIATION/WAIVER Thermal Vacuum Sequence/Procedure Change				17. CONTRACT NO. & LINE ITEM NAS5-24200			
18. CONFIGURATION ITEM NOMENCLATURE F-1 Thematic Mapper				19. DEFECT CLASSIFICATION ☒ MINOR ☐ MAJOR ☐ CRITICAL			
20. NAME OF PART OR LOWEST ASSEMBLY AFFECTED Thematic Mapper		21. PART NO. OR TYPE DESIG. 51065		22. LOT NO. 003		23. QTY 1	
24. EFFECT ON COST/PRICE None				25. EFFECT ON DELIVERY SCHEDULE None			
26. EFFECT ON INTEGRATED LOGISTIC SUPPORT, INTERFACE, ETC. None							
27. DESCRIPTION OF DEVIATION/WAIVER Delete from TVTS60RB08 (BL19/20 Mini 4A). Resequence TVTS60RB12 (SRT-PRIM), ORB13 (SRT-REDN), and ORB14 (SRT-SCNL) to follow TVTS60RB07 (BL17).							

ORIGINAL PAGE IS
OF POOR QUALITY

28. NEED FOR DEVIATION/WAIVER

To conduct tests; requested by NASA GSFC and SBRC System Engineering, within the normal timeline of the Thermal Vacuum Performance Test. The tests will consist of various STR's which will encompass a greater area of parameters obtained throughout the T/V test phase and will also allow for revisiting tests which have been conducted throughout the normal sequence of testing.

29. PRODUCTION EFFECTIVITY BY SERIAL NUMBER P/N 51065 S/N 003 ONLY		30. SUBMITTING ACTIVITY AUTHORITY NO SIGNATURE Minor - System Engineering Major/Critical - Program Manager	
31. APPROVAL RECOMMENDED ☒ APPROVAL RECOMMENDED		32. APPROVED ☒ APPROVED ☐ DISAPPROVED	
33. GOVERNMENT ACCT NO. LANDSAT-D		34. SIGNATURE J. Weinstein 9-3-82	

DD FORM 1694

ORIGINAL PAGE IS
OF POOR QUALITY

4.3 ENGINEERING CHANGE PROPOSALS

The following are copies of Engineering Change
Proposals (ECP) submitted for the Flight Model
Thematic Mapper.

ENGINEERING CHANGE PROPOSAL, PAGE 1
(SEE MIL-STD-400 FOR INSTRUCTIONS)

DATE PREPARED
18 July 1978

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS Hughes Aircraft Company, S&CG P.O. Box 92919 - Airport Station, Los Angeles, CA 900C9						2. CLASS OF ECP 1		3. ECP CODE B		4. ECP TYPE R	
5. ECP DESIGNATION						6. BASELINE AFFECTED ☐ FUNCTIONAL ☐ ALLOCATED ☐ PRODUCT					
7. MODEL/TYPE N/A		8. MFR CODE 82577		9. SYS DESIG. HS236		10. ECP NO. 02		11. TYPE F		12. REV. --	
13. CORR --		14. OTHER SYS / CONFIG ITEMS AFFECTED ☐ YES ☒ NO									
8. SPECIFICATIONS AFFECTED - TEST PLAN						9. DRAWINGS AFFECTED					
MFR CODE		SPEC / DOC NO		SCN		MFR CODE		NUMBER		REV	
10. SYSTEM 82577		TP32015-500/A									
11. ITEM											
12. TEST PLAN											
10. TITLE OF CHANGE System Test Plan, Revision A TP32015-500										11. CONTRACT NO & LINE ITEM NAS5-24200	
12. CONFIGURATION ITEM NOMENCLATURE Thematic Mapper System (3533000-100)										13. IN PRODUCTION ☐ YES ☒ NO	
14. NAME OF PART OR LOWEST ASSEMBLY AFFECTED Thematic Mapper System										15. PART NO OR TYPE DESIGNATION 3533000-100	
16. DESCRIPTION OF CHANGE Revise TP32015-500 System Test Plan											

ORIGINAL PAGE IS
OF POOR QUALITY

17. NEED FOR CHANGE

Per ECR 664618

18. PRODUCTION EFFECTIVITY BY SERIAL NUMBER 1 & Up						19. EFFECT ON PRODUCTION DELIVERY SCHEDULE NONE					
20. RETROFIT											
21. RECOMMENDED ITEM EFFECTIVITY N/A						22. SHIP/VEHICLE CLASS AFFECTED N/A					
23. ESTIMATED KIT DELIVERY SCHEDULE N/A						24. LOCATIONS OR SHIP/VEHICLE NUMBERS AFFECTED N/A					
25. ESTIMATED COSTS/SAVINGS UNDER CONTRACT						26. ESTIMATED NET TOTAL COSTS NONE					
27. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE L.E. Blanchard						28. TITLE HS236 Program Manager					
29. APPROVAL/DISAPPROVAL											
30. CLASS I ☒ APPROVAL RECOMMENDED				31. CLASS II ☐ APPROVED ☐ DISAPPROVED				32. CONCUR IN CLASSIFICATION OF CHANGE ☐ DO NOT CONCUR IN CLASSIFICATION OF CHANGE			
33. GOVERNMENT ACTIVITY						34. SIGNATURE DATE					

DD FORM 1692

☆ GPO 1960 - 843 TMS/023

8-61

ORIGINATOR NAME AND ADDRESS

Hughes Aircraft Company, S&CG

P.O. Box 92919 - Airport Station, Los Angeles, CA 90009

ECP NUMBER

002

EFFECTS ON FUNCTIONAL/ALLOCATED CONFIGURATION IDENTIFICATION

25 OTHER SYSTEMS AFFECTED

NONE

26 OTHER CONTRACTORS/ACTIVITIES AFFECTED

NONE

27 CONFIGURATION ITEMS AFFECTED

THEMATIC MAPPER

28 EFFECTS ON PERFORMANCE ALLOCATIONS AND INTERFACES IN SYSTEM SPECIFICATIONS

N/A

ORIGINAL PAGE IS
OF POOR QUALITY

29 EFFECTS ON EMPLOYMENT INTEGRATED LOGISTIC SUPPORT TRAINING, OPERATIONAL EFFECTIVENESS ETC

N/A

30 EFFECTS ON CONFIGURATION ITEM SPECIFICATIONS

N/A

31 DEVELOPMENTAL REQUIREMENTS AND STATUS

N/A

32 TRADE OFFS AND ALTERNATIVE SOLUTIONS

N/A

8/15/78

33 DATE BY WHICH CONTRACTUAL AUTHORITY IS NEEDED

DD FORM 1692-1

GPO 1969 - 343 763, 626

HUGHES

HUGHES AIRCRAFT COMPANY

*UOE IDENT 82577

HUGHES
SPECIFICATION CHANGE NOTICE

SPECIFICATION TITLE <i>ENGINE TEST PLAN REVISION A</i>		SPEC NO. <i>TF 32015-500</i>	REV <i>A</i>
EFFECTIVITY <i>SN 14612</i>	AUTHORITY (E.C.A. UCN NO.) <i>4615-CL1</i>	SCN NO. <i>DVC</i>	
SYSTEM/EQUIPMENT <i>THRUSTING ENGINE</i>		DATE <i>8-1-78</i>	

THIS NOTICE INFORMS RECIPIENTS THAT THE SPECIFICATION IDENTIFIED BY THE NUMBER (AND REVISION LETTER OR NUMERAL) SHOWN ABOVE HAS BEEN CHANGED. THE PAGES CHANGED BY THIS SCN BEING THOSE FURNISHED HEREWITH AND CARRYING THE SAME DATE AS THIS SCN. THE PAGES OF THE PAGE NUMBERS AND DATES LISTED BELOW IN THE SUMMARY OF CHANGED PAGES, COMBINED WITH NON-LISTED PAGES OF THE ORIGINAL ISSUE OF THE REVISION SHOWN ABOVE CONSTITUTE THE CURRENT VERSION OF THIS SPECIFICATION.

SCN NO.	PAGES CHANGED (INDICATE DELETIONS)	*S	*A	DATE	
<i>DVC</i>	<i>ENGINE TEST PLAN REVISED</i> <i>ALL PAGES</i>		<i>X</i>	<i>8-1-78</i>	
ORIGINAL PAGE IS OF POOR QUALITY					
	ORG CODE	DATE	RESPONSIBLE SPEC. ACTIVITY <i>[Signature]</i>	ORG CODE <i>45-74</i>	DATE <i>7/80</i>
	ORG CODE	DATE	RELEASED BY <i>[Signature]</i>	ORG CODE	DATE

ENGINEERING CHANGE ANALYSIS SHEET 1

RUGHES

☒ COMPLETE ☐ ADVANCE SH 1 OF 1

PROGRAM THEMATIC 17774 HS 236	SYS/EQUIP NAME OR DLS 544-771	CONTROL ITEM NAME & NO. PLANN 544-000-100	ECR NO. 664618
CONTRACT NO. NA533132			

REC. 1	ASS	URGENCY	RELATED ECA NO. (5)
---------------	-----	---------	---------------------

BASE LINE AFFECTED	PRODUCT BASE LINE AFFECTED AND CHANGE IS: ☒ PRODUCTION ONLY ☐ PRODUCTION AND RETROFIT ☐ RETROFIT ONLY
--------------------	--

SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED

SPECIFICATION OR DRAWING NO.	NEW	CHANGED	DE- LETED	SPECIFICATION OR DRAWING NO.	NEW	CHANGED	D LET
TP 2015-500		1 E V A					

TITLE OF CHANGE SYSTEM TEST	RELATED FACTORS ON SH 2 ARE AFFECTED ☐ YES ☒ NO
---------------------------------------	---

DESCRIPTION OF CHANGE
REMOVED

JUSTIFICATION FOR CHANGE
**ORIGINAL PAGE IS
OF POOR QUALITY**

EXTENT OF TESTING 40112	RECM CHANGE EFFECTIVITY 17774
	RECM DISPOSITION OF ITEMS 17774

APPROVAL FOR EVALUATION

ORG CODE	DATE	REASON FOR	ORG CODE	DATE	REQUIRED:
41-41	8/15/78	DEPARTMENT MGR	45-74	7/26/78	ECAC ☐ YES ☒
44-24	8/16/78	CONFIG MGMT OFFIC	44-27	8/24/78	MAEC ☐ YES ☒
75-24	8/5/78	PROGRAM MANAGER	44-01	8/17/78	SAEC ☐ YES ☒

CHANGE APPROVAL

	ORG CODE	DATE	ORG CODE	DATE
☐ APPROVED				
☐ REJECTED				
CHANGE REVIEW BOARD CHM				

AUTHORIZATION FOR RELEASE

SAL NO.	CHG CLASS	CHANGE EFFECTIVITY	CUSTOMER	DATE
CONTRACTUAL AUTH	☐ ADVANCE TO COMPLETE	DISPOSITION OF ITEMS	ENHNG CHANGE CTR	DATE

ENGINEERING CHANGE PROPOSAL, PAGE 1
(SEE MIL-STD-480 FOR INSTRUCTIONS)

DATE PREPARED

9/18/78

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS

HUGHES AIRCRAFT CO., P.O. BOX 92919 - AIRPORT STATION
LOS ANGELES, CA 90009

2. CLASS OF ECP

1

3. JUST. CODE

B

4. TIME

\$

5. ECP DESIGNATION

6. MODEL/TYPE

N/A

7. MFR CODE

82577

8. SYS DESIG

HS236

9. ECP NO.

03

10. TYPE

F

11. REV.

12. CORR

13. BASELINE AFFECTED

☐ FUNDAMENTAL

☐ ALLOCATED

☐ PRODUCT

14. OTHER SYS / CONFIG ITEMS AFFECTED

☐ YES

☒ NO

15. SPECIFICATIONS AFFECTED - TEST PLAN

16. DRAWINGS AFFECTED

17. MFR CODE

82577

18. SPEC / DOC NO

3533000-400/A

19. SCN

20. MFR CODE

21. NUMBER

22. REV.

23. NOR NO

24. SYSTEM

25. ITEM

26. TEST PLAN

27. TITLE OF CHANGE

REVISION "A" OF 3533000-400

28. CONTRACT NO & LINE ITEM

NAS 5-24200

29. CONFIGURATION ITEM NOMENCLATURE

THEMATIC MAPPER SYSTEM (3533000-100)

30. IN PRODUCTION

☐ YES

☒ NO

31. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

THEMATIC MAPPER SYSTEM

32. PART NO OR TYPE DESIGNATION

3533000-100

33. DESCRIPTION OF CHANGE

REVISE INTERFACE CONTROL DRAWING

ORIGINAL PAGE IS
OF POOR QUALITY

34. NEED FOR CHANGE

IMPROVEMENT OF THE INTERFACE DEFINITION

35. PRODUCTION EFFECTIVITY BY SERIAL NUMBER

1 & UP

36. EFFECT ON PRODUCTION DELIVERY SCHEDULE

NONE

37. RETROFIT

38. RECOMMENDED ITEM EFFECTIVITY

N/A

39. SHIP/VEHICLE CLASS AFFECTED

N/A

40. ESTIMATED KIT DELIVERY SCHEDULE

N/A

41. LOCATIONS OR SHIP/VEHICLE NUMBERS AFFECTED

N/A

42. ESTIMATED COSTS/SAVINGS UNDER CONTRACT

43. ESTIMATED NET TOTAL COSTS

NONE

44. SIGNATURE

L. E. BLANCHARD

45. TITLE

HS236 PROGRAM MANAGER

46. APPROVAL/DISAPPROVAL

47. CLASS I

☐ APPROVAL
☐ RECOMMENDED

48. CLASS II

☐ APPROVED

☐ DISAPPROVED

☐ CONCUR IN CLASSIFICATION OF CHANGE

☐ DO NOT CONCUR IN CLASSIFICATION OF CHANGE

49. GOVERNMENT ACTIVITY

50. SIGNATURE

51. DATE

DD FORM 1 DEC 68 1692

GPO 1969 - 843 785/003

16-51100

bcc: LE Blanchard, EW Wilkins, JL Sharp, Data Bank HS236 (2), File

HUGHES AIRCRAFT COMPANY

SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIA

In reply refer to: 78(44)21820/D4596
HS236/0019-0414

26 September 1978

National Aeronautics and Space Administration
Goddard Space Flight Center
Greenbelt, Maryland 20771

Attention: Mr. J. E. Firmin
Procurement Manager
Code 283/400.8

ORIGINAL PAGE IS
OF POOR QUALITY

Subject: Contract NAS5-24200, Thematic Mapper; Engineering
Change Proposal No. 3, ECA No. 467040

Pursuant to Article XIV, Configuration Management, subject ECP for Thematic Mapper Interface Control Drawing 3533000-400, Revision A is herewith submitted for GSFC review and approval.

The Interface Control Drawing has been revised and updated as follows:

1. Completed the definition of the TM instrument outline and extremities.
2. Clarified fields of view for radiative cooler, thermal radiators, sun calibrator, and scan mirror.
3. Added installation requirements and mounting details.
4. Added electrical interface connector designations, functions and locations.
5. Defined thermal requirements including thermal finishes.
6. Included current TM weight.
7. Added access requirements for purging, removal of protective covers, and requirements during testing and operations.
8. Revised the TM instrument coordinate system to be consistent with the requirement of GSFC 400.8-D-201.

There is no cost or schedule impact with this change.

Very truly yours,

HUGHES AIRCRAFT COMPANY

J. L. Sharp
J. L. Sharp
Contract Negotiator, Sr.
NASA Systems Division

*Copy of Drawing not
in file*

cc: T. P. Sciacca, NASA Resident Representative
O. Weinstein, Code 400.8
L. Gonzales, Code 400.8
A. Hardesty, Code 283/400.8
J. Baniszewski, Code 283 (w/o encl.)

ENGINEERING CHANGE ANALYSIS SHEET 1				HUGHES		ECA NO. 467040		REV	
				☒ COMPLETE ☐ ADVANCE		SH 1 OF 1			
THEMATIC MAPPER		SYS/EQUIP NAME OR DES		THEMATIC MAPPER		CONTROL ITEM NAME & NO. THEMATIC MAPPER INTERFACE CONTROL DRAWING 3533000-400		ECR NO. 664626 CONTRACT NO. NAS 5-2420	
ECM CLASS I	URGENCY						RELATED ECA NO. (5) -----		
BASE LINE AFFECTED 1 & UP		PRODUCT BASE LINE AFFECTED AND CHANGE IS: ☐ PRODUCTION ONLY ☒ PRODUCTION AND RETROFIT ☐ RETROFIT ONLY							
SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED									
SPECIFICATION OR DRAWING NO.	NEW	CHANGED	DE- LETED	SPECIFICATION OR DRAWING NO.	NEW	CHANGED	LI		
3533000-400		REV. "A"							
TITLE OF CHANGE REVISE AND REDRAW THE INTERFACE CONTROL DRAWING								RELATED FACTORS ON SH 2 ARE AFFECTED ☐	
DESCRIPTION OF CHANGE REVISED AND REDRAWN TO INCORPORATE INTERFACE INFORMATION NOT PREVIOUSLY SPECIFIED.									
ORIGINAL PAGE IS OF POOR QUALITY									
JUSTIFICATION FOR CHANGE INTERFACE DEFINITION NOT COMPLETE.									
EXTENT OF TESTING N/A						ECM CHANGE EFFECTIVITY 1 & UP ECM DISPOSITION OF ITEMS N/A			
APPROVAL FOR EVALUATION									
F. D. McLAUGHLIN		ORG CODE 40-92	DATE 9/18/78	RSA OR REA <i>[Signature]</i>		ORG CODE 44-92	DATE 9-25-78	REQUIRED:	
W D Hand		48-20	7/20/78	DEPARTMENT MGR				ECAE ☐ YES ☒	
				CONFIG MGMT OFFICE <i>[Signature]</i>		44-27	7/25/78	MAEC ☐ YES ☒	
				PROGRAM MANAGER <i>[Signature]</i>		44-00-01	9/21/78	SAEC ☐ YES ☒	
CHANGE APPROVAL									
☒ APPROVED ☐ REJECTED	ORG CODE		DATE				ORG CODE		DATE
					CHANGE REVIEW BOARD CHM <i>[Signature]</i>		44-29		
AUTHORIZATION FOR RELEASE									
PROPOSAL NO.	CHG CLASS	CHANGE EFFECTIVITY				CUSTOMER		DATE	
CONTRACTUAL AUTH	☐ ADVANCE TO COMPLETE	DISPOSITION OF ITEMS				ENGRG CHANGE CTR		DATE	

Attachment 1

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-461 FOR INSTRUCTIONS)

DATE PREPARED

ECP NO.

PROCEDURE ACTIVITY NO.

004

ORIGINATOR NAME AND ADDRESS

Hughes Aircraft Company

Culver City, California 90230

1. WFL CODE

2. CLASS OF ECP

3. JCT. CODE

4. PRIORITY

82577

I

5. SPECIFICATIONS AFFECTED

7. ORIGINATOR AFFECTED

WFL CODE	SPECIFICATION/DOCUMENT NO.	WFL CODE	NUMBER	REV.
		HAC	3533000-400	A

8. TITLE OF CHANGE

9. CONTRACT NO. & LINE ITEM

Revise Interface Control Drawing 3533000, and design to reflect (1) deletion of Nadir Thermal Louver, and (2) Modification to Thematic Mapper Mounting Feet

NAS5-24200

10. CONFIGURATION ITEM NOMENCLATURE

11. IN PRODUCTION

Thematic Mapper Interface Control Drawing 3533000-400

☒ YES☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

13. PART NO. OR TYPE DESIGNATION

Main Frame

50840

14. DESCRIPTION OF CHANGE

- 1) Change mounting foot design to permit installation of the mounting bolts from the spacecraft side of the mechanical interface per GSFC request.
- 2) Remove Nadir Louver and all associated requirements including field-of-view and thermal finish requirements.

ORIGINAL PAGE IS
OF POOR QUALITY

15. REASON FOR CHANGE

- 1) GSFC request.
- 2) Nadir Louver thermal performance does not justify the additional weight.

16. EFFECT ON ASSOCIATED EQUIPMENT

Assembly and testing fixtures, two (2) will be retrofitted to accommodate new foot design.

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

Engineering, Protoflight, and Flight Models

None

19. RECOMMENDED RETROFIT EFFECTIVITY

20. ESTIMATED RIT DELIVERY SCHEDULE

Engineering, Protoflight, and Flight Models

21. ESTIMATED COSTS/SAVINGS

See Change Proposal No. 014

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

TITLE

L. E. Blanchard

Thematic Mapper Program Manager

23. APPROVAL/DISAPPROVAL

Revision of ICD 35-3300 to reflect Items 14-1 and 14-2 is approved. Additional needed changes to ICD 35-3300A were provided by separate letter (D. Stuenkel).

NASS/GSFC Landsat-D Project

SIGNATURE

O. Weinstein, T.O. NASS-24200

K. Cockerham

Contracting Officer

DATE

3/24/77

DD FORM 1693 1693 41043A

6-15809

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

ORIGINAL PAGE IS
OF POOR QUALITY

ECP 004
Page 3 of 5

Proposed Thematic Mapper Interface Control Drawing (3533000-400, Rev. A)
change.

1. Issue Revision B to 3533000-400A per attached blue/line prints (2).

ORIGINAL PAGE IS
OF POOR QUALITY

ECP 004
Page 4 of 5

STATEMENT OF WORK

CHANGE NO. 1; CHANGE MOUNTING FOOT DESIGN

Task I. Design and Drawing

Conduct engineering design and analysis to specify new foot design. Issue new foot design drawing. Change existing assembly and interface drawings as necessary to incorporate the requirements of the new foot design.

Task II. Structural Mechanics Analysis

Conduct the following analysis:

- A. Natural frequency and normal modes analysis for two cases which bound the results.
- B. Modal random response analysis (protoflight levels) to predict launch loads using frequencies and modes computed in A above.
- C. Self-induced transient analysis to predict on-orbit performance using frequencies and modes computed in A above.
- D. On-orbit thermal distortion analysis based upon Task III.B below.

Task III. Thermal Analysis and Documentation

- A. Revise the operational constraints summary and conduct analysis.
- B. Revise thermal analysis summary assuming 75 percent power supply efficiency with new spacecraft interface. Incorporate spacecraft backloads into analysis.

Task IV. Assembly and Test Fixture

Conduct engineering design and analysis to specify the new retrofit requirements for the assembly and test fixture. Revise existing drawings as necessary to reflect foot design changes.

ORIGINAL PAGE IS
OF POOR QUALITY

ECP 004
Page 5 of 5

Task V. Procurement of TM Mounting Feet

Issue modification to subcontract and procure twelve (12) TM mounting feet of the revised design.

Task VI. Retrofit Machining of Assembly and Test Fixture

Issue modification to subcontract and retrofit machine two (2) assembly and test fixtures.

Task VII. Project Management and System Engineering

Provide Project Management and System Engineering supervision and direction for completion of the engineering effort.

CHANGE NO. 2: DELETE NADIR LOUVER

Change No. 2 is a no-cost change.

ENGINEERING CHANGE PROPOSAL (ECP FORM)
(SEE MIL-STD-411 FOR INSTRUCTIONS)

DATE PREPARED

ECP NO.

PROCURING ACTIVITY NO.

006 A

ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company
Silver City, California 90230

82577

I

6. SPECIFICATION EFFECTS		7. DRAWING AFFECTED	
REF. CODE	SPECIFICATION/DOCUMENT NO.	REF. CODE	MASTER
	HAC	3533000-400	

8. TITLE OF CHANGE

REVISE INTERFACE CONTROL DRAWING 3533000-400 TO REFLECT
REQUESTED CHANGE TO LOCATIONS OF ELECTRICAL INTERFACE
CONNECTORS J9 THROUGH J20 AND J24

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

THEMATIC MAPPER INTERFACE CONTROL DRAWING 3533000-400

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

ELECTRONIC MODULE TOP COVER

13. PART NO. OR TYPE DESIGNATION

52360

14. DESCRIPTION OF CHANGE

RELOCATES ELECTRICAL INTERFACE CONNECTORS J9 THROUGH J20, AND J24; AND SPECIFIES
MASTER POLARIZING KEYS FOR THESE CONNECTORS. SEE ATTACHED ENGINEERING CHANGE
DOCUMENTATION; ECR 664537 A, and ECA 467236

ORIGINAL PAGE IS
OF POOR QUALITY

15. REASON FOR CHANGE

PRESENT LOCATION OF CONNECTORS CANNOT BE ACCOMMODATED BECAUSE OF EXTENSIVE REDESIGN
OF THE TM ELECTRONICS MODULE STRUCTURE.

16. EFFECT ON ASSOCIATED EQUIPMENT

NONE

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

ENGINEERING, PROTOFLIGHT, AND FLIGHT MODELS

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

NONE

19. RECOMMENDED RETROFIT EFFECTIVITY

ENGINEERING, PROTOFLIGHT, AND FLIGHT MODELS

20. ESTIMATED KIT DELIVERY SCHEDULE

NONE

21. ESTIMATED COSTS/SAVINGS

THIS IS A "NO COST" ECP

22. APPROVAL AND DISAPPROVAL

[Signature]

ASST PRG MGR TM

23. APPROVAL/DISAPPROVAL

24. APPROVAL/DISAPPROVAL

SIGNATURE

DATE

DD FORM 1693 6-70

6-1120

ENGINEERING CHANGE REQUEST

HUGHES

CODE IDENT 82577

ECR NO. **Nº 664537**

SHEET 1 OF 3

REQUEST

PROGRAM	SYS/EQUIP NAME OR DES	CONTROL ITEM NAME & NO.	SPECIFICATION/DWG NO.(S)
HS 236	THEMATIC MAPPER	3533000-100 THEMATIC MAPPER	INTERFACE CONTROL DRAWING 3533000-400

DESCRIPTION OF PROBLEM

Connector location interferes with electronic module structure

PROPOSED SOLUTION

ORIGINAL PAGE IS
OF POOR QUALITY

See SBRC ECR attachments

REQUESTED BY	EXT	BLDG./M/S	ORG CODE	DATE	URGENCY
D. ROWLEY	4243	761/58	22/15	8/9/77	
APPROVED					
<i>McLaughlin</i>	83479	373	44-29	10-8-79	
APPROVED					
					RECD EFF 1 1 up
					RECD DISP OF ITEMS

DISPOSITION

☒ ACCEPTED	REASON FOR REJECTION	DATE RECD IN ECC	SCH REPLY DATE	ADVA
<i>Implement</i>	<i>ECR #6</i>			☐
☐ REJECTED				

CHANGE CLASS	SPECIFICATION OR CONTROL ITEM	RESP SPEC ACT. OR RESP ENGRG ACT.	ECA NUMBER
☒ I ☐ IIA ☐ IIB		<i>McLaughlin</i>	<i>467236</i>
DOCUMENT NO.(S) FOR IIB CHANGE			

ORG CODE	DATE	ORG CODE	DATE	RESP ENGRG ACT.	ORG CODE	DATE
				<i>McLaughlin</i>	<i>44-29</i>	<i>10/1</i>

CLASS IIB RELEASE AUTHORIZATION

CHANGE EFFECTIVITY	CONTRACT NO.	MANUFACTURING
		☐
DISPOSITION OF ITEMS	CUSTOMER	DATE
		<i>9/25</i>
		ENGRG CHANGE CTR ☐

252 CS OCT 72

[SERC]

ENGINEERING CHANGE REQUEST

NO. _____

SHEET 2 OF 3

DRAWING TITLE *THEMATIC MAPPER
INTERFACE CONTROL DRAWING*DRAWING NUMBER
3533000-400

REV

B

CLASS CHANGE



DRAWING TYPE



PRIORITY OF CHANGE



PROJECT NUMBER


OTHER AFFECTED ENGINEERING DOCUMENTS

*NGNE*ORIGINAL PAGE IS
OF POOR QUALITY


REASON CHANGE NEEDED (EXPLAIN IN FULL)

*CONNECTOR LOCATION INTERFERES WITH
ELECTRONIC MODULE STRUCTURE*

NATURE OF PROBLEM AND/OR REQUIRED CHANGE

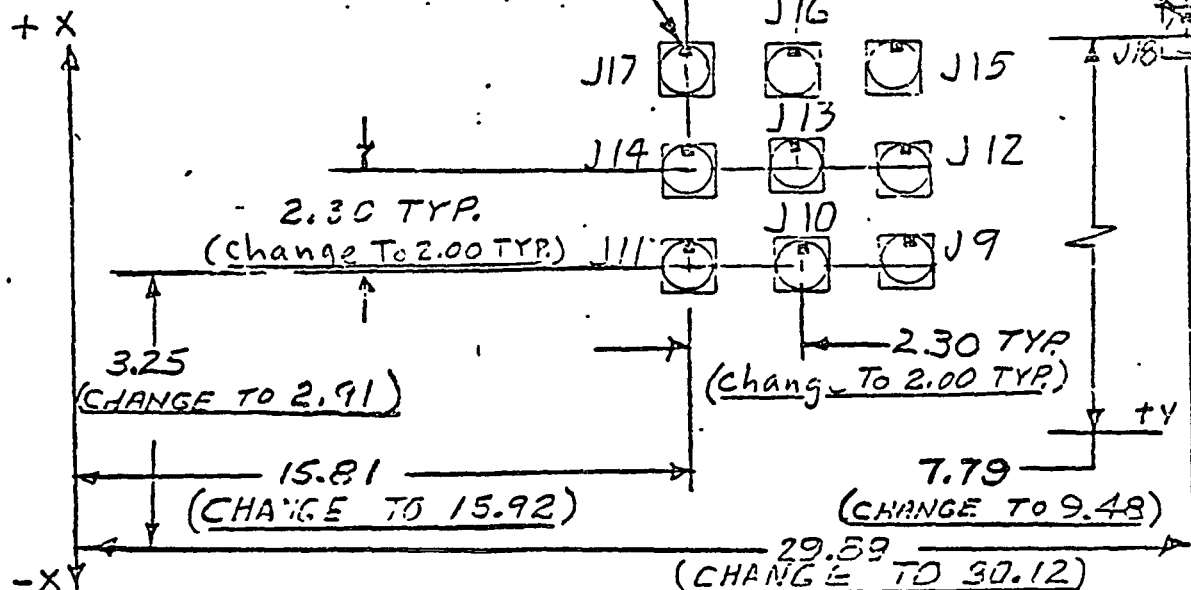*3533000-400 Page 3**PATTERN SHRINKS IN SIZE**[30] Master Polarizing Key
(Typical J9 thru J24)*

REQUESTED BY <i>T. BANKS</i>	DATE <i>7-9-79</i>	APPROVAL <i>[Signature]</i>	DATE <i>7-9-79</i>	VELLUM ISSUE APPROVED BY		
CMO REVIEWER	DATE	APPROVAL <i>[Signature]</i>	DATE <i>7-9-79</i>	☐ CD		
EFFECTIVITY		APPROVAL <i>[Signature]</i>	DATE <i>10-5-79</i>	☐ CMO		
ITEM DISPOSITION				ACTION TAKEN		
REWORK ☐ ITEMS CONFORM ☐				E.O. _____ DWG. REV. _____		
NO ITEMS MADE ☐ REJECT ☐				INCORP BY _____ DATE _____ MRS REQ _____		
USE ☐ NOT APPLICABLE ☐				CHECKED BY _____ DATE _____ MRS REQ _____		

 

ENGINEERING CHANGE REQUEST NO. _____

SHEET 3 OF 3

DRAWING TITLE *THERMAL MAPPER*


DRAWING NUMBER

3533000-400

REV

INTERFACE CONTROL DRAWING

INFORMATION ENTERED HERE MUST BE IDENTIFIED BY THE APPROPRIATE BLOCK HEADING FROM SHEET 1

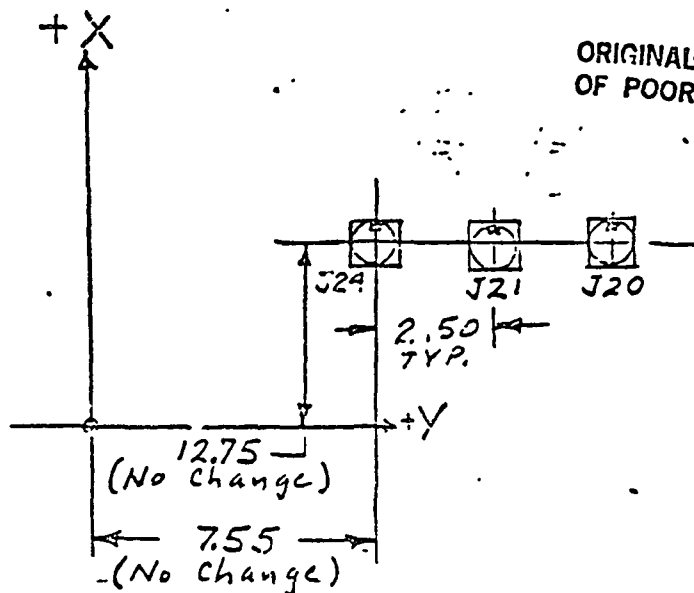

Add Note 30:

- " **30** Connectors J9 Thru J24 To Be Oriented With The Master Polarizing Key In The +X Direction. "

Add Note 31:

- " **31** The Tolerance For Dimensions Locating Electrical Interface Connectors Shall Be ± 0.06 inches. "

ENGINEERING CHANGE ANALYSIS SHEET 1				HUGHES CODE IDENT 8-774		LCA NO. 467236		REV	
						☒ COMPLETE ☐ ADVANCE		SH 1 OF 4	
GRAM 8-1-36			SYS/EQUIP NAME OR DES THEMATIC MAPPER			CONTROL ITEM NAME & NO. 3533000-100			ECR NO 664537A
									CONTRACT NO.
IM CLASS I		URGENCY ROUTINE					RELATED ECA NO. (S)		
LINE AFFECTED 1 AND UP			PRODUCT BASE LINE AFFECTED AND CHANGE IS: ☐ PRODUCTION ONLY ☒ PRODUCTION AND RETROFIT ☐ RETROFIT ONLY						
SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED									
SPECIFICATION OR DRAWING NO.		NEW		CHANGED		DELETED		SPECIFICATION OR DRAWING NO.	
NEW		CHANGED		DELETED		SPECIFICATION OR DRAWING NO.		NEW	
3523000-400 B				INCORPORATE IN REV C					
LE OF CHANGE RELOCATION OF CONNECTORS						ORIGINAL PAGE IS OF POOR QUALITY		RELATED FACTORS ON SH 2 ARE AFFECTED ☐ YES ☐ NO	
DESCRIPTION OF CHANGE									
THE PATTERN FOR CONNECTORS J9 THRU J17 SHRINKS IN SIZE, CONNECTORS J18, J19 ARE MOVED FARTHER AWAY FROM THE Y AXIS IN THE +X DIRECTION, J20 & J24 have been relocated. CONNECTOR LOCATIONS INTERFERE WITH ELECTRONICS MODULE STRUCTURE AS A RESULT OF STRUCTURAL REDESIGN									
TEST OF TESTING NONE						RCM CHANGE EFFECTIVITY 1 AND UP			
						RCM DISPOSITION OF ITEMS NA			
APPROVAL FOR EVALUATION									
ORG CODE		DATE		RSA OR REA		ORG CODE		DATE	
46-42		10/18/79							
44-29		10/18/79		DEPARTMENT MGR					
46-28		11/13/79		CONFIG MGMT OFFICE		44-29		11/30/79	
				PROGRAM MANAGER					
REQUIRED: ECAE ☐ YES ☒ NO MAEC ☐ YES ☒ NO SAEC ☐ YES ☒ NO									
CHANGE APPROVAL									
APPROVED		ORG CODE		DATE		ORG CODE		DATE	
REJECTED									
						CHANGE REVIEW BOARD CHM SBRL 11/27/79			
AUTHORIZATION FOR RELEASE									
DISPOSAL NO		CHG CLASS		CHANGE EFFECTIVITY		CUSTOMER		DATE	
INTRA...		☐ ADVANCE TO COMPLETE		DISPOSITION OF ITEMS		ENGRG CHANGE CTR		DATE	

HUGHES
AIRCRAFT COMPANY
CODE IDENT 82577

467236

SHEET 2 OF 4

SPECIFICATION OR DRAWING NUMBER	NEW	CHANGED	DE- LETED	SPECIFICATION OR DRAWING NUMBER	NEW	CHANGED	DE- LETED
3533000-400 B		INCORPORATE IN REV C		.			
				.			
				. .			
- -				.			
				.			

WHEN A FACTOR IS CHECKED YES, EXPLAIN
BELOW OR ON A CONTINUATION SHEET

FACTOR	YES	NO	FACTOR	YES	NO	FACTOR	YES	NO
SPECIFICATION, CONTRACTUALLY APPLICABLE	X		EMI (RFI)		X	MATERIALS & PROCESSES		X
PERFORMANCE	X		OPERATING INSTALLATION	X		PARTS APPLICATION		X
SAFETY		X	GFAE, GFS, GFP, ETC.	X		SUBCONTRACTOR DEVELOPED ITEM		X
WEIGHT/MASS PROPERTIES		X	OTHER SYSTEMS		X			
INTERCHANGEABILITY	X		INTERFACE	X				
RELIABILITY		X	OPERATIONAL COMPUTER PROGRAMS		X			
MAINTAINABILITY		X	SUPPORT EQUIPMENT	X				

ORIGINAL PAGE IS
OF POOR QUALITY

ECR/ECA/ECAE
CONTINUATION SHEET

HUGHES

HUGHES AIRCRAFT COMPANY
CODE IDENT 62577

☐ ECR ☒ ECA ☐ ECAE

NO.

467236

REV

SH NO.


3 OF 4

INFORMATION ENTERED HEREON SHALL BE IDENTIFIED BY THE APPROPRIATE BLOCK HEADING FROM THE ECR, ECA, ECAE

Revise

3533000-400 Page 3 As shown

30 Master Polarizing key
(Typical J9 thru J24)

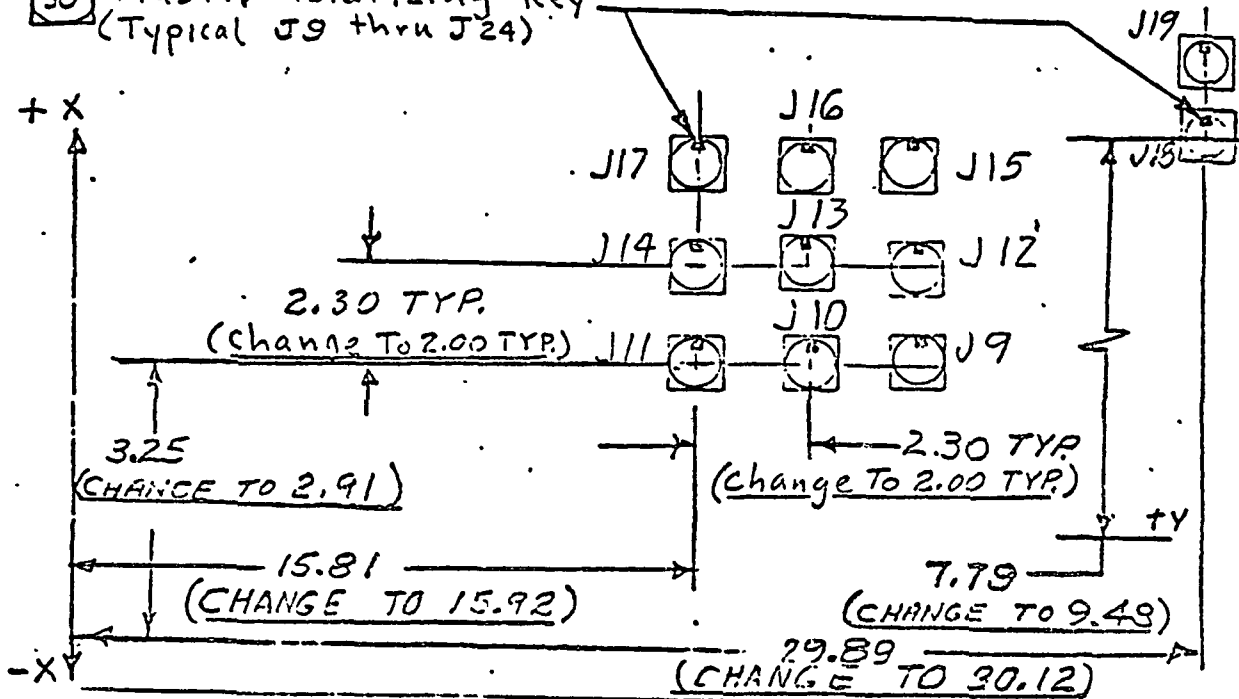

ORIGINAL PAGE IS
OF POOR QUALITY

ECR/ECA/ECAE
CONTINUATION SHEET

HUGHES

HUGHES AIRCRAFT COMPANY
CODE IDENT 62877

☐ ECR ☒ ECA ☐ ECAE

NO.

467236

REV


SH NO.

40-4

ALL INFORMATION ENTERED HEREON SHALL BE IDENTIFIED BY THE APPROPRIATE BLOCK HEADING FROM THE ECR, ECA, OR ECAE

ORIGINAL PAGE IS
OF POOR QUALITY

+X Revise Drawg# 353300-400 Page 3 as shown.

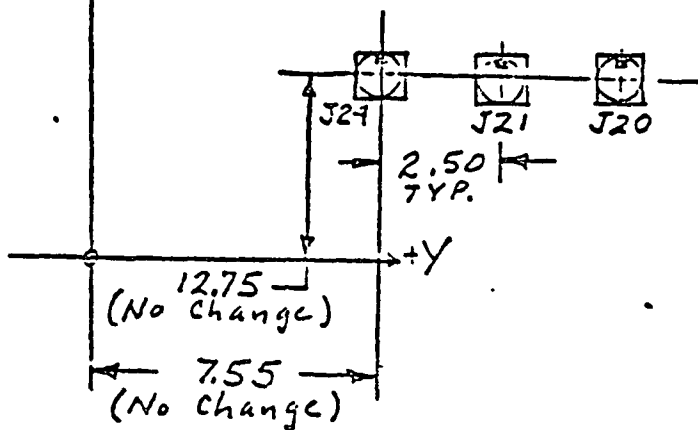

Add Note 30 :

" 30 Connectors J9 Thru J24 To Be Oriented With The Master Polarizing Key In The +X Direction. "

Add Note 31 :

" 31 The Tolerance For Dimensions Locating Electrical Interface Connectors Shall Be ± 0.06 inches. "

ORIGINAL PAGE IS
OF POOR QUALITY

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE 210-370-401 FOR INSTRUCTIONS)

DATE PREPARED

ECP NO.

PROCURING ACTIVITY NO.

007

1. ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company
Culver City, California 90230

2. W.D. CODE
825TT

3. CLASS OF ECP

4. P.R. CODE
5. PRIORITY

6. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

W.D. CODE	SPECIFICATION/DOCUMENT NO.	W.D. CODE	DRAWING	REV.
	IGSFC 400.8-D-210, HS236-6241			

8. TITLE OF CHANGE

9. CONTRACT NO. & LINE ITEM

DELETION OF BAND 6 MODULATION TEST (AC05R)

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

SYSTEM TEST

11. IN PRODUCTION

☐ YES

☒ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

N/A

13. PART NO. OR TYPE DESIGNATION

14. DESCRIPTION OF CHANGE

- (1). CANCELL AC05R. VERIFY COMPLIANCE WITH THE BAND 6 MODULATION USING THE RESULTS OF UNIT LEVEL TESTS AND ANALYSIS (PER HS236-1381).
- (2). CHANGE THE TOP LINE SPECIFICATION FOR BAND 6 MODULATION TO READ "1/2% OF FULL SCALE" RATHER THAN "1/2% OF THE AVERAGE" OUTPUT SIGNAL. (GSFC 400.8-D-210, PARAGRAPH 3.2.9.3). IT THEN BECOMES THEORETICALLY POSSIBLE TO MEET THE SPECIFICATION FROM SCENE TEMPERATURES 260°-320°K.

15. REASON FOR CHANGE

THERE ARE TWO MAJOR PROBLEMS WITH AC05R AS CURRENTLY PLANNED AND SCHEDULED:

- (1). A CONSERVATIVE ANALYSIS USING RECENT RESULTS OF UNIT LEVEL TESTS HAS SHOWN THAT THE SPECIFICATION, AS MODIFIED ABOVE, WILL BE MET. WITHOUT THE CHANGE, THE SPECIFICATION IS THEORETICALLY IMPOSSIBLE AT LOW SCENE TEMPERATURES.
- (2). A MUCH MORE COMPLEX (AND EXPENSIVE) SYSTEM LEVEL TEST WOULD BE REQUIRED TO PROVIDE MORE INFORMATION THAN IS OBTAINED BY THE UNIT TEST/ANALYSIS APPROACH.

16. EFFECT ON ASSOCIATED EQUIPMENT

NONE

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

N/A

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

N/A

19. RECOMMENDED RETROFIT EFFECTIVITY

N/A

20. ESTIMATED KIT DELIVERY SCHEDULE

N/A

21. ESTIMATED COSTS/SAVINGS

NONE

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

L. E. BLANCHARD

23. TITLE

ASSOCIATE PROGRAM MANAGER

24. APPROVAL/DISAPPROVAL

GOVERNMENT ACTIVITY

NASA/GSFC

SIGNATURE

K-TT-P. Lin

DATE

10/31/79

DD FORM 1693 GA 4104JA

0-10340

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

ORIGINAL PAGE IS
OF POOR QUALITY

INTERDEPARTMENTAL CORRESPONDENCE



TO: Tom VanHorne
ORG: 44-29-00
SUBJECT: Band 6 Modulation,
System Performance Analysis
and Error Budget

CC: (See attached)

DATE: 21 June 1979

REF. HS236-1381

FROM: Neal Dougherty

ORG. 40-92

BLDG. 373

MAIL STA. A340

LOC. SC

EXT. 81731

INTRODUCTION

The IDC presented here examines four contributors to band 6 modulation, predicts the system modulation which will be observed, and recommends that the planned system level test not be conducted. As an alternative, subsystem level tests combined with system modeling are recommended to verify compliance with the system band 6 modulation specification.

SUMMARY OF RESULTS AND CONCLUSIONS

The System Level Scan Modulation Specification

The specification for band 6 modulation should be changed to require that the peak-to-peak modulation be less than 1/2 percent of maximum signal level. The specification currently requires that the peak-to-peak modulation be less than 1/2 percent the average signal level. Meeting the current specification is theoretically impossible at scene radiation temperatures near the minimum (260°K). Also, at low scene temperatures, 1/2 percent of the signal is well below the quantizing noise.

The optical contributions to the system scan modulation are conservatively estimated to be less than 0.33 percent. These contributions result from motion of the scan mirror and the scan line corrector.

If the electronic subsystem specifications are met, the net electronic contribution to band 6 modulation will not exceed 0.16 percent and the total band 6 modulation would be less than 0.49 percent.

Currently planned subsystem tests, combined with modeling and analysis, are sufficient to establish compliance with the band 6 modulation specification.

Need for System Level Tests

The currently planned system level band 6 modulation tests will not be capable of isolating and characterizing the subsystem contributions to system band 6 modulation. Much more extensive system testing is required to do this.

ORIGINAL PAGE IS
OF POOR QUALITY

It is not anticipated that corrective ground based processing will be required to comply with the band 6 modulation specification. However, if it were required, the model used for ground correction would necessarily be based upon the results of subsystem level tests and modeling, not on system level tests.

Necessary Conditions for Systems Level Testing

If the system level test is performed, the "uniform temperature plate" must be sufficiently rough and diffuse that no specular reflections are possible and the emissivity is independent of direction. Ideally, the plate surface would be a nondirectional blackbody.

A system level test cannot determine compliance with either the existing specification or the proposed modified specification unless preceded by band 6 radiometric calibration. Neither full scale nor average signal level are accurately defined before calibration.

SUBSYSTEM CONTRIBUTIONS TO BAND 6 MODULATION

There are four subsystem contributors to band 6 modulation: 1) scan mirror reflectivity (variation with scan angle), 2) scan line corrector, 3) detector/preamplifier ac coupling, and 4) video dc restore. The contribution of each subsystem is discussed and the total contribution conservatively estimated in this section.

The contribution of each subsystem is expressed as a fraction of full scale rather than as a fraction of the average signal. The rationale for this choice is presented in the next section which discusses a problem with the system level specification.

Scan Mirror Reflectivity Contribution

To analyze the impact of scan mirror variations on band 6 modulation, consider the simplified model of Figure 1. The radiation from the mirror which results in irradiance, H , at the image plane consists of reflected radiation (image forming) and emitted radiation (nonimage forming or background). The irradiance of the image plane can then be expressed as

$$H = K \left\{ \rho(\theta) N(T_s) + \epsilon(\theta) N(T_m) \right\} + H_B \quad (1)$$


where:

$N(T)$ = "in band" radiance of a blackbody at temperature, T

T_s = radiation temperature of the scene

T_m = surface temperature of the mirror

ORIGINAL PAGE IS
OF POOR QUALITY

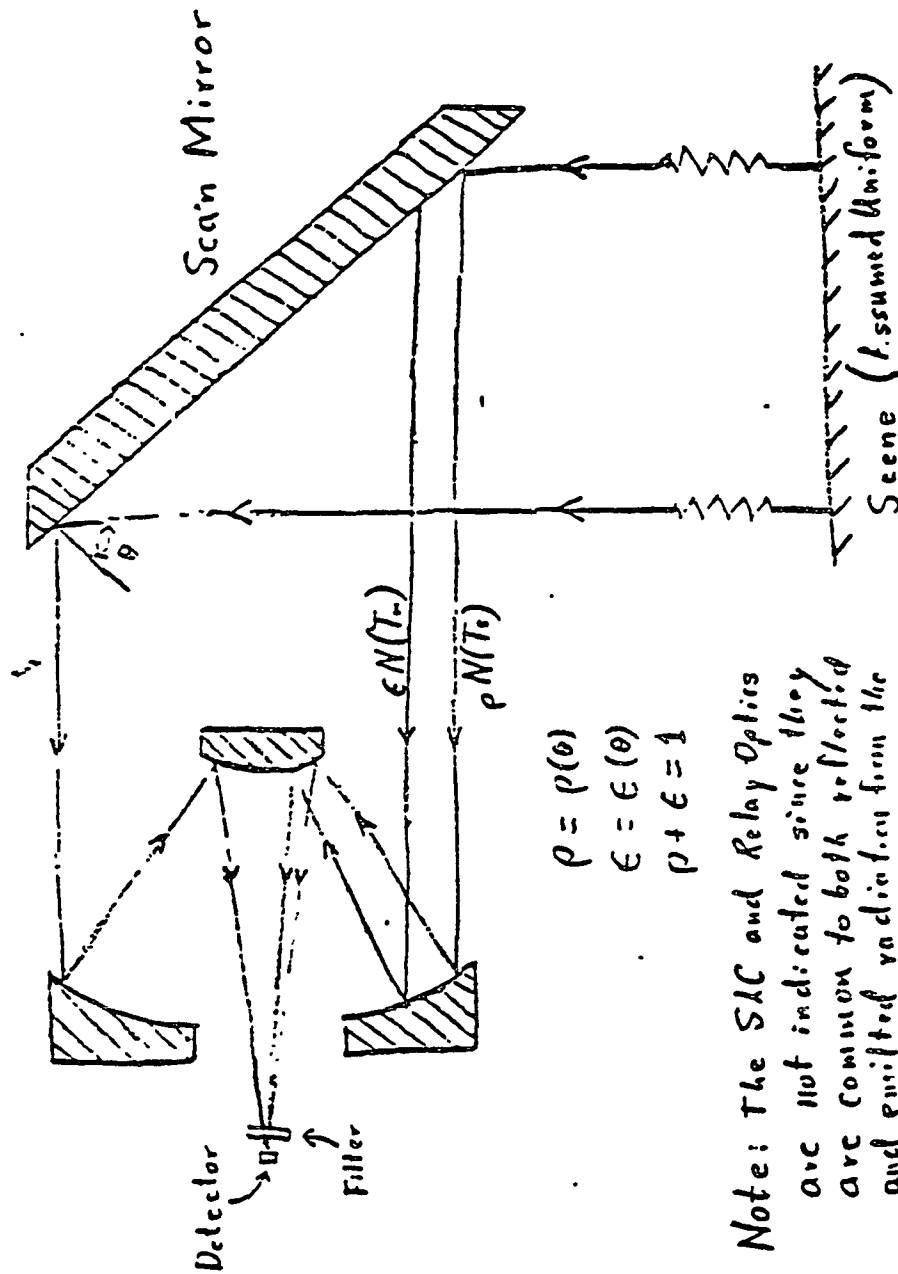

$$\rho = \rho(\theta)$$

$$\epsilon = \epsilon(\theta)$$

$$\rho + \epsilon = 1$$

Note: The SAC and Relay Optics
are not indicated since they
are common to both reflected
and emitted radiation from the
Scan Mirror.

FIGURE 1. SCAN MIRROR MODULATION MODEL

ORIGINAL PAGE IS
OF POOR QUALITY

$\epsilon(\theta)$ = mirror emissivity at angle

$\rho(\theta)$ = mirror reflectivity at angle

θ = angle of incidence of the mirror

K = a constant which incorporates the lens and mirror efficiencies

H_B = background irradiance

From Kirchoff's radiation law as applied to an opaque reflecting surface,

$$\rho(\theta) + \epsilon(\theta) = 1. \quad (2)$$

Substituting for ϵ in Equation 1 and collecting the terms:

$$H = K \left\{ N(T_m) - \rho \left[N(T_s) - N(T_m) \right] \right\} + H_B \quad (3)$$

The incremental change, ΔH_p , for a small change, $\Delta \rho$, can then be computed as

$$\Delta H_p = \frac{\partial H}{\partial \rho} \Delta \rho = K \left[N(T_s) - N(T_m) \right] \Delta \rho \quad (4)$$

For a full scale signal, the incremental change in focal plane irradiance, ΔH_{FS} , is

$$\Delta H_{FS} = H(T_s^{Max}) - H(T_s^{Min}) \quad (5)$$

and substituting Equation 3 into Equation 5

$$\Delta H_{FS} = K \left[N(T_s^{Max}) - N(T_s^{Min}) \right] \rho \quad (6)$$

ORIGINAL PAGE IS
OF POOR QUALITY

The fractional contribution to band 6 modulation, $F_p(T_s)$, is the ratio $\Delta H_p / \Delta H_{FS}$. Dividing Equation 5 by Equation 6 obtains:

$$F_p(T_s) = \frac{\Delta H_p}{\Delta H_{FS}} = \frac{[N(T_s) - N(T_m)] \Delta P}{[N(T_s^{Max}) - N(T_s^{Min})] \rho} \quad (7)$$

Since $N(T)$ is a monotonically increasing function of T , the extreme value of $F_p(T_s)$ can be determined by computing the value at $T_s = T_s^{Max}$ and T_s^{Min} and selecting the largest absolute value of the two.

For the Thematic Mapper, the following values apply:

<u>Parameter</u>	<u>Value</u>	<u>Source</u>
ρ	.953	(See Appendix A)
ΔP	.0055	(See Appendix A)
T_s^{Max}	320°K	
T_s^{Min}	260°K	
T_m	294°K	

which, substituted into Equation 7 and referring to blackbody tables produce:

$$F_p(320^\circ K) = 2.4 \times 10^{-3}$$

and

$$F_p(260^\circ K) = -3.1 \times 10^{-3}$$

The largest contribution to band 6 from the scan mirror is then 0.31 percent.

It is worth noting that scene radiation temperatures below 260°K and above 320°K would be clipped since they lie outside the band 6 dynamic range. The usefulness of the imagery would be seriously limited as the average scene radiation temperature approaches these dynamic range limits. Thus the 0.31 percent scan modulation contribution represents a conservative upper limit.

Scan Line Corrector Contribution

The contribution of the scan line corrector to band 6 modulation results from the translation of the image of the telescope (as viewed from

ORIGINAL PAGE IS
OF POOR QUALITY

the detector plane) over a 1.066 inch range. Since the mapper has been carefully designed to avoid vignetting, any modulation will be due to the slight changes of perspective which cause each detector to view an incrementally different solid angle of internal structural and baffling members. If only one of these members (the odd member) differs by ΔT from the cavity temperature, the fractional contribution, F_{SLC} , can be estimated as:

$$F_{SLC} = R_{\Omega} \frac{\epsilon \Delta T}{\tau (60^{\circ}K)} \quad (8)$$

where:

R_{Ω} = ratio of the incremental change in solid angle of the odd member to the solid angle of the telescope exit pupil

ϵ = emissivity of the odd temperature member

τ = telescope effective transmission, including the obscuration ratio

ΔT = temperature difference of the odd member ($^{\circ}K$)

$60^{\circ}K$ = TM band 6 dynamic range

For the Thematic Mapper, the following values are representative

$$R_{\Omega} = 1.33 \times 10^{-3}$$

$$\epsilon = 0.8$$

$$\tau = 0.7$$

which, substituted into Equation 8, yield

$$F_{SLC} = 2.5 \times 10^{-5} \Delta T \quad (9)$$

If the odd member is assumed to be at a temperature difference $8^{\circ}K$ from the cavity (an extreme value considering existing thermal predictions), F_{SLC} becomes 2.0×10^{-4} .

ORIGINAL PAGE IS
OF POOR QUALITY

AC Coupling Contribution

The signal from the detector preamplifier combination is ac coupled to the remainder of the video chain. This results in low frequency response that will result in some droop in the signal during a line scan. The subsystem specification limits this droop to not more than 0.1 percent of full scale signal.

DC Restore Contribution

The dc restore for band 6 is located in the multiplexer. The dc restore drift is restricted to 2.5 mV out of a full scale 4.0 volts. This translates into a fractional contribution of .06 percent.

Total Band 6 Modulation*

If the subsystem specifications for ac coupling and dc restore are met, the upper limit of band 6 modulation is presented in the following tabulation. All modulation contributions are expressed as a percentage of full scale signal.

Subsystem	Modulation Contribution, %	References
Scan mirror	0.31	Derived function of $P(\theta)$, T_m , T_s
SLC	0.02	Derived worst case, HS 236-5687
AC coupling	0.10	DS 32015-003B
DC restore	0.06	DS 32015-005
Total	0.49	

A PROBLEM WITH THE SYSTEM SPECIFICATION

The system specification (GSFC S-726-9, paragraph 3.2.9.3) for scan modulation requires that the scan modulation be less than 1/2 percent of the average signal level of the scan. This presents two problems:

- 1) When the average signal level is relatively low within the dynamic range, 1/2 percent of the average level is far below the combined analog and quantizing noise of the system.

*See Appendix B for a reconciliation between the table and the performance budget presented at the Detailed Design Review.

- 2) Certain contributors to scan modulation, while very small, do not approach zero as the signal level shrinks. As the average signal level approaches zero, these contributors alone will prevent the specification from being met. An example is analyzed and discussed below.

Scan Mirror

For illustration purposes, the scan mirror reflectivity will be allocated all of the scan modulation budget of 1/2 percent of the average signal level. From Equation 4 above, the scan modulation is then

$$\Delta H_p = K [N(I_s) - N(I_m)] \Delta p \quad (10)$$

The average signal level can be computed as

$$\Delta H_{AVE} = \frac{1}{\theta_2 - \theta_1} \int_{\theta_1}^{\theta_2} [H(I_s) - H(I_s^{Min})] d\theta \quad (11)$$

and substituting from Equation 3,

$$\Delta H_{AVE} = \frac{K}{\theta_2 - \theta_1} [N(I_s) - N(I_s^{Min})] \int_{\theta_2}^{\theta_1} p(\theta) d\theta$$

which may be expressed as

$$\Delta H_{AVE} = K [N(I_s) - N(I_s^{Min})] p_{AVE} \quad (12)$$

where

$$p_{AVE} = \frac{1}{\theta_2 - \theta_1} \int_{\theta_1}^{\theta_2} p(\theta) d\theta$$

ORIGINAL PAGE IS
OF POOR QUALITY

The specification requires the following relationship be satisfied:

$$\left| \frac{\Delta H_p}{\Delta H_{AVE}} \right| \leq 0.005 \quad (13)$$

and substituting from Equations 10 and 12

$$\left| \frac{[N(T_s) - N(T_m)] \Delta P}{[N(T_s) - N(T_s^{\text{Min}})] P_{AVE}} \right| \leq 0.005 \quad (14)$$

and dividing by $\left| \frac{\Delta P}{P_{AVE}} \right|$:

$$\left| \frac{N(T_s) - N(T_m)}{N(T_s) - N(T_s^{\text{Min}})} \right| \leq \frac{0.005}{\left| \frac{\Delta P}{P_{AVE}} \right|} \quad (15)$$

For the Thematic Mapper, the following values apply

$$\left| \frac{\Delta P}{P_{AVE}} \right| = 0.003$$

$$T_s^{\text{Min}} = 260^{\circ}\text{K}$$

$$T_m = 294^{\circ}\text{K}$$

which, substituted into Equation 15, yield

$$\left| \frac{N(T_s) - N(294^{\circ}\text{K})}{N(T_s) - N(260^{\circ}\text{K})} \right| \leq 1.67 \quad (16)$$

Remembering that $N(T)$ is a monotonically increasing function of T , it is clear that as T_s approaches 260°K , the magnitude of the numerator remains finite while the denominator approaches zero. Clearly, Equation 16 cannot be satisfied as T_s approaches 260°K .

ORIGINAL PAGE IS
OF POOR QUALITY

Equation 16 demonstrates that the system specification cannot be met throughout the scene temperature dynamic range even if all of the error budget were allocated to the scan mirror. This is true while the worst case contribution of the scan mirror reflectivity is only .62 times one quantizing level.

COMMENTS

Comments on the system level test are as follows:

- 1) If band 6 scan modulation is to be measured on a systems level, the test must be performed with actual subsystems. Since the multiplexer will not be available at the time the test is scheduled, the test should be postponed.
- 2) The worst case contribution of the scan mirror reflectivity occurs at 260°K (8°F). If the worst cases are to be included in the test, the plate should be cooled to this temperature. Of course, when the test plate is well below the room (or cavity temperature), its reflectivity must be very low to avoid invalidating the test. Condensation may also be a problem.
- 3) If the test were conducted with the test plate at the same temperature as the scan mirror, Equation 4 shows that the scan modulation contribution of the mirror reflectivity would be zero, independent of the variation in reflectivity over the scan.
- 4) If the test plate is only going to be operated above the mirror temperature, the surface should be rough (diffuse) and its emissivity known. The emissivity need not approach 1.
- 5) The key element in conducting a valid experimental assessment of the contribution of scan line corrector is that the internal structural members of the telescope assume the actual dynamic temperatures which would occur during an orbital cycle. A method is required to force these temperatures to comply with predicted values or, alternatively, to simulate the orbital environment.
- 6) The system level test requires the output of band 6 calibration to determine compliance with the system specification.

RECOMMENDATIONS

The following recommendations are made:

- 1) Replace system level test with subsystem (or unit) tests and the above analysis.

ORIGINAL PAGE IS
OF POOR QUALITY

- 2) Review the subsystem tests planned to establish compliance for the dc restore and the ac coupling. Make certain the tests are conducted in a manner which will permit these subsystems to be characterized as well as measured.
- 3) Negotiate a change in the scan modulation specification to allow 1/2 percent of full scale signal rather than 1/2 percent of the average signal.

ORIGINAL PAGE IS
OF POOR QUALITY

APPENDIX A. Band 6 Reflectivity Over the Angular Range

During the time which imagery is being collected, the angle of incidence at the scan mirror ranges linearly from 31° to 39° . The band 6 bandpass is from $10.5 \mu\text{m}$ to $12.5 \mu\text{m}$.

From the average reflectivity values computed by Tim Wise and Sam Pellicori, the following table was constructed:

$\lambda (\mu\text{m})$	$\rho (31^{\circ})$	$\rho (39^{\circ})$	$\Delta \rho$
10.5	0.9581	0.9484	0.0087
11.5	0.9753	0.9692	0.0061
12.5	0.9832	0.9814	0.0018
Averages	0.9667		0.0055

APPENDIX B. Reconciliation

The scan modulation performance budget developed in this IDC is significantly different than that presented at the Detailed Design Review (HS 236-0677, Table 2.1-16, p. 2-41). The new performance budget reflects a refinement of the underlying analysis as well as the current status of subsystem development and testing.

Scan Mirror Reflectivity and Polarization

The scan mirror reflectivity and polarization changed from 0.30 percent to 0.31 percent. While the numerical change is small, the analytical bases for the values are quite different. The anticipated Δ over and δ is now 0.55 percent rather than 0.2 to 0.3 percent. However, when the mirror self-emission is accounted for, the contribution to band 6 modulation is 0.31 percent under worst case conditions.

Scan Line Corrector

It was previously assumed that the scan line corrector contribution to band 6 modulation resulted from the angle of incidence, the position of the beam on the corrector mirrors, and the presence of strong lateral thermal gradients on these mirrors. However, this is no longer the case. The scan line corrector contribution is now understood to result from small perspective changes of internal members of the telescope as viewed by the detectors.

Signal Droop

Signal droop is treated as two separate contributors, dc restore and ac coupling. We now anticipate that the subsystem specification for the multiplexer dc restore circuit will be readily met, producing a contribution not to exceed 0.06 percent.

The ac coupling contribution to band 6 modulation as defined in the top line specification is actually negligible. This is because band 6 modulation is defined as the response to a uniform scene. Ac coupling only contributes to band 6 modulation when the scene average temperature is changing, not when it is uniform. In the new performance budget, a conservative upper limit of 0.1 percent (the subsystem specification) has been assumed.

In flight operation, the ac coupling will contribute to band 6 Modulation since the average scene temperature changes along track. The along-track radiation temperature gradients for which 0.1 percent modulation will not be exceeded are discussed later in this appendix.

Stray Radiance

When current measurements of the scattering properties of the scan mirror surface in the band 6 region are considered, the stray radiance in this band is found to vary less than 0.01 percent as the mirror scans. For this reason, this contribution is not included in the performance budget of this IDC.

Component Temperature Variations

Component temperature variations are considered in the scan line corrector contribution since this is the way they can significantly contribute during a 60 ms active scan. They are not separately considered.

Finally, note that this IDC algebraically sums the contributions to band 6 modulation to estimate total modulation. This is more conservative than root sum squaring them as was done in HS 236-0677, Table 2.1-16.

Ac Coupling, In-Flight Contribution

In-flight, significant along-track (i.e., north-south) average radiation temperature gradients will occur. These gradients will, in turn, cause the ac coupling contribution to band 6 modulation to be nonzero. Using the measured time constant (14 seconds), it is possible to examine the along-track gradient conditions under which the contribution will be less than 0.1 percent full scale.

To bound these conditions, it was assumed that at the average temperature along-track was constant until some point at which a gradient began. For a maximum 0.1 percent scan modulation, the relationship between the gradient and the distance over which the gradient extends is derived. The result is presented in Figure 2.

Below the curve in which the modulation equals 0.1 percent, the scan modulation will be less than 0.1 percent. At the line, the 0.1 percent subsystem specification will be equaled. Above the line, the specification will be exceeded.

Several features of the curve are of interest. Note that on the left hand side the curve begins to approach the line where the product of the gradient times the distance is 14°K . 14°K is the maximum increment for a step function without exceeding 0.1 percent modulation.

On the other hand, for gradients less than $.0167^{\circ}\text{K/km}$, the 0.1 percent scan modulation limit will not be exceeded no matter how long the distance over which they extend. In this context, a relatively extreme average winter gradient from Texas to the Canadian Border would be about $.025^{\circ}\text{K/km}$. Local gradients which are much higher, but extend for shorter

ORIGINAL PAGE IS
OF POOR QUALITY

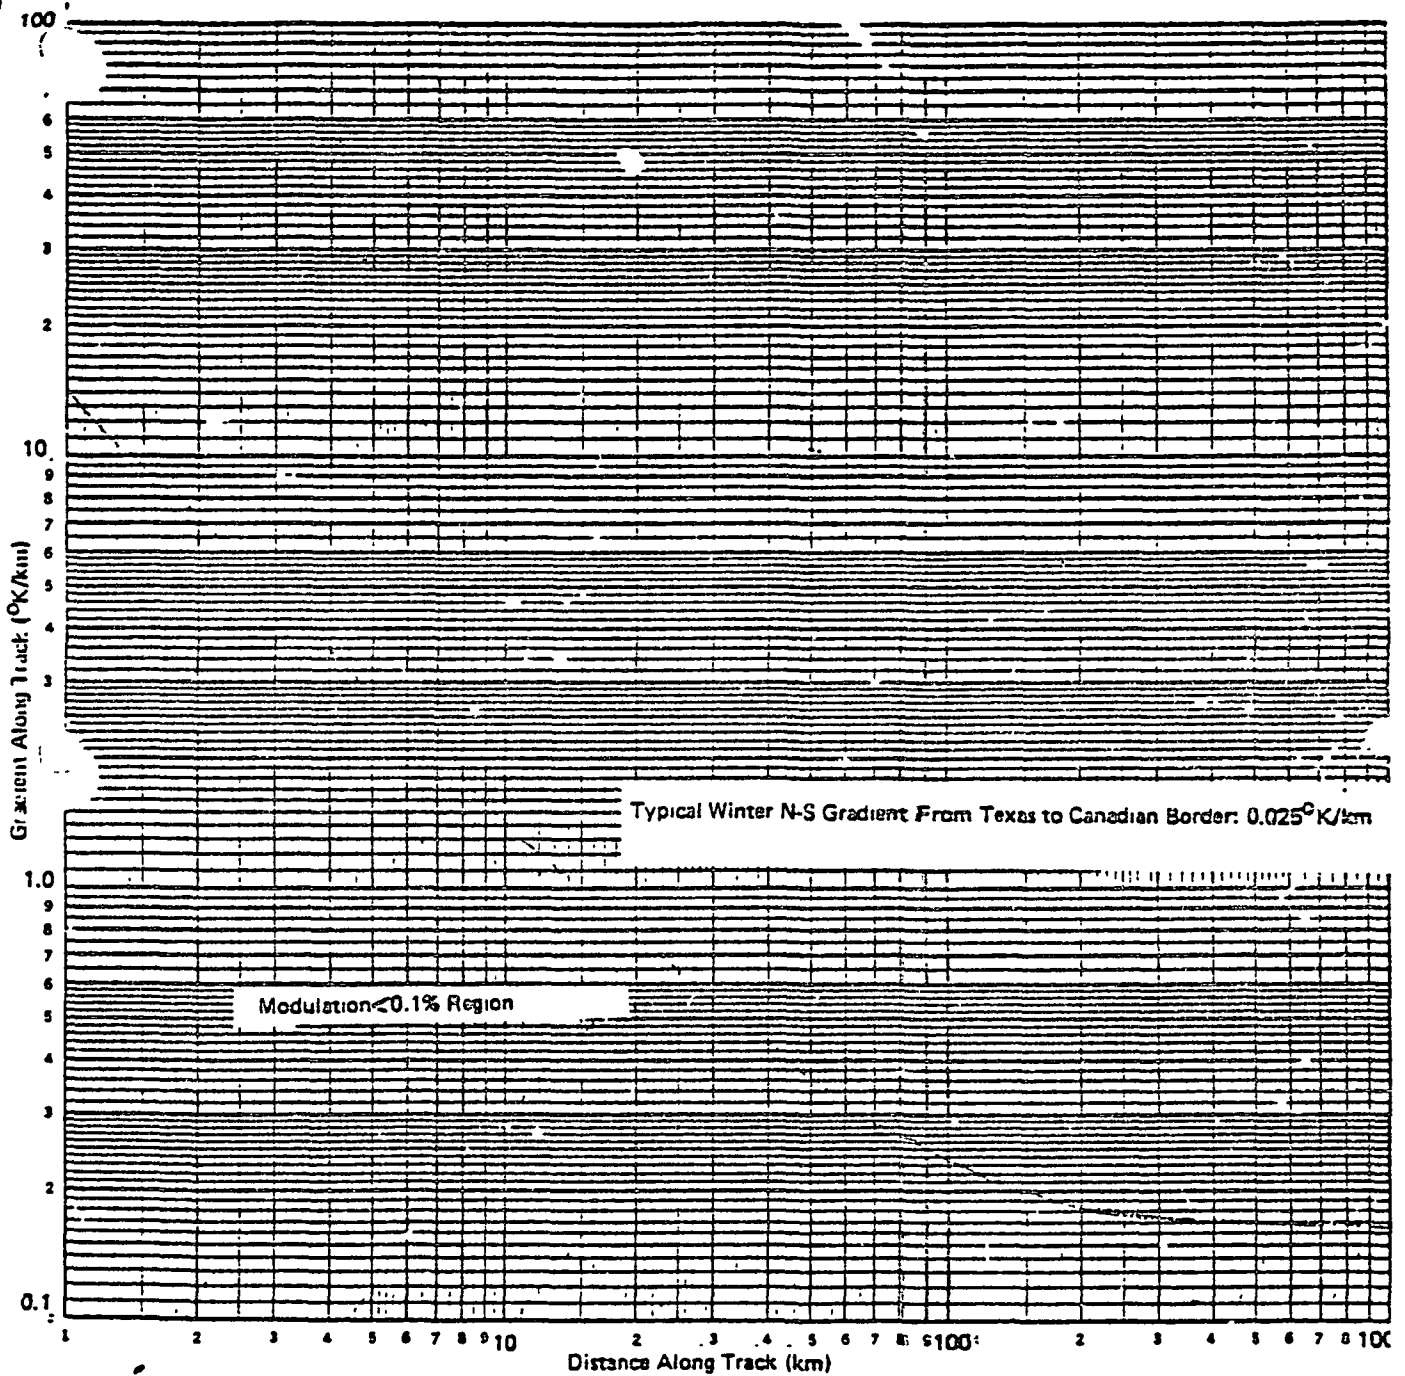


FIGURE 2. A/C COUPLING SCAN MODULATION ($< 0.1\%$ REGION)

ORIGINAL PAGE IS
OF POOR QUALITY

distances, would be common in the continental United States. The highest gradients would occur at land water interfaces.

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-481 FOR INSTRUCTIONS)

DATE PREPARED

8/16/79

ECR NO.

8

PROCURING ACTIVITY NO.

ORIGINATOR NAME AND ADDRESS

Hughes Aircraft Company

Culver City, California 90230

1. ECR CODE

825TT

2. CLASS OF ECR

I

3. SUB. CODE

4. PRIORITY

5. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

SYB. CODE	SPECIFICATION/SECTION NO.	4. ECR CODE	REASON	REV.
	GSFC 400.8-D-210. Revision B	h		
	DS32015-003B	h		

8. TITLE OF CHANGE

CHANGES IN THEMATIC MAPPER SYSTEM SPECIFICATION

(GSFC 400.8-D-210, REVISION B, APRIL 1978), SEC. 3.2.8.1

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

THEMATIC MAPPER SYSTEM

11. IN PRODUCTION

☐ YES

☒ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

THEMATIC MAPPER

13. PART NO. OR TYPE DESIGNATION

14. DESCRIPTION OF CHANGE

INCORPORATE THE CHANGES OUTLINED IN THE MARCH 26, 1979 MEMO FROM V. V. SALOMONSON TO O. WEINSTEIN (MODIFIED TO REFLECT THE VERBAL DIRECTION PROVIDED TO N. R. DOUGHERTY BY V. SALOMONSON, 7/17/79). THE CHANGES ADDRESS:

- (1). THE RADIOMETRIC CALIBRATION CRITERIA
- (2). THE SPECTRAL MATCHING CRITERIA

ORIGINAL PAGE IS
OF POOR QUALITY

15. REASON FOR CHANGE

CUSTOMER REQUEST

16. EFFECT ON ASSOCIATED EQUIPMENT

NONE

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

NA

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

NONE

19. RECOMMENDED RETROFIT EFFECTIVITY

NA

20. ESTIMATED RET DELIVERY SCHEDULE

NA

21. ESTIMATED COSTS/SAVINGS

NONE

APPROVING ACTIVITY

N. DOUGHERTY

GOVERNMENT ACTIVITY

T. B. VAN HORNE

SIGNATURE

DATE

DD FORM 1693 1693 GA 4104JA

9-15304

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

TABLE III

Band No.	Spectral Radiance at Lower Band Edge ($\text{mw}/\text{cm}^2\text{-sr-}\mu\text{m}$)		Spectral Radiance at Upper Band Edge ($\text{mw}/\text{cm}^2\text{-sr-}\mu\text{m}$)		In Band Flat Radiance ($\text{mw}/\text{cm}^2\text{-sr}$)		Minimum Saturation Levels From 3.2.9.4 ($\text{mw}/\text{cm}^2\text{-sr}$)	
	WAS	IS	WAS	IS	WAS	IS	WAS	IS
1	7.9	5.7	10.0	10.0	0.70	0.45	1.00	1.00
2	7.1	9.9	5.0	9.1	0.57	0.77	2.33	2.33
3	3.3	3.2	7.7	7.8	0.46	0.25	1.35	1.35
4	10.7	13.2	21.4	14.1	3.00	1.93	3.00	3.00
5	2.3	2.3	2.9	1.7	0.58	0.40	0.6	0.6
7	1.2	0.47	1.6	.41	.43	0.12	.43	.43

The specified performance shall be achieved after application of a calibration that is the same for both test conditions. Verification that the instrument meets the requirements of this paragraph may be achieved through a combination of component testing (e.g. filter and detector response) and analysis.

3.2.9 Radiometric Requirements

3.2.9.1 Radiometric Sensitivity

The TM output in each of the bands 1 through 5 and 7 shall have a signal-to-noise ratio (SNR) for specified input in accordance with Table IV. For a constant input radiance, the SNR is defined as the ratio of the output value (in units of radiance) averaged over at least one hundred samples to the root mean squared (RMS) value of the noise equivalent radiance which is defined as the RMS of the deviations of the output samples from the average value. All SNR measurements shall be taken with the processing electronics in a linear gain mode except for those bands where quantizing noise precludes meeting the SNR requirements.

TABLE IV

Band No.	Constant In Band Input Radiance ($\text{mw}/\text{cm}^2\text{-sr}$)	Minimum SNR
1	0.28	32
2	0.24	35
3	0.13	26
4	0.19	32
5	0.08	13
7	0.046	5

poses when the Thematic Mapper is mounted on a spacecraft. The optical surfaces shall be polished optical flats of $1/4$ wavelength quality with reflectivity greater than 70 percent. All mirror surfaces on the cube shall be orthogonal to within ± 5.0 arcsec. Normals to these surfaces shall be used to define the Thematic Mapper axes within 3 arcmin. One of these normals shall be set up parallel to the Thematic Mapper optical axis within 3 arcmin ($873 \mu\text{rad}$) and shall be known (measurable) to less than $300 \mu\text{rad}$ in each axis. The Thematic Mapper optical axis is defined at the midscan view of the nadir.

TABLE III. SPECTRAL MATCHING

Band No.	Condition I				Condition II	
	Spectral Radiance at Lower Band Edge, $\text{mW}/\text{cm}^2\text{-sr-}\mu\text{m}$		Spectral Radiance at Upper Band Edge, $\text{mW}/\text{cm}^2\text{-sr-}\mu\text{m}$		Band Flat Spectral Radiance, $\text{mW}/\text{cm}^2\text{-sr-}\mu\text{m}$	
	WAS	IS	WAS	IS	WAS	IS
1	7.9	5.7	10.0	10.0	10.0	6.43
2	7.1	9.9	5.0	9.1	7.1	9.63
3	3.3	3.2	7.7	7.8	7.7	4.17
4	10.7	13.2	21.4	14.1	21.4	13.79
5	2.3	2.3	2.9	1.7	2.9	2.00
7	1.2	0.47	1.6	.41	1.6	.44

for purposes of implementation, the center scan mirror locked position and end of scan hold positions may be used.

3.3 Subsystem Requirements

3.3.1 Telescope Assembly

3.3.1.1 Optical Mitering Structure. The requirements for the optical mitering structure are given in the specification 16085 and drawing 50841.

3.3.1.2 Primary Optics. The radiometer shall be designed with a two-element reflective optical system (Ritchey-Cretien) with the following basic characteristics:

Effective Focal Length	96.0 ± 0.15 inches
Diameter Primary Mirror	16.0 inches nominal
Diameter Secondary Mirror	5.3 inches nominal
Reflectivity, each mirror	94 percent minimum
Focal length/aperture	6
Useful collecting area	163.0 in^2

Unvignetted field covers the detector array that is shown in figure 4.

ORIGINAL PAGE IS
OF POOR QUALITY

HS 236-0019-0587

ENGINEERING CHANGE REQUEST

HUGHES

CODE IDENT 82577

ECR NO. - 831325

SHEET 1 OF 5 SHEETS

REQUEST

PROGRAM	SYS/EQUIP NAME OR DES	CONTROL ITEM NAME & NO.	SPECIFICATION/DWG NO.(1)
THEMATIC MAPPER	SYSTEM		TP32015-500

DESCRIPTION OF PROBLEM

THE PRESENT RADIOMETRIC CALIBRATION AND CHANNEL GAIN ADJUSTMENT REQUIRES EQUAL RESPONSE FROM ALL CHANNELS FOR THE SPECTRUM FROM THE 48" INTEGRATING SPHERE. TYPICAL EARTH SCENE SPECTRA WILL DIFFER CONSIDERABLY AND COULD RESULT IN STRIPING DUE TO SPECTRAL MISMATCHING OF THE CHANNELS

PROPOSED SOLUTION

- MAKE CHANNEL GAIN ADJUSTMENTS BASED ON THE SPECTRA SPECIFIED IN GSFC 400.8-D-210 AS MODIFIED BY THE REVISIONS RECOMMENDED BY U. SALOMONSON

REQUESTED BY	EXT	BLDG./W/S	ORG CODE	DATE	URGENCY
T. R. VAN HORN	82149	375/603	44-29	4/13/74	S/W MODIFICATIONS MAY BE REQUIRED
APPROVED					RECM EFF
APPROVED					RECM DIS OF ITEMS

DISPOSITION

☒ ACCEPTED	REASON FOR REJECTION	DATE RECD IN ECC	SCH REPLY DATE	ADV
☐ REJECTED	Prepare ECP	4/13/74		L

CHANGE CLASS	SPECIFICATION OR CONTROL ITEM	RESP SPEC ACT. OR RESP ENGRG ACT.	ECA NUMBER
☒ I ☐ IIA ☐ IIB	ECP N. Lougher, Jr.	0	ECC 4671
DOCUMENT NO.(S) FOR IIB CHANGE			

ORG CODE	DATE	ORG CODE	DATE	RESP ENGRG ACT.	ORG CODE	D
				PROGRAM MGMT		

CLASS IIB RELEASE AUTHORIZATION

CHANGE EFFECTIVITY	CONTRACT NO.	MANUFACTURING
DISPOSITION OF ITEMS	CUSTOMER	ENGRG CHANGE CTR

250 CS OCT 72

ENGINEERING CHANGE ANALYSIS				HUGHES		ECA NO. 467153		REV
SHEET 1				CODE IDENT 22377		☒ COMPLETE ☐ ADVANCE		SH 1 OF
SYS/EQUIP NAME OR DES		CONTROL ITEM NAME & NO.		ECHR NO.		CONTRACT NO.		
HS236		THEMATIC MAPPER				C31325		
ECM CLASS	URGENCY					RELATED ECA NO. (S)		
	ROUTINE							
CASE LINE AFFECTED		PRODUCT BASE LINE AFFECTED AND CHANGE IS:						
		☐ PRODUCTION ONLY ☐ PRODUCTION AND RETROFIT ☐ RETROFIT ONLY						
SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED								
SPECIFICATION OR DRAWING NO.	NEW	CHANGED	DELETED	SPECIFICATION OR DRAWING NO.	NEW	CHANGED		
GSFC 400.8-D-210, Rev. "B"								
DS32015-003B		SCN						
TITLE OF CHANGE							RELATED FACTORS ON SH 2 ARE AFFECTED	
CHANGES IN THEMATIC MAPPER SYSTEM SPECIFICATION (GSFC 400.8-D-210, REVISION "B", APRIL 1978) SECTION 3.2.8.1							☐ Y ☐ N	
DESCRIPTION OF CHANGE								
INCORPORATE CHANGES OUTLINED IN THE MARCH 26, 1979 MEMO FROM V. V. SALONONSON TO O. WEINSTEIN (MODIFIED TO REFLECT VERBAL DIRECTION PROVIDED TO N. R. DOUGHERTY BY V. V. SALONONSON, 7/17/79)								
(1). RADIOMETRIC CALIBRATION CRITERIA								
(2). SPECTRAL MATCHING CRITERIA								
JUSTIFICATION FOR CHANGE								
CUSTOMER REQUEST								
ORIGINAL PAGE IS OF POOR QUALITY								
EXTENT OF TESTING						ECM CHANGE EFFECTIVITY		
-NO CHANGE								
						ECM DISPOSITION OF ITEMS		
APPROVAL FOR EVALUATION								
ORG CODE		DATE		ORG CODE		DATE		REQUIRED:
<i>William D. Herd</i>		<i>4-20-01 7/31/79</i>		<i>40-91</i>		<i>7/10/79</i>		
				DEPARTMENT MGR				ECAE ☐ YES ☐
				CONFIG MGMT OFFICE				MAEC ☐ YES ☐
				PROGRAM MANAGER				SAEC ☐ YES ☐
CHANGE APPROVAL								
APPROVED		ORG CODE		DATE		ORG CODE		DATE
☒								
REJECTED								
☐								
						CHANGE EFFECTIVE DATE		
						<i>7/29/79</i>		<i>5/3</i>
AUTHORIZATION FOR RELEASE								
PROPOSAL NO.	CHG CLASS	CHANGE EFFECTIVITY				CUSTOMER		DATE
CONTRACTUAL AUTH		ADVANCE TO COMPLETE		DISPOSITION OF ITEMS		ENGRG CHARGE		DATE

ENGINEERING CHANGE PROPOSAL (ECR) FORM
(SEE 216-570-421 FOR INSTRUCTIONS)

DATE PROPOSED

1/17/80

ECR NO.

9 REV. A

PROCESSING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company
Van City, California 90230

2. JPL CODE
3. CLASS OF ECR
4. ECR NO.
5. PRIORITY

82577

1

2252

PRIORITY

6. DRIVEN EFFECTS
7. DRIVEN EFFECTS
8. DRIVEN EFFECTS
9. DRIVEN EFFECTS
10. DRIVEN EFFECTS
11. DRIVEN EFFECTS
12. DRIVEN EFFECTS
13. DRIVEN EFFECTS
14. DRIVEN EFFECTS
15. DRIVEN EFFECTS
16. DRIVEN EFFECTS
17. DRIVEN EFFECTS
18. DRIVEN EFFECTS
19. DRIVEN EFFECTS
20. DRIVEN EFFECTS
21. DRIVEN EFFECTS
22. DRIVEN EFFECTS
23. DRIVEN EFFECTS
24. DRIVEN EFFECTS
25. DRIVEN EFFECTS
26. DRIVEN EFFECTS
27. DRIVEN EFFECTS
28. DRIVEN EFFECTS
29. DRIVEN EFFECTS
30. DRIVEN EFFECTS
31. DRIVEN EFFECTS
32. DRIVEN EFFECTS
33. DRIVEN EFFECTS
34. DRIVEN EFFECTS
35. DRIVEN EFFECTS
36. DRIVEN EFFECTS
37. DRIVEN EFFECTS
38. DRIVEN EFFECTS
39. DRIVEN EFFECTS
40. DRIVEN EFFECTS
41. DRIVEN EFFECTS
42. DRIVEN EFFECTS
43. DRIVEN EFFECTS
44. DRIVEN EFFECTS
45. DRIVEN EFFECTS
46. DRIVEN EFFECTS
47. DRIVEN EFFECTS
48. DRIVEN EFFECTS
49. DRIVEN EFFECTS
50. DRIVEN EFFECTS
51. DRIVEN EFFECTS
52. DRIVEN EFFECTS
53. DRIVEN EFFECTS
54. DRIVEN EFFECTS
55. DRIVEN EFFECTS
56. DRIVEN EFFECTS
57. DRIVEN EFFECTS
58. DRIVEN EFFECTS
59. DRIVEN EFFECTS
60. DRIVEN EFFECTS
61. DRIVEN EFFECTS
62. DRIVEN EFFECTS
63. DRIVEN EFFECTS
64. DRIVEN EFFECTS
65. DRIVEN EFFECTS
66. DRIVEN EFFECTS
67. DRIVEN EFFECTS
68. DRIVEN EFFECTS
69. DRIVEN EFFECTS
70. DRIVEN EFFECTS
71. DRIVEN EFFECTS
72. DRIVEN EFFECTS
73. DRIVEN EFFECTS
74. DRIVEN EFFECTS
75. DRIVEN EFFECTS
76. DRIVEN EFFECTS
77. DRIVEN EFFECTS
78. DRIVEN EFFECTS
79. DRIVEN EFFECTS
80. DRIVEN EFFECTS
81. DRIVEN EFFECTS
82. DRIVEN EFFECTS
83. DRIVEN EFFECTS
84. DRIVEN EFFECTS
85. DRIVEN EFFECTS
86. DRIVEN EFFECTS
87. DRIVEN EFFECTS
88. DRIVEN EFFECTS
89. DRIVEN EFFECTS
90. DRIVEN EFFECTS
91. DRIVEN EFFECTS
92. DRIVEN EFFECTS
93. DRIVEN EFFECTS
94. DRIVEN EFFECTS
95. DRIVEN EFFECTS
96. DRIVEN EFFECTS
97. DRIVEN EFFECTS
98. DRIVEN EFFECTS
99. DRIVEN EFFECTS
100. DRIVEN EFFECTS

8. TITLE OF CHANGE
MULTI MUX CONNECTORS FOR CABLE ACCESS

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE
PROTOFLIGHT AND FLIGHT MODELS

11. IN PRODUCTION
☒ YES ☐ NO

12. NAME OF PART OR SUB-ASSEMBLY AFFECTED
RF CONNECTOR HOUSING COVER

13. PART NO. OR TYPE DESIGNATION
3569208

14. DESCRIPTION OF CHANGE
MODIFY MULTIPLEXER ELECTRICAL INTERFACE CONNECTOR ORIENTATION 50°, ANGLED TOWARD THE MUX MOUNTING SURFACE, AND RELOCATE THEM TO BE IN LINE PARALLEL TO THE X-AXIS. THIS CHANGE AFFECTS J1 THROUGH J8.

NOTE: CONTRACT MODIFICATION NO. 25 DIRECTS IMPLEMENTATION OF THIS CHANGE.

15. IS FOR CHANGE
CUSTOMER DIRECTION:
THE PRESENT LOCATION OF THE MULTIPLEXER ELECTRICAL INTERFACE CONNECTORS IS IN THE IMMEDIATE VICINITY OF A LANDSAT-D STRUCTURAL MEMBER. AS A RESULT, THE ACCESS TO THESE CONNECTORS FOR MATING AND DEMATING IS VERY LIMITED.

ORIGINAL PAGE IS
OF POOR QUALITY

16. EFFECT ON ASSOCIATED EQUIPMENT
NONE

17. PRODUCTION EFFECTIVITY BY SERIAL NO.
PROTOFLIGHT AND FLIGHT

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE
NONE FOR INCORPORATION OF THIS CHANGE TO 3533000-400B

19. RECOMMENDED RETROFIT EFFECTIVITY
NONE

20. ESTIMATED KIT DELIVERY SCHEDULE
N/A

21. ESTIMATED COST SAVINGS
REFER TO HUGHES TXN. HS2236-0010-0475, MOD. NO. 25 DATED 12/18/78

22. APPROVAL
Thematic Mapper Program Manager

23. APPROVAL/DISAPPROVAL
SIGNATURE
DATE

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

ENGINEERING CHANGE ANALYSIS SHEET 1				HUGHES		ECR NO. 567006-1		REV A	
				CODE 12EN-1217		☒ COMPLETE ☐ ADVANCE		SH 1 OF 6	
PROGRAM IS236 THEMATIC MAPPER			SYS/EQUIP NAME OR DES THEMATIC MAPPER			CONTROL ITEM NAME & NO. THEMATIC MAPPER INTERFACE CONTROL DRAWING 3533000-400, Rev. B			ECR NO. 740687
ECM CLASS I			URGENCY HIGH PRIORITY						CONTRACT NO. WAS 5-24200
BASE LINE AFFECTED PROTOFLIGHT & FLIGHT			PRODUCT BASE LINE AFFECTED AND CHANGE IS: ☒ PRODUCTION ONLY ☐ PRODUCTION AND RETROFIT ☐ RETROFIT ONLY						
SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED									
SPECIFICATION OR DRAWING NO.	NEW	CHANGED	DE- LETED	SPECIFICATION OR DRAWING NO.	NEW	CHANGED	DE- LETED		
353300-400 Rev. B		INCORPORATE IN REV. C							
TITLE OF CHANGE MUX CONNECTOR TILT								RELATED FACTORS ON SM 2 ARE AFFECTED ☒ YES ☐ NO	
DESCRIPTION OF CHANGE TILT MUX CONNECTORS TO PROVIDE INTERFACE ACCESS FOR GE ELECTRICAL CABLING.									
ORIGINAL PAGE IS OF POOR QUALITY									
JUSTIFICATION FOR CHANGE CUSTOMER REQUEST									
EXTENT OF TESTING NONE						ECRM CHANGE EFFECTIVITY PROTOFLIGHT & FLIGHT			
						ECRM DISPOSITION OF ITEMS SCRAP			
APPROVAL FOR EVALUATION									
ORG CODE		DATE		RSA OR REA		ORG CODE		DATE	
<i>40-62</i>		<i>1/10/80</i>							
<i>44-29</i>		<i>1/10/80</i>		DEPARTMENT MGR					
				CONFIG MGMT OFFICE					
				PROGRAM MANAGER					
REQUIRED: SCAE ☐ YES ☒ MAEC ☐ YES ☒ SAEC ☐ YES ☒									
CHANGE APPROVAL									
☐ APPROVED		ORG CODE		DATE		ORG CODE		DATE	
☐ REJECTED									
						CHANGE REVIEW BOARD CHM <i>[Signature]</i>			
						<i>44-29 1/25</i>			
AUTHORIZATION FOR RELEASE									
PROPOSAL NO.		CHG CLASS		CHANGE EFFECTIVITY			CUSTOMER		DATE
CONTRACTUAL AUTH		☐ ADVANCE TO COMPLETE		DISPOSITION OF ITEMS			ENGRG CHANGE CTR		DATE

ENGINEERING CHANGE ANALYSIS SHEET 2	HUGHES CODE IDENT 42877	ECA NO. 467096-1	REV A
		SHEET 2 OF 6	

CODE IDENT 42877

REV

A

SHEET 2 OF 6

[illegible]

WHEN A FACTOR IS CHECKED YES, EXPLAIN
BELOW OR ON A CONTINUATION SHEET

FACTOR	YES	NO	FACTOR	YES	NO	FACTOR	YES
SPECIFICATION, CONTRACTUALLY APPLICABLE	X		EMI (RFI)		X	MATERIALS & PROCESSES	
PERFORMANCE		X	OPERATING INSTALLATION	X		PARTS APPLICATION	
SAFETY		X	GFAE, GFE, GFP, ETC.		X	SUBCONTRACTOR DEVELOPED ITEM	
WEIGHT/MASS PROPERTIES	X		OTHER SYSTEMS		X		
INTERCHANGEABILITY	X		INTERFACE	X			
RELIABILITY		X	OPERATIONAL COMPUTER PROGRAMS		X		
MAINTAINABILITY		X	SUPPORT EQUIPMENT		X		

9253B CS OCT 72

ORIGINAL PAGE IS
OF POOR QUALITY

SHEET 3 OF 6

ECA 467096-1 A

THEMATIC MAPPER INTERFACE CONTROL DRAWING 3533000-400

REV B

SHEET 3

ZONE 39 E

IS: 16.03 ± 0.08


IS: 20.93 ± 0.08

WAS: 16.25


WAS: 24.14

ZONE 40 G

IS:

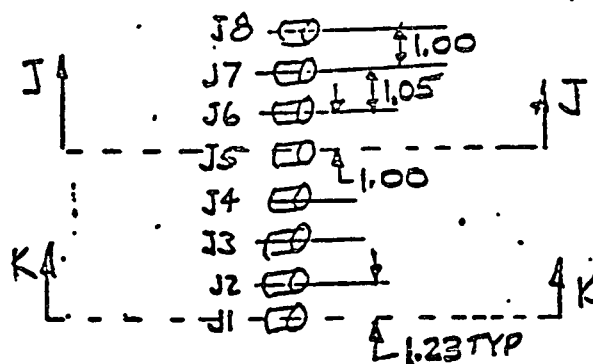

WAS:

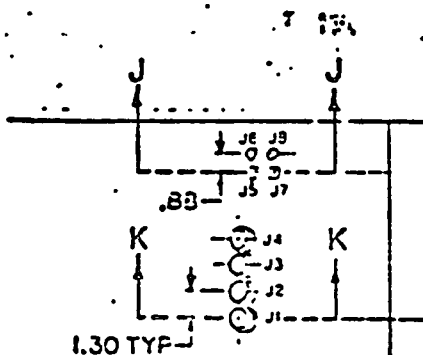


ORIGINAL PAGE IS
OF POOR QUALITY

SHEET
4 OF 6


ECA 467096-1 A

THEMATIC MAPPER INTERFACE CONTROL DRAWING 3533000-400
SHEET 3 REV B

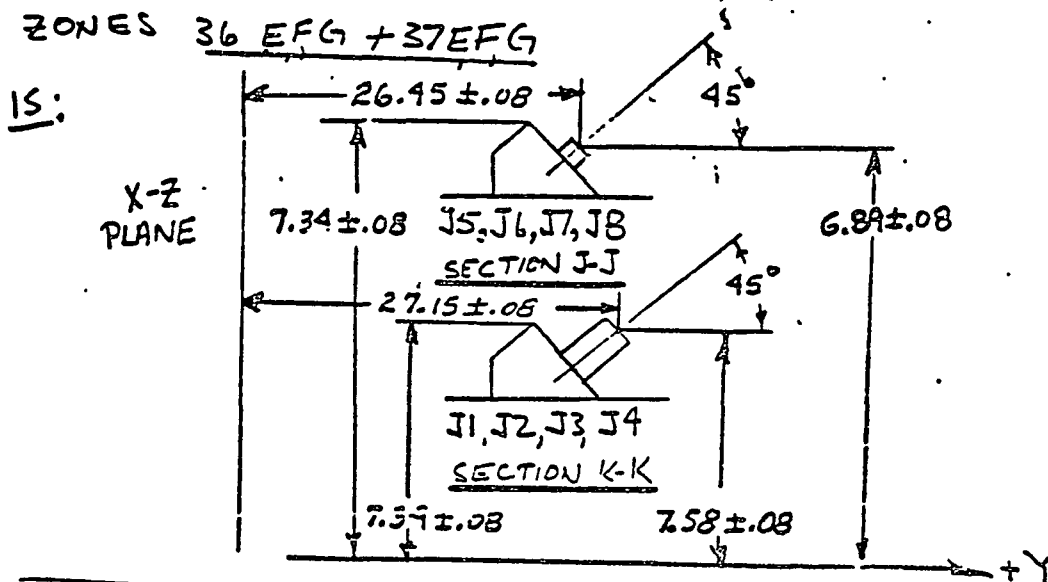

WAS:

X-Z PLANE

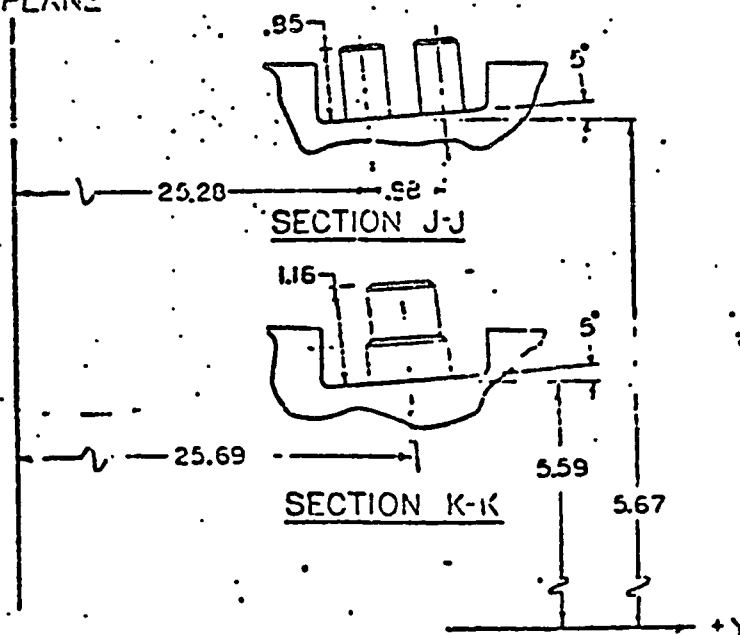

ECA 467096-1 A


THEMATIC MAPPER INTERFACE CONTROL DRAWING

3533000 REV B

SHEET 1


ZONE 12 F

IS:

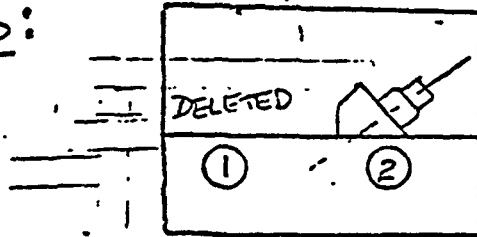

ORIGINAL PAGE IS
OF POOR QUALITY

WAS:

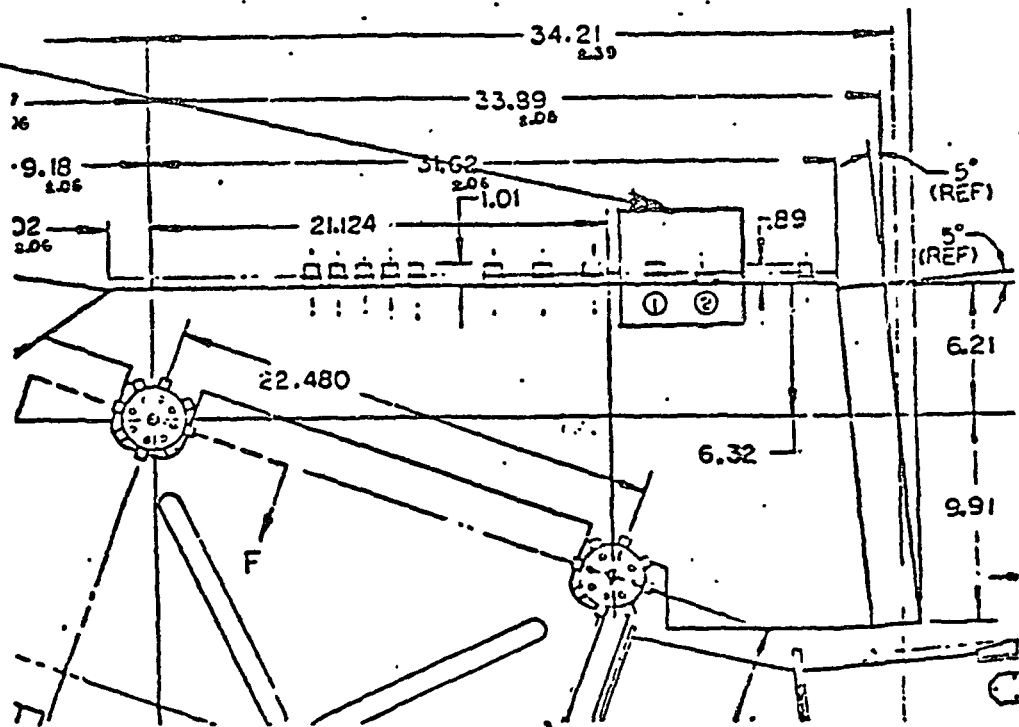

ECA 467096-1A

SHEET 6 OF 6

THEMATIC MAPPER INTERFACE CONTROL DRAWING
3533 000 REV B SHEET 2


IS: ZONE 26F



ORIGINAL PAGE IS
OF POOR QUALITY

ORIGINAL PAGE IS
OF POOR QUALITY

WAS:

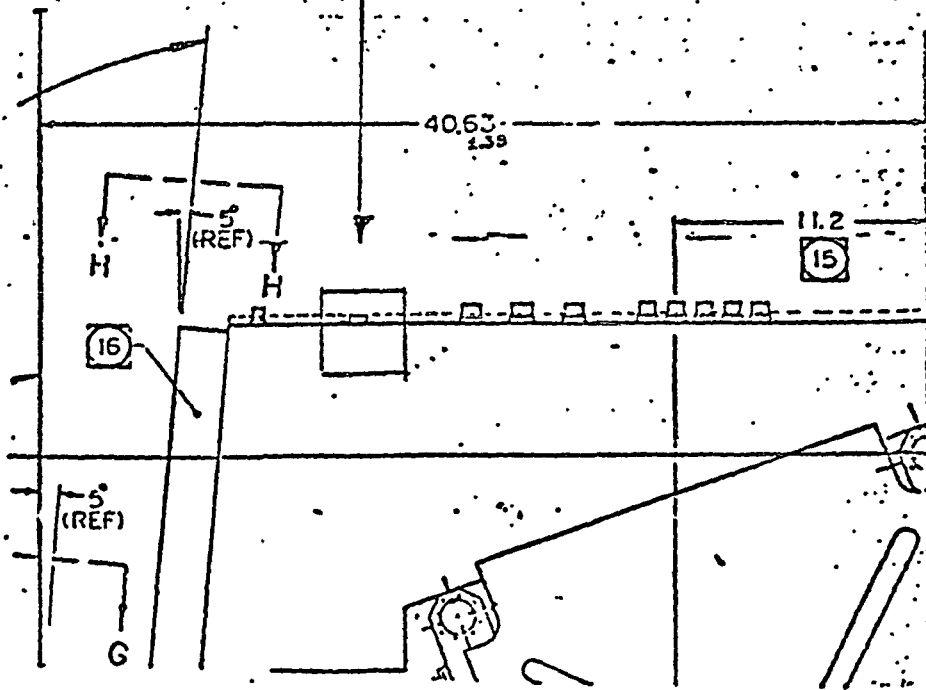

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE 216-573-481 FOR INSTRUCTIONS)

DATE PREPARED
8/23/79

EDP NO.
10

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company

Wulver City, California 90230

2. EDP NO.
825TT

3. CLASS OF EDP
1

4. EDP NO.
5. PRIORITY

6. SPECIFICATIONS AFFECTED		7. DRAWINGS AFFECTED		
WFR. CODE	SPECIFICATION/REVISION NO.	WFR. CODE	DRAWER	REV.
		" RAC	3533000-400	B

8. TITLE OF CHANGE

DELETE ELECTRICAL INTERFACE CONNECTORS J22 AND J23

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

THEMATIC MAPPER INTERFACE CONTROL DRAWING NO. 3533000-400B

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LATEST ASSEMBLY AFFECTED

CABLE ROUTING ASSEMBLY

13. PART NO. OR TYPE DESIGNATION

52347

14. DESCRIPTION OF CHANGE

DELETE ELECTRICAL INTERFACE CONNECTORS J22 AND J23 SHOWN ON TM INTERFACE CONTROL DRAWING NO. 3533000-400B ENGINEERING CHANGE ANALYSIS NO. 467106 FOR INTERFACE CONTROL DRAWING NO. 3533000-400B, IS SUBMITTED HERewith.

ORIGINAL PAGE IS
OF POOR QUALITY

15. REASON FOR CHANGE

ELECTRICAL CONNECTORS J22 AND J23 SHOWN ON THE INTERFACE CONTROL DRAWING 3533000-400B HAVE APPLICATION ONLY TO THE ENGINEERING MODEL. THE ICD HAS EFFECTIVITY FOR THE PROTOFLIGHT AND FLIGHT MODELS ONLY.

16. EFFECT ON ASSOCIATED EQUIPMENT

NONE

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

PROTOFLIGHT AND FLIGHT MODELS

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

NONE

19. RECOMMENDED RETROFIT EFFECTIVITY

NONE

20. ESTIMATED RET DELIVERY SCHEDULE

N/A

21. ESTIMATED COST/SAVINGS

NO COST

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE
C. R. JONES

23. APPROVAL SIGNATURE
THEMATIC MAPPER PROGRAM MANAGER

24. APPROVAL DATE

SIGNATURE

DATE

DD FORM 1693 GA 41043A

0-1536

[illegible]

ORIGINAL PAGE IS
OF POOR QUALITY

ENGINEERING CHANGE ANALYSIS SHEET 1

HUGHES

ECA NO. 467106

REV

☒ COMPLETE

☐ ADVANCE

SH 1 OF 6

SKAIA

236

SYS/EQUIP NAME OR DES

Thematic
Mapper

CONTROL ITEM NAME & NO.

3.533000-100

ECR NO.

740692

CONTRACT NO.

CLASS

1

URGENCY

RELATED ECA NO. (S)

LINE AFFECTED

2 and Up

PRODUCT BASE LINE AFFECTED AND CHANGE IS:

☒ PRODUCTION ONLY

☐ PRODUCTION AND RETROFIT

☐ RETROFIT ONLY

SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED

SPECIFICATION OR DRAWING NO.

NEW

CHANGED

DELETED

SPECIFICATION OR DRAWING NO.

NEW

CHANGED

DELETED

533000-400

DESCRIPTION OF CHANGE

Remove Electrical Connectors J22 and J23 from ICD

RELATED FACTORS ON WHICH ARE AFFECTED

☒ YES

☐ NO

DESCRIPTION OF CHANGE

Delete connectors J22 and J23 from the ICD.

ORIGINAL PAGE IS
OF POOR QUALITY

REASON FOR CHANGE

Electrical connectors J22 and J23 shown on the ICD have application only to the engineering model. The ICD effectiveness is for the protflight and flight models only.

TESTING

Testing will be unchanged.

RECM CHANGE EFFECTIVITY

2 and Up

RECM DISPOSITION OF ITEMS

N/A

APPROVAL FOR EVALUATION

ORG CODE	DATE	ORG CODE	DATE
40-92	13 Dec 78		
46-20	3/8/79		
44-29	3/12/79	44-27	3/13/79

REQUIRED:

ECAE ☐ YES ☒ NO

MAEC ☐ YES ☒ NO

SAEC ☐ YES ☒ NO

CHANGE APPROVAL

APPROVED	ORG CODE	DATE	ORG CODE	DATE
☒				
☐				

CHANGE REVIEW BOARD CHM

AUTHORIZATION FOR RELEASE

DISPOSAL NO.	CHG CLASS	CHANGE EFFECTIVITY	CUSTOMER	DATE
	1			
CONTRACTUAL AUTH	ADVANCE TO COMPLETE	DISPOSITION OF ITEMS	ENGINEERING CHANGE CTR	DATE
	☐			

16, 15 OCT 79

ENGINEERING CHANGE REQUEST	HUGHES CODE IDENT 02677	ECR NO. 740692 SHEET 1 OF 2 SHEETS
----------------------------	---	---

REQUEST			
HS 236	SYS/EQUIP NAME OR DES Thematic Mapper.	CONTROL ITEM NAME & NO. 3533000-100	SPECIFICATION/DWG NO.(S) 3533000-400

DESCRIPTION OF PROBLEM

J22 and J23 presently specified on the Thematic Mapper Interface Control Drawing, 3533000-400, have application only to the TM Engineering Model. The ICD effectivity is for the Protoflight and Flight Models only.

PROPOSED SOLUTION

Delete electrical connectors J22 and J23 and associated dimensions from the ICD.

ORIGINAL PAGE IS
OF POOR QUALITY

REGULATED BY FD McLaughlin	EXT 83479	BLDG./M/J 373/0035	ORG CODE 10-42	DATE 17 Dec 78	URGENCY High Priority
APPROVED					RECM EFF 2 up
APPROVED					RECM DISP OF ITEMS N/A

DISPOSITION			
☒ ACCEPTED	REASON FOR REJECTION Offer for ECR prep 1/23/79 JHK	DATE RECD IN ECC 1/12/79	SCH REPLY DATE
☐ REJECTED			ADVANCE

CHANGE CLASS ☒ I ☐ IIA ☐ IIB	SPECIFICATION OR CONTROL ITEM 3533000-400	RESP SPEC ACT. OR RESP ENGRG ACT. McLaughlin Systems Eng	ECA NUMBER W.F.C. 46716
DOCUMENT NO.(S) FOR IIB CHANGE			
ORG CODE	DATE	ORG CODE	DATE
		RESP ENGRG ACT.	ORG CODE
		PROGRAM MGMT Blaskome	44-29 1/23/79

CLASS IIB RELEASE AUTHORIZATION			
EFFECTIVITY	CONTRACT NO.	MANUFACTURING	DATE
DISPOSITION OF ITEMS	CUSTOMER	DATE	ENGRG CHANGE CTR

152 CS OCT 72

WACK-IN CRB 1-23-77

CODE IDENT 02577

REV

SHEET 2 OF 2

ENGINEERING CHANGE PROPOSAL (ENCL. FORM)
(SEE MIL-STD-481 FOR INSTRUCTIONS)

DATE PREPARED

CDR NO.

PROCESSING ACTIVITY/ NO.

3/31/80

11A

ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company
Culver City, California 90230

5. ORG. CODE

825TT

6. NAME OF CD

1

4. INT. CODE

3. PRIORITY

7. SPECIFICATION EFFECTS

7. DRAWING EFFECTS

8. SPEC. CODE	SPECIFICATION EFFECT NO.	9. SPEC. CODE	10. DRAWING	REV.
	HAC	3533000-400		B

8. TITLE OF CHANGE

SPECIFY THE LOCATION OF THE THEMATIC MAPPER PURGE FITTING.

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

THEMATIC MAPPER INTERFACE CONTROL DRAWING, #3533000-400B

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LATEST ASSEMBLY AFFECTED

MAIN FRAME

13. PART NO. OR TYPE DESIGNATION

50840

14. DESCRIPTION OF CHANGE

PROVIDE MISSING DIMENSIONS TO SPECIFY THE LOCATION OF THE THEMATIC MAPPER PURGE FITTING.
ENGINEERING CHANGE ANALYSIS No. 467126 FOR INTERFACE CONTROL DRAWING NO. 3533000-400
REVISION B, SUBMITTED HERewith.

ORIGINAL PAGE IS
OF POOR QUALITY

15. REASON FOR CHANGE

LOCATION OF PURGE FITTING MUST BE KNOWN FOR DESIGN OF TESTING AND SUPPORT EQUIPMENT.
IT IS ALSO REQUIRED FOR THE GE INTERFACE STAGE RELEASE SYSTEM.

16. EFFECT ON ASSOCIATED EQUIPMENT

PURGE LINES MUST ACCOMMODATE PURGE FITTING LOCATION.

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

ENGINEERING, PROTOFLIGHT, AND FLIGHT MODELS.

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

NONE

19. RECOMMENDED RETROFIT EFFECTIVITY

NOT REQUIRED

20. ESTIMATED RETROFIT SCHEDULE

N/A

21. ESTIMATED COST/SAVINGS

NO COST

22. SIGNATURE AND TITLE OF ORIGINATOR

R. JONES

23. SIGNATURE AND TITLE OF APPROVER

THEMATIC MAPPER PROGRAM MANAGER

GOVERNMENT ACTIVITY

LAUNCH-1
ORIGINATING OFFICE

SIGNATURE

Frank L. Burnett

DATE

4/25/80

DD FORM 1393-10-1

8-13300

REV

SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED

TIME* A FACTOR IS CHECKED YES EXPLAIN
BELOW OR ON A CONTINUATION SHEET

ORIGINAL PAGE IS
OF POOR QUALITY

|PROCURING ACTIVITY NO.

12.

B257

I

	५०	१२३४५६७८९१०१११२१३१४१५१६१७१८१९२०२१२२२३२४२५२६२७२८२९३०३१३२३३३४३५३६३७३८३९४०४१४२४३४४४५४६४७४८४९५०५१५२५३५४५५५६५७५८५९६०६१६२६३६४६५६६६७६८६९७०७१७२७३७४७५७६७७७८७९८०८१८२८३८४८५८६८७८८८९९०९१९२९३९४९५९६९७९८९९
--	----	---

1. 1950, 1951

1770000
1770000

REV.

1

Figure 1 illustrates a 1D lattice chain. A horizontal line represents the lattice, with vertical bars indicating the positions of lattice sites. A single electron, represented by a small circle with a minus sign, is shown moving from one site to the next. The diagram is labeled with "1D LATTICE CHAIN" and "ELECTRON".

6. CONTRACT NO. & LINE ITEM

NAS 5-24200

III. IN PRODUCTION

☐ YES ☐ NO

13. PART NO. OR TYPE DESIGNATION
3533000-100

THE THEMATIC MAPPER (TM) INTERFACE DRAWING WILL NOW SHOW COLOR CODING FOR CONNECTORS J5-J8 AND MASTER POLARIZING KEY POSITIONS FOR CONNECTORS J1-J8.

ORIGINAL PAGE IS
OF POOR QUALITY

TO CONFORM TO INTERFACE SPECIFICATION IS32015-100A

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

ENGINEERING, PROTOFLIGHT & FLIGHT MODELS

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

NONE

18. ~~RECOMMENDED~~ RETROFIT EFFECTIVITY

20. ESTIMATED KIT DELIVERY SCHEDULE

ENGINEERING MODEL

N/A

21. ESTIMATED COSTS, SAVINGS
NONE

ALL INFORMATION CONTAINED HEREIN IS UNCLASSIFIED
DATE 08-28-2013 BY 60322 UCBAW

ASST PROGRAM MGR TM

23 APPROVAL DISCOUNT

COVER SHEET

SIGNATURE

DATE

DD FORM 1693a-10422

0-11240

ENGINEERING CHANGE ANALYSIS SHEET 1

HUGHES

44-7235-2

REV

☐ COMPLETE

☐ ADVANCE

SM 1 OF 3

OGRAM

SYS/EQUIP NAME OR QES

CONTROL ITEM: NAME & NO.

ECH NO.

S 236

THEMATIC MAPPER

3533000-100

751506
CONTRACT NO.
1145 5-24200

CM CLASS

URGENCY

RELATED ECA NO. (S)

I

IMMEDIATE

SC LINE AFFECTED

PRODUCT BASE LINE AFFECTED AND CHANGE IS:

☐ PRODUCTION ONLY

☒ PRODUCTION AND RETROFIT

☐ RETROFIT ONLY

SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED

SPECIFICATION OR DRAWING NO.

NEW

CHANGED

DE-
LETED

SPECIFICATION OR DRAWING NO.

NEW

CHANGED

DE-
LETED

3533000-400B

FILE OF CHANGE

ADDITION OF COLOR CODING FOR CONNECTORS J5-J8,
AND ADDITION OF POLARIZING KEY FOR CONN. J1-J8

RELATED FACTORS ON
SM 2 ARE AFFECTED

☒ YES
☐ NO

DESCRIPTION OF CHANGE

COLOR CODING AND POLARIZING POSITIONS WILL BE INCORPORATED
INTO THE TM INTERFACE DRAWINGS

ORIGINAL PAGE IS
OF POOR QUALITY

1ST ACTION FOR CHANGE

TO CONFORM TO INTERFACE SPEC IS 32015-100A

CONTENT OF TESTING

NONE

RECM CHANGE EFFECTIVITY

PF AND F

RECM DISPOSITION OF ITEMS

APPROVAL FOR EVALUATION

ORG CODE	DATE	RSA OR REA	ORG CODE	DATE	REQUIRED:
DSm20	40-42	11/1/79			
11/1/79	44-29	11/6/79			ECAE ☐ YES ☒ NO
William D. Neal	46-20	11/13/79	44-29	12/5/79	MAEC ☐ YES ☒ NO
					SAEC ☐ YES ☒ NO

CHANGE APPROVAL

APPROVED	ORG CODE	DATE	ORG CODE	DATE
☒				
☐				

CHANGE REVIEW BOARD CH

SBRL 11/2/79

AUTHORIZATION FOR RELEASE

PROPOSAL NO.	CHG CLASS	CHANGE EFFECTIVITY	CUSTOMER	DATE
CONTRACTUAL AUTH	ADVANCE TO COMPLETE	DISPOSITION OF ITEMS	ENCHG CHANGE CTR	DATE

BJA CS OCT 78

HUGHES
COD* IDENT 82577

467235-2

REV

SHEET 2 OF 3

[illegible]

WHEN A FACTOR IS CHECKED YES, EXPLAIN
BELOW OR ON A CONTINUATION SHEET

FACTOR	YES	NO	FACTOR	YES	NO	FACTOR	YES	NO
SPECIFICATION, CONTRACTUALLY APPLICABLE	X		EMI (RFI)		X	MATERIALS & PROCESSES		X
PERFORMANCE		X	OPERATING INSTALLATION		X	PARTS APPLICATION		X
SAFETY		X	GFAE, GFE, GFP, ETC.		X	SUBCONTRACTOR DEVELOPED ITEM		X
WEIGHT/MASS PROPERTIES		X	OTHER SYSTEMS		X			
INTERCHANGEABILITY	X		INTERFACE	X				
RELIABILITY		X	OPERATIONAL COMPUTER PROGRAMS		X			
MAINTAINABILITY		X	SUPPORT EQUIPMENT					

ORIGINAL PAGE IS
OF POOR QUALITY

ECR/ECA/ECAE
CONTINUATION SHEET

HUGHES

HUGHES AIRCRAFT COMPANY
CODE IDENT 83877

☐ ECR ☒ ECA ☐ ECAE

NO. 467235-2

REV

SH NO.


3

ALL INFORMATION ENTERED HEREON SHALL BE IDENTIFIED BY THE APPROPRIATE BLOCK HEADING FROM THE ECP, ECA, OR ECAE

DWG 3533000-400


ADD VIEW L-L

ORIGINAL PAGE IS
OF POOR QUALITY

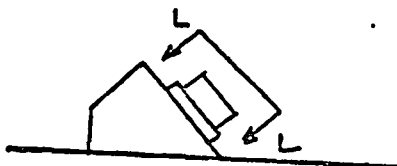

VIEW L-L

MASTER POLARIZING KEY J1-J8

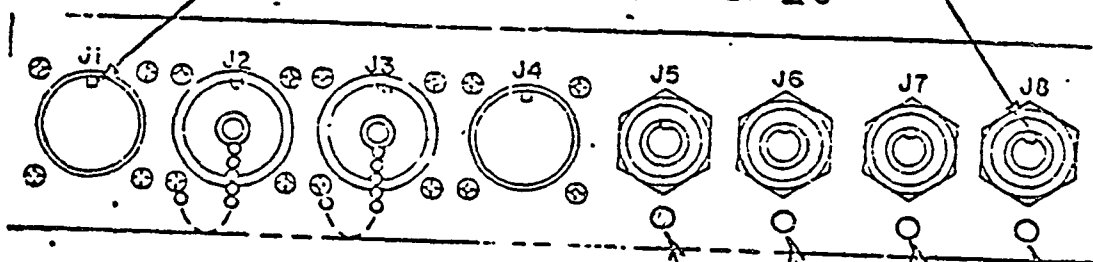

VIEW L-L

BROWN (XX)

YELLOW (XX)

GREEN (XX)

BLUE (XX)

Add Note



"Spacecraft mating electrical connector shall be color coded with the same colors for J5 through J8."

(XX Note number to be defined upon incorporation)

ENGINEERING CHANGE REQUEST

HUGHES

CODE IDENT 82877

ECR NO. — 831506

SHEET 1 OF 2 SHEETS

REQUEST

PROGRAM	SYS/EQUIP NAME OR DES	CONTROL ITEM NAME & NO.	SPECIFICATION, DWG NO.(S)
HS 236	THEMATIC MAPPER	THEMATIC MAPPER 3533000-100	INTERFACE CONTROL DRAWING TM 3533000-400

DESCRIPTION OF PROBLEM

INTERFACE CONTROL DRAWING DOES NOT SHOW MASTER
POLARIZING KEYS FOR MUX CONNECTORS (J1-J8),
NOR COLOR CODING FOR J5 THRU J8.

PROPOSED SOLUTION

ADD VIEW TO SHOW MASTER POLARIZING KEYS
AND COLOR CODING.

REQUESTED BY <i>D.L. Smith</i>	EXT <i>CO-15</i>	BLOG. M/S <i>373/125</i>	ORG CODE <i>10-92</i>	DATE	URGENCY <i>ROUTINE</i>
APPROVED					RECM EFF <i>PF & FLT</i>
APPROVED					RECM DISP OF ITEMS <i>None</i>

DISPOSITION

☒ ACCEPTED <i>Implementation</i>	REASON FOR REJECTION	DATE RECD IN ECC	SCH REPLY DATE	ADVANCE ☐
☐ REJECTED				

RANGE CLASS ☒ I ☐ IIA ☐ IIB	SPECIFICATION OR CONTROL ITEM	RESP SPEC ACT. OR RESP ENGRG ACT.	ECA NUMBER
DOCUMENT NO.(S) FOR IIB CHANGE		<i>Julian FCA</i>	<i>467635</i>
		<i>MCLantern ICR</i>	
ORG CODE	DATE	ORG CODE	DATE
	RESP SPEC ACT.	PROGRAM MGMT	
		<i>4429</i>	<i>10/12/72</i>

CLASS IIB RELEASE AUTHORIZATION

RANGE EFFECTIVITY	CONTRACT NO.	MANUFACTURING	DATE
POSITION OF ITEMS	CUSTOMER	ENGRG CHANGE CTR	DATE

CS OCT 72


ORIGINAL PAGE IS
OF POOR QUALITY

ECR 831506


SHEET 2 OF 2

DWG 3533 000-400

ADD VIEW L-L

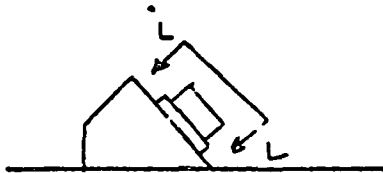

VIEW L-L

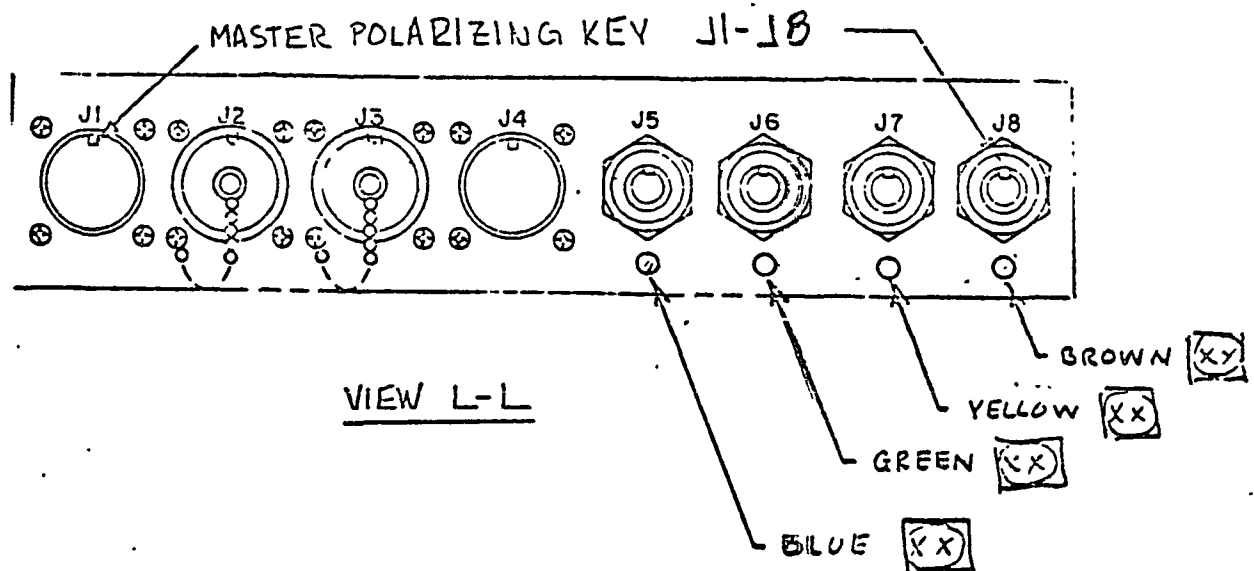

Add Note

(X) "Spacecraft mating electrical connector shall be color coded with the same colors for J5 through J8."

(XX Note number to be defined upon incorporation)

ENGINEERING CHANGE PROPOSAL (MIL-STD-883C)
(SEE MIL-STD-883C FOR INSTRUCTIONS)

DATE PREPARED

ECF NO.

PROJURING ACTIVITY NO.

013

1. ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company

2. W.D. CODE
82577

3. CLASS OF WORK
I

4. PRIORITY
C

5. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

W.D. CODE	SPECIFICATION/SECTION NO.	W.D. CODE	FIGURE	REV.
		HAC	3533000-400	C

8. TITLE OF CHANGE

Revise Thematic Mapper Interface Control Drawing from Revision B to Revision C.

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

Thematic Mapper

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

Thematic Mapper 51065

13. PART NO. OR TYPE DESIGNATION

3533000-100

14. DESCRIPTION OF CHANGE

Revise Thematic Mapper Interface Control Drawing from Revision B to Revision C.

ORIGINAL PAGE IS
OF POOR QUALITY

15. NEED FOR CHANGE

Various design modifications require changes to the Thematic Mapper interface requirements. See attached engineering documentation.

16. EFFECT ON ASSOCIATED EQUIPMENT

No major effect

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

Protoflight and Flight Models

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None

19. RECOMMENDED RETROFIT EFFECTIVITY

Protoflight and Flight Models

20. ESTIMATED RET DELIVERY SCHEDULE

N/A

21. ESTIMATED COSTS/SAVINGS

No cost change

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

[Signature]

23. TITLE

PROGRAM MANAGER

24. APPROVAL/DISAPPROVAL

GOVERNMENT ACTIVITY
LANDSAT-D PROJECT

[Signature]

DATE 8/14/80

SIGNATURE

[Signature]

DATE 7/3/80

DD FORM 1693 GA 41042A

ORIGINAL PAGE IS
OF POOR QUALITY

Engineering Change Proposal SHEET 2			013		REV	
SHEET 2 OF 2						
SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED						
SPECIFICATION OR DRAWING NUMBER	REV	CHANGED ECA No.	DE LETED	SPECIFICATION OR DRAWING NUMBER	NEW	CHANGED ECA No. (continued)
3533000-400	C	467096-1A		3533000-400	C	467289
		467106				467290
		467126A				467282
		467156-1				
		467198				
		467235-2				
		467236				
		467248-3A				
		467263-1				
		467286				
		467287				
		467288				
RELATED FACTORS AFFECTED						
WHEN A FACTOR IS CHECKED YES EXPLAIN BELOW OR ON A CONTINUATION SHEET						
FACTOR	YES	NO	FACTOR	YES	NO	FACTOR
SPECIFICATION CONTRAC- TUALY APPLICABLE	X		EMI (RFI)		X	MATERIALS & PROCESSES
PERFORMANCE	X		OPERATING INSTALLATION	X		PARTS APPLICATION
SAFETY		X	GFAE, GFE, GFP, ETC.		X	SUBCONTRACTOR DEVELOPED ITEM
WEIGHT/MASS PROPERTIES	X		OTHER SYSTEMS		X	
INTERCHANGEABILITY	X		INTERFACE	X		
RELIABILITY		X	OPERATIONAL COMPUTER PROGRAMS		X	
MAINTAINABILITY		X	SUPPORT EQUIPMENT	X		

ENGINEERING CHANGE PROTOCOL (SHORT FORM)
(SEE MIL-STD-883C FOR INSTRUCTIONS)

DATE PREPARED
27 August 1980

EXP. NO.
14

PROCURING ACTIVITY NO.

40/52833

1. ORIGINATOR NAME AND ADDRESS
Boeing Aircraft Company

2. W3. CODE
825TT

3. CLASS OF EXP.
I

4. EST. 5. PRIORITY

6. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

W3. CODE	SPECIFICATION/ORDINATE NO.	W3. CODE	NUMBER	REV.
HAC	3533000-100	II		
		III		
		IV		

8. TITLE OF CHANGE

Coherent Noise Specification Change

9. CONTRACT NO. & LINE ITEM

NAS5-24200

10. CONFIGURATION ITEM NOMENCLATURE

Thematic Mapper

11. IN PRODUCTION

☒ YES ☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

13. PART NO. OR TYPE DESIGNATION

3533000-100

14. DESCRIPTION OF CHANGE

Revise GSFC 400.8-D-210, Revision B, paragraphs 3.2.9.1 and 4.2.3, to read as indicated on the attached sheets.

ORIGINAL PAGE IS
OF POOR QUALITY

15. REED FOR CHANGE

See attached engineering documentation (HS236-6859).

16. EFFECT ON ASSOCIATED EQUIPMENT

No effect on TM

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

Protoflight and Flight Models

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None

19. RECOMMENDED RETROFIT EFFECTIVITY

Protoflight and Flight Models

20. ESTIMATED RET DELIVERY SCHEDULE

N/A

21. ESTIMATED COSTS/SAVINGS

No cost change

22. APPROVAL/DISAPPROVAL

23. APPROVAL/DISAPPROVAL

Program Manager: Thematic Mapper

24. ORIGINATOR ACTIVITY

NAS-7/6, WILLOW SPRING FLIGHT CENTER

SIGNATURE

Elizabeth R. Petre 1-12-81

DATE

DD FORM 1693 GA 4104.2A

1-12-81

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

Paragraph 3.2.9.1 shall be changed to read as follows:

ORIGINAL PAGE IS
OF POOR QUALITY

3.2.9.1 Radiometric Sensitivity

The TM output in each of the bands 1 through 5 and 7 shall have a signal-to-noise ratio (SNR) for specified input in accordance with Table IV. For a constant input radiance, the SNR is defined as the ratio of the output value (in units of radiance) averaged over at least one hundred samples to the root mean squared (RMS) value of the noise equivalent radiance which is defined as the RMS of the deviations of the output samples from the average value. All SNR measurements shall be taken with the processing electronics in a linear gain mode except for those bands where quantizing noise precludes meeting the SNR requirements.

TABLE IV

Band No.	Constant In Band Input Radiance ($\text{mw}/\text{cm}^2\text{-sr}$)	Minimum SNR
1	0.28	32
2	0.24	35
3	0.13	26
4	0.19	32
5	0.08	13
7	0.046	5

The sensitivity of Band 6 is measured in terms of noise equivalent temperature difference (NETD) defined in 6.1. The NETD for Band 6 for an extended scene at a temperature of 300 K is 0.5 K. The minimum scene temperature for this band is 260 K.

The TM output shall have negligible coherent noise in all seven bands for all values of radiance including zero. The coherent noise pattern shall be subjectively evaluated by inspecting photographic images. No coherent noise pattern shall be discernible at any radiance/signal level with the display set so that each quantizing level from 0 to 1/4 of full scale is visible for Bands 1-5, 7 and 4 quantizing levels spread over the dynamic range are visible for Band 6.

Paragraph 4.2.3 shall be changed to read as follows:

4.2.3 Pictorial Displays

The contractor shall produce pictorial outputs using the BTCE or capital (facility) equipment.

The pictorial display used for testing all spectral bands may utilize a one dimensional target. The purpose of this test is to evaluate the coherent noise of the system, usually only obvious on an image and when viewing a mid-range, diffuse scene. The input radiance for this display shall increase slowly from 0 to full scale. The rate of change of radiance shall be slow enough to allow relatively constant levels of radiance for at least 10 scans. No coherent noise shall be visible. This type of noise is objectionable if it can be seen by the unaided eye of a trained observer in a picture that is at least eight inches on a side.

An acceptable alternative test method would involve scanning a scene with a radiance gradient which allows approximately ten samples at each quantizing level over the lowest 1/4 of the dynamic range for Bands 1-5, 7. Band 6 would involve scanning a scene with constant radiance for at least four different radiance levels spread over its dynamic range. No coherent noise shall be visible.

ORIGINAL PAGE IS
OF POOR QUALITY

SANTA BARBARA RESEARCH CENTER
A Subsidiary of Hughes Aircraft Company
INTERNAL MEMORANDUM

ATTACHMENT TO
ECP 14 - 8/27/80
Page 5 of 6

TO: Jack Engel

CC: Data Bank (11)
Distribution

DATE: 16 June 1980

REF: HS 236-6859

SUBJECT: Coherent Noise Testing

ORIGINAL PAGE IS
OF POOR QUALITY

FROM: Rick Osgood ✓

BLDG. 761 MAILSTA. 79
EXT. 4262

Some deviations from the NASA Spec. are being implemented in BL-12R (Coherent Noise) testing. The method of testing relative to these changes is as follows:

1. A minimum of 64 pcm levels (0-64 MUX levels) rather than the full dynamic range will be required to be displayed (Bands 1-5, 7) for coherent noise testing.
2. The data pertinent to 1. (above) will be represented by differences from the intensity gradient.
3. Only 4 pcm levels, spread over the dynamic range, will be used in Band 6 testing.
4. A pictorial format smaller than 8" x 8" will be used to display coherent noise pictures. (An attempt will be made to make the pictures as large as possible, consistent with the data quantity.)
5. Coherent noise in Band 6 will be tested in the Thermal Balance Test with a full aperture plate. This will only be performed on the Engineering Model. (We will not test in the Protoflight and Flight models due to probable elimination of the aperture plate.)

The rationale for the above changes is as follows:

Items 1 and 2 eliminate the need for the four-color option on the Optronics Laser Writer making the coherent noise pictures easier to read. (The four-color option is necessary since the film has only 64 distinct densities.)

Item 1, furthermore, eliminates a radiance gradient ramping problem. That is, the flooding lamp can deliver 0-64 MUX levels or greater, filling the entire video scan line. (Otherwise, we have to adjust lamp currents and the band may still saturate before the end of scan line.)

Item 1 also eliminates a lamp lifetime problem. (Presently, to get close to the minimum saturation level, the current in the calibrator flooding lamp has to be so high that plotting

ATTACHMENT TO
ECP 14 - 8/27/80
Page 6 of 6

HS 236-6859
16 June 1980
Page 2

ORIGINAL PAGE IS
OF POOR QUALITY

of tungsten occurs on the envelope and the lamp lifetime is reduced.

Item 3 is necessary to eliminate collecting a large amount of data and producing a large number of pictures.

Rick Osgood
Rick Osgood

/ldb

Distribution:

A. S. Chapman
W. L. Conover
K. W. Hubbard
T. P. Sciacca

C - 3

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-461 FOR INSTRUCTIONS)

DATE PREPARED

EXP. NO.

PROPOSING ACTIVITY NO.

015

1. ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company

2. ORG. CODE
82577

3. CLASS OF WORK
I

4. EST. PRIORITY
CCE

5. SPECIFICATIONS AFFECTED		7. DRAWINGS AFFECTED	
WFO. CODE	SPECIFICATION/DOCUMENT NO.	WFO. CODE	NUMBER
HAC	IS 32015-001		
GSEC	400.R-D-201		

8. TITLE OF CHANGE

Add In-Plane and Out-of Plane motion requirement for spacecraft mounting surfaces provided for Thematic Mapper installation

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

Thematic Mapper

11. IN PRODUCTION

☒ YES ☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

Thematic Mapper

13. PART NO. OR TYPE DESIGNATION

3533000-100

14. DESCRIPTION OF CHANGE

Add requirements to the spacecraft interface specifications so as to limit the relative motion of the Thematic Mapper mounting locations during the pre-launch, launch and on-orbit environments

ORIGINAL PAGE 13
OF FOUR QUALITY

15. REASON FOR CHANGE

Spacecraft mounting points relative motion must be limited to prevent excessive stresses in the Thematic Mapper structure

16. EFFECT ON ASSOCIATED EQUIPMENT

None

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

Protoflight and Flight Models

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None

19. RECOMMENDED RETROFIT EFFECTIVITY

Protoflight and Flight Models

20. ESTIMATED RETROFIT DELIVERY SCHEDULE

N/A

21. ESTIMATED COST/SAVINGS

No cost/change

22. AUTHORIZING ACTIVITY SIGNATURE

D. L'Heureux

23. AUTHORIZING ACTIVITY

Manager, Contracts

NASA Systems Division

24. APPROVAL/DISAPPROVAL

25. GOVERNMENT ACTIVITY

SIGNATURE

DATE

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

ENGINEERING CHANGE PROPOSAL PAGE 3 OF 3 ECP NO. 015

Change GSFC 400.8 - D - 201, Section 4.5 as follows:

1. Delete the last sentence in the section and add the following:

The thematic mapper mounting fasteners shall be the responsibility of the spacecraft contractor.

The spacecraft Instrument Module shall provide mounting surfaces to which the TM shall be installed. These mounting surfaces and TM mounting provisions shall conform to the requirements of the TM Interface Control Drawing, 3533000-400 and the requirements in Table 4.5, below.

ORIGINAL PAGE IS
OF PCOR QUALITY

Table 4.5 Maximum Spacecraft Mounting Location Displacement

Environment	Maximum Out-of-Plane Displacement (inches)	Maximum In-Plane Displacement (inches)
At TM installation	0.001*	0.002
During Launch	0.016	0.019
On-Orbit	0.004	0.008

* Limited shimming by the spacecraft contractor may be required.

ORIGINAL PAGE IS
OF POOR QUALITY

ENGINEERING CHANGE ANALYSIS SHEET 1				HUGHES		ECA NO. 467313		REV -							
				CODE SENT 1237		☒ COMPLETE ☐ ADVANCE		SM 1 OF 3							
PROGRAM		SYS/EQUIP NAME OR DES		CONTROL ITEM NAME & NO.		ECR NO.									
HS 236		Thematic Mapper		Thematic Mapper		831335									
				3533000 - 100		CONTRACT NO. NAS5-24200									
RECM CLASS		URGENCY		RELATED ECA NO. (S)											
I		Immediate (ECP Required)													
BASE LINE AFFECTED		PRODUCT BASE LINE AFFECTED AND CHANGE IS:													
Protoflight & Flight		☒ PRODUCTION ONLY ☐ PRODUCTION AND RETROFIT ☐ RETROFIT ONLY													
SPECIFICATIONS AND ENGINEERING DRAWINGS AFFECTED															
SPECIFICATION OR DRAWING NO.		NEW		CHANGED		DE-LETED		SPECIFICATION OR DRAWING NO.		NEW		CHANGED		DE-LETED	
IS 32015-001				✓											
TITLE OF CHANGE										RELATED FACTORS ON SM 2 ARE AFFECTED		☒ YES ☐ NO			
Add In-Plane/Out-of-Plane Mounting Requirements															
DESCRIPTION OF CHANGE															
Add requirements on the spacecraft so as to limit its mounting surface motion during the launch and on orbit environments. Change Paragraph 3.4.5 as shown on page 3 of this ECA.															
JUSTIFICATION FOR CHANGE															
spacecraft mounting points relative motion must be limited to prevent excessive stresses in the TM structure															
EXTENT OF TESTING										RECM CHANGE EFFECTIVITY					
No Additional Testing										PF & FLT					
										RECM DISPOSITION OF ITEMS		N/A			
APPROVAL FOR EVALUATION															
70 m Janglin		ORG CODE		DATE		RSA OR REA		ORG CODE		DATE		REQUIRED:			
		44-29		30 Sept 80								ECAC ☐ YES ☒ NO			
						DEPARTMENT MGR						MAEC ☐ YES ☐ NO			
						CONFIG MGMT OFFICE						SAEC ☐ YES ☐ NO			
						PROGRAM MANAGER									
CHANGE APPROVAL															
☐ APPROVED				ORG CODE		DATE				ORG CODE		DATE			
☐ REJECTED															
										CHANGE REVIEW BOARD CHM		22-61 10/1/80			
AUTHORIZATION FOR RELEASE															
PROPOSAL NO.		CHG CLASS		CHANGE EFFECTIVITY		CUSTOMER		DATE							
CONTRACTUAL AUTH		☐ ADVANCE TO COMPLETE		DISPOSITION OF ITEMS		ENGRG CHANGE CTR		DATE							

ORIGINAL PAGE IS
OF POOR QUALITY

[illegible]

ECA 467313
ECR 831335
sheet 3 of 3

In IS32015-001, Paragraph 3.4.5:

Delete the last two sentences and add the following:

ORIGINAL PAGE IS
OF POOR QUALITY

The TM mounting fasteners are the responsibility of the SPACECRAFT CONTRACTOR.

The spacecraft Instrument Module shall provide mounting surfaces to which the TM shall be installed. These mounting surfaces and TM mounting provisions shall conform to the requirements of the TM Interface Control Drawing, 3533000-400 and the requirements in Table 7.5, below.

Table 7.5 Maximum Spacecraft Mounting Location Displacements

Environment	Maximum Out-of-Plane Displacement (inches)	Maximum In-Plane Displacement (inches)
At TM Installation	0.001 *	0.002
During Launch	0.016	0.019
On-Orbit	0.004	0.008

* Limited shimming by the spacecraft contractor may be required.

National Aeronautics and
Space Administration
Goddard Space Flight Center
Greenbelt, Maryland
20771

ORIGINAL PAGE IS
OF POOR QUALITY



FILE

APR 17 1981

Reply to Attn of 283

Hughes Aircraft Company
Attention: Mr. E. A. Dawson
Space and Communications Group
NASA Systems Division
P. O. Box 92919
Los Angeles, CA 90009

Subject: Contract NAS 5-24200, Engineering Change
Proposal (ECP) No. 16

Reference: Hughes Aircraft Company (HAC) HS236/0019-1127,
dated December 12, 1980

The subject ECP has been reviewed by the NASA Goddard Space Flight Center (GSFC) and is rejected as submitted. The specification changes proposed by HAC would require substantial additional explanation and the numbers in column 2 of Table III b) would have to be revised. Rather than HAC revising and resubmitting this ECP, we will initiate a Configuration Change Request (CCR) to be processed through the Landsat-D Configuration Control Board (CCB) to change the last sentence of Specification 400.8-D-210, section 3.2.8.1 from "component testing...and analysis" to "test and analysis." This change to the specification wording will allow HAC to proceed with the spectral matching test as planned. Subsequent to approval of the CCR by the Landsat-D CCB, a contract modification will be issued incorporating this specification change.

I have been informed that the appropriate HAC technical personnel have concurred with the above. If there are any further questions on this subject, please do not hesitate to contact me.

Elizabeth Austin

Elizabeth Austin
Landsat-D Project
Contracting Officer

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-883 FOR INSTRUCTIONS)

DATE PREPARED

4 FEB 81

ECP NO.

017

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS

Hughes Aircraft Company

2. W3. CODE

82577

3. CLASS OF W3

I

4. ECP NO. 5. PRIORITY

6. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

W3. CODE	SPECIFICATION	SECTION NO.	W3. CODE	REVISION	REV.
GSFC	GSFC 400.8-D-201	"	"		
		"	"		
		"	"		

8. TITLE OF CHANGE

Revise the specification for spacecraft 28vdc power supplied to Thematic Mapper from 21vdc - 35vdc, to 23vdc - 25vdc.

9. CONTRACT NO. & LINE ITEM

NAS5-24200

10. CONFIGURATION ITEM NOMENCLATURE

Thematic Mapper

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

Thematic Mapper

13. PART NO. OR TYPE DESIGNATION

50869

14. DESCRIPTION OF CHANGE

Revise the specification for the 28vdc power supplied to the Thematic Mapper to be 28vdc + 7vdc, -5vdc, instead of 28vdc +7vdc. Page 2 of this ECP specifies the proposed changes to the GSFC 400.8-D-201 specification section

Continued on page 2

ORIGINAL PAGE IS
OF POOR QUALITY

15. NEED FOR CHANGE

The present specification for bus voltage, 28vdc + 7vdc, does not allow for proper operation of the TM power supply. The power supply will not regulate properly at bus voltages below 23vdc. The technical personnel at GSFC, who are aware of this condition, have indicated that the spacecraft 28vdc power bus will be above 23vdc in all normal operating situations.

16. EFFECT ON ASSOCIATED EQUIPMENT

None

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

Protoflight and Flight Models

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None

19. RECOMMENDED RETROFIT EFFECTIVITY

Protoflight and Flight Models

20. ESTIMATED KIT DELIVERY SCHEDULE

N/A

21. ESTIMATED COSTS/SAVINGS

No-cost change.

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

X

23. APPROVAL/DISAPPROVAL

GOVERNMENT ACTIVITY

SIGNATURE

DATE

DD FORM 1693 GA 4104.3A

1-1-1980

DESCRIPTION OF PROPOSED CHANGES TO GSFC 400.8-D-201:

1. Section 3.3.2.1

A. Revise "...± 7vdc..." to read "...+ 7vdc, - 5vdc...".

2. Section 3.3.2.4

A. Revise "... (may not stay within the 21-25 volt operation range)" to read "... (may not stay within the 23-35 volt operation range)"

B. Revise "... (within the 21 to 35 volt operating range)" to read "... within the 23 to 35 volt operating range)".

3. Section 3.3.3.6

A. Revise "...values of 35V, 28V and 21V." to read "...values of 35V, 28V and 23V."

ORIGINAL PAGE IS
OF POOR QUALITY

**ORIGINAL PAGE IS
OF POOR QUALITY**

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-883 FOR INSTRUCTIONS)

DATE PREPARED

4 FEB 81

SEP NO.

018

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS
Hughes Aircraft Company

2. WFL CODE

32577

3. CLASS OF WORK

I

4. EST. PRIORITY

CODE

5. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

WFL CODE	SPECIFICATION/DOCUMENT NO.	WFL CODE	NUMBER	REV.
GSFC	GSFC 400.8-D-210	"		

6. TITLE OF CHANGE

Revise Thematic Mapper Maximum Weight from 243.2 Kg to 258 Kg

9. CONTRACT NO. & LINE ITEM

NAS5-24200

10. CONFIGURATION ITEM NOMENCLATURE

Thematic Mapper

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

Thematic Mapper

13. PART NO. OR TYPE DESIGNATION

3533000-100

14. DESCRIPTION OF CHANGE

Revisa GSFC 400.8-D-210 specification to increase the Thematic Mapper maximum specified weight to 258 Kg (568.79 pounds). The present maximum specified weight is 243.2 Kg (536.16 pounds).

Continued on page 2.
on page

15. NEED FOR CHANGE

On 1 DEC 80, the weight of the Thematic Mapper was 245.65 Kg, based upon about 96% actual weights of components and subassemblies. Based upon data from other space projects, the TM can expect to increase in weight about 5% per year until it is delivered. This growth rate relates to hardware in an integration and system test phase. Assuming a delivery of the TM in late September 1981, the expected weight growth since December 1980 would be about 12.30 Kg. Adding the 2.45 Kg deficit in December will bring the project weight deficit in September 1981 to 14.75 Kg (32.51 pounds). The present maximum specified weight plus the expected weight growth will sum to 257.95; say, 258 Kg.

16. EFFECT ON ASSOCIATED EQUIPMENT

None

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

Protoflight and Flight Models

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None

19. RECOMMENDED RETROFIT EFFECTIVITY

Protoflight and Flight Models

20. ESTIMATED RET DELIVERY SCHEDULE

N/A

21. ESTIMATED COST/SAVINGS

No-cost change

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

[Signature]

23. APPROVAL/DISAPPROVAL

GOVERNMENT ACTIVITY

NASA/Goddard Space Flight Center

SIGNATURE

DATE

[Signature] 11 FEB 1981

DD FORM 1502

2-1-2000

14. DESCRIPTION OF PROPOSED CHANGE TO GSFC 400.8-D-210:

1. Section 3.2.1 Configuration

- a. Revise "...in no case shall this weight exceed 243.2 Kg. (535 lbs.)." to read "...in no case shall this weight exceed 258 Kg (568.8 lbs.)."

ORIGINAL PAGE ☒
OF FOUR QUALITY

COORDINATION APPROVAL SIGNATURE:

CR Jonge

bcc: Dist. B: GC Benson, EF Carle, AH Connor, RL Cook, RC Cooley, JL Engel, EA Dawson, WH Freudenstein, BF Gritt, RL Julian, JC Kodak, LE Long, JD Love, AB Marchant, KC Nas, V Nichols, FR Phillips, DM Randall, TP Sciacca, RJ Wilkerson, Data Bank (2), File

HUGHES AIRCRAFT COMPANY

SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIA

ORIGINAL PAGE IS
OF POOR QUALITY

17 June 1981

In reply refer to: 81(44)07001/D4596
HS236/0019-1287

National Aeronautics and Space Administration
Goddard Space Flight Center
Greenbelt, Maryland 20771

Attention: Elizabeth Austin
Contracting Officer
Code: 283

Subject: Contract NAS5-24200 for Thematic Mapper;
Engineering Change Proposal (ECP) No. 019

Reference: Hughes letter HS236/0019-1239, E. A. Dawson
to Elizabeth Austin, dated 8 May 1981

The subject Engineering Change Proposal (ECP), submitted on 8 May 1981, requested a revision to Specification GSFC 400.8-D-210, Revision B pertaining to shipment of the Thematic Mapper by Air Freight. The Hughes Program Office has initiated efforts to make the shipping container compatible with the shipment by air freight requirements. It is therefore requested that ECP Number C19 be cancelled, and that no further action be taken by the Goddard Configuration Control Board regarding this matter.

If you have any questions, please call me.

Very truly yours,

HUGHES AIRCRAFT COMPANY

E. A. Dawson
E. A. Dawson
Head, Contracts
NASA Systems Division

/mc

ORIGINAL PAGE IS
OF POOR QUALITY

ENGINEERING CHANGE PROPOSAL (FORM 1)
(SEE MIL-STD-883C FOR INSTRUCTIONS)

DATE PREPARED

20 August 1981

ECR NO.

020

PROCURING ACTIVITY NO.

DESIGNATION NAME AND ADDRESS
Hughes Aircraft Company

S. W. CODE

825TT

3. CLASS OF EC

1

4. CODE

CODE

5. PRIORITY

6. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

WFR. CODE	SPECIFICATION/ECR NO.	WFR. CODE	DRAWING	REV.
GSFC	GSFC 400.8-D-201	"		
GSFC	GSFC 400.8-D-210	"		

8. TITLE OF CHANGE

Increase electrical power allocation for the
Thematic Mapper.

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

THEMATIC MAPPER

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

THEMATIC MAPPER

13. PART NO. OR TYPE DESIGNATION

3533000-100

14. DESCRIPTION OF CHANGE

Revise GSFC 400.8-D-201, and GSFC 400.8-D-210 to increase the electrical
power allocation to the Thematic Mapper as follows:

Peak Power	400 Watts
Maximum Average Power (Picture Mode)	350 Watts
Maximum Standby Power	100 Watts
(Launch mode, no change)	

Continued on Page 2

15. REED FOR CHANGE

During system testing, the engineering and protoflight models of the Thematic Mapper have consumed approximately 335 watt average power in the picture mode, and 94 watts in the standby mode. The present specification requirements are respectively 300 watts, and 75 watts. The GSFC technical personnel are aware of this condition, and have been advised that an engineering change proposal would be submitted to request that additional power be provided for Thematic Mapper.

16. EFFECT ON ASSOCIATED EQUIPMENT

NONE

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

Engineering/Protoflight/Flight Models

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

NONE

19. RECOMMENDED RETROFIT EFFECTIVITY

N/A

20. ESTIMATED RET DELIVERY SCHEDULE

N/A

21. ESTIMATED COSTS/SAVINGS

No-Cost Change

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

C. Richard Jones

23. APPROVAL/DISAPPROVAL

Program Manager

GOVERNING ACTIVITY

NASA/GSFC

SIGNATURE

Richard Jones

DATE

3/15/82

ORIGINAL PAGE IS
OF POOR QUALITY

ENGINEERING CHANGE PROPOSAL PAGE 2 OF 2 ECP NO. 020

(Continued from Page 1, Block #14)

1. Description of proposed change to GSFC 400.8-D-201, Section 3.3.2.2, Power Output (available to Thematic Mapper).

REVISE: "Maximum operational - 300 watts" -- to read...

TO READ: "a. Peak Power: 400 watts
b. Maximum Average Power (Picture Mode): 350 watts
c. Maximum Standby Power: 100 watts
d. Launch Mode Power: 14 watts"

2. Description of proposed change to GSFC 400.8-D-210, Section 3.3.43, Power Supply.

REVISE: "The basic power characteristics shall be in accordance with the ICD. Total power consumption of the TM instrument shall not exceed 300 watts, including thermal control power, if required. A non-operating orbital standby mode shall exist in which the TM consumes no more than 75 watts and is maintained at a temperature adequate to prevent instrument damage." -- to read...

TO READ: "The basic power characteristics shall be in accordance with the ICD. The peak power consumption of the TM instrument shall not exceed 400 watts, including thermal control power, if required. The maximum average power consumption of the TM in the picture mode shall not exceed 350 watts. A non-operating orbital standby mode shall exist in which the TM consumes no more than 100 watts, and is maintained at a temperature adequate to prevent instrument damage."

ORIGINAL PAGE IS
OF POOR QUALITY

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-481 FOR INSTRUCTIONS)

DATE PREPARED
18 NOV 1981

ECP NO.
021

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS SANTA BARBARA RESEARCH CENTER 75 COROMAR DR. GOLETA, CAL. 93117		2. MFR. CODE 11323	3. CLASS OF ECP I	4. JUST. CODE	5. PRIORITY
6. SPECIFICATIONS AFFECTED MFR. CODE SPECIFICATION/DOCUMENT NO.		7. DRAWINGS AFFECTED MFR. CODE NUMBER REV.			
GSFC GSFC 400.8-D-201		11323 52347 B + EO 2781A			

8. TITLE OF CHANGE Connection of Thematic Mapper Unipoint Signal Ground To Chassis Ground within Thematic Mapper Electronics Module	9. CONTRACT NO. & LINE ITEM NAS 5-24200
--	--

10. CONFIGURATION ITEM NOMENCLATURE Thematic Mapper Assy	11. IN PRODUCTION ☒ YES ☐ NO
---	--

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED Electronics Module Assy-TM	13. PART NO. OR TYPE DESIGNATION 52347
--	---

14. DESCRIPTION OF CHANGE

Addition of 2 26 AWG wires from A26E01 terminal (TM Unipoint signal ground) to physically nearest chassis ground screw.

REF: Attached SBRC EO 3903A

15. NEED FOR CHANGE

To lessen the general level of noise exhibited in Thematic Mapper video data, Oscar Weinstein, GSFC Technical Officer, directed the above defined grounding system.

16. EFFECT ON ASSOCIATED EQUIPMENT

NONE

17. PRODUCTION EFFECTIVITY BY SERIAL NO. PROTOFLIGHT/FLIGHT	18. EFFECT ON PRODUCTION DELIVERY SCHEDULE NONE
--	--

19. RECOMMENDED RETROFIT EFFECTIVITY 51065 SERNO 002	20. ESTIMATED RIT DELIVERY SCHEDULE N/A
---	--

21. ESTIMATED COSTS/SAVINGS

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE	TITLE
23. APPROVAL/DISAPPROVAL	

GOVERNMENT ACTIVITY	SIGNATURE	DATE
---------------------	-----------	------

ORIGINAL PAGE IS
OF POOR QUALITY

ELEC

[SERC] ENGINEERING ORDER / ~~REVISION NOTICE~~ NO. 3903A					
DRAWING TITLE			DRAWING NUMBER		
ELECTRONICS MODULE ASSY T.M.			52347-B		
PROJECT NUMBER	ITEM DISPOSITION	CLASS CHANGE	DRAWING TYPE		
PL 1162	REWORK ☒ ITEMS CONFORM ☐	☒ I ☐ II	☒ A ☐ B		
EFFECTIVITY	NO ITEM ☒ REVISION ☐ STATUS THIS PREVIOUS ☐ NOT MAINTAINED AFTER	REWORKING ECR NUMBER			
SE: NO 0023 SUBQ	USE ☐ NOT APPLICABLE	53/01			
DESCRIPTION OF CHANGE					
1. ADDED TO L/M:					
NOV 18 1981 DO NOT USE THIS PRINT UNLESS YOUR ORDER OR INSTRUCTIONS SPECIFY THE REVISION LEVEL SHOWN					
(10) ** AR	SM80003-0109	WIRE, INSUL, 26 AWG, WHITE *			
(10) ** I	MS35431-1	TERMINAL LUG, NO. 4 **			
2. ADDED G/US					
*. SUBSEQUENT TO INSTALLATION OF ALL PWB ASSY'S INTO THE ELECTRONICS MODULE ASSEMBLY (52347) VERIFY THAT OPEN CIRCUIT ($> 1m\Omega$) EXISTS BETWEEN SIGNAL UNIPONT RTN (AZG EOI).					
(**) AT ONE END SOLDER TWO WIRES ITEM * TO TERMINAL LUG ITEM ** AND THE OTHER ENDS OF THE WIRE TO AZG EOI TERMINALS. LENGTH OF WIRES TO BE DETERMINED AT INSTALLATION. USE EXISTING AZG BOARD MOUNTING HARDWARE TO TIE DOWN TERMINAL LUG ITEM **. (CONNECT THEMATIC MAPPER UNIPONT SIGNAL GROUND TO ELECTRONICS MODULE CHASSIS GROUND).					
* NOTE AND/OR ITEM NUMBER TO BE ASSIGNED AT TIME OF INCORPORATION.					
PREPARED BY	DATE	QUALITY APPROVAL	DATE	RELEASED BY	DATE
J. J. ...	11/17/81	[Signature]	11/17/81	[Signature]	11/17/81
CHECKED BY	DATE	MANUFACTURING APPROVAL	DATE	INCORPORATED BY	DATE
[Signature]	11/17/81				
REA/RSA APPROVAL	DATE	PROJECT APPROVAL	DATE	DRAWING REV LETTER	
A. Banach	11/17/81	[Signature]	11/17/81		

ORIGINAL PAGE IS
OF POOR QUALITY

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-461 FOR INSTRUCTIONS)

DATE PREPARED

5/5/82

ECP NO.

022

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS

Santa Barbara Research Center
75 Coronar Drive, Goleta, CA 93117

2. MFR. CODE

11323

3. CLASS OF ECP

1

4. JUST. CODE

5. PRIORITY

6. SPECIFICATIONS AFFECTED

MFR. CODE

SPECIFICATION/DOCUMENT NO.

GSFC

400.8-D-210 Rev. B

7. DRAWINGS AFFECTED

MFR. CODE

NUMBER

REV.

8. TITLE OF CHANGE

Deletion of Power Supply
Synchronization to the Multiplexer

9. CONTRACT NO. & LINE ITEM

NAS5-24200

10. CONFIGURATION ITEM NOMENCLATURE

Thematic Mapper System

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

Thematic Mapper System

13. PART NO. OR TYPE DESIGNATION

51065

14. DESCRIPTION OF CHANGE

In specification 400.8-D-210, Rev B, section 3.3.4.3, delete the sentences "The converter(s) shall operate at frequencies that are integral multiples of, and/or synchronized with the scan rate of the TM. The synchronizing clock signal shall be obtained from the multiplexer."

15. REASON FOR CHANGE

At discrete power bus voltages, the synchronization signal may introduce an occasional instantaneous over-current shutdown. In orbit, each shutdown could interrupt picture making for ten to fifteen seconds. Removal of synchronization has been proven to be no detriment to system performance.

16. EFFECT ON ASSOCIATED EQUIPMENT

None

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

S/N 002

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None

19. RECOMMENDED RETROFIT EFFECTIVITY

None

20. ESTIMATED KIT DELIVERY SCHEDULE

N/A

21. ESTIMATED COSTS/SAVINGS

N/A

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

HR Phillips

TITLE

Program Manager

23. APPROVAL/DISAPPROVAL

GOVERNMENT ACTIVITY

NASA/GSFC

SIGNATURE

Richard G. Austin 8/31/82

DATE

FORM 1 DEC 68 1693 6/N-0102-020-8500

WZ @

ENGINEERING CHANGE PROPOSAL (SHORT FORM)
(SEE MIL-STD-883 OR INSTRUCTIONS)

DATE PREPARED

5/20/82

ECP NO.

023

PROCURING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS

Santa Barbara Research Center
75 Coromair Drive, Goleta, CA 93117

2. MFR. CODE

11323

3. CLASS OF ECP

I

4. JUST. CODE

5. PRIORITY

6. SPECIFICATIONS AFFECTED

MFR. CODE	SPECIFICATION/DOCUMENT NO.
11323	Temp Controller, Subassy 50942
	(A4) Electronics Test, Procedure
	for/ 16255

7. DRAWINGS AFFECTED

MFR. CODE	NUMBER	REV.
11323	50942	G
11323	50943	E

8. TITLE OF CHANGE

Installation of capacitors to stop
oscillations on the Temperature Controller Circuit
Board.

9. CONTRACT NO. & LINE ITEM

NAS 5-24200

10. CONFIGURATION ITEM NOMENCLATURE

TM Top Assy.

11. IN PRODUCTION

☒ YES ☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

PWB Assy, Temp Controller (A4)

13. PART NO. OR TYPE DESIGNATION

50942, Rev. G.

14. DESCRIPTION OF CHANGE

Mount and connect 2 ea. new 0.1 μ F/100V capacitors on the board
per EO 4343A to Dwg. 50942.

ORIGINAL PAGE 19
OF POOR QUALITY

15. NEED FOR CHANGE

Capacitance on the temp. sense diodes' lines causes their
bias control loops to oscillate. The oscillations are at a low amplitude
and at approximately 200 kHz, which is above the video bandwidth. It is
not considered good practice to allow the oscillations to exist because
there is no certain control over their future effect on the TM system.

16. EFFECT ON ASSOCIATED EQUIPMENT

None.

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

51065 SERNO 3 AND SUBQ

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None

19. RECOMMENDED RETROFIT EFFECTIVITY

51065 SERNO 2

20. ESTIMATED KIT DELIVERY SCHEDULE

5/8/82

21. ESTIMATED COSTS/SAVINGS

None. Reliability improvement.

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

F.R. Phillips 5-21-82

TITLE

PROGRAM MANAGER

23. APPROVAL/DISAPPROVAL

GOVERNMENT ACTIVITY

SIGNATURE

DATE

Paula R. Burnett 6/11/82

ORIGINAL PAGE IS
OF POOR QUALITY

SANTA BARBARA RESEARCH CENTER
A Subsidiary of Hughes Aircraft Company
INTERNAL MEMORANDUM

TO F. R. Phillips cc. Distribution DATE 27 May 1982
REF: HS236-8006
SUBJECT: Tests on F1 TM Backup Shutter FROM: N. F. Current
BLDG. B12 MAIL STA. 58
EXT. 6198

To confirm that the addition of the 3 ea. 0.01 μ F capacitors and the change in resistor R60 to 17.4K would have no unexpected bad effects on the operation of the system, a test was made this morning under FR's S 8128, 8129 and 8372.

At least five consecutive, successfully locking turn-on's were done (with no failures to lock) with the power supply sync lines open and closed and the scan line corrector on. Then the following timing measurements were made with the same conditions:

Test Procedure TP 32015-532, Paragraph

5.2.1.39	SME 1 SAM Mode.
5.2.1.46	SME 2 Bumper Mode.
5.2.1.51	SME 2 SAM Mode.
5.2.1.58	SME 1 Bumper Mode.

There were no failures to lock each time the Backup Shutter was turned on. All timing measurements were within specifications, as recorded on pp. 43 and 44 of the F1 System Test Log.

This test shows that the proposed circuit changes have no adverse effects on system operation. Accordingly, EO's 4432A and 4433A with their ECR's, Deviation/Waiver D153 and ECP 024 have been prepared to authorize the PWB changes and are ready for signature.

NF Current
N. F. Current

NFC:are

Distribution

Brandshaft, D. G.	Long, L. E.
Brown, A. C.	O'Connell, L.
Buckley, R. C.	Plews, G. S.
Cannon, G. W.	/Sciacca, T. P. (NASA)/
Evans, L. B.	Young, D. (AF)
Gritt, G. B. (NASA)	

HUGHESHUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIA

SPACE AND COMMUNICATIONS GROUP

FAILURE REPORTORIGINAL PAGE IS
OF POOR QUALITY**S 8372**

1 PROGRAM NAME AND NUMBER TM		2 GLA V411		3 MODEL FLT		4 TIME OBSERVED 1:00 PM		5 DATE OBSERVED MO 5 DA 6 YR 82	
6 HARDWARE LEVEL WHEN FAILURE WAS OBSERVED ☐ SPACECRAFT ☒ SYSTEM ☐ SUBSYSTEM ☐ UNIT		☐ ASSEMBLY ☐ SUBASSEMBLY		☐ MODULE ☐ MICAM		☐ CARD ☐ PART			
EQUIPMENT IDENTIFICATION		NAME		PART NUMBER		SYM		MANUFACTURER	
7 SUBSYSTEM									
8 UNIT									
9 ☐ ASSEMBLY ☐ SUBASSEMBLY									
10 ☐ MODULE ☐ MICAM ☒ CARD 51398 Red. Shutter Driver		51398						SBRC	
11 OTHER									
12 TEST WHEN FAILURE WAS OBSERVED ☐ DEVELOPMENT ☐ IN PROCESS ☐ QUALIFICATION ☐ ACCEPTANCE ☒ INTEGRATION ☐ SYSTEM ☐ LAUNCH OPERATIONS									
13 ENVIRONMENT WHEN FAILURE WAS OBSERVED ☒ AMBIENT ☐ EMC/RFI ☐ RADIATION ☐ VIBRATION ☐ TEMP ☐ THERMAL VAC ☐ HRS-AT ☐ OTHER									
14 DESCRIPTION OF FAILURE Redundant Shutter would not phase lock									
15 TEST PROCEDURE TP-1 = 015-532		16 PARA 52.1.39		17 ORIGINATOR L Evans		18 ORG 2213		19 DATE 9/6/82	
18 VERIFICATION AND FAILURE ANALYSIS								20 CONTINUATION SHEET USED	
19 FAILED ITEM NAME AND PART NUMBER									
20 FOLLOWING REWORK/RETEST REQUIRED ☐ REWORK/RETEST NOT REQUIRED BECAUSE									
21 AUTHORIZATION									
22 REWORK/RETEST ACTION TAKEN								23 CONTINUATION SHEET USED	
24 QA REWORK								25 QA RETEST	
26 LIST ALL PARTS REPLACED PART NUMBER		CXT SYM		PART LOT NUMBER		DATE CODE		MANUFACTURER	
								PROBABLE DEFECT	
								ANALYSIS NUMBER	
27 REWORK BY		ORG		DATE		28 RETESTED BY		ORG	
								DATE	
29 CAUSE AND CORRECTIVE ACTION								30 CONTINUATION SHEET USED	
								31 CONTINUATION SHEET USED	
32 DOCUMENT IMPLEMENTING CORRECTIVE ACTION								33 FIB CLOSURE	
34 BASIC CAUSE OF VERIFIED FAILURE ☐ DESIGN ENVIRONMENTAL DEFECTIVE PARTS ☐ TEST EQUIPMENT ☐ TEST PROCEDURE ☐ TEST SET UP ☐ MFG PROCEDURE ☐ ASSY/FAB ERROR ☐ WORKMANSHIP ☐ WIRING ERROR ☐ ROUGH HANDLING ☐ WEAR-OUT ☐ UNKNOWN								DEFECT CODE	
35 FAILURE TYPE ☐ PRIMARY ☐ INDUCED ☐ UNKNOWN ☐ NO FAILURE						36 FAILURE CLASSIFICATION ☐ CRITICAL ☐ MAJOR ☐ MINOR ☐ SAFETY			
37 RESPONSIBLE ENGINEER		ORG		DATE		38 SPACECRAFT SYSTEM ENGINEER		ORG	
								DATE	
39 RELIABILITY		ORG		DATE		40 CUSTOMER OR SUPPLIER		DATE	

ORIGINAL PAGE IS
OF POOR QUALITY

HUGHES

HUGHES AIRCRAFT COMPANY
SPACE AND COMMUNICATIONS GROUP
EL SEGUNDO, CALIFORNIA

SPACE AND COMMUNICATIONS GROUP
FAILURE REPORT

S 8372

PROGRAM NAME AND NUMBER 1. <i>177</i>		2. CLA <i>V 411</i>	3. CODE <i>FLT</i>	4. TIME OBSERVED <i>1:00 PM</i>	5. DATE ORDERED <i>NO 5 DA 6 YR 32</i>
6. FUNCTIONAL AREA WHERE FAILURE WAS OBSERVED	☒ SPACECRAFT SYSTEM	☐ SUBSYSTEM UNIT	☐ ASSEMBLY SUBASSEMBLY	☐ MODULE MICAM	☐ CARD PART
EQUIPMENT IDENTIFICATION SUBSYSTEM		NAME		PART NUMBER	S.N.
3. UNIT					
4. ☐ ASSEMBLY ☐ SUBASSEMBLY					
5. ☐ MODULE ☐ MICAM ☒ BOARD		<i>51397 Red Shutter</i>		<i>51398</i>	<i>SBRC</i>
11. OTHER <i>Driver</i>					
12. TEST WHEN FAILURE WAS OBSERVED		☐ DEVELOPMENT PROCESS	☐ QUALIFICATION ACCEPTANCE	☒ INTEGRATION SYSTEM	☐ LAUNCH OPERATIONS
13. ENVIRONMENT WHEN FAILURE WAS OBSERVED		☐ AMBIENT EMC RFI	☐ RADIATION VIBRATION	☐ TEMP AXIS FOR	☐ THERMAL JAC HRS:AT MIN TYPE ☐ OTHER
14. DESCRIPTION OF FAILURE		<i>Redundant Shutter would not phase lock</i>			
15. PRELIMINARY FAILURE ANALYSIS		16. <i>2015-532</i> 17. <i>521.391</i> 18. <i>L. Evans</i> 19. <i>2015 5/8/82</i> 20. ☒ ANALYSIS			
19. FOLLOWING REPAIR/RETEST REQUIRED REPAIR/RETEST NOT REQUIRED BECAUSE		21. AUTHORIZATION			
22. REWORK/RETEST ACTION TAKEN		23. AUTHORIZATION		24. DATE	25. SHEET USED
26. LIST ALL PARTS REPLACED		27. PART NUMBER	28. CKT SYM	29. PART LOT NUMBER	30. DATE CODE
31. REWORK BY		32. DATE	33. RETESTED BY	34. DATE	35. SHEET USED
36. CAUSE AND CORRECTIVE ACTION		37. FAB CLOSURE			
38. DOCUMENT IMPLEMENTING CORRECTIVE ACTION		39. DOCUMENTATION SHEET USED			
40. BASIC CAUSE IF VERIFIED		☐ DESIGN ENVIRONMENTAL DEFECTIVE PARTS	☐ TEST EQUIPMENT TEST PROCEDURE TEST SET UP	☐ MFG PROCEDURE ASSEMBLY ERROR WORKMANSHIP	☐ SPRING ERROR ROUGH HANDLING WEAR OUT
41. FAILURE TYPE		☐ PRIMARY NO CODE	☐ UNKNOWN NO FAILURE	☐ FAILURE CLASSIFICATION	☐ CRITICAL MAJOR MINOR SAFETY
42. RESPONSIBLE ENGINEER		43. DATE	44. SPACECRAFT SYSTEM ENGINEER	45. DATE	46. CAUSE

ORIGINAL PAGE IS
OF POOR QUALITY



National Aeronautics and
Space Administration

Goddard Space Flight Center
Greenbelt, Maryland
20771

Reply to ACR of 284.4

Santa Barbara Research Center
Attention: E. A. Dawson
75 Curomar Drive
Goleta, CA 93017

Subject: Contract NAS5-24200 for Thematic Mapper, Approval of
Deviation and ECP (GSFC CCR's 399 and 401)

The following deviations and waivers have been approved by the
Landsat-D CCB.

U-153 - Capacitor addition to assure phase lock

ECP-U24 - Capacitor addition to assure phase lock

The signed DD 1693 and DD 1694 are enclosed for your files.

A handwritten signature in cursive script, reading "Elizabeth Austin".

Elizabeth Austin
Contracting Officer

ORIGINAL PAGE IS
OF POOR QUALITY

1. ORIGINATOR NAME AND ADDRESS
(2. MIL-STD-883C INSTRUCTIONS)

DATE PREPARED
5/26/82

EEP NO.
324

REWORKING ACTIVITY NO.

1. ORIGINATOR NAME AND ADDRESS

Santa Barbara Research Center
75 Coromar Drive, Goleta, CA 93117

2. MFR. CODE
11323

3. CLASS OF EEP
I

4. JUST. CODE

5. PRIORITY

6. SPECIFICATIONS AFFECTED

7. DRAWINGS AFFECTED

MFR. CODE	SPECIFICATION/DOCUMENT NO.	MFR. CODE	NUMBER	REV.
11323	PWB Assy Cal Shutter, Backup	11323	51398	E
	51398, Rev. E	11323	51399	C

8. TITLE OF CHANGE

Capacitor addition to assure phase lock.

9. CONTRACT NO. & LINE ITEM

NAS5-24200

10. CONFIGURATION ITEM NOMENCLATURE

Thematic Mapper Top Assembly

11. IN PRODUCTION

☒ YES

☐ NO

12. NAME OF PART OR LOWEST ASSEMBLY AFFECTED

PWB Assembly, Cal Shutter, Backup, Rev. E

13. PART NO. OR TYPE DESIGNATION

51398, Rev. E

14. DESCRIPTION OF CHANGE

Capacitors are proposed to be added across the phototransistor leads per EO's 4432A and 4433A. The threshold voltage determined by R60 is also to be changed to approx. +1.5V by changing the value of R60 to compensate for the timing shift between the dc restore pulse and the shutter shadow that results due to the added capacitors.

15. NEED FOR CHANGE

With the power supply sync lines opened to prevent random shutdown, the standby shutter sometimes failed to phase lock. Noise picked up on the phase reference pickoff phototransistor leads caused random transitions in the outputs of the flip-flops driven by the phototransistor comparators. The random transitions caused 180° phase reversals at the phase detector output and confused the phase lock loop, preventing it from locking. See Failure Report S8372.

16. EFFECT ON ASSOCIATED EQUIPMENT

None

17. PRODUCTION EFFECTIVITY BY SERIAL NO.

51065, SERNO 3

18. EFFECT ON PRODUCTION DELIVERY SCHEDULE

None for Fl.

19. RECOMMENDED RETROFIT EFFECTIVITY

20. ESTIMATED RET DELIVERY SCHEDULE

6/1/82

21. ESTIMATED COSTS/SAVINGS

None. Functional improvement.

22. SUBMITTING ACTIVITY AUTHORIZING SIGNATURE

FR Phillips

TITLE

Program Manager

23. APPROVAL/DISAPPROVAL

GOVERNMENT ACTIVITY

SIGNATURE

Paula R. Burnett 6/30/82

4.4

ORIGINAL PAGE IS
OF POOR QUALITY

4.4 NON-CONFORMING MATERIAL

The following section lists the non-conforming material Reports (NCRM) that were generated during the Flight Model Fabrication tasks. Copies of the NCRM's are maintained at the contractor's facility and are available for review.

ORIGINAL PAGE IS
OF POOR QUALITY

NCMR's

NO.	277572	- P/N	51480(A)	- Frame Silicon DET and Preamp
	277573	-	50797(E)	- Silicon DET and Preamp Assy.
	277671	-	50973(B)	- Cold Focal Plane Assy.
	277772	-	50797	- Silicon DET. and PreAmp Assy. Band 1
	277773	-	52420	- Filter Retainer
	277776	-	50955	- Cooled Focal Plane
	277777	-	50958	- DET Array, Bands 5&7 InSb
	277790	-	50799-1(A)	Quartz Substrate
	277794	-	50958	- Detector Array Band 7
	277800	-	50958(B)	- Detector Array Band (-)
	288469	-	52451(A)	- Filter Assy. - Band 1
	294836	-	51337(D)	- Telescope Assembly
	294837	-	52249(F)	- Redundant Shutter
	294838	-	50809	- Substrate, LED Source
	294839	-	52347	- Electronic Module
	294842	-	51512	- Aft Optics Assy.
	294852	-	51672 Rev. A	- Lens Spacer
	294854	-	52049 Rev C	- Shim RAD Cooler Adapter
	294859	-	50980 Rev E	- Cooled Focal Plane Housing Preamplifier
	294861	-	51740 Rev E	- RAD Cooler Door Assy.
	294862	-	51740 Rev E	- RAD Cooler Door Assy.
	294888	-	44220-2	- Mirror Mount
	294889	-	45769 Rev A	- Nut plate
	295099	-	52347 Rev B	- Elect. Module Assy.
	298142	-	51402	- TLMY Scaling - fuse link Lamp
	298645	-	50904-1	- Post Amp PWB Bundl
	299608	-	51337 Rev. A	- Telescope Assy.
	299663	-	51337 Rev. D	- Telescope Assy.
	299681	-	51512	- AFT Optics Assy.
	299684	-	54211 Rev. A	- Frame, Silicon Det. & PreAmp - Bracket
	299686	-	54180 Rev. A	- Frame
	299687	-	51337 Rev. D	- Telescope Assy.
	359650	-	90-50968	- Spare PWB Distribution Cold Focal Plane
	359651	-	51015(B)	- Silicon Preamp Assy.
	359652	-	51015(D)	- Silicon Preamp Assy.
	359655	-	50958(B)	- Band 7 InSb Array
	359661	-	50973(B)	- Cold Focal Plane Assy.
	359663	-	50802-1(E)	- Substrate, Silicon Det. Preamp
	359797	-	52420	- Filter Retainer
	359800	-	51015-1(D)	- Silicon Preamp Assy
	360066	-	50802-1	- Substrate E, Silicon Det. Preamp
	360077	-	50795	- Prime FPA
	386729	-	50993(E)	- Flex Printed Wiring Cable
	386730	-	51394	- Flex Printed Wiring Cable
	386755	-	51209 Rev. D	- Cover, Intermediate Stage
	386757	-	51200	- Rad Cooler
	386758	-	50980	- Preamp Module Assy.
	386759	-	52566-2(C)	- SMA Strip Heater
	392151	-	51015-1(D)	- Silicon Preamp Assy.
	392154	-	50797-1(E)	- Silicon Detector and PreAmp Assy.
	392155	-	50807-(H)	- Led Source Silicon Focal Plane Assy.
	392156	-	50968(B)	- PWB, Distribution, Cold Focal Plane
	392546	-	51015-1(D)	- Silicon Preamp Assv.
	392547	-	50973 (B)	- Cold Focal Plane Assy.
	392551	-	50955	- C.F.P./Cold Finger Assy.

NCMR'S

ORIGINAL PAGE IS
OF POOR QUALITY

NO.	392555 - P/N	50958(B) - InSb Array
	392557 -	50797(D) - Silicon Detector and preamp Assy.
	393227 -	50973(B) - Cooled Focal Plane Assy.
	393244 -	50795 - Flight Prime Focal Plane Assy.
	393245 -	52421 - Flight Assy.
	393246 -	52421 - Filter Assy.
	393247 -	52421 - Filter Assy.
	393248 -	52421 - Filter Assy.
	393250 -	51015 - Silicon Preamp Assy.
	393251 -	50970 - FFWA Cooler Cable Band 5
	393252 -	50958 - InSb Det. Array Band 7
	393253 -	50958 - InSb Det. Array Band 5
	393254 -	51333-99C- Filter Mount Sub Assy, Spare
	393255 -	51333-98C- Filter Mount Sub Assy, Spare
	393256 -	50795 - Silicon Focal Plane Assy.
	393261 -	50968 - PWB, Distribution, Cold Focal Plane
	393268 -	50961
		(50955)(E)- Cooled Focal Plane Finger Assy.
	393269 -	50802
		(50797)(E)- Silicon Detector and preamp Assy.
	393272 -	50992
		(50973)(B)- Cold Focal Plane Assy.
	393273 -	50797(E) - Silicon Detector and PreAmp Assy.
	393274 -	51480
		(50797-1)(E) - Silicon Detector and PreAmp Assy.
	393275 -	50803
		(50797)(E) - Silicon Detector and PreAmp Assy.
	393276 -	50973(B) - Cold Focal Plane Assy.
	393277 -	50797(E) - Silicon Detector and PreAmp Assy.
	393278 -	50807(H) - LED source/silicon FPA
	393279 -	50802-1(E) - Substrate, Silicon Detector Preamp
	393280 -	50807(H) - LED source-silicon FPA
	393281 -	50955(E) - Cooled Focal Plane/Cold Finger Assy.
	393282 -	50955(E) - Cooled Focal Plane/Cold Finger Assy.
	393283 -	50955(E) - Cooled Focal Plane/Cold Finger Assy.
	411554 -	51402 - PWB Assy. Telemetry sealing
	411649 -	52797 - Aux. Circuit Board
	411881 -	53060 REV A - Analog Processor (A4)
	411979 -	53286 REV D - Cable Assy. (W3) Heater and Sensor Band 6
	412432 -	51402 - Telemetry Scaling PWB
	412442 -	52788 - Cable Harness
	412446 -	50860 - Silicon Detector PreAmp
	412471 -	50916 - PWB Assy. Cal Shutter Main
	?	50955 - CFP/Cold Finger Assy.
	412473 -	50916 - PWB Assy. Calib Mainshutter A6
	412474 -	50904-3 - PWB Assy. Post Amp Band 1-4
	412478 -	52360 - Top Cover
	412487 -	53757 RLV B - Elect. Assy. Reg Module
	425451 -	50869 - Power Supply
	411836 -	509082-2 - PostAmp Band 7
	412016 -	50904 - PostAmp Bds.
	392150 -	50797-2 - Silicon DET and PreAmp Assy.
	386761 -	52052-3 - SHIM, Cooler Shroud
	412015 -	50904-4 - Post Amp Band 4
	411920 -	50904-2 - PWB Assy. Post Amp 1-4

ORIGINAL PAGE IS
OF POOR QUALITY

NCMR'S

No.	298649 - P/N	51065 -	Thematic Mapper Assy.
	299665 -	52483 -	Shutter Arm Assy - Cal/Restore
	412016 -	50904 -	Post Arp. Bds.
	411836 -	50908-2-	Post Amp. Band 7
	299645 -	51512 -	Aft Optics Assy. TM
	299630 -	53414 -	Transformer Assy.
	412468 -	52347 -	Electronic Module Assy.
	294814 -	50843 -	AFT Optics Support