# NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

# WARTIME REPORT

# ORIGINALLY ISSUED

January 1943 as Advance Restricted Report

THE ANALYSIS OF STRAINS INDICATED BY MULTIPLE-STRAND

RESISTANCE-TYPE WIRE STRAIN GAGES USED AS ROSETTES


By Norris F. Dow

Langley Memorial Aeronautical Laboratory
Langley Field, Va.



### WASHINGTON

NACA WARTIME REPORTS are reprints of papers originally issued to provide rapid distribution of advance research results to an authorized group requiring them for the war effort. They were previously held under a security status but are now unclassified. Some of these reports were not technically edited. All have been reproduced without change in order to expedite general distribution.

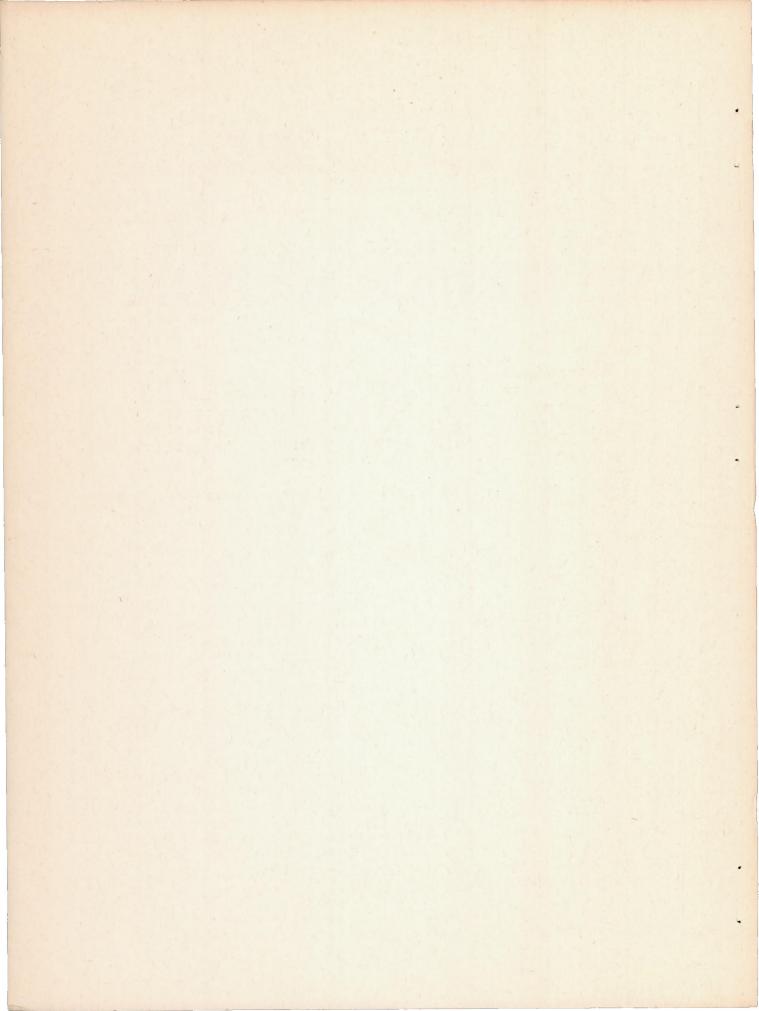

### ADVANCE RESTRICTED REPORT

THE ANALYSIS OF STRAINS INDICATED BY MULTIPLE—STRAND

RESISTANCE—TYPE WIRE STRAIN GAGES USED AS ROSETTES

By Norris F. Dow

### SUMMARY

Methods are given for making the necessary corrections to the strains indicated by multiple—strand resistance—type wire strain gages used singly or as rosettes to measure strains at an angle to the principal strain. The results of tests to determine the validity of the methods of correction are reported.

A rosette arrangement having several advantages over the arrangements now commonly in use is described.

#### INTRODUCTION

The resistance—type wire strain gages are particularly adaptable for use in strain rosettes because of compactness and facility of reading. When used as rosettes, three of the gages are generally arranged at angles of 45° or 60° to each other or, less frequently, a fourth gage is added to the 45° arrangement. In any arrangement, only one gage in the rosette measures the strain at the gage length in question and the other gages are mounted above or to the side of that gage.

A strain-rosette computing machine, described in reference 1, has been developed for calculating principal strains from the individual strain-gage readings of a three-gage 60° rosette or a four-gage 45° rosette. This machine cannot be conveniently used with a three-gage 45° rosette. A rosette arrangement that combines the features of the 45° and 60° rosettes and is particularly adapted for use with this machine is herein described.

It has been recognized that rosettes made up of resistance—type wire strain gages so wound that some of

the resistance wire is at an angle to the axis of the gage are affected by the component of strain acting at that angle. Strains having an angular component different from the angular component present in the calibration of the gage will accordingly cause errors in strain indication that are a function of the geometry of the grid of the resistance wire. A method by Baldwin Southwark for correcting these errors, by making a correction to each gage reading, for the commercial SR-4 type R-1 rosette is given in appendix A.

Because the magnitude and direction of the principal strains are usually of greater interest than individual gage readings, a correction to be directly applied to the indicated principal strains is generally more convenient than corrections to each strain indication. In the use of a rosette computing machine, some time might also be saved by making corrections to the principal strains rather than to the original gage readings. Methods, adaptable to any wire strain gage, for making these corrections are described in this report, together with the results of tests of SR-4 rosettes to determine the accuracy of the corrections.

### T-DELTA ROSETTE

The strain rosette arrangements now in common use, the three— and four—gage 45° star rosettes and the three—gage 60° delta rosettes, have advantages and disadvantages peculiar to each arrangement. A rosette made up of gages at 60° forming a delta, with a fourth gage in the center of the delta perpendicular to one of the three other gages, designated T—delta appears to offer a maximum of the advantages of the usual arrangements. These advantages are:

- 1. The two perpendicular arms may be mounted in the expected directions of the principal strains, which minimizes the errors introduced by incorrect angular alinement of the gages.
- 2. The gage at the center may be mounted on the point at which it is desired to measure the strain and along the expected direction of principal strain, and the other three gages will fall approximately as far from that point as the three gages in the usual delta.
- 3. The principal strains may be computed from the rosette even if one of the gages fails during the test.

4. A check on the accuracy of measurement is provided by the fourth gage.

# CORRECTION OF STRAINS INDICATED BY SINGLE

### MULTIPLE-STRAND GAGE

The strain indications from a multiple-strand resistance-type wire gage at an angle  $\theta$  to the direction of a simple tensile or compressive stress (when one of the principal stresses is zero) may be corrected for the effect of the width of the gage as follows:

l. The gage factor  $G_0$  for the gage mounted in the direction of a simple tensile or compressive stress is determined by

$$G_{o} = \frac{\frac{\Delta R}{R}}{\frac{R}{e_{o}}} \tag{1}$$

in which

R resistance of gage

AR change in resistance

eo strain along stress direction

2. A correction factor Q is calculated from the equation

$$Q = \frac{1}{1 - (1 + \mu) \frac{W}{L}} \left\{ 1 - \left[ \frac{2(1 + \mu) \cos 2\theta}{(1 - \mu) + (1 + \mu) \cos 2\theta} \right] \frac{W}{L} \right\}$$
 (2)

in which

μ Poisson's ratio for material used

L total length of resistance wire in gage

W width of grid of resistance wire

The derivation of equation (2) is given in appendix B.

3. The strain at the angle  $\theta$  may now be calculated as

$$e_{\theta} = \frac{\Delta R}{R \over G_{\theta}} \tag{3}$$

in which  $G_{\theta} = G_{0}Q$ .

Values of  $G_{\theta}$  for an SR-4 type A-1 gage for which  $G_{0}=2.09$ , L = 5.01 inches, and W = 0.16 inch are plotted in figure 1.

# CALCULATION OF TRUE PRINCIPAL STRAINS FROM

# INDIVIDUAL GAGE READINGS

As shown by Hill in reference 2 and Sibert in reference 3, the true principal strains may be calculated from the true strains measured on three or more intersecting gage lines from the formulas

$$e_{x} = K(Y + 1) \tag{4}$$

$$e_{y} = K(Y - 1) \tag{5}$$

in which  $e_{\rm X}$  and  $e_{\rm y}$  are the true principal strains. The constants K and Y are determined from the arrangement of the rosette and strain readings. For a rosette composed of three gages mounted on gage lines intersecting at angles of  $45^{\circ}$ 

$$K_{45} = 0.707 / (e_{145} - e_{245})^2 + (e_{245} - e_{345})^3$$
 (6)

$$Y_{45} = \frac{^{e}1_{45} + ^{e}3_{45}}{2K_{45}} \tag{7}$$

in which elds, e245, and e345 are the true strains along the gage lines. Throughout this report true strains

will be designated e with appropriate subscripts.

Strains indicated by wire gages will be designated e.

For a rosette composed of gages mounted at angles of 60°

$$X_{60} = 0.471 / \left(e_{1_{60}} - e_{2_{60}}\right)^{2} + \left(e_{1_{60}} - e_{3_{60}}\right)^{2} + \left(e_{2_{60}} - e_{3_{60}}\right)^{2} + \left(e_{2_{60}} - e_{3_{60}}\right)^{2}$$

$$Y_{60} = \frac{e_{1_{60}} + e_{2_{60}} + e_{3_{60}}}{3K_{60}}$$
(9)

For a rosette composed of a delta plus a fourth gage at the center, that is, for a T-delta rosette,

$$K_{60T} = 0.577 / \left(e_{160T} - e_{260T}\right)^2 + 3\left(e_{260T} - e_{460T}\right)^2$$
 (10)

or

$$\mathbf{x}_{60T} = 0.408 \sqrt{\mathbf{e}_{160T} - \mathbf{e}_{260T}}^2 + \left(\mathbf{e}_{160T} - \mathbf{e}_{360T}\right)^2 + 3\left[\left(\mathbf{e}_{260T} - \mathbf{e}_{460T}\right)^2 + \left(\mathbf{e}_{360T} - \mathbf{e}_{460T}\right)^2\right] (10a)$$

$$\mathbf{y}_{60T} = \frac{\mathbf{e}_{160T} + \mathbf{e}_{460T}}{2\mathbf{x}_{60T}}$$

$$(11)$$

in which e4 is the center gage, perpendicular to e1.

The true principal strains may be calculated from the strains indicated by multiple—strand resistance—type wire gages by use of these same formulas if the following method is used:

1. The true strain—sensitivity factor S for the resistance wire in the gage is used for obtaining strain readings. The true strain—sensitivity factor is equal to the gage factor for a single—strand wire gage and may be determined experimentally or calculated as

$$S = G_0Q_{45}$$
 (12)

in which  $Q_{45}$  is given by equation (2) for  $\theta = 45^{\circ}$ .

- 2. The constants K' and Y' are calculated from equations (6) to (11) by substituting e' for e throughout.
  - 3. These constants are corrected as

$$K_{r} = K! \left( \frac{L}{L - 2W} \right) \tag{13}$$

$$Y_{r} = Y' \left( \frac{L - 2W}{L} \right) \tag{14}$$

Then

$$e_{x} = K_{r}(Y_{r} + 1) \tag{15}$$

$$e_y = K_r (Y_r - 1)$$
 (16)

### CALCULATION OF TRUE PRINCIPAL STRAINS FROM

### INDICATED PRINCIPAL STRAINS

The principal strains  $e_{\rm x}$ ' and  $e_{\rm y}$ ', calculated directly from the strain indications of the multiple—strand wire rosettes as by a rosette computing machine, may also be corrected as follows:

- l. The true strain-sensitivity factor S is used for calculating all gage readings.
- 2. The principal strains are directly calculated from these readings.
  - 3. A constant C' is determined as

$$c_{45}' = \frac{e_1' + e_3'}{2}$$
 for a 45° rosette (17)

$$C_{60}' = \frac{e_1' + e_2' + e_3'}{3}$$
 for a 60° rosette (18)

$$C_{60T}' = \frac{e_1' + e_4'}{2}$$
 for a T-delta rosette (19)

or

$$C! = \frac{e_x' + e_y!}{2}$$
 for any rosette (20)

in which  $e_x$ ' and  $e_y$ ' are the indicated principal strains.

- 4. This constant C' is deducted from the major principal strain  $\mathbf{e_x}^!$  calculated from the strain indications.
- 5. The remainder is multiplied by the factor  $\left(\frac{L}{L-2W}\right)$ , which gives  $K_r$ . Then

$$e_{x} = C! + K_{r}$$
 (21)

$$e_y = C! - K_r$$
 (22)

EXTENSION OF HILL'S SEMIGRAPHICAL METHOD TO ANALYSIS

OF MULTIPLE—STRAND WIRE ROSETTES

Hill's semigraphical method may be readily extended for use with multiple-strand gages. Many of the following steps are taken directly from reference 2.

- 1. The true strain-sensitivity factor for the wire in the gage is determined. The true factor may be experimentally determined or calculated by multiplying the gage factor for the gage as normally calibrated by the value of Q from equation (1) for  $\theta=45^{\circ}$ .
- 2. A master curve of the function  $f = \cos 2\theta$  is constructed on transparent paper or cloth, in which f is plotted against  $\theta$  for the region  $-45^{\circ} < \theta < 135^{\circ}$ . This master curve may be used each time that the method is applied to a set of strain data.
- 3. The unit strains el', e2', e3' indicated on the three gages when the true strain sensitivity is used, are

divided by an adjustment factor K! to be determined from the appropriate equation (6), (8), or (10), as

$$K_{60T}' = 0.577 / \left(e_{1_{60T}'} - e_{2_{60T}'}\right)^2 + 3 \left(e_{2_{60T}'} - e_{4_{60T}'}\right)^2$$
 (10)

- 4. The adjusted strain readings are plotted as ordinates to the same scale as used for f-values on the master curve. The  $\theta$ -values, that is, angles between gage lines, are the abscissas. The choice of origin for this graph is immaterial; the relative positions of the three gage lines are important.
- 5. An auxiliary horizontal line representing the average of the adjusted strain values for gage lines 1 and 3 isodrawn. The ordinate Y' for this line may be found from equation (7), (9), or (11), as

$$Y' = \frac{e_{160T}' + \frac{e_{460T}'}{K'}}{2}$$
 (11)

6. A new adjustment factor  $K_{\mathbf{r}}$  is determined from the equation

$$K_{r} = K^{\dagger} \left( \frac{L}{L - 2W} \right) \tag{13}$$

7. A second auxiliary horizontal line is drawn, for which the ordinate Y<sub>c</sub> from the origin of the plotted strains is given by

$$\lambda^{c} = \lambda_{i} \left( \frac{T}{5M} \right) \tag{52}$$

- 8. The master curve is placed over the graph, with its horizontal axis coinciding with the first auxiliary line of the graph, and in such a position that the plotted points fall on the master curve.
- 9. The abscissas of the maximum and the minimum points of the master curve, referred to the origin of the graph, indicate the directions of the principal strains and the

ordinates, referred to the second auxiliary line, indicate the magnitude of their adjusted values. In order to obtain the true magnitude of the principal strains, these values must be multiplied by the adjustment factor  $K_{\mathbf{r}}$ .

10. The principal stresses may be found from the principal strains by the formulas

$$\sigma_{\text{max}} = \frac{\mathbb{E}\left(e_{\text{max}} + \mu e_{\text{min}}\right)}{1 - \mu^{2}} \tag{24}$$

$$\sigma_{\min} = \frac{E\left(e_{\min} + \mu e_{\max}\right)}{1 - \mu^{2}} \tag{25}$$

in which E = Young's modulus.

11. The directions of the principal stresses may be found from the graph or may be calculated from

$$(\cos 2\theta)_{60T} = \frac{e_{160T}' - e_{460T}'}{2K_{60T}'}$$
 (26)

12. The maximum shear stress Tmax, acting at 45° to the principal stresses, may be found from

$$\tau_{\text{max}} = \frac{\sigma_{\text{max}} - \sigma_{\text{min}}}{2} \tag{27}$$

## CHECK OF ACCURACY OF CORRECTIONS

Because the stresses at the center of a polygonal dural block of 16 sides loaded in compression between parallel pairs of its 16 sides are combined, such a specimen was used to compare the strains measured by Tuckerman optical strain gages and by SR-4 type R-1 wire strain rosettes. A photograph of the polygonal specimen is given as figure 2. This specimen had the further advantage that the principal strains could be inclined at angles of  $22\frac{1}{2}^{\circ}$ ,  $45^{\circ}$ ,  $67\frac{1}{2}^{\circ}$ , and  $90^{\circ}$  to the axis of any gage in the rosette.

The properties of the specimen were first surveyed by mounting Tuckerman gages on the front and the rear of the block at the center of the block and parallel to the line drawn between the midpoints of two opposite sides. The specimen was loaded in a hydraulic testing machine accurate to one—half of l percent, at angles of  $0^{\circ}$ ,  $22\frac{1}{2}^{\circ}$ ,  $45^{\circ}$ ,  $67\frac{1}{2}^{\circ}$ , and  $90^{\circ}$  to the axis of the Tuckerman gages and the strains measured at each angle for load increments of 100,000 pounds. The gages were then rotated  $45^{\circ}$  and the survey repeated; surveys were made at each  $45^{\circ}$  rotation of the gages.

The properties of the specimen were found to be sufficiently uniform. An average of the survey could therefore be used to determine the strains at any angle at the center of the block for a load increment of 100,000 pounds. The maximum variation from the average properties as indicated by the Tuckerman gages was 0.91 percent, or a strain of 0.000009 inch per inch.

The Tuckerman gages were replaced by SR-4 rosettes and the surveys repeated. The results are given in table 1 for the average true strains, for the average electrical readings uncorrected, corrected by the Baldwin Southwark method, and corrected by the methods of the present report.

Langley Memorial Aeronautical Laboratory,
National Advisory Committee for Aeronautics,
Langley Field, Va.


## REFERENCES

- 1. Klemperer, W. B.: A Rosette Strain Computer. NACA TN No. 875, 1942.
- 2. Hill, H. N.: A Semi-Graphical Method for Analyzing Strains Measured on Three or Four Gage Lines Intersecting at 45°. NACA TN No. 709, 1939,
- 3. Sibert, H. W.: Principal Stresses from Three Strains at 45°. Jour. Aero. Sci., vol. 7, no. 1, Nov. 1939, pp. 26-27.

### APPENDIX A

# BALDWIN SOUTHWARK METHOD OF COMPUTING STRAINS FROM TYPE R-1 ROSETTE

The following sketch and method of computing strains from an SR-4 type R-1 rosette was obtained from directions accompanying the gages, which were manufactured by Baldwin Southwark Division of The Baldwin Locomotive Works.

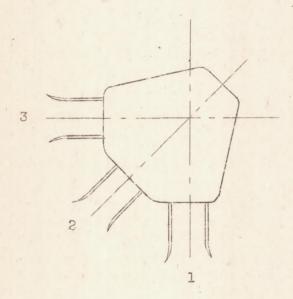

The numbers 1, 2, and 3 indicate the gage axes. The true strains along the gage axes are designated e<sub>1</sub>, e<sub>2</sub>, e<sub>3</sub>. The strains indicated by instrument are designated e<sub>1</sub>, e<sub>2</sub>, and e<sub>3</sub>. Then, according to Baldwin Southwark

$$e_1 = e_1' - \frac{1}{45} e_3'$$
 $e_2 = 1.02e_2' - \frac{1}{45} (e_1' + e_3')$ 
 $e_3 = e_3' - \frac{1}{45} e_1'$ 

The symbols e1', e2', and e3' have here been used instead of R1, R2, and R3, given in the original directions, to conform with the other symbols in the present report.

# APPENDIX B

ANALYSIS OF STRAIN INDICATIONS GIVEN BY MULTIPLE-STRAND WIRE GAGES

The true strain  $e_{\theta}$  at an angle  $\theta$  to the direction of principal strain is given by the equation from reference 1

$$e_{\theta} = \frac{1}{2} \left[ (e_{x} + e_{y}) + (e_{x} - e_{y}) \cos 2\theta \right]$$
 (A-1)

in which ex and ev are the principal strains.

If the gage is attached at an angle 0 to the principal strain, the length of wire in the gage minus the width of the wire grid is subjected to the strain ea and the width of the gage is subjected to the strain at the angle  $(\theta + 90^{\circ})$ . The strain indicated by the gage is then expressed as follows:

$$\frac{\Delta R_{\theta}}{R_{\theta}} = c \left\{ \frac{1}{2} \left[ (e_{x} + e_{y}) + (e_{x} - e_{y})\cos 2\theta \right] \left( \frac{L - W}{L} \right) + \frac{1}{2} \left[ (e_{x} + e_{y}) + (e_{x} - e_{y})\cos 2(\theta + 90^{\circ}) \right] \left( \frac{W}{L} \right) \right\} (A-2)$$

in which

constant

change in resistance of gage divided by gage resistance

ex and ev principal strains

L and W previously defined

The strain indicated by the gage as normally calibrated, that is, with the axis of the gage parallel to the direction of simple tension or compression is therefore

$$\frac{\Delta R_{\text{C}}}{R_{\text{O}}} = c \left\{ \frac{1}{2} \left[ \left( e_{\text{X}} - \mu e_{\text{X}} \right) + \left( e_{\text{X}} + \mu e_{\text{X}} \right) \right] \right. \\ \left. \left( \frac{L - W}{L} \right) + \frac{1}{2} \left[ \left( e_{\text{X}} - \mu e_{\text{X}} \right) - \left( e_{\text{X}} + \mu e_{\text{X}} \right) \right] \left( \frac{W}{L} \right) \right\}$$

or

$$\frac{\Delta R_0}{R_0} = c \left[ e_X \left( \frac{L - W}{L} \right) - \mu e_X \left( \frac{W}{L} \right) \right] \tag{A-3}$$

For a simple tensile or compressive strain of unity ( $e_X=1$ ,  $e_Y=-\mu$ ), the result Q of dividing the strain indicated by the gage mounted at an angle  $\theta$  to the direction of  $e_X$ , and so subjected to a strain  $e_\theta$ , by the strain indication that would be calculated at that angle from substituting  $e_\theta$  in equation (A-3) is

$$Q = \frac{\frac{\Delta R_{\theta}}{R_{\theta}}}{\frac{\Delta R_{\theta}}{R_{\theta}}} = \frac{\frac{1}{2} \left[ (1-\mu) + (1+\mu)\cos 2\theta \right] \left( \frac{L-W}{L} \right) + \frac{1}{2} \left[ (1-\mu) + (1+\mu)\cos 2(\theta+90^{\circ}) \right] \left( \frac{W}{L} \right)}{\frac{1}{2} \left( \frac{L-W}{L} - \mu \frac{W}{L} \right) \left[ (1-\mu) + (1+\mu)\cos 2\theta \right]}$$

or 
$$Q = \frac{[(1-\mu)+(1+\mu)\cos 2\theta](L-W) + [(1-\mu)+(1+\mu)\cos 2(\theta+90^\circ)](W)}{(L-W-\mu W)[(1-\mu)+(1+\mu)\cos 2\theta]}$$

or 
$$Q = \frac{1}{1 - (1 + \mu) \frac{W}{L}} \left\{ 1 - \left[ \frac{2(1 + \mu)\cos 2\theta}{(1 - \mu) + (1 + \mu)\cos 2\theta} \right] \frac{W}{L} \right\}$$
 (A-4)

In order to show that Hill's semigraphical analysis may be applied to the readings given by multiple-strand wire gages to give the true principal strains, it is necessary to show that the variation in indicated strain with change of angle is a function of the form

If equation (A-2) is rewritten

$$\frac{\Delta R_{\theta}}{R_{\theta}} = (A + B \cos 2\theta) \frac{L - W}{L} + (A - B \cos 2\theta) \frac{W}{L} \qquad (A-5)$$

in which

$$A = \frac{e_X + e_Y}{2}$$

and

$$B = \frac{e_x - e_y}{2} \cos 2(\theta + 90^\circ) = -\cos 2\theta \left(\frac{e_x - e_y}{2}\right)$$

Then

$$\frac{\Delta R_{\theta}}{R_{\theta}} = A + B \frac{(L - 2W)}{L} \cos 2\theta \qquad (A-6)$$

Equation (A-6) is in the required form and Hill's semigraphical method may be used if the proper corrections are applied to the adjustment factor K and to the ordinate of the auxiliary horizontal line. The constant K is given in reference 2 by

$$K = 0.707 \sqrt{(e_1 - e_2)^2 + (e_2 - e_3)^2}$$

in which  $e_1$ ,  $e_2$ , and  $e_3$  are the true strains measured on gage lines intersecting at angles of  $45^{\circ}$ .

In order to calculate the new adjustment factor  $K_r$ , it is necessary only to find the relation between the principal strain as indicated by multiple-strand gages and the true principal strains. The principal strains indicated by the multiple-strand gage, when the true strainsensitivity factor is used, are

$$e_{x}^{1} = \frac{e_{1}^{1} + e_{3}^{1}}{2} + K^{1}$$
 (A-7)

$$e_y! = \frac{e_1! + e_3!}{2} - K!$$
 (A-8)

with

$$K_{45}' = 0.707 \sqrt{(e_1' - e_2')^2 + (e_2' - e_3')^2}$$

in which e<sub>1</sub>', e<sub>2</sub>', and e<sub>3</sub>' are the strains indicated by the wire gages.

Equation (A-2) also gives  $e_X^i$  and  $e_Y^i$  when  $\theta=0^\circ$  and  $\theta=90^\circ$ , respectively, as follows:

$$e_{x'} = \frac{1}{2} [(e_{x} + e_{y}) + (e_{x} - e_{y})] \left(\frac{L - W}{L}\right) + \frac{1}{2} [(e_{x} + e_{y}) - (e_{x} - e_{y})] \left(\frac{W}{L}\right)$$

$$e_{x}' = e_{x} \left( \frac{L - W}{L} \right) + e_{y} \left( \frac{W}{L} \right)$$
 (A-9)

and

$$e_y' = e_y \left(\frac{L - W}{L}\right) + e_x \left(\frac{W}{L}\right)$$
 (A-10)

Combining equations (A-7) and (A-9) and equations (A-8) and (A-10) and solving for  $e_{\rm X}$  and  $e_{\rm y}$  gives

$$e_{X} = \frac{e_{1}' + e_{3}'}{2} + K' \left(\frac{L}{L - 2W}\right)$$
 (A-11)

$$e_y = \frac{e_1' + e_3'}{2} - K! \left(\frac{L}{L - 2W}\right)$$
 (A-12)

The expression for K, as given by Hill, may be written

$$K = 0.707 \sqrt{(e_x - e_{45})^2 + (e_{45} - e_y)^2}$$
 (A-13)

in which  $e_{45}$  is the true strain at an angle of  $45^{\circ}$  to principal strains. From equation (A-2)

$$e_{45} = \frac{1}{2} (e_x + e_y) \left( \frac{L - W}{L} \right) + \frac{1}{2} (e_x + e_y) \left( \frac{W}{L} \right)$$
 (A-14)

Combining equations (A-11), (A-12), and (A-14) gives

$$e_{45} = \frac{1}{2} \left[ \frac{e_{1}' + e_{3}'}{2} + K' \left( \frac{L}{L-2W} \right) + \frac{e_{1}' + e_{3}'}{2} - K' \left( \frac{L}{L-2W} \right) \right] \left( \frac{L-W}{L} + \frac{W}{L} \right) (A-15)$$
and
$$e_{45} = \frac{e_{1}' + e_{3}'}{2}$$

$$(A-16)$$

From the expressions for  $e_{\rm X}$ ,  $e_{45}$ , and  $e_{\rm y}$ , an expression for  $K_{\rm r}$  may be written

$$K_r = 0.707 / (e_x - e_{45})^2 + (e_{45} - e_y)^2$$
 (A-13)

$$K_{r} = 0.707 \sqrt{\left[\frac{e_{1}' + e_{3}'}{2} + K'\left(\frac{L}{L - 2W}\right) - \frac{e_{1}' + e_{3}'}{2}\right]^{2} + \left[\frac{e_{1}' + e_{3}'}{2} - \frac{e_{1}' + e_{3}'}{2} + K'\left(\frac{L}{L - 2W}\right)\right]^{2}}$$
 (A-17)

$$K_{r} = K! \left(\frac{L}{L - 2W}\right) \tag{A-18}$$

and for the new ordinate Yr

$$Y_{r} = \frac{\frac{e_{x}}{K_{r}} + \frac{e_{y}}{K_{r}}}{2}$$
 (A-19)

$$Y_{r} = \frac{e_{1}! + e_{3}!}{2} + K_{r} + \frac{e_{1}! + e_{3}!}{2} - K_{r}$$

$$Y_{r} = \frac{\frac{e_{1}!}{K_{r}} + \frac{e_{3}!}{K_{r}}}{2}$$
 (A-20)

or

$$Y_r = Y! \left(\frac{L - 2W}{L}\right) \tag{A-21}$$

TABLE 1

COMPARISON OF STRAIN MEASUREMENTS TAKEN WITH TUCKERMAN OPTICAL STRAIN

GAGES AND WITH SR-4 TYPE R-1 ROSETTES

[All strains given in microin. per in.]

T	True	Electrical strain indications				Electrical strains			
(deg)	strain (av. of	Uncorrected (Gage factor = 2.09)		Corrected by method		Corrected as indi-		Corrected by Hill's semigraphical analysis	
	Tuckerman readings)	Reading	Difference from true value	Reading	Difference from true value	Reading	Difference from true value	Reading	Difference from true value
0	-981	-979	2	-992	-11	-979	2	-978	3
112	-922	-919	3	-930	-8	-918	14	-919	3
221/2	-751	-751	0	-758	-7	-749	2	-749	2
331	-496	-500	-4	-502	-6	-494	2	-494	2
45	-194	-203	9	-198	-)+	-193	1	-192	2
564	121	108	-13	119	-2	. 124	3	122	1
67출	362	345	-17	362	0	362	0	362	0
783	534	515	-19	535	1	534	0	534	0
90	593	572	-21	594	1	593	0	593	0

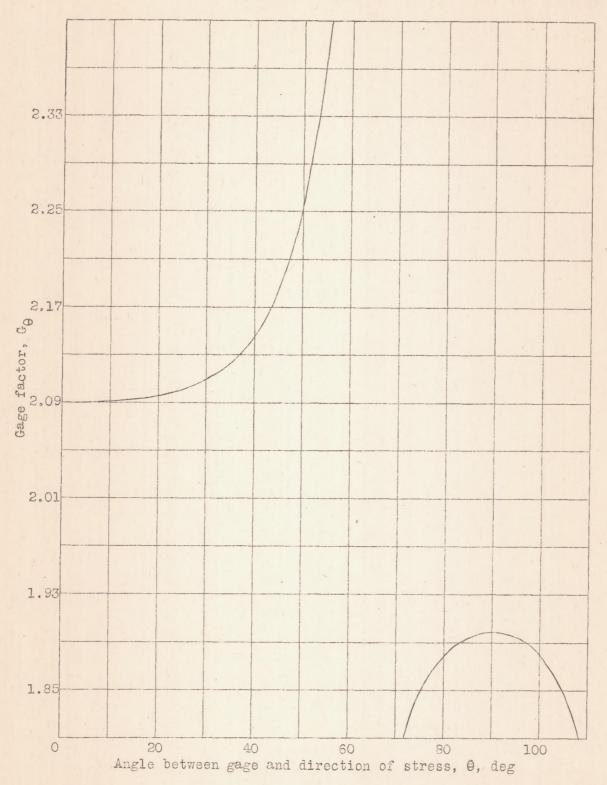


Figure 1.- Variation in gage factor with angle between SR-4 type A-1 gage and direction of stress. Ga = 2.09; L=5.01 inches; W=0.16 inch.

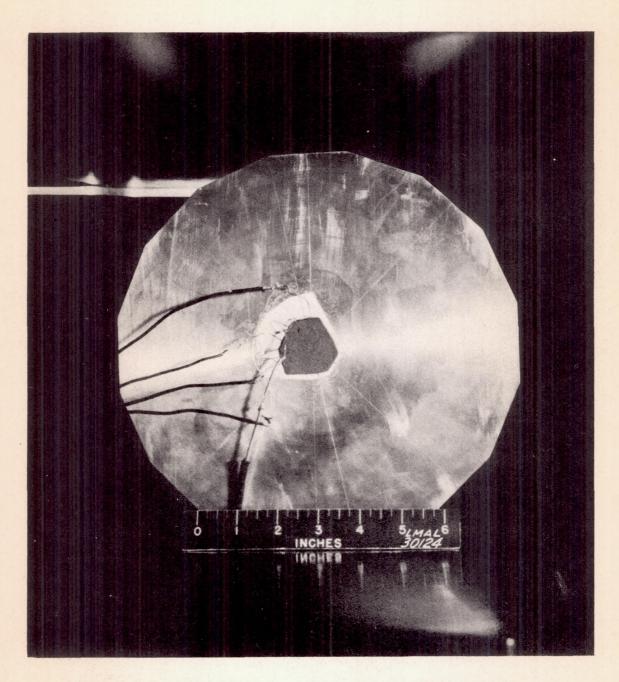


Figure 2. Polygonal specimen for testing rosettes.