

Shearographic Non-Destructive Evaluation of Space Shuttle Thermal Protection Systems

Christopher K. Davis, NASA
Jeffery A. Hooker, INET
Stephen M. Simmons, INET
Kenneth E. Tenbusch, NASA

John F. Kennedy Space Center, Florida

ABSTRACT

Preliminary results of shearographic inspections of the shuttle external tank (ET) spray-on foam insulation (SOFI) and solid rocket booster (SRB) Marshall sprayable ablative (MSA-2) epoxy-cork thermal protection systems (TPS) are presented. Debonding SOFI or MSA-2 damage the orbiter "belly" tile and exposes the ET/SRB to thermal loading.

Previous work with the ET/SRB showed promising results with shearography. The first area investigated was the jack pad close-out, one of many areas on the ET where foam is applied at KSC. Voids 0.375 inch were detected in 1.75 inch thick foam using a pressure reduction of less than 0.4 psi. Of primary interest are areas of the ET that directly face the orbiter tile TPS. It is estimated that 90% of tile TPS damage on the orbiter "belly" results from debonding SOFI during ascent. Test panels modeling these areas were manufactured with programmed debonds to determine the sensitivity of shearography as a function of debond size, SOFI thickness and vacuum. Results show repeatable detection of debonds with a diameter approximately half the SOFI thickness at less than 0.4 psi pressure reduction. Preliminary results are also presented on inspections of MSA-2 and the remote manipulator system (RMS) honeycomb material.

1. PROBLEM DESCRIPTION

1.1 External tank (ET)

The ET thermal protection is provided by SOFI on the launch pad and during the ascent portion of the flight. Four types of SOFI are used: NCFI in the aft dome and CPR everywhere else except for KSC close-outs. BX-250 and PDL foam are used for KSC Close-outs. Many KSC close-outs are poured with the ET vertical; the foam expands unevenly causing voids and surface contamination on the substrate may cause debonds.

Debonding SOFI causes most of the damage to the orbiter "belly" tile and exposes the ET to point thermal loading. At present no non-destructive techniques for evaluation of TPS on the ET have been approved for use at KSC. Only pull tests on representative test panels are conducted to determine the integrity of the SOFI bond to the aluminum substrate of the ET. Of the techniques available, laser shearography provides good detectability and sensitivity to the areas of concern and provides sufficient immunity to environmental conditions, such as vibration, to be used in the field. Results with Shearography have detected debonds with a diameter approximately half of the SOFI thickness with less than 0.4 psi pressure reduction.

2.3 Description of system

The current Shearography System being implemented at KSC consists of the following: (1) a 750 mW Krypton-Ion laser, (2) a shearographic camera using a birefringent shearing optic, (3) an image processor, (4) an acoustic horn and controller, (5) a heat gun for thermal stressing, (5) a vacuum hood with an integral camera and controller.

The laser is tuned to a wavelength of 641 nm which provides excellent reflectivity off of the SOFI. Both vacuum and acoustic controllers permit automatic testing to permit high inspection rates once test parameters are established.

The light from the laser is fed to the camera head by fiber optics. The camera head contains the CCD detector, shearing optics and controls to adjust the size and position of the spot of laser illumination being projected on to the surface. The field of view and focus of the camera can be controlled remotely. The controller processes the images containing the speckle phase information and displays the results at video rates.

3. KSC TESTING WITH SHEAROGRAPHY

3.1 Historical reports

Laser Technology Incorporated (LTI) and Marshall Space Flight Center (MSFC) have successfully tested the ET SOFI and the SRB MSA-2 with shearography. LTI received a set of test panels from MSFC and performed a blind test. All programmed debonds as small as one inch in two inches of SOFI were detected. Pressure reduction stressing of 5 inches or less of water provided adequate surface deflection. When debonds were so large as to create leak paths, acoustic excitation of up to 120 dB was substituted for vacuum stressing.

LTI tested an entire cone shaped SRB Forward Section with a 75 inch base diameter and 78 inch height. LTI observed the programmed debonds prior to MSA-2 application. A test chamber provided pressure reduction stressing of up to 2 psi (normally .2 psi). LTI also used acoustic excitation of 120 dB and thermal stressing. Vacuum stressing was the most sensitive detecting debonds as small as 0.375 inch in diameter. Acoustic stressing detected debonds as small as 0.75 inch in diameter. Thermal stressing in conjunction with peak value detection imaging provided results similar to acoustic stressing. Shearography detected all preplanned debonds and 8 unplanned debonds. ³

3.2 Jack pad close-out

The ET jack pad is a 4.5 inch square located near both aft bipod struts. Ground Support Equipment (GSE) connected to the Jack Pad at 4 attach bolt locations guides the ET to mate to the Solid Rocket Boosters (SRB). After mating KSC technicians apply PDL foam to the area. SOFI is the surrounding material and Aluminum is the substrate.

This close-out has had a history of debonds and voids culminating with both jack pad close-outs completely debonding and separating from the ET in April 1994 during STS 59/OV-105 ascent. Partial debonding has occurred numerous other missions. The problematic nature of this close-out prompted some kind of inspection prior to flight and shearography was the only NDI method available at KSC. This area is also one of many areas on the ET to which unique a geometry and access require a dedicated NDI procedure.

The test panels and defects were configured as closely as possible to the ET flight article. A 11 inch by 9 inch surface was sprayed with BX-250 and a 4.5 inch square was removed from the center. Fourteen panels were created. Twelve panels were used to test the a new close-out foam configuration in which the 4.5 inch square is replaced with four 1 inch diameter holes in order to reduce the surface area of the close-out. These panels were destructively inspected to determine the benefits of the new application technique. The remaining two panels (panel 10 and panel 12) were used to simulate debonds and voids using the established close-out configuration. "Balloons" ranging from 0.375 and 1.5 inch diameter glued to the substrate simulated voids. Two pieces of Teflon tape, placed face to face, simulated debonds.

Both test panels were sent to LTI, who had facilities to adequately test the panels. LTI knew only how the defects were created. The test articles were inspected using pressure reductions of 2, 5, and 10 inches of water with vertical and horizontal shear vectors.

LTI found 3 strong indications and 3 weak indications in panel 10. The strong indications correctly located the 3 programmed flaws of 0.75, 1.0 and 0.375 inch. The 3 weak indications corresponded to porosity or collection of voids with diameters between 0.125 and 0.25 inch. This porosity is located at the SOFI/BX-250 interface, which represents the perimeter of the close-out. The perimeter of the close-out has an adhesive applied to it before the BX-250 close-out foam is applied. LTI verified this porosity in panel 10 by destructive evaluation.

LTI found 2 strong indications and 5 weak indications in panel 12. KSC destructively inspected this panel. One strong and two weak indications corresponded to a 1.5 by 0.785 inch face to face Teflon debond. This indication was obscured by a nearby strong indication that turned out to be porosity or a collection of voids with diameters between 0.125 and 0.25 inch within one inch of the debond. This porosity was an unintentional defect introduced by the foam application process. Another weak indication correlated to a 0.375 inch diameter void. The final two weak indications corresponded to porosity at the SOFI/BX-250 adhesive interface⁴.

Though there was not a direct one-to-one correlation between programmed flaws and shearographically indicated flaws, all the flaws, were detected. In addition, the unintentional flaws, introduced by the problematic foam application process were detected. This effort was terminated when the manufacturer of the ET decided to go to the new close-out configuration on a permanent basis. Nevertheless, the ability of shearography to detect debonds and voids was demonstrated and the next logical step was to characterize the sensitivity of shearography for the majority of the remaining areas of concern.

3.3 SOFI Test Panels

There were three test panels fabricated for this investigation. It was desirable to have a larger set of panels to increase the data set, however, due to time and availability constraints the test specimens were limited to three. Every effort was made to maximize the information content of each panel.

3.3.1 SOFI Test Panel Construction

Each test panel was constructed from a 24-inch square aluminum substrate with a nominal thickness of 0.125 inch. The substrate was prepared with a two-part epoxy primer by Martin Marietta corporation⁵. Prior to applying the programmed debonds the primer

was prepared to a water-break-free surface by cleaning with distilled water and a freon wash.

The programmed debonds were prepared by the Teflon sandwich method in which two thin sheets of Teflon are cut to the desired shape, placed face-to-face and covered with a thin layer of tape to maintain debond integrity. The debonds were placed close enough to each other on the test panels to maximize the number of debonds per panel but not so close as to interfere with each other during testing.

Programmed debonds consisted of symmetric and asymmetric geometry's. Circular and square debonds were created ranging from 0.5 inch to 2 inches in 0.25 inch increments. There are also seam/strip debonds and "L" shaped debonds to determine the dependency of detectability on shear vector orientation. Also incorporated in the test panels are annular debonds and groups of debonds placed in close proximity to determine the ability of the system to spatially discriminate flaws which may be separate but closely spaced. A resolution debond was constructed from a triangle approximately 12 inches in height with a 4 inch base. This debond was used to help determine the a detectability threshold for SOFI depth verses flaw extent.

The test panels were sprayed with standard SOFI equipment used at KSC to a nominal thickness of 3 inches. Subsequently, the panels were planed off to a thickness of 1.5 inches.

3.3.2 SOFI Test Panel Inspection

Each panel was inspected with two field of views with four orientations of the shear vector in each view. The first view consisted of the entire 24 inch square panel. Using this field of view the entire panel was inspected using a vertical shear vector, a shear vector 45 degrees off of vertical, a horizontal shear vector and a shear vector 135 degrees off of vertical. The field of view was then reduced to an area which sub-divided the test panel in to nine sub-areas with some overlap between adjacent sub-areas. Each of the nine sub-areas were then inspected, again, with the four shear vector orientations. This process was carried out for each of the three test panels at a fixed SOFI thickness.

Two to three inspectors were present during all testing and the panels were tested in random order. A scale was developed for use in grading the detection of the flaws. The grades were assigned with a value of 1 to 10 and the following criteria was used:

- 1 A perceived non-uniform disturbance in the image when observed under dynamic stress (metaphysical detection).
- 2 A non-uniform disturbance in the image observed under static stress.
- 3 An apparent separation of two areas (derivative) under dynamic stress warrant future investigation.
- 4 A surface deflection sufficient to cause single phase step resulting in uniformly bright doublet with no secondary fringes. Considered to be a detection of a flaw.
- 5 A surface deflection sufficient cause the formation of a double bullseye i.e. one complete set of fringes. (Light / dark pair)
- 6 A surface deflection sufficient to cause the formation of two sets of fringes.
- 7 A surface deflection sufficient to cause the formation of three sets of fringes.
- 8 A surface deflection sufficient to cause the formation of four sets of fringes.
- 9 A surface deflection sufficient to cause the formation of five sets of fringes.
- 10 A surface deflection sufficient to cause the formation of six or more sets of fringes.

For the purposes of flaw identification a grade of 4 or higher is considered to be a detection. A grade of 3 would be cause for additional testing e.g. by zooming in on an area of grade 3 the image is enhanced and the area may then be upgraded to 4 if it meets the criteria.

When the inspection of all panels were completed the SOFI was then reduced by a quarter of an inch and the entire test procedure was repeated. This process continued until the SOFI was reduced to a thickness of 0.5 inch. The nominal thickness of the SOFI on the external tank is 1 inch and as such extra data was taken at that thickness. This is discussed in more detail below.

3.3.3 Additional Testing

Data at all thicknesses and views were typically performed at with 1 inch of water vacuum. Full panel views were performed at a nominal laser power of 500 mw and area testing was performed at 100 mw. Additional testing at the nominal foam thickness of 1 inch included vacuums of 1, 5, 10, and 15 inches of water in the full panel views and 1 and 10 inches of water in the small area testing. No detectability enhancement was observed for various vacuum levels for the SOFI. Shown below in FIGURE 1 is a typical shearogram showing debonded areas in 1 inch of SOFI at a vacuum of 1 inch of water

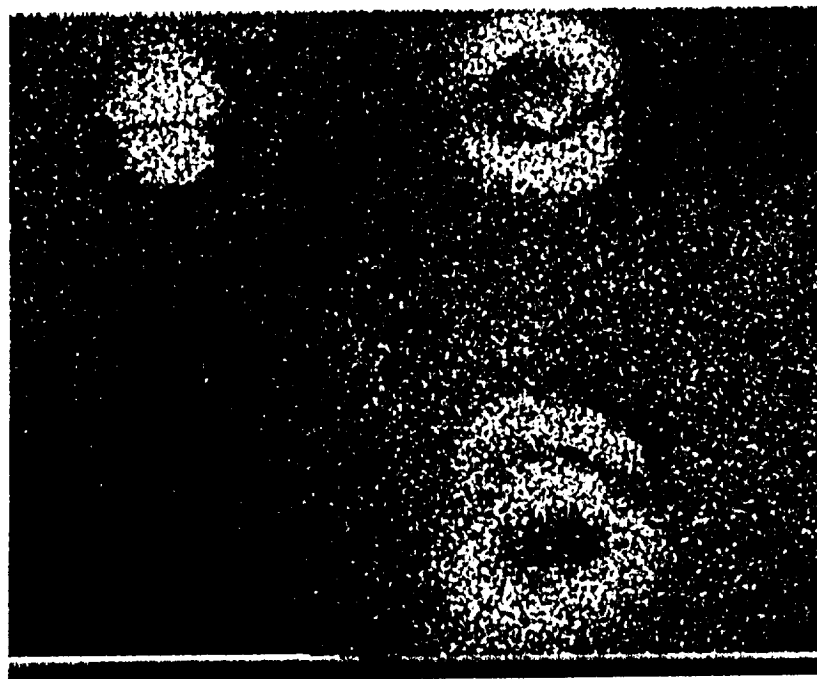


FIGURE 1: A shearogram of debonds in SOFI. The SOFI thickness is 1 inch and a vacuum of 1 inch of water has been applied. The debond in the upper left corner is a 1 inch square, the debond in the upper right corner is a 1.5 inch circle and the debond in the lower right corner is a 2 inch circle. There is a 0.5 inch debond present in the lower left corner but it is not quite visible in this image.

3.3.4 Preliminary results of SOFI testing

The preliminary results of the SOFI testing indicate that debonds with dimensions along the direction of the shearing on the order of the foam thickness were easily detectable and flaws with dimensions on the order of half the foam thickness were often detected and a significant number of even smaller defects were observed. The shearing optics in the camera used in testing had a 0.5 degree shearing angle, a limited number of images were taken with 1 degree shearing optics. The 1 degree camera did not provide any additional detections, but did provide better fringe visibility. Preliminary data showing defect detection as a function of defect size and SOFI thickness are shown below in CHART 1.

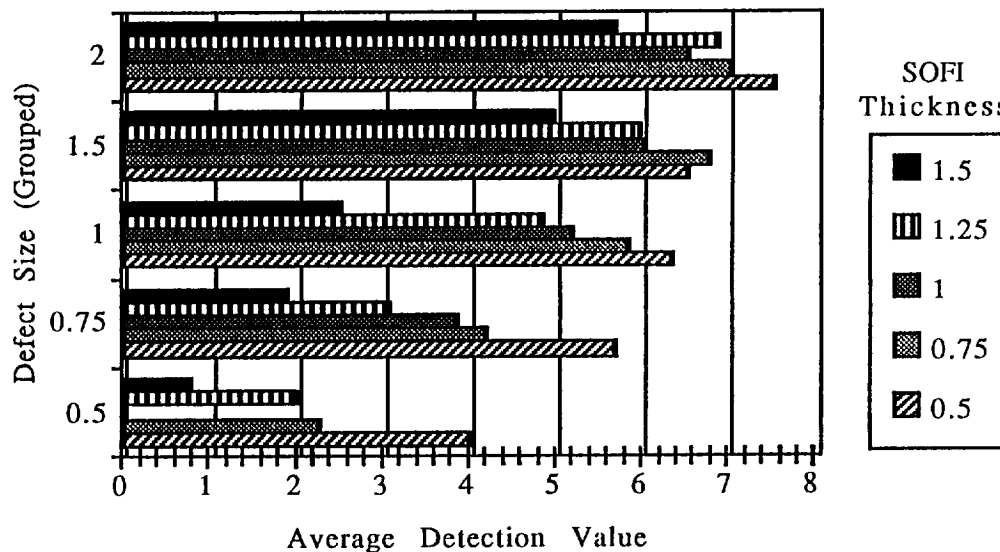


CHART 1: Average detection values of debonds in SOFI at a vacuum of 1 inch of water. Values of 4 or greater are detects.

The inspection of the SOFI test panels was very extensive resulting in a data base of over 600 images and nearly a 1000 datum. The testing began in November of 1994 and was just recently concluded in March of 1995. A probability of detection (POD) analysis has begun on this data in an effort to establish the reliability of shearography for use on ET SOFI and begin the process of standardizing the instrument for field operations. A complete report containing the entire POD analysis, all data and a detailed description of the experiment is expected to be completed in May of 1995.

3.4 K5NA SRB ablative material

A 24 inch square test panel consisting of K5NA ablative material 0.25 inch thick on an aluminum substrate was available and was tested using shearography. The K5NA material reacted well to thermal and acoustic stressing, however, vacuum stressing provided the best and most repeatable results. The authors have no knowledge of the

method used to program the debonds on the panel and therefore the results shown below are provided only to indicate the possible effectiveness of laser shearography in detecting debonds in K5NA material. With a pressure drop of 1 inch of water defects ranging from less than 0.25 inch to 2 inches in extent were detected. Shown below in FIGURE 2 is a shearogram of the 2 inch defect containing many fringe pairs.

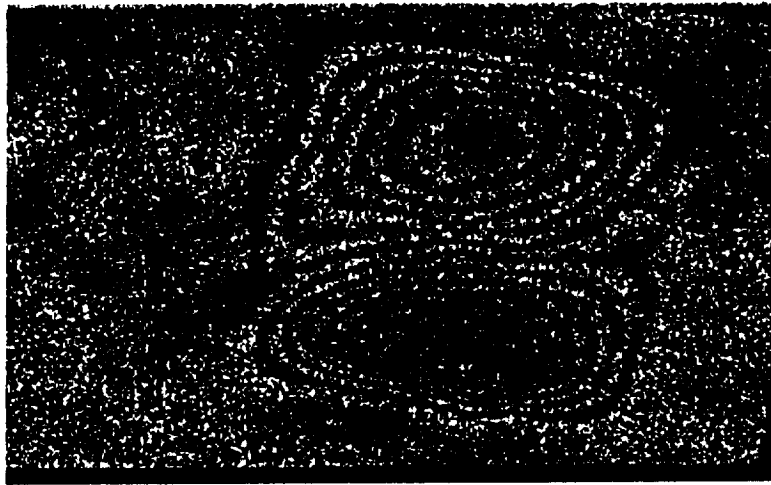


FIGURE 2: Shearogram of a 2 inch debond in 0.25 inch of K5NA cork-epoxy material at a vacuum of 1 inch of water.

3.5 Robotic Manipulator System (RMS) Inspection

Shearographic inspection of RMS, P/N: 51140F5-5, serial number -202 (Manufacturer date: May 1993), occurred in two intervals, the lower arm and the upper arm. The RMS hung in the GSE, providing access to approximately 75 % of the honeycomb structure. The remaining 25%, is partially obscured by wire bundles and GSE. The area obscured by the GSE is inspectable while the RMS is installed in the midbody of the orbiter. First, thermal stressing identified all the defects. Next, with automated acoustic testing, the debonds in the upper arm were re-inspected. The field of view was about nine inches square, partly limited by the curvature of the 13.5 inch outer diameter of the RMS.

Shearography detected the following two debonds to the lower arm:

Debond 1: 0.50 to 0.75 inches in diameter, located 57 inches from elbow joint, and at 8 o'clock (facing aft); suspect kevlar to honeycomb debond

Debond 2: 3.5 to 4 inches wide by 2 inches high (elliptical/oval shaped) located 56 to 60 inches from elbow joint at 4 o'clock (facing aft); suspect honeycomb to graphite-epoxy.

Shearography detected the following three debonds to the upper arm:

Debond 3: A series of debonds located 1 to 4 inches from elbow joint, running circumferentially from 1 to 9 o'clock (facing aft). This coincides with a lap joint connecting the joint to the honeycomb.

Debond 4: A series of debonds located 105 to 107 inches from elbow joint, running circumferentially from 2 to 9 o'clock (facing aft). This coincides with a lap joint connecting the joint to the honeycomb.

Debond 5: A series of debonds located 2 to 4 inches from the wrist joint hinge, running circumferentially from 3 to 7 o'clock (facing aft). This coincides with a lap joint connecting the joint to the honeycomb.

Several visually detected "bubbles" were only surface irregularities and were not debonds. Thermal stressing detected debonds as small as 0.5 inch; however, the acoustic stressing provided sensitivity as small as an individual honeycomb cell, the maximum sensitivity required. The thermal stressing required only a short 2-3 second heating period distributed evenly over the field of view and 30 seconds afterward to detect any debonds. Automated acoustic stressing operated at 110 to 120 decibels and a frequency sweep between 2 and 15 kilohertz. Acoustic test time was 2 seconds with 2 to 4 sweeps per test.

Post-test image enhancement improves the quality of the image. FIGURE 3 below is a shearogram of Debond 1 described above. As an option, Pseudocoloring can improve the identification of the debond.

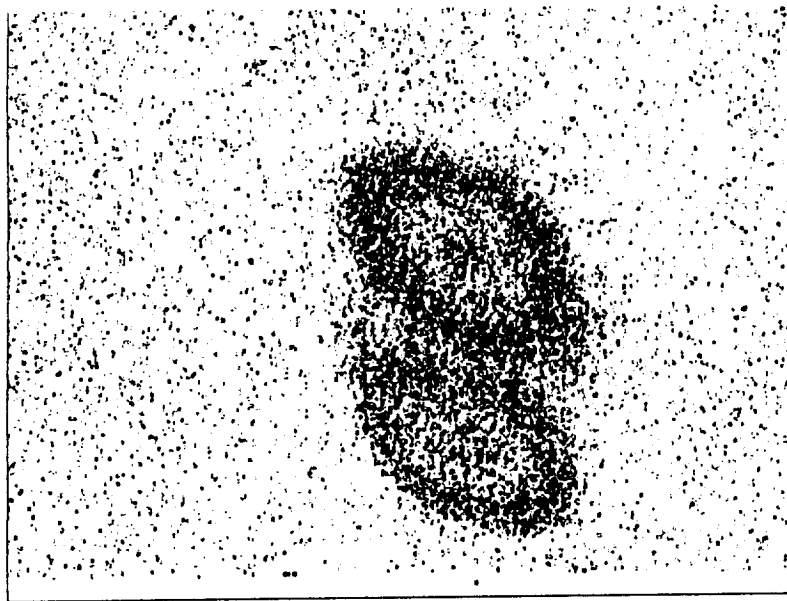


FIGURE 3: An image enhanced shearogram of Debond 1 found on the RMS.

A ten flight interval inspection of this honeycomb was rescinded by the Design Center when no NDI method was available to inspect this area of the RMS. Though shearography is not a certified inspection procedure, system engineers will use the results to determine the integrity of the honeycomb. These known debonds are not considered

mission threatening, nor even structurally significant, at this time. Until the Design Center develops accept/reject criteria, shearography will inspect all RMS on a ten flight interval to monitor/detect any debonds.

3.6 New Composite Nose Cone (CNC) and Ogive

As part of the weight savings effort for the Space Station, a new Composite Nose Cone (CNC) is under development. The test article consists of graphite-phenolic nose cone and the new CFC-free foam on the Ogive (the transition area between the nose cone and the cylindrical portion of the ET). The 18 ply 0.243 inch thick graphite-phenolic CNC and the 0.286 to 0.215 inch thick SOFI covering the Ogive are undergoing a series of cryogenic cycling simulating launch conditions. After all testing is complete in August, shearography will test both components for debonds and delaminations in the CNC.

The aforementioned results determined that vacuum stressing provided the greatest sensitivity to SOFI. Acoustic stressing, somewhat less sensitive, was necessary when large debonds created a leak path. Vibration, vacuum, and thermal stressing applies to the CNC. Vibration stressing, the optimal technique, requires development as it is not available at KSC now, however, equipment necessary to facilitate this form of stressing is expected by June.

In preparation for the August test, contoured interfacing "feet" were fabricated and retro-fitted to the existing vacuum hood. This should provide minimal loading against the SOFI or graphite-phenolic. Based on previous experience on the SOFI foam it is estimated that a 0.5 psi or less pressure reduction should be sufficient to detect flaws on the Ogive area. Acoustic stressing parameters require definition for use on the SOFI and vibration stressing parameters require definition for use on the CNC.

4. ET Implementation Plan

4.1 ET Flight Vehicle

Based on these preliminary investigations shearography seem a promising NDI technique for the ET TPS. In order to incorporate this new non-certified NDI technique in to KSC operations the following Implementation Plan is being proposed. It is believed that utilizing shearography as part of the normal vehicle flow will reduce, if not eliminate the problems of debonding TPS.

- Complete testing of the CFC-free TPS on Ogive & graphite-phenolic CNC. This is one of the most unique areas of the ET.
- Coordinate the results of all aforementioned testing with the Design Center. Determine maximum stressing levels. Determine negligible/acceptable defect/debond size. Determine method to verify sensitivity of shearography inspection of KSC close-outs and incidental damage of the rest of the ET TPS due to handling or operations.
- Fabricate all interfacing equipment and specific support equipment for testing the ET or SRB in the VAB.

5. Conclusions

Shearography is an excellent NDI technique for TPS inspection of the ET and the SRB. Implementation of shearography should greatly reduce damage to the orbiter belly tile resulting from debonding ET SOFI. Any reduction in tile damage translates to a large cost savings for the Space Shuttle program. The accurate detection of defects permits foam application improvements as well as assessing handling and maintenance induced damage. Reliable detection of flaws on the ET and SRB contributes not only to cost savings but also to the safety of those who fly aboard the Space Shuttle.

Shearographic inspection of composites used for structure on the Orbiter requires development. The more rigid composite structures are more sensitive to acoustic stressing, particularly in the ultrasonic range. KSC is in the process of acquiring instrumentation which will facilitate acoustic stressing in the frequency ranges most suitable for composite materials. Given the abundant use and many types of composites on the Orbiter, an efficient and effective NDI technique will enhance safety and reduce processing costs.

6. References

1. Hung, Y. Y., "Shearography: A New Optical Method for Strain Measurement and Nondestructive Testing," Opt. Eng., 391-395 (May/June, 1982)
2. Owner-Peterson, M., "Digital Speckle Pattern Shearing Interferometry: Limitations and Prospects," Appl. Opt. 30, 2730-2738 (1991)
3. LTI Report "Advanced Shearography NDT demonstration," MFSC, 28 January to February 2, 1991
4. LTI Report "Shearography Inspection of Spaced Shuttle ET Jack Pad SOFI Close-out," KSC. 20 June 1994
5. Martin Marietta Report, "Shearographic NDE for External Tank TPS," T.D. 3.6.2.1-651-R14