A STUDY OF THE PLANE STRESS OR STRAIN FINITE ELEMENT ANALYSIS FOR SOLUTION OF STRESS DISTRIBUTION IN PLANE ELASTIC CONTINUA

by

THOMAS C. HELBING

B. S., Kansas State University, 1965

AN ABSTRACT OF A MASTER'S REPORT

submitted in partial fulfillment of the

requirements for the degree

MASTER OF ARCHITECTURE

College of Architecture and Design

KANSAS STATE UNIVERSITY
Manhattan, Kansas

1969

The "finite element method" for solution of stress distribution in a plane elastic continuum is studied in this report. This numerical method of stress analysis can be used for obtaining a solution to problems, which heretofore relied upon approximate calculations of doubtful validity. The finite element analysis, when coupled with a high-speed computer, can provide quick solutions that converge to "exact method" answers.

O. C. Zienkiewicz and Y. K. Cheung[1] have presented the theory behind the finite element method and a computer program which applies the plane stress or strain finite element analysis to a plane elastic continua. The theory of the finite element method and the computer program are included in this report.

A plane elastic continua is divided into a finite number of nodal points which are interconnected to form triangular elements. Force-displacement relationships are determined for these triangular elements. "Displacement method" equations[2] in matrix notation are formed with the displacements of the nodal points as unknowns. Inversion of the force-displacement matrix and multiplication by the force matrix leads to a solution for the unknown displacements. These displacements are used to calculate the stresses at the centroids of the triangular elements which are then converted to principal stresses and their angles of deviation from the original X-Y coordinate system.

The finite element method computer program taken from reference 1 is written in FORTRAN IV language and is intended for use on an IBM 360 series computer. Detailed flow charts of the main program and its subroutines are included in the report, along with a listing of the operational program and an explanation of the data preparation for the program.

The accuracy of the stress solutions obtained using the finite element method program is dependent upon the fineness of the triangular grid. An infinite number of combinations of loading and support conditions can be approximated using this method.

Two example problems are included in this report. One example shows the solution of a simple problem based on a well-known "classical" method compared to the solution using the computer program. The other example shows the solution of a complex problem, namely, the calculation of the stress distribution around a rectangular hole in the web of a wide-flange beam.

A STUDY OF THE PLANE STRESS OR STRAIN FINITE ELEMENT ANALYSIS FOR SOLUTION OF STRESS DISTRIBUTION IN PLANE ELASTIC CONTINUA

by

THOMAS C. HELBING

B.S., Kansas State University, 1965

A MASTER'S REPORT

submitted in partial fulfillment of the

requirements for the degree

MASTER OF ARCHITECTURE

College of Architecture and Design

KANSAS STATE UNIVERSITY
Manhattan, Kansas

1969

Approved by:

Major Professor

TABLE OF CONTENTS

SYNOPSIS

The "finite element method" for solution of stress distribution in a plane elastic continuum is studied in this report. This approximate method of analysis can be used for obtaining a solution to previously intractable problems. An existing "finite element method" computer program is made operational as a requirement of the report. A simple problem will be solved using a classical "exact method" and will then be analyzed using the "finite element method" to get an idea of the correspondence of the results of the two methods. A problem for which a "classical method" does not exist will then be analyzed using the "finite element method" to illustrate the power of its application.

INTRODUCTION

Structural analysts are becoming increasingly aware of the power of numerical methods in providing reasonably accurate solutions to complex problems which heretofore relied upon approximate calculations of doubtful validity. The plane stress or strain finite element analysis is one of these numerical methods which, when coupled with a high-speed computer, can provide quick solutions that converge to "exact method" answers.

O. C. Zienkiewicz and Y. K. Cheung[1], in their book, have presented the theory behind the finite element method and a computer program which applies the plane stress or strain finite element analysis to a plane elastic continua.

The plane elastic continua is divided into a finite number of nodal points which are interconnected to form triangular elements. Force-displacement relationships are determined for these triangular elements. "Displacement method" equations[2] in matrix notation are formed with the displacements of the nodal points as unknowns. Inversion of the force-displacement matrix and multiplication by the force matrix leads to a solution for the unknown displacements. These displacements are used to calculate the stresses at the centroids of the triangular elements which are then converted to principal stresses and their angle of deviation from the original X-Y coordinate system.

The general "displacement method" equation is given as

$$\{F\}^e = [k]^e \{\delta\}^e + \{F\}_p^e \qquad (1)$$

in which $\{F\}^e$ represents the force matrix composed of forces at the nodal points, $[k]^e$ represents the force-displacement or stiffness matrix

determined from the element properties, $\{\delta\}^e$ represents the nodal displacement for a particular element, and $\{F\}_p^e$ represents the nodal forces due to body forces.

The general equation used to solve for the stresses is given as

$$\{\sigma\}^e = [S]^e \{\delta\}^e \qquad (2)$$

in which $\{\sigma\}^e$ represents the stress matrix composed of the stress in the X- and Y-directions and the shear stress, and $[S]^e$ represents the stress-displacement matrix determined from the material properties. A further explanation of equations (1) and (2) will be given in the section on derivations.

The finite element method computer program taken from reference 1 and included in this report is written in FORTRAN IV language and in its present form is intended for use on an IBM 360-series computer.

Even though it is limited to the solution of problems which lie in the X-Y plane, the finite element program (FINELEM) has a wide range of application. Each element can have one of up to 10 different sets of elastic properties for a given problem and any constant thickness.

The program is not limited to isotropic materials. Anisotropic materials, which are "stratified" and have rotational symmetry in the plane of the strata, can also be solved. When the direction of the strata in a transversely isotropic material is inclined to the X-axis, a transformation matrix included in the program relates the stresses back to the major X-Y coordinates.

The accuracy of the stress solutions obtained using FINELEM is dependent upon the fineness of the triangular grid. An area of a certain problem with an expected high stress or variable stress should be divided into a finer grid than an area with an expected constant stress. An infinite number of combinations of loading conditions and support conditions can be approximated using this method.

In this report, a simple problem with a solution based on a well-known "classical" method is compared with the solution using FINELEM. The correctness of the program and the accuracy of the method is studied using this simple problem. Once the program is judged to be performing correctly, a complex problem is solved to illustrate the method's usefulness and versatility.

DERIVATIONS

The general equation

$$\{F\}^e = [k]^e \{\delta\}^e + \{F\}_p^e \tag{1}$$

containing the unknown displacements will now be presented in more detailed mathematical form.

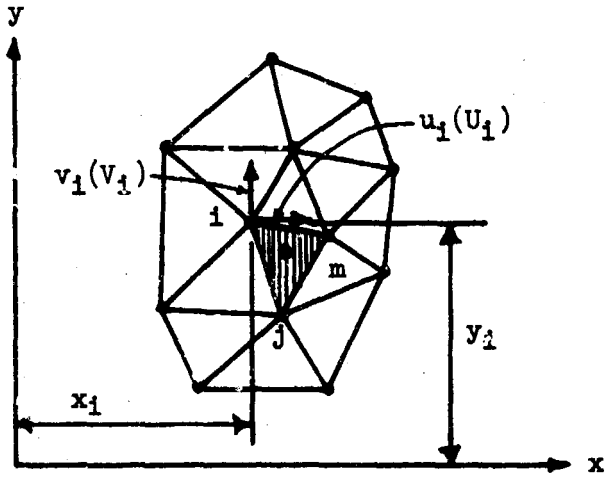

Fig. 1. A Plane Stress Region Divided Into Finite Elements.

A typical finite element, e, is defined by nodes i, j, m, etc., and straight-line boundaries. The displacements at any point within the element will be defined as a column vector, $\{f(x,y)\}$ or

$$\{f\} = [N]\{\delta\}^e = [N_i, N_j, N_m, \ldots] \begin{Bmatrix} \delta_i \\ \delta_j \\ \delta_m \\ \vdots \\ \vdots \\ \vdots \end{Bmatrix} \tag{3}$$

in which $[N]$ is a position matrix dependent upon the element geometry and $\{\delta\}^e$ is, as defined previously, a matrix composed of X and Y nodal point

displacements for a certain element. In the case of plane stress

$$\{f\} = \begin{Bmatrix} u(x,y) \\ v(x,y) \end{Bmatrix} \tag{4}$$

represents horizontal and vertical translocation of a typical nodal point within the element and

$$\{\delta_i\} = \begin{Bmatrix} u_i \\ v_i \end{Bmatrix} \tag{5}$$

the corresponding displacements of a node i. The six components of element displacements are listed as a vector

$$\{\delta\}^e = \begin{Bmatrix} \delta_i \\ \delta_j \\ \delta_m \end{Bmatrix} \tag{6}$$

The displacements within an element are uniquely defined by these six values. Two linear polynomials

$$\begin{aligned} u &= \alpha_1 + \alpha_2 x + \alpha_3 y \\ v &= \alpha_4 + \alpha_5 x + \alpha_6 y \end{aligned} \tag{7}$$

represent the relationship between the displacements. If the nodal coordinates are inserted and the displacements equated to the appropriate nodal

displacements, two sets of three simultaneous equations will arise in which the six constants α can be evaluated. For example,

$$\begin{aligned} u_i &= \alpha_1 + \alpha_2 x_i + \alpha_3 y_i \\ u_j &= \alpha_1 + \alpha_2 x_j + \alpha_3 y_j \\ u_m &= \alpha_1 + \alpha_2 x_m + \alpha_3 y_m \end{aligned} \tag{8}$$

We can solve for α_1, α_2, and α_3 in terms of the nodal displacements u_i, u_j, and u_m. We would finally obtain for the horizontal displacement

$$u = \frac{1}{2\Delta}\left[(a_i + b_i x + c_i y)u_i + (a_j + b_j x + c_j y)u_j + (a_m + b_m x + c_m y)u_m\right] \tag{9}$$

in which

$$\begin{aligned} a_i &= x_j y_m - x_m y_j \\ b_i &= y_j - y_m \\ c_i &= x_m - x_m \end{aligned}$$

$$\begin{aligned} a_j &= x_m y_i - x_i y_m \\ b_j &= y_m - y_i \\ c_j &= x_i - x_m \end{aligned} \tag{10}$$

$$\begin{aligned} a_m &= x_i y_j - x_j y_i \\ b_m &= y_i - y_j \\ c_m &= x_i - x_i \end{aligned}$$

and where

$$2\Delta = \det \begin{vmatrix} 1 & x_i & y_i \\ 1 & x_j & y_j \\ 1 & x_m & y_m \end{vmatrix} = 2(\text{area of triangle } ijm) \tag{11}$$

Similarly, the equation for vertical displacement would be

$$v = \frac{1}{2\Delta}\left[(a_i + b_i x + c_i y)v_i + (a_j + b_j x + c_j y)v_j + (a_m + b_m x + c_m y)v_m\right] \tag{12}$$

with the same coefficients as were given in equation (10).

We can represent the relationships in equations (9) and (12) in the form of equation (3)

$$\{f\} = \begin{Bmatrix} u \\ v \end{Bmatrix} = [N]\{\delta\}^e = [IN_i', IN_j', IN_m']\{\delta\}^e \tag{13}$$

with I a two by two identity matrix and

$$N_i' = \frac{(a_i + b_i x + c_i y)}{2\Delta}$$

$$N_j' = \frac{(a_j + b_j x + c_j y)}{2\Delta} \tag{14}$$

$$N_m' = \frac{(a_m + b_m x + c_m y)}{2\Delta}$$

The calculation of the coefficients can be simplified if the coordinates are taken from the centroid of the element. The relationships[1]

$$x_i + x_j + x_m = y_i + y_j + y_m$$

and (15)

$$a_i = \frac{2\Delta}{3} = a_j = a_m$$

would result.

The displacement functions above automatically guarantee continuity of displacements with adjacent elements.

The strains, ϵ, at any point can now be determined from the displacements known at all points within the element. Written in matrix notation, this relationship is

$$\{\epsilon\} = [B]\{\delta\}^e \tag{16}$$

The total strain at any point within the element for the plane stress case can be defined in terms of the displacements by well-known relationships[3]

$$\{\epsilon\} = \begin{Bmatrix} \epsilon_x \\ \epsilon_y \\ \gamma_{xy} \end{Bmatrix} = \begin{Bmatrix} \frac{\partial u}{\partial x} \\ \frac{\partial v}{\partial y} \\ \frac{\partial u}{\partial y} + \frac{\partial v}{\partial x} \end{Bmatrix} \tag{17}$$

Taking the appropriate partial derivatives of equations (9) and (12), we have

$$\{\epsilon\} = \frac{1}{2\Delta}\begin{bmatrix} b_i, & o, & b_j, & o, & b_m, & o \\ o, & c_i, & o, & c_j, & o, & c_m \\ c_i, & b_i, & c_j, & b_j, & c_m, & b_m \end{bmatrix}\{\delta\}^e \tag{18}$$

which defines the matrix $[B]$ of equation (16).

The relationship between stress and strain will be linear assuming general elastic behavior; therefore,

$$\{\sigma\} = [D]\{\epsilon\} \tag{19}$$

where $[D]$ is an elasticity matrix containing the appropriate material properties. For the plane stress case, three components of stress correspond to the strains already defined

$$\{\sigma\} = \begin{Bmatrix} \sigma_x \\ \sigma_y \\ \tau_{xy} \end{Bmatrix} \tag{20}$$

The matrix $[D]$ is now obtained from the usual isotropic stress-strain relationship[3].

$$\begin{aligned} \epsilon_x &= \frac{1}{E}\sigma_x - \frac{\mu}{E}\sigma_y \\ \epsilon_y &= -\frac{\mu}{E}\sigma_x + \frac{1}{E}\sigma_y \\ \gamma_{xy} &= \frac{2(1+\mu)}{E}\tau_{xy} \end{aligned} \tag{21}$$

Solving for $\{\sigma\}$ in terms of $\{\epsilon\}$, we get the appropriate terms for the matrix

$$[D] = \frac{E}{1-\mu^2}\begin{bmatrix} 1 & \mu & 0 \\ \mu & 1 & 0 \\ 0 & 0 & \frac{(1-\mu)}{2} \end{bmatrix} \tag{22}$$

A similar matrix can be formed for the plane strain case. Let

$$\{p\} = \begin{Bmatrix} X \\ Y \end{Bmatrix} \tag{23}$$

be the distributed load on the element in which X and Y are the "body force" components and $\{p\}$ is defined as the distributed loads acting on a unit volume of material within the material with directions corresponding to those of the displacements $\{f\}$ at that point.

The simplest method to make the nodal forces statically equivalent to the actual boundary stresses and distributed loads is to impose an arbitrary (virtual) nodal displacement and to equate the external and internal work done by the various forces and stresses during that displacement.

Let the virtual displacement be $\{\delta^*\}^e$ at the nodes. By equations (13) and (16), the displacement strains within the element would be equal to

$$\{f^*\} = [N]\{\delta^*\}^e \quad \text{and} \quad \{\epsilon^*\} = [B]\{\delta^*\}^e \tag{24}$$

respectively.

The work done by the nodal forces is equal to the sum of the products of the individual force components and corresponding displacements; that is, in matrix language

$$\left(\{\delta^*\}^e\right)^T \{F\}^e \tag{25}$$

Similarly, the internal work per unit volume done by the stresses and distributed forces is

$$\{\epsilon^*\}^T \{\sigma\} - \{f^*\}^T \{p\} \tag{26}$$

or

$$\left(\{\delta^*\}^e\right)^T\left([B]^T\{\sigma\} - [N]^T\{p\}\right) \tag{27}$$

Equating the external work with the total internal work obtained by integrating over the volume of the element, we get

$$\left(\{\delta^*\}^e\right)^T\{F\}^e = \left(\{\delta^*\}^e\right)^T\left(\int [B]^T\{\sigma\}\, d(vol) - \int [N]^T\{p\}\, d(vol)\right) \tag{28}$$

Since this relation is valid for any value of the virtual displacement, the equality of the multipliers must exist. Therefore, substituting equations (16) and (19), we have

$$\{F\}^e = \left(\int [B]^T[D][B]d(vol)\right)\{\delta\}^e - \int [N]^T\{p\}\, d(vol) \tag{29}$$

which is in the form of equation (1), the general equation with

$$[k]^e = \int [B]^T[D][B]d(vol) \tag{30}$$

and

$$\{F\}_p^e = -\int [N]^T\{p\}\, d(vol) \tag{31}$$

The terms $[k]^e$ and $\{F\}_p^e$ can be written in simpler forms by performing the integrations indicated on a general triangular element.

Equation (30) can be written as

$$[k]^e = \int [B]^T[D][B]t\, dx\, dy \tag{32}$$

where t is the constant thickness of the element and the integration is taken over the area of the triangular element. Since neither of the matrices in equation (32) contains x nor y, we have

$$[k]^e = [B]^T[D][B]t\,\Delta \tag{33}$$

where Δ is the area of the triangle as defined by equation (11). The matrix $[k]^e$ appears in the program FINELEM in this form. Equation (31) can be written as

$$\{F\}_p^e = -\int [N]^T \begin{Bmatrix} X \\ Y \end{Bmatrix} dx\,dy \tag{34}$$

which, when further simplified[1], can be shown to be

$$\{F\}_p^e = \begin{Bmatrix} X \\ Y \\ X \\ Y \\ X \\ Y \end{Bmatrix} \frac{\Delta}{3} \tag{35}$$

This simply means that the total forces acting in x- and y-directions due to the body forces are distributed to the nodes in three equal parts. The matrix $\{F\}_p^e$ appears in FINELEM in this form.

General equation (1) is applicable to any typical element in a continuum. To obtain a complete solution for the entire continuum, two conditions - namely, displacement compatibility and equilibrium - have to

be satisfied throughout. The requirement of displacement compatibility is automatically satisfied for a system of nodal displacements $\{\delta\}$

$$\{\delta\} = \begin{Bmatrix} \delta_1 \\ \cdot \\ \cdot \\ \cdot \\ \delta_n \end{Bmatrix} \tag{36}$$

in which all of the elements participate.

Since equation (1) establishes equilibrium within a typical element, all that is necessary for overall equilibrium is to establish equilibrium at the nodes of the structure.

Consider the structure to be loaded by external forces $\{R\}$

$$\{R\} = \begin{Bmatrix} R_1 \\ \cdot \\ \cdot \\ \cdot \\ R_n \end{Bmatrix} \tag{37}$$

applied at the nodes in addition to the distributed loads applied to the individual elements.

To establish equilibrium conditions for a typical node, i, each component of R_i has, in turn, to be equated to the sum of the component forces contributed by the elements meeting at the node. Thus, considering all the force components, we have

$$\{R_i\} = \sum \{F_i\} \tag{38}$$

the summation being taken over all the elements. The stiffness matrices of each element will clearly always be square and of the form

$$[k]^e = \begin{bmatrix} k_{ii} & k_{ij} & k_{im} \\ \cdot & \cdot & \cdot \\ \cdot & \cdot & \cdot \\ k_{mi} & k_{mj} & k_{mm} \end{bmatrix} \tag{39}$$

in which k_{ii}, etc., are submatrices which are square and of the size $t \times t$, where t is the number of force components to be considered at the nodes. Introducing the characteristics of the element given by equation (1) and taking note only of the appropriate forces F_i, by using the submatrices of equation (39), the above equations become

$$\{R_i\} = \sum_{m=t}^{m=n} [k_{im}]^a \{\delta_m\} + \sum \{F_i\}_p^a \tag{40}$$

The inside summation is taken over all the elements of the structure indicated by the superscript a. Once all elements have been considered, the overall system of equations is established.

Equation (40) can be written in a simpler form as

$$[K]\{\delta\} = \{R\} - \{F\}_p \tag{41}$$

in which the submatrices are

$$[K] = \sum_{m=t}^{m=n} [k_{im}]^a$$

$$\{F\}_p = \sum \{F_i\}_p^a \tag{42}$$

with summations including all elements. The system of equations resulting from equation (41) can be solved once prescribed support displacements have been substituted.

Once the solution of the unknown displacements has been obtained, the stress and internal forces are obtained by applying equation (2) to each element in turn.

The general equation

$$\{\sigma\}^e = [S]^e \{\delta\}^e \tag{2}$$

will now be presented in a more detailed mathematical form. Once the nodal displacements $\{\delta\}^e$ have been determined by solution of equation (1), the stresses at any point of the element can be found from the relationships in equations (16) and (19) which give

$$\{\sigma\}^e = [D][B]\{\delta\}^e \tag{43}$$

The term

$$[S]^e = [D][B] \tag{44}$$

is the element stress matrix as it will be found in FINELEM. In FINELEM the stresses are assigned to the centroid of each element and are converted to principal stresses and their directions.

In order to reduce the physical size of the stiffness matrix, equation (33), a partitioning scheme is used. The nodal points of the structure are divided into a number of partitions. Only the elements concerned with the nodal points in a particular partition are used in the calculations.

The partitioning system is known as a "tridiagonal" system. Physically, this corresponds to the fact that the partitions are connected in series, as illustrated in Figure 2.

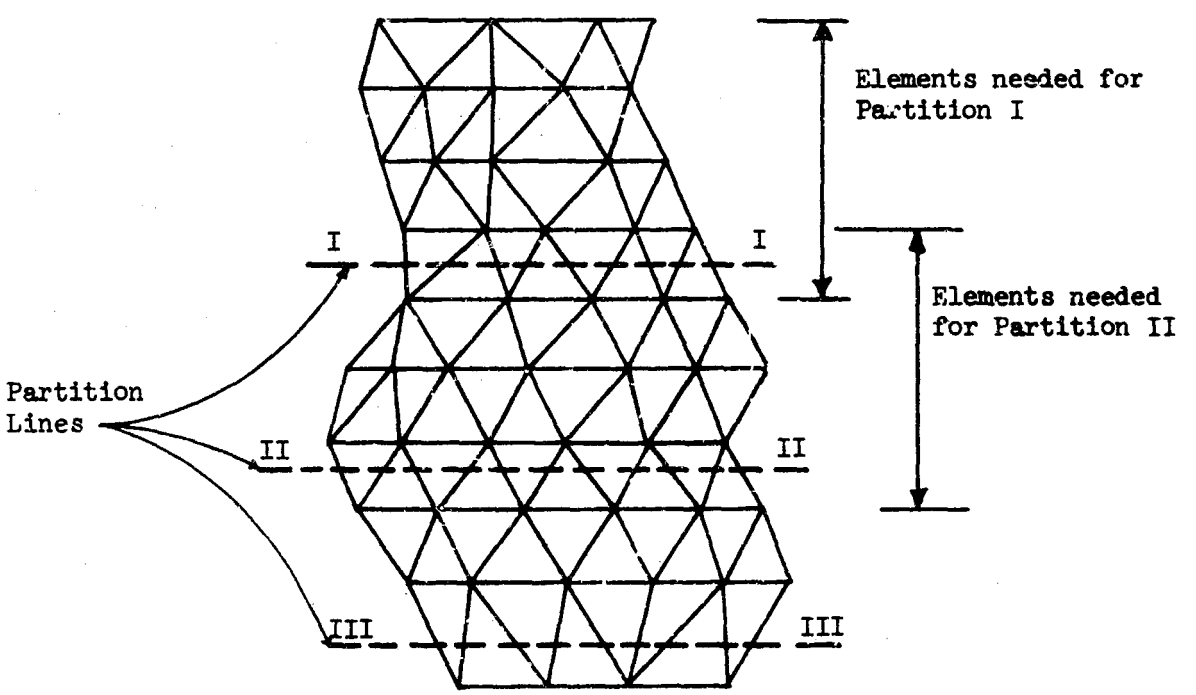

Fig. 2. Partitioning of a Structure.

The partitioning system allows the stiffness matrix to be written in the following tridiagonalized form:

$$\begin{bmatrix} K_I & C_I & 0 & 0 & \cdot & \cdot & 0 & 0 & 0 \\ C_I^T & K_{II} & C_{II} & 0 & \cdot & \cdot & 0 & 0 & 0 \\ 0 & C_{II}^T & K_{III} & C_{III} & \cdot & \cdot & 0 & 0 & 0 \\ \cdot & \cdot & \cdot & \cdot & \cdot & \cdot & \cdot & \cdot & \cdot \\ \cdot & \cdot & \cdot & \cdot & \cdot & \cdot & \cdot & \cdot & \cdot \\ 0 & 0 & 0 & 0 & \cdot & \cdot & K_{N-1} & C_{N-1} & \\ 0 & 0 & 0 & 0 & \cdot & \cdot & C_{N-1}^T & K_N & \end{bmatrix} \begin{Bmatrix} \delta_I \\ \delta_{II} \\ \delta_{III} \\ \cdot \\ \cdot \\ \delta_{N-1} \\ \delta_N \end{Bmatrix} = \begin{Bmatrix} P_I \\ P_{II} \\ P_{III} \\ \cdot \\ \cdot \\ P_{N-1} \\ P_N \end{Bmatrix} \tag{45}$$

This system of equations will be solved as follows: The first two matrix equations can be written as

$$\begin{aligned} [K_I]\langle\delta_I\rangle + [C_I]\langle\delta_{II}\rangle &= \langle P_I\rangle \\ [C_I]^T\langle\delta_I\rangle + [K_{II}]\langle\delta_{II}\rangle + [C_{II}]\langle\delta_{III}\rangle &= \langle P_{II}\rangle \end{aligned} \tag{46}$$

The first equation will yield

$$\langle\delta_I\rangle - [K_I]^{-1}\langle P_I\rangle - [K_I]^{-1}[C_I]\langle\delta_{II}\rangle \tag{47}$$

and substituting into the second yields

$$\left([K_{II}] - [C_I]^T[K_I]^{-1}[C_I]\right)\langle\delta_{II}\rangle + [C_{II}]\langle\delta_{III}\rangle = \langle P_{II}\rangle - [C_I]^T[K_I]^{-1}\langle P_I\rangle \tag{48}$$

By defining new symbols,

$$\left[\bar{K}_{II}\right] = \left(\left[K_{II}\right] - \left[C_I\right]^T\left[K_I\right]^{-1}\left[C_I\right]\right)$$

$$\left\{\bar{P}_{II}\right\} = \left\{P_{II}\right\} - \left[C_I\right]^T\left[K_I\right]^{-1}\left\{P_I\right\} \tag{49}$$

equation (48) may be written as

$$\left[\bar{K}_{II}\right]\left\{\delta_{II}\right\} + \left[C_{II}\right]\left\{\delta_{III}\right\} = \left\{\bar{P}_{II}\right\} \tag{50}$$

from which $\left\{\delta_{II}\right\}$ can be obtained as in equation (47) and substituting into the next row equation to give $\left[\bar{K}_{III}\right]$ and $\left\{\bar{P}_{III}\right\}$.

This process of substitution and elimination goes on until the last row is reached, that is,

$$\left[\bar{K}_N\right]\left\{\delta_N\right\} = \left\{\bar{P}_N\right\} \tag{51}$$

where a direct inversion will yield $\left\{\delta_N\right\}$.

The process is then reversed and the known displacement values are back-substituted into equations in the form of equation (47), giving solutions for all of the unknowns.

To check the errors introduced in the solution of equation (45), the residuals are calculated as

$$\left\{R\right\} = \left\{P\right\} - \left[K\right]\left\{\delta\right\} \tag{52}$$

FINELEM PROGRAM NOTATION

NPROB	number of problems to be done in one execution of program
NPART	total number of partitions
NPOIN	total number of nodal points
NELEM	total number of elements
NBOUN	total number of nodal points with prescribed displacements
NYM	total number of different elastic properties
NCOLN	total number of load vectors to be read in
NFREE	number of degrees of freedom per node
NP	NP = 0, plane strain case
	NP = 1, plane stress case
NCARD	number of cards read in for the previous set, used in checking
NCONC	number of points with concentrated loads
X	X,Y coordinates of the nodal points
NOD	the three nodal numbers defining a triangular element, counting anticlockwise
NEP	elastic property number relevant to the triangular element
AN	angle which the X-axis of orthotropy of element made with the global X-axis (in degrees)
THICK	thickness of each element
NF(1)	nodal point number 1 with prescribed displacements
NB	NB(1,1) = 0, displacement in X-direction is prescribed
	NB(1,2) = 0, displacement in Y-direction is prescribed
	NB(1,1) = 1, displacement in X-direction is not prescribed
	NB(1,2) = 1, displacement in Y-direction is not prescribed

BV	BV(1,1) = prescribed value of displacement in X-direction
	BV(1,2) = prescribed value of displacement in Y-direction
EARTH	force per unit volume in X-direction
DENSIT	force per unit volume in Y-direction
NSTART	first element in each partition
NEND	last element in each partition
NFIRST	first nodal point in each partition
NLAST	last nodal point in each partition
U	loads in X- and Y-directions
E1	Young's modulus in X-direction
E2	Young's modulus in Y-direction
P1	Poisson's ratio in X-direction
P2	Poisson's ratio in Y-direction
GE	shear modulus

FLOW CHART SYMBOLS

OPERATIONAL STATEMENT OR
STATEMENTS

INPUT OR OUTPUT STATEMENT

DO LOOP STATEMENT
20 = LAST STATEMENT OF DO LOOP
(I = 1,M) = RANGE OF VARIABLE IN DO LOOP

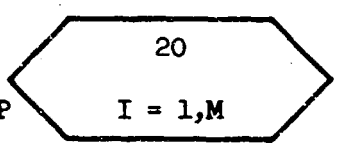

STATEMENT NUMBER

IF STATEMENT

FINELEM FLOW CHARTS

A detailed flow chart of the program FINELEM is shown on the left side of the page and an explanation of the adjacent flow chart operation is given on the right side of the page.

MAIN PROGRAM

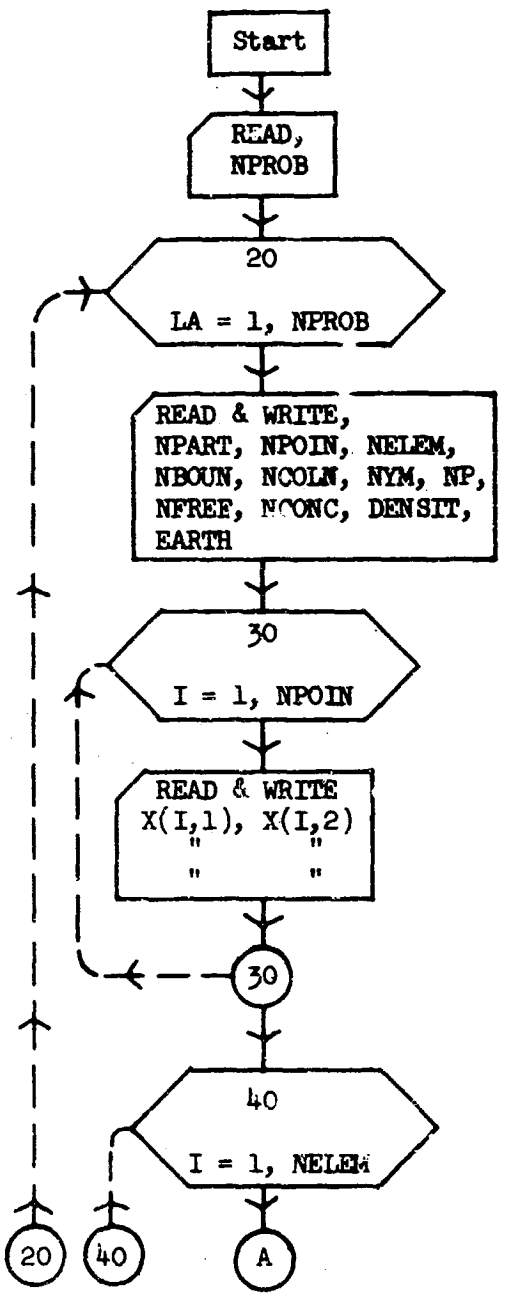

Indicate number of problems to be worked.

Indicate parameters of a particular problem; no. partitions, no. elements, etc.

Indicate X and Y coordinates of each nodal point.

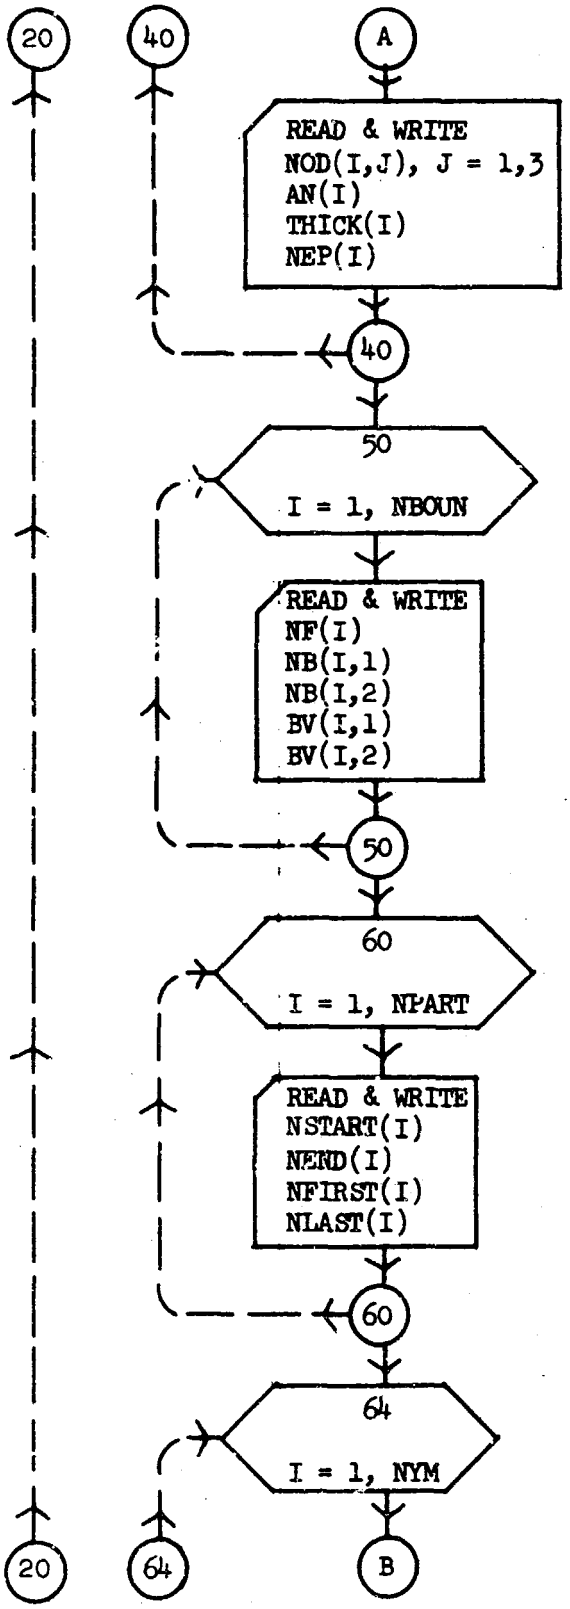

Indicate nodal points, angle of deviation, thickness and material property number for each element.

Indicate nodal points with prescribed displacements.

Indicate nodal points and elements in each partition in order.

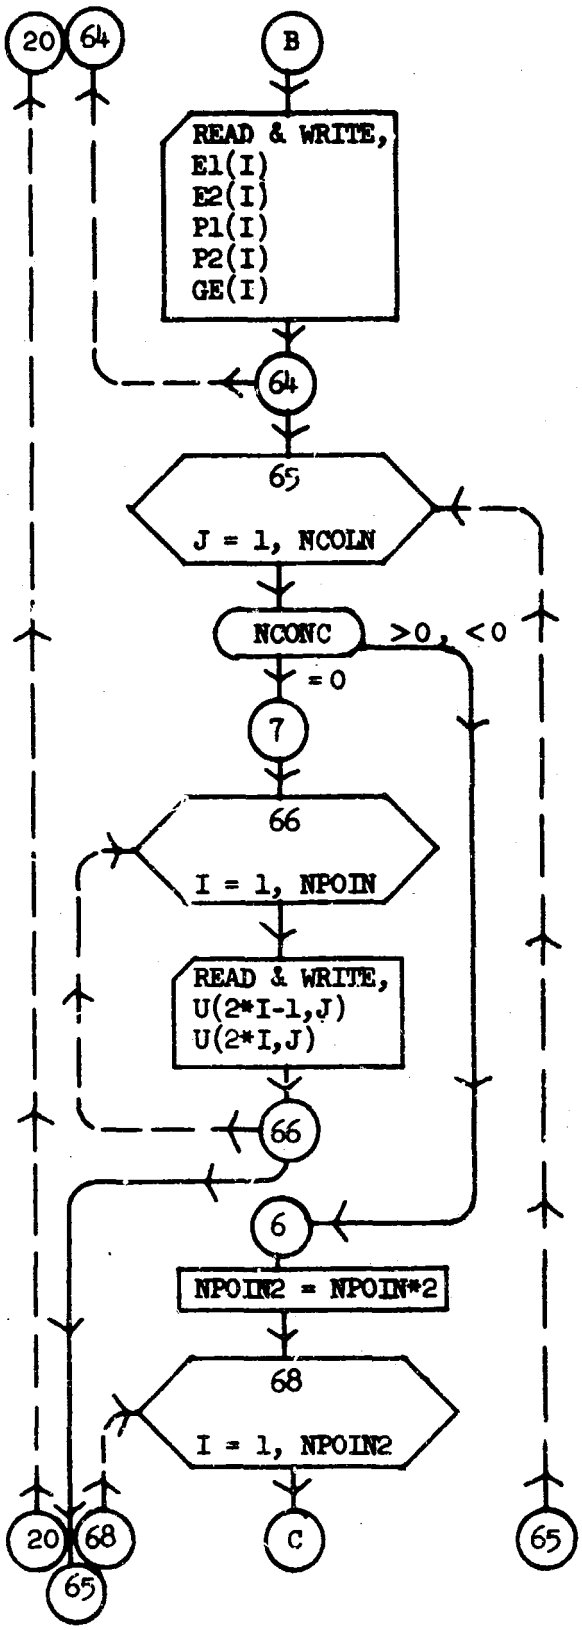

Indicate different sets of elastic properties.

Indicate number of points with concentrated loads. The first option allows only load vectors at specific nodes to be read in.

The second option requires that the load vectors at all nodes be read in.

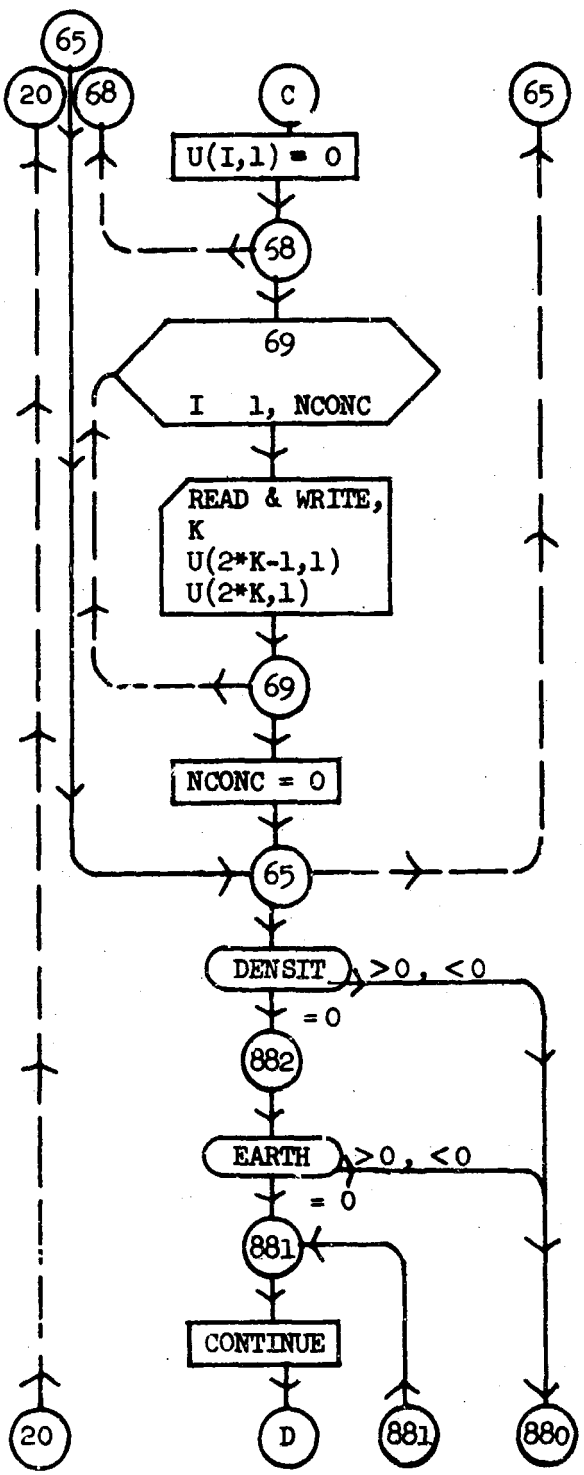

All data is now in the computer.

If uniform body loads are present, the subroutine LOAD is called to calculate the body forces due to these loads.

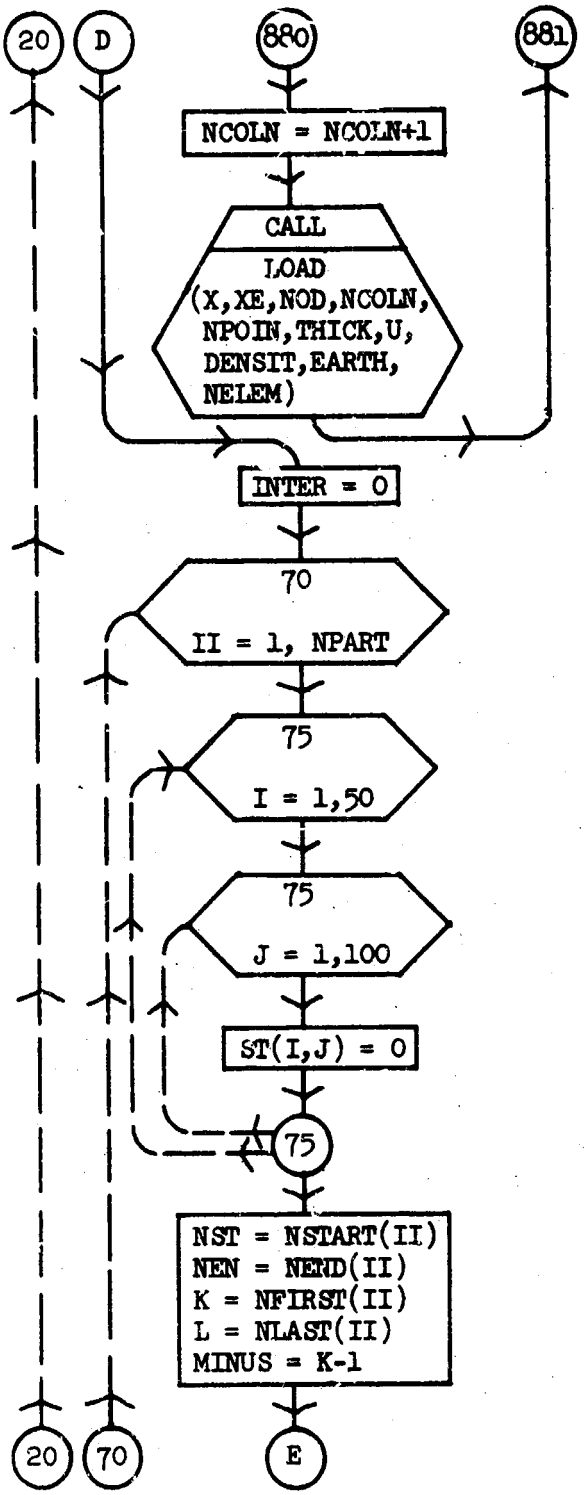

The subroutine LOAD is called.

The appropriate matrices are formed taking the partitions one at a time.

The overall stiffness matrix for a particular partition is initialized. ST(50,100)

The first and last nodes and elements in the partition are specified to be sure the proper partition is used.

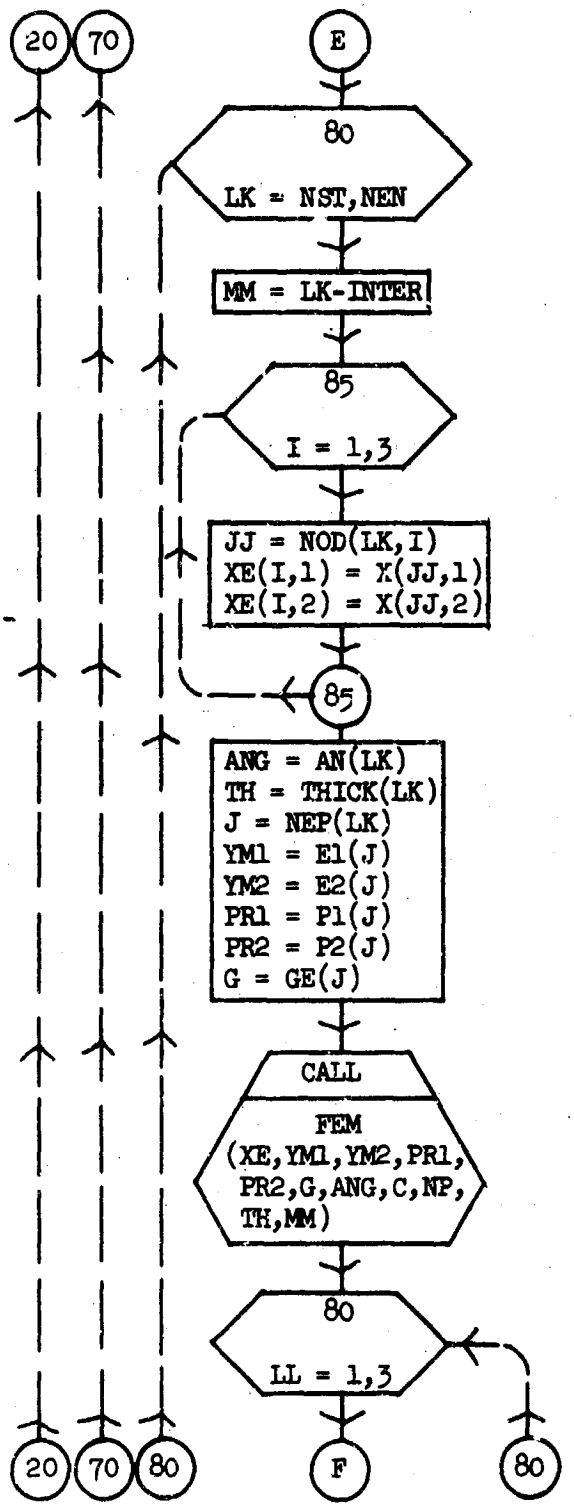

The appropriate matrices for the individual elements are formulated one at a time.

The X and Y components of the element being considered are retrieved.

The properties of the element being considered are retrieved.

The subroutine FEM is called to formulate the stress and stiffness matrices for the particular element being considered.

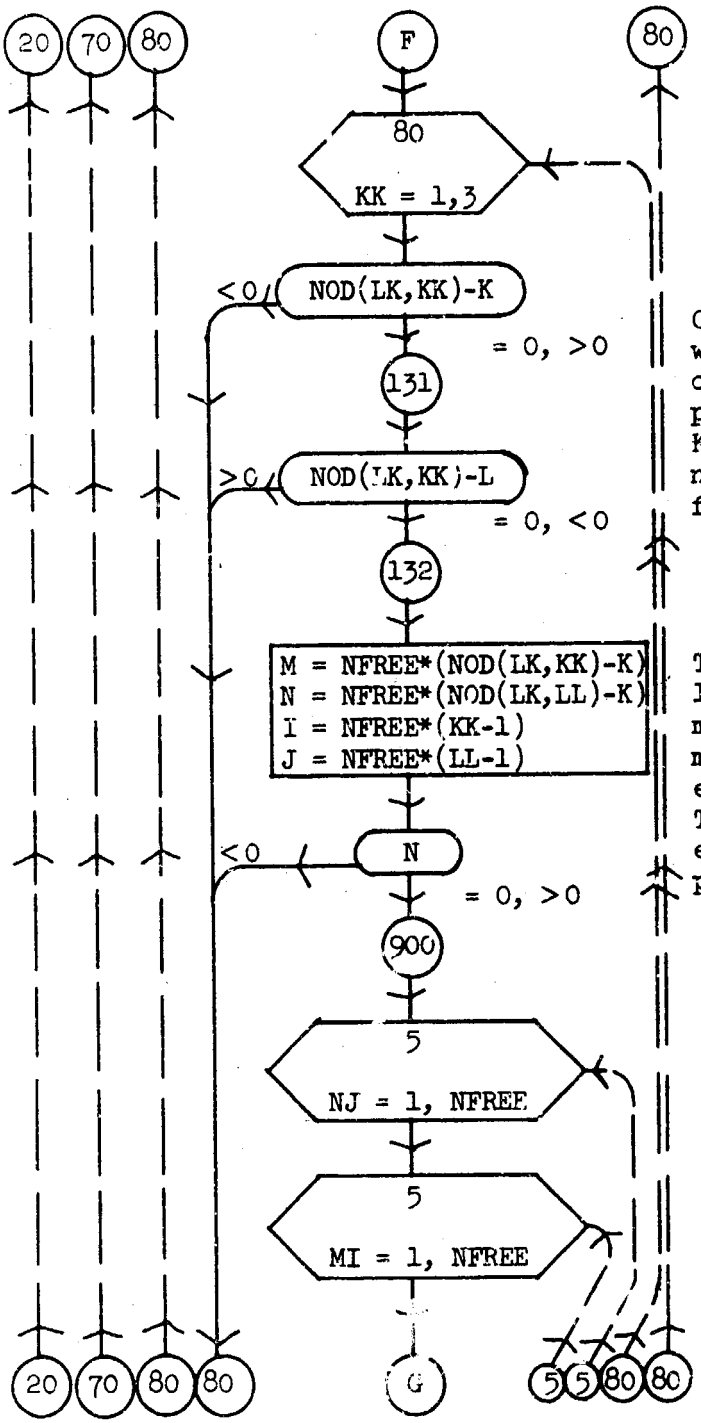

Checks are made to determine which partition the nodal points of the element are in. Nodal points in the partition form the K terms of equation (45) and nodal points out of the partition form the C terms of equation (45).

These coefficients specify the location of the element stiffness matrix in the overall partition matrix. The K and C terms of equation (45) are being formed. The subscript on the terms of equation (45) indicate the partition being considered.

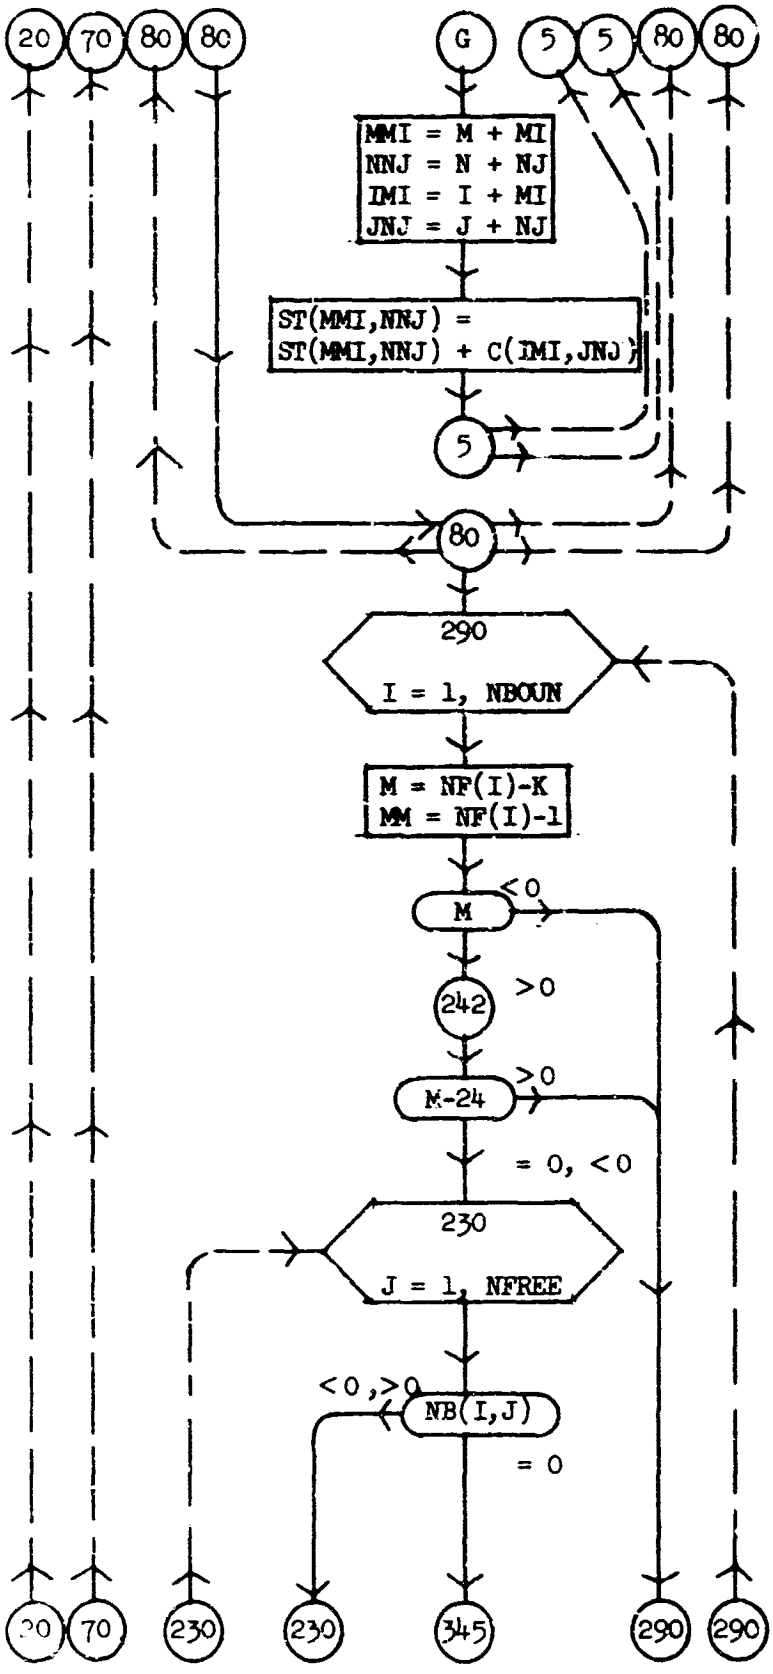

The individual element stiffness is inserted in the overall partition matrix.

The prescribed displacements are introduced.

Only prescribed displacements at the nodal points in the partition being considered are introduced.

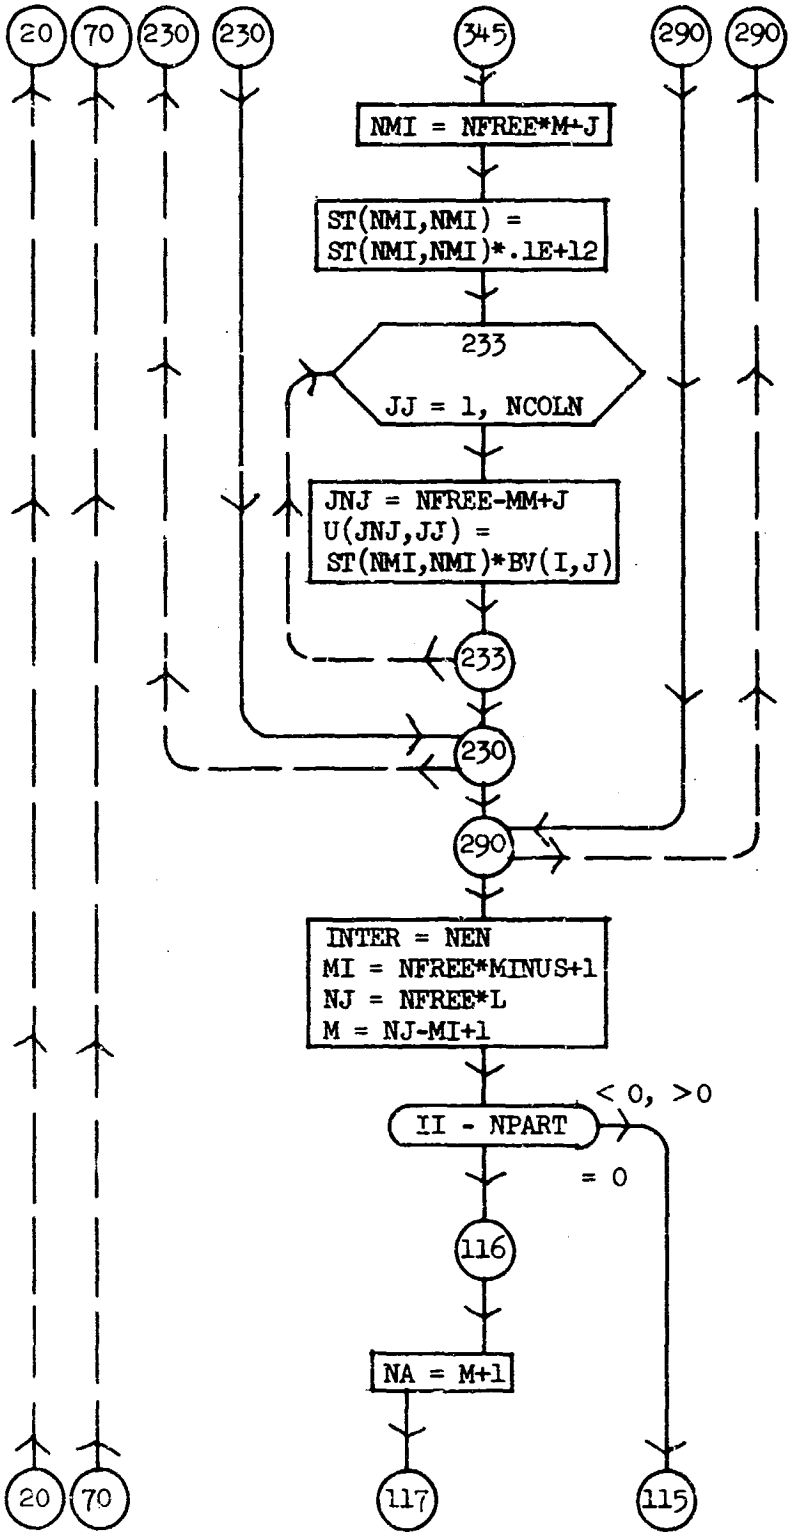

The prescribed displacements are multiplied by a large number.

The known displacements are inserted in the displacement matrix.

A check is made to see if the last partition was being considered.

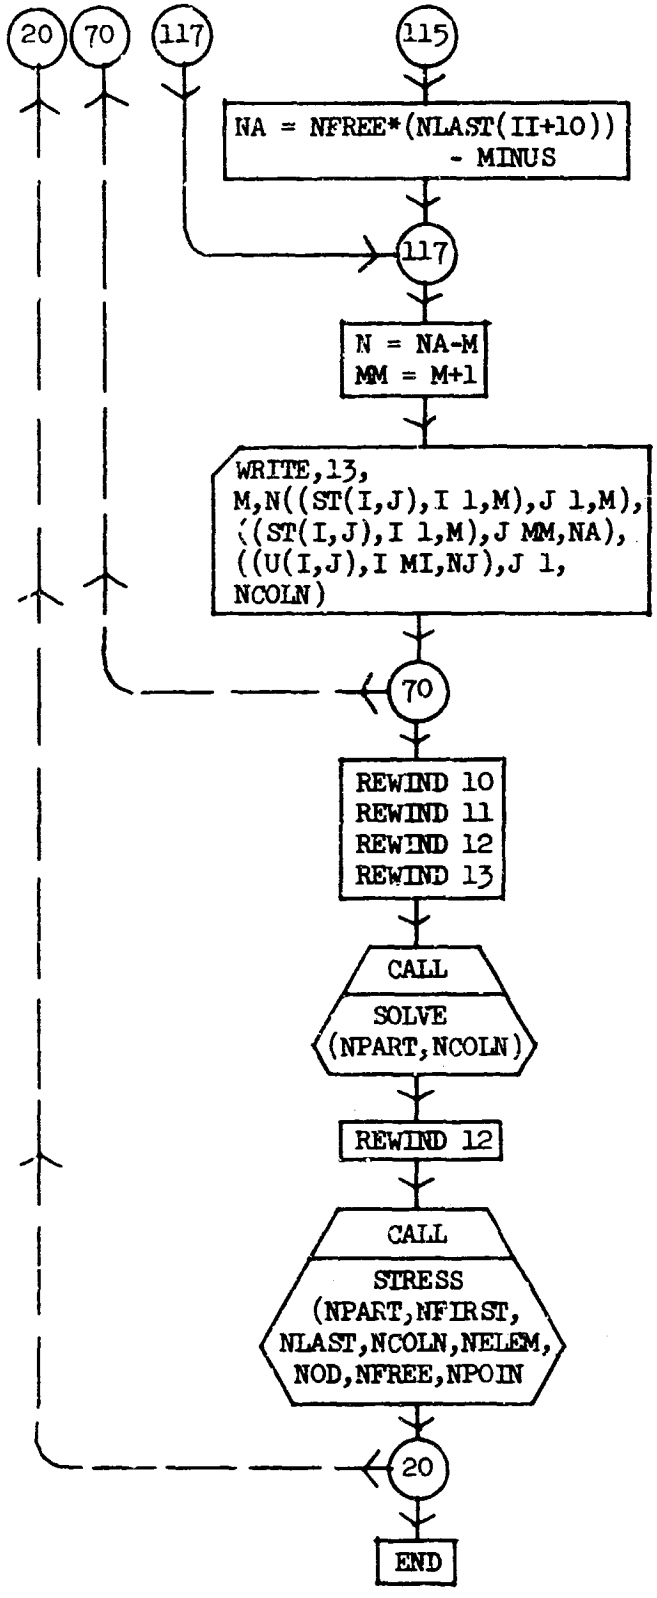

The [K], [C] and known displacement terms of the tridiagonalized stiffness matrix, equation (45), are stored for future use.

The subroutine SOLVE calculates the unknown displacements by following the theory given in equations (45) through (51). An error check is made according to equation (52). All of the terms of equation (41) are known; therefore, all terms are defined.

The stresses are calculated at the centroid of each element and are resolved into principal stresses and their angle of deviation from the original coordinate system.

SUBROUTINE LOAD

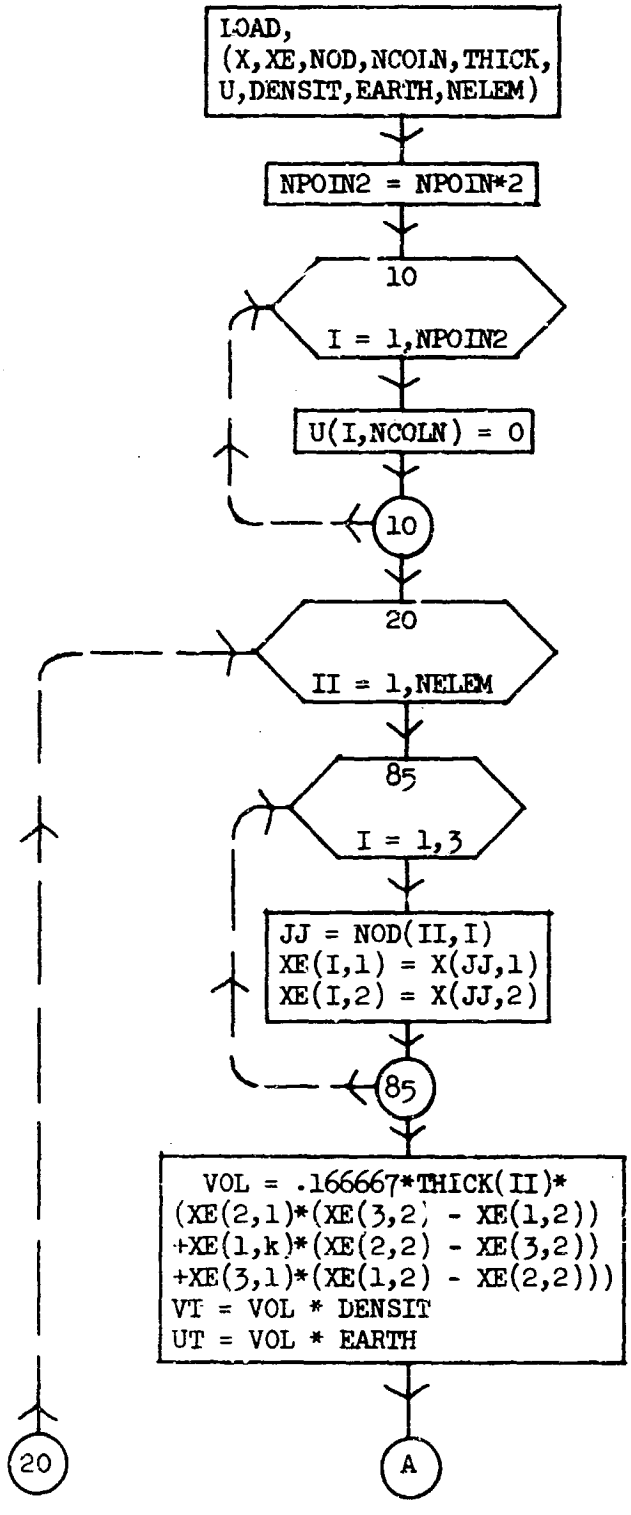

The load vector due to the body forces is initialized.

The nodal points of the element being considered are retrieved.

This operation is equation (11) times the element thickness divided by 6, which when multiplied by the appropriate body force per unit volume yields the terms that make up equation (35).

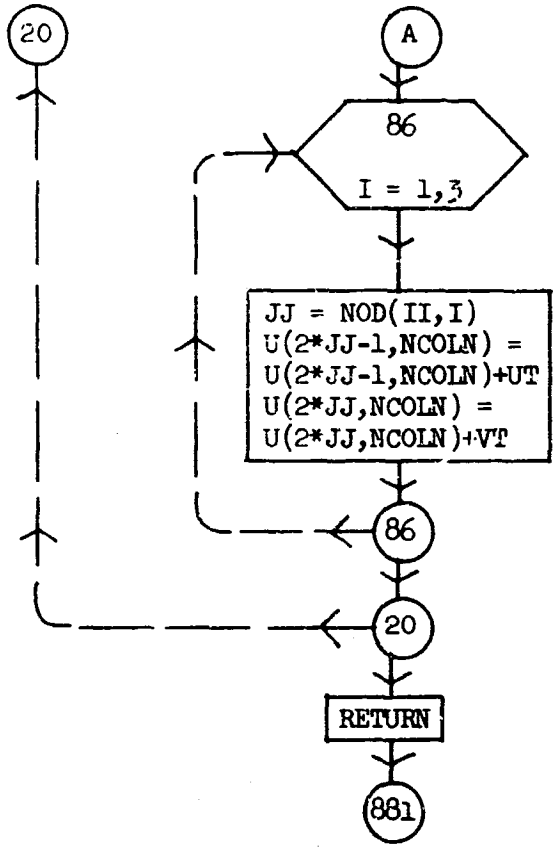

The terms that make up equation (35) are arranged in the appropriate places to yield equation (35).

SUBROUTINE FEM

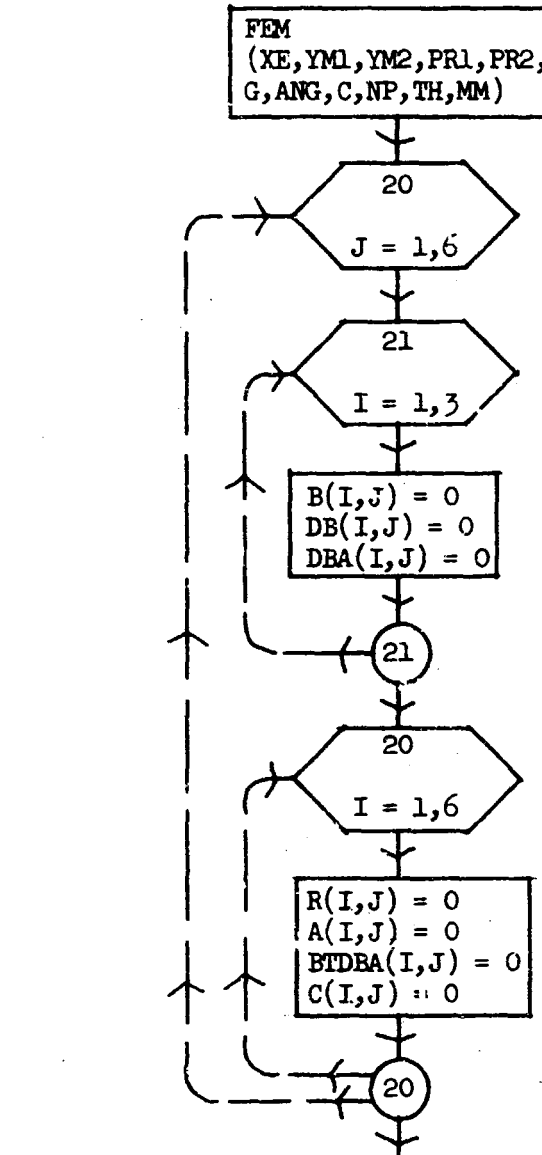

Initialize matrices.

Initialize matrices.

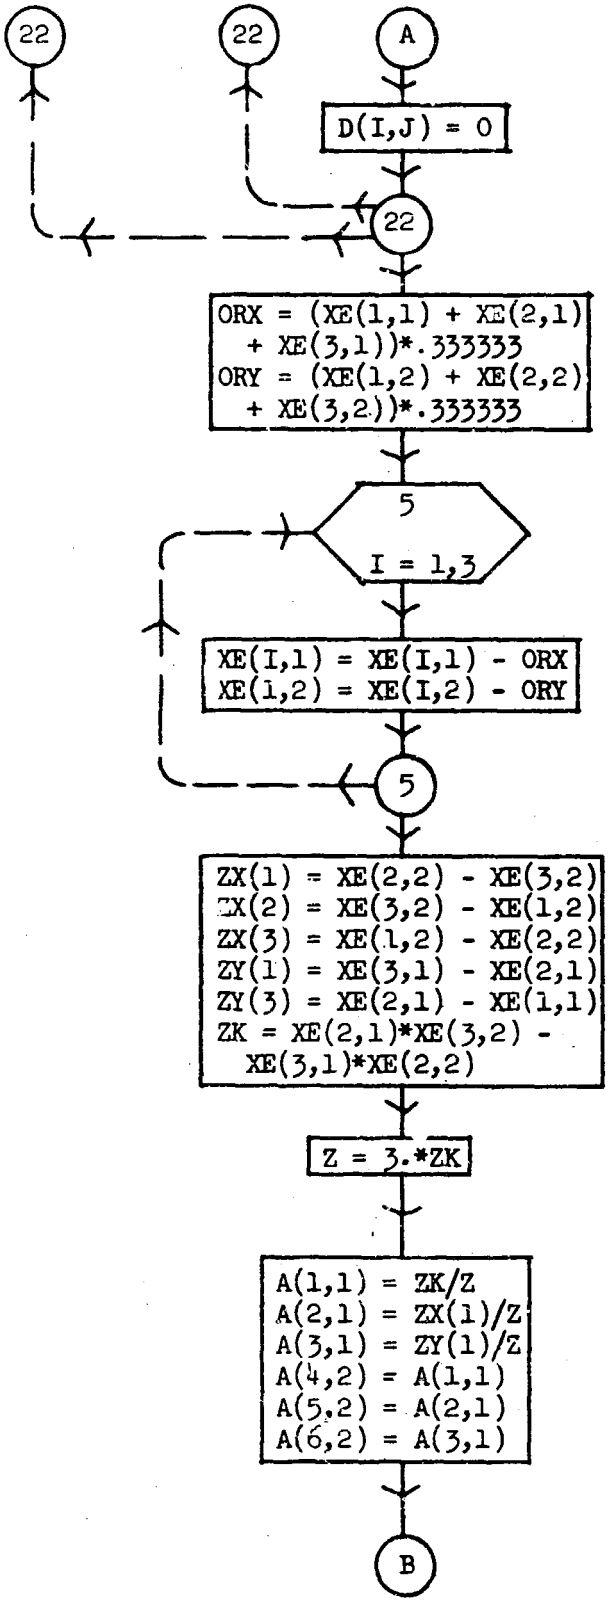

Locate the centroid of a particular element relative to the original X,Y coordinate system.

Locate nodal points relative to an X,Y coordinate system through the element centroid.

The terms of equation (10) are formed in the following order: $b_i, b_j, b_m, c_i, c_j, c_m, a_i, a_j$, and a_m where $a_i = a_j = a_m$.

The relationships of equation (15) are made use of

The term N_i' of equations (13) and (14) is formed.

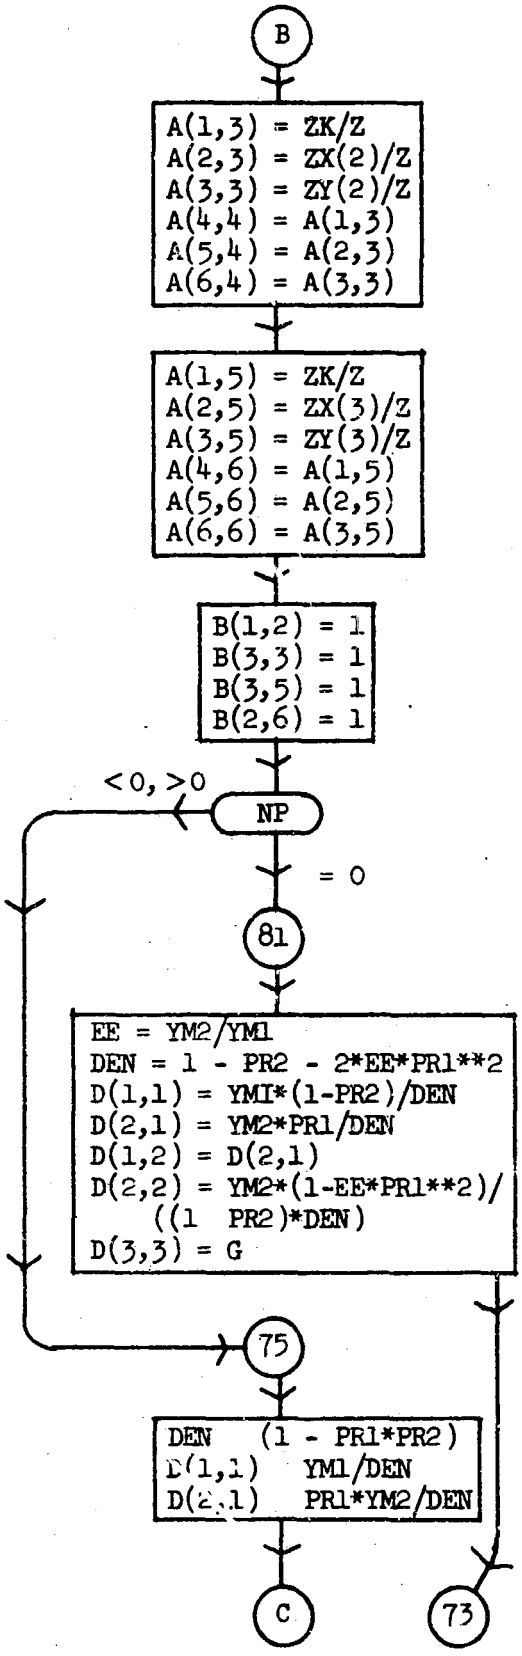

The term N_j' of equations (13) and (14) is formed.

The term N_m' of equations (13) and (14) is formed.

The relationships of equations (9) and (12) are formed.

This is an intermediate step in the formation of the matrix of equation (16).

The formation of the plane stress or plane strain matrix is specified.

The elasticity matrix for the plane strain case is formed.

The elasticity matrix for the plane stress case is formed, equation (22)

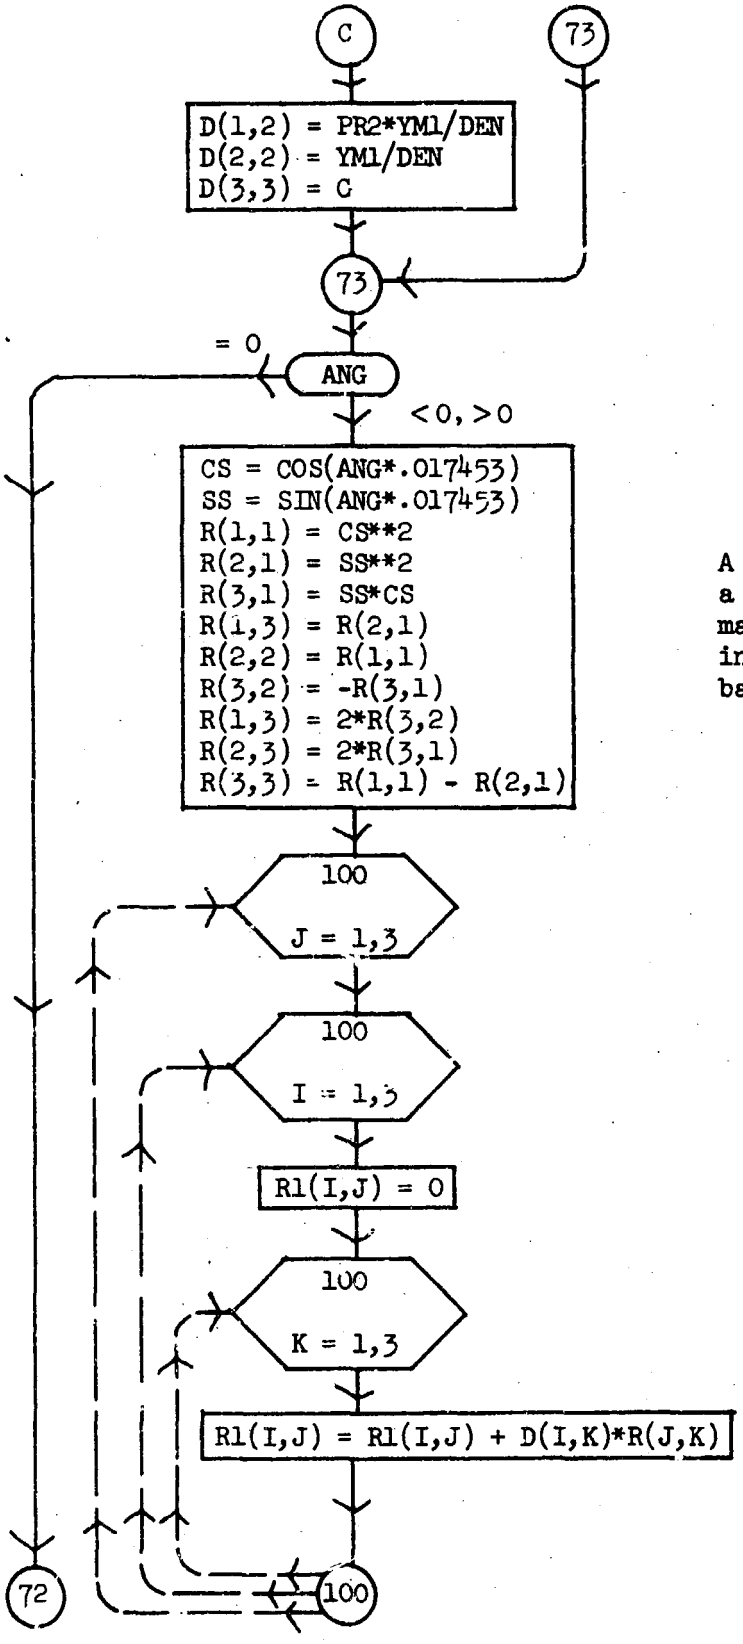

A matrix for transforming a transversely isotropic material from an axis inclined to the major axis back to the major is formed.

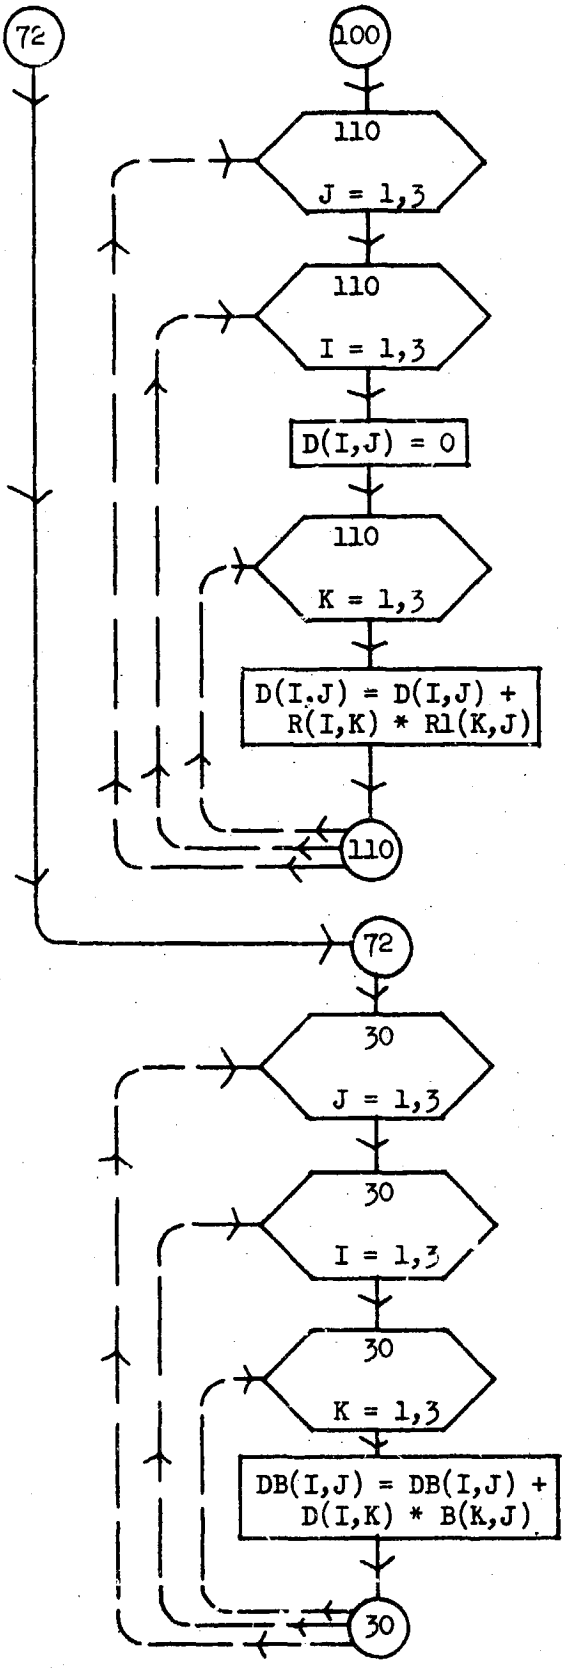

The axis transformation matrix is formed.

The [A] and [B] matrices are multiplied together as a step in the formation of the stress and stiffness matrices.

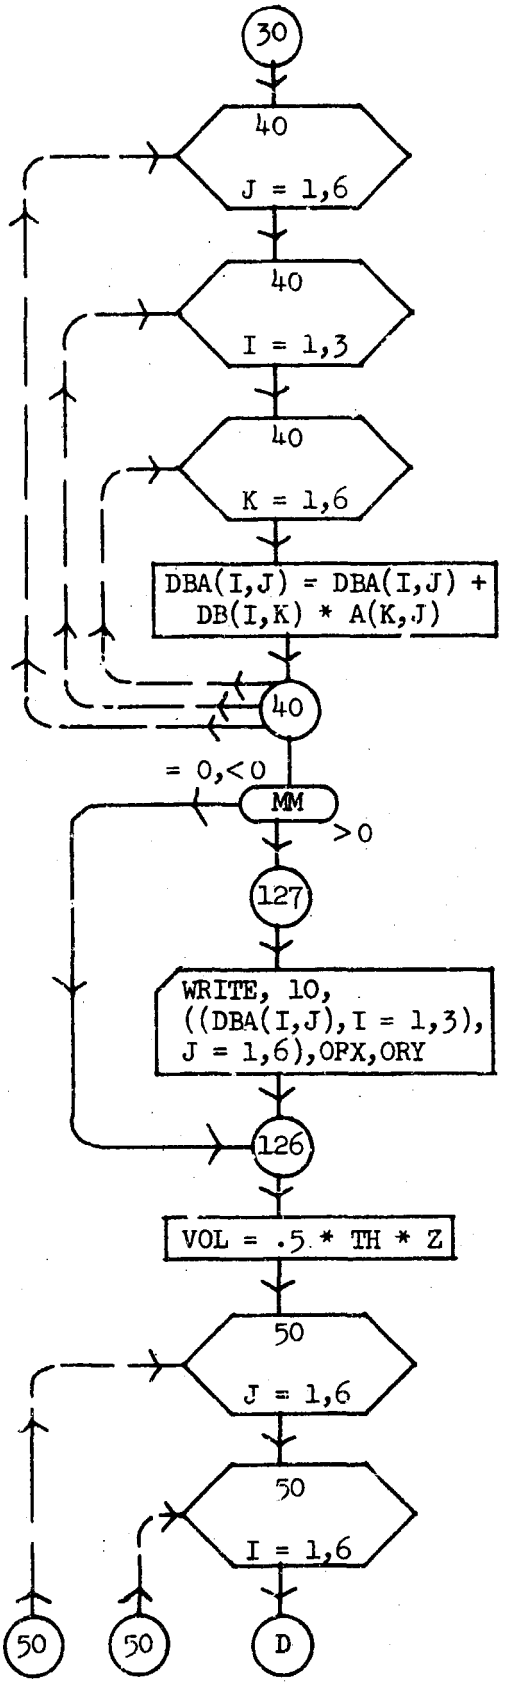

The [DBA] matrix is formed.

The [DBA] matrix in the program notation is the stress matrix of equation (44).

[D] in program notation is [D] in the report notation.

[B][A] in program notation is [B] in the report notation.

The element stress matrix is stored on a disc for use later in calculating the stresses at the centroid of the element.

The Δ and t of equation (33) are formed.

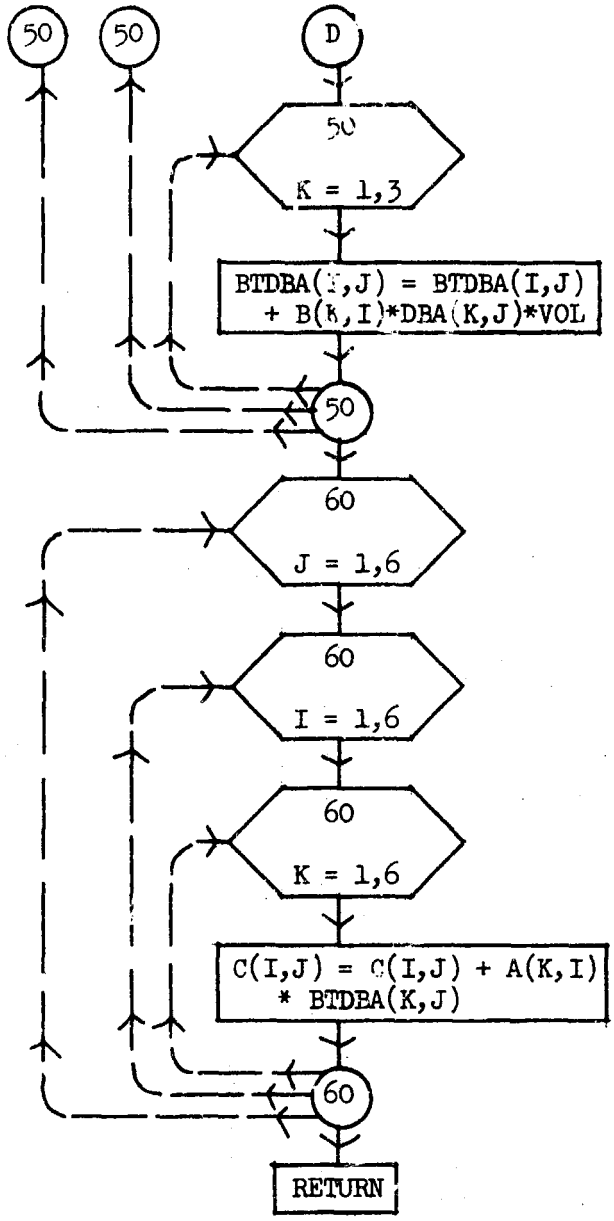

This is a preliminary step in the formation of the element stiffness matrix.

The element stiffness matrix, equation (33), is formed.

SUBROUTINE SOLVE

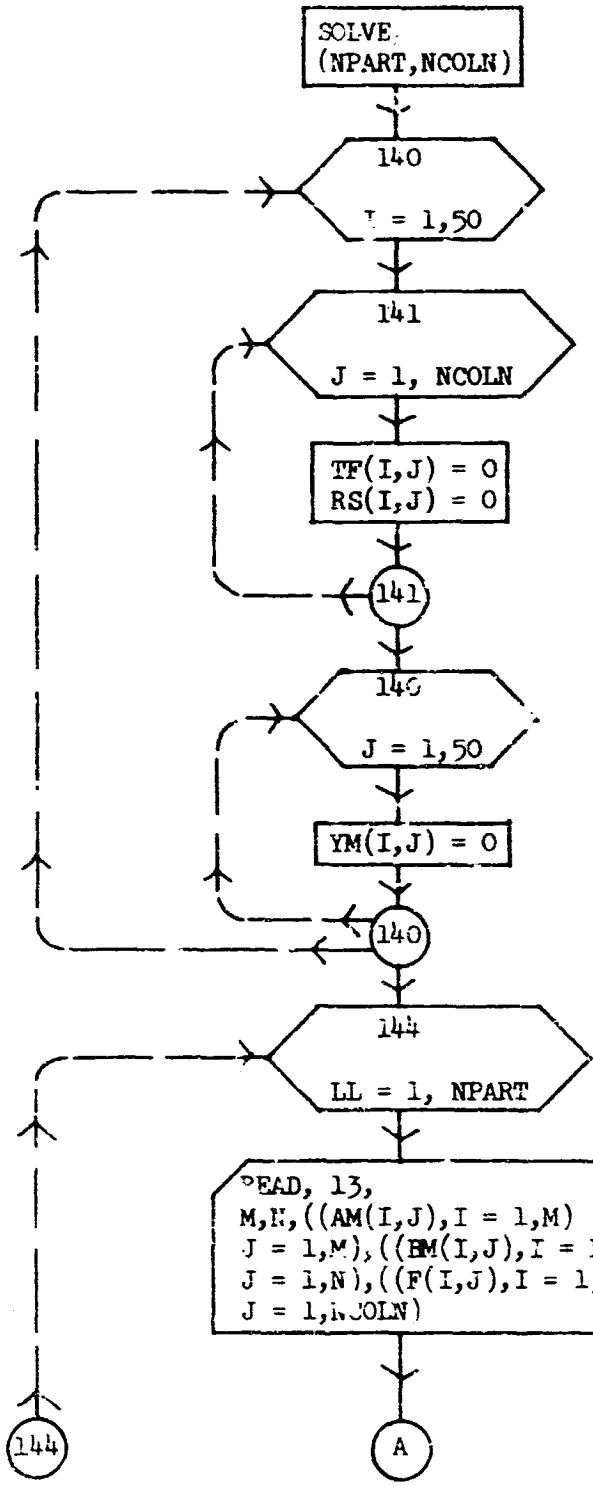

Initialize matrices.

The terms of the tridiagonalized stiffness matrix, equation (45), for each partition are read in one at a time. These terms are $[K]$, $[C]$, and $[P]$ of equation (45).

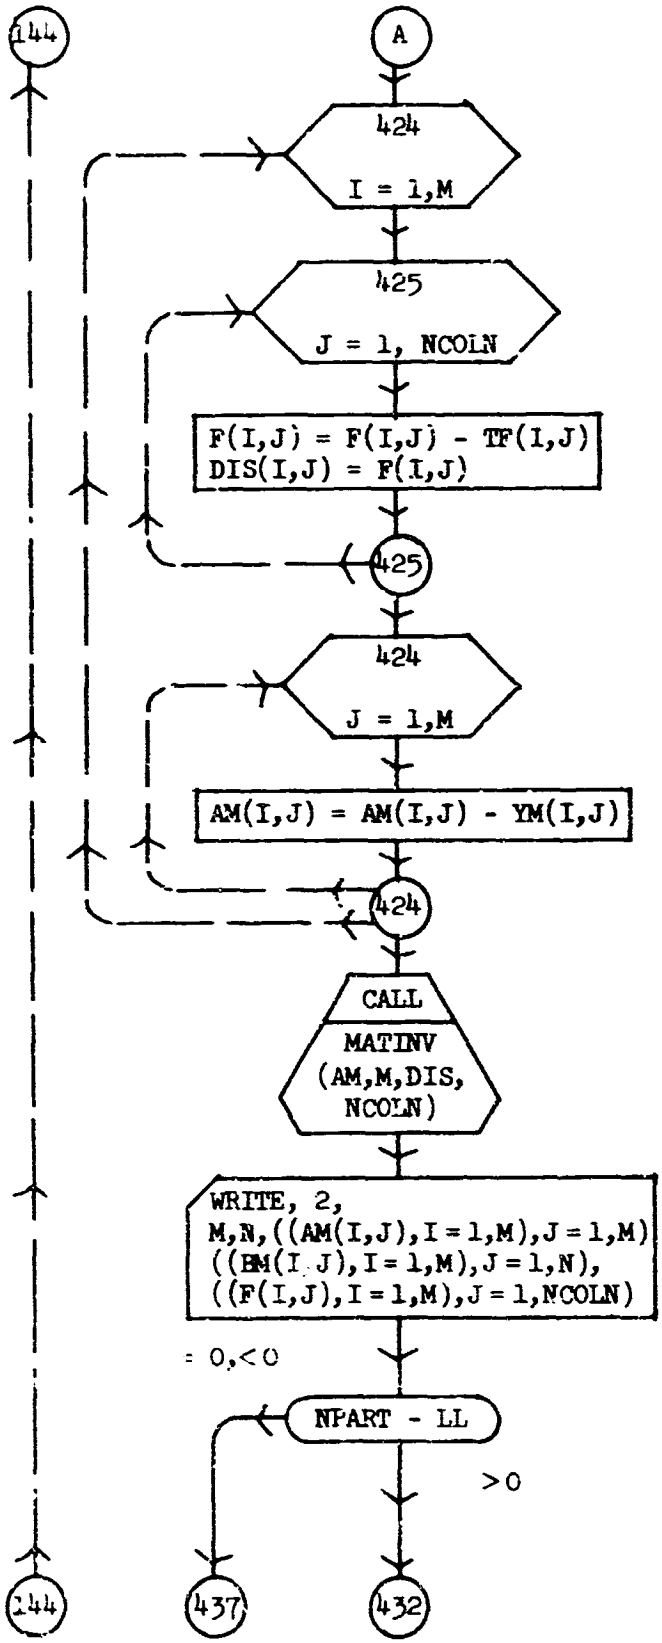

The [P] matrix of equation (46) is formed.

The [K] matrix of equation (46) is formed.

This subroutine inverts the [K] matrix and multiplies it by the [P] matrix to form the first term to the right of the equal sign in equation (47).

The term formed above is stored for future use.

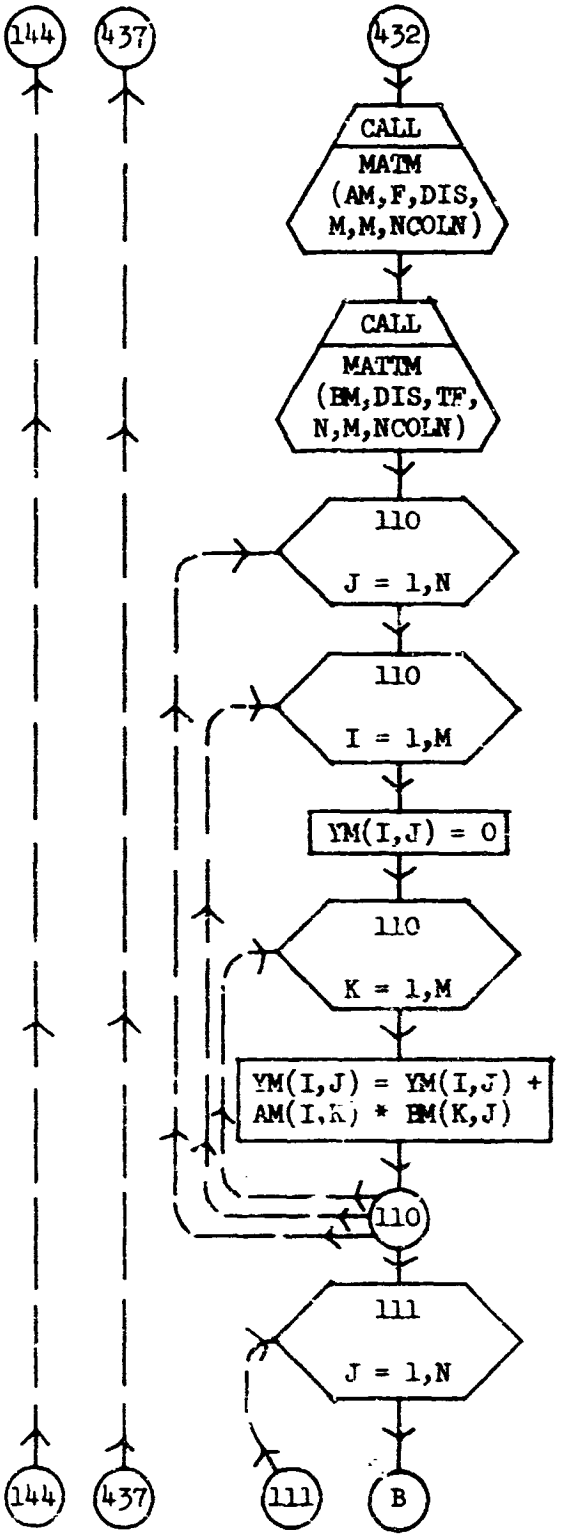

This subroutine multiplies the inverted [K] matrix by the [C] matrix to form part of the second term to the right of the equal sign in equation (47).

This subroutine transposes the [C] matrix of equation (46) and multiplies it by the first term to the right of the equal sign in equation (47) to form the second term to the right of the equal sign in equation (48).

The inverted [K] matrix is multiplied by the [C] matrix to form part of the second term of the first two terms enclosed in the first parenthesis of equation (48).

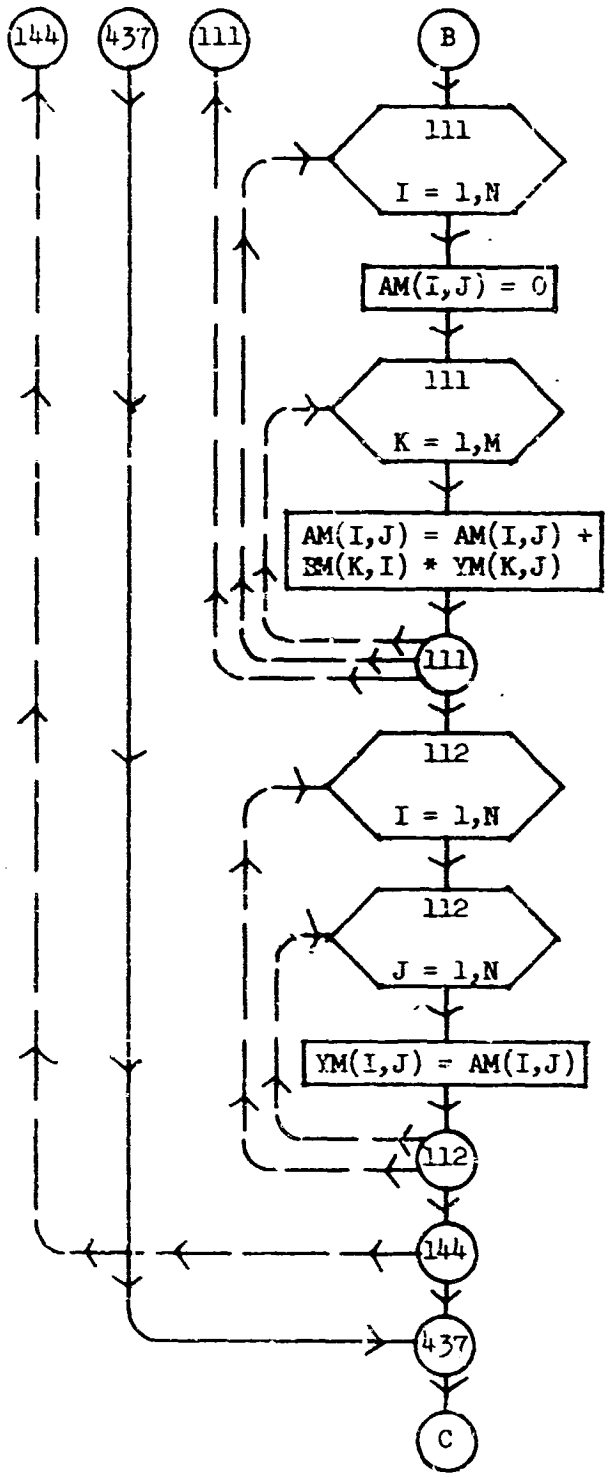

The term formed in the last operation is multiplied by the transposed [C] matrix to form the second term of the two terms enclosed in the first parenthesis of equation (48).

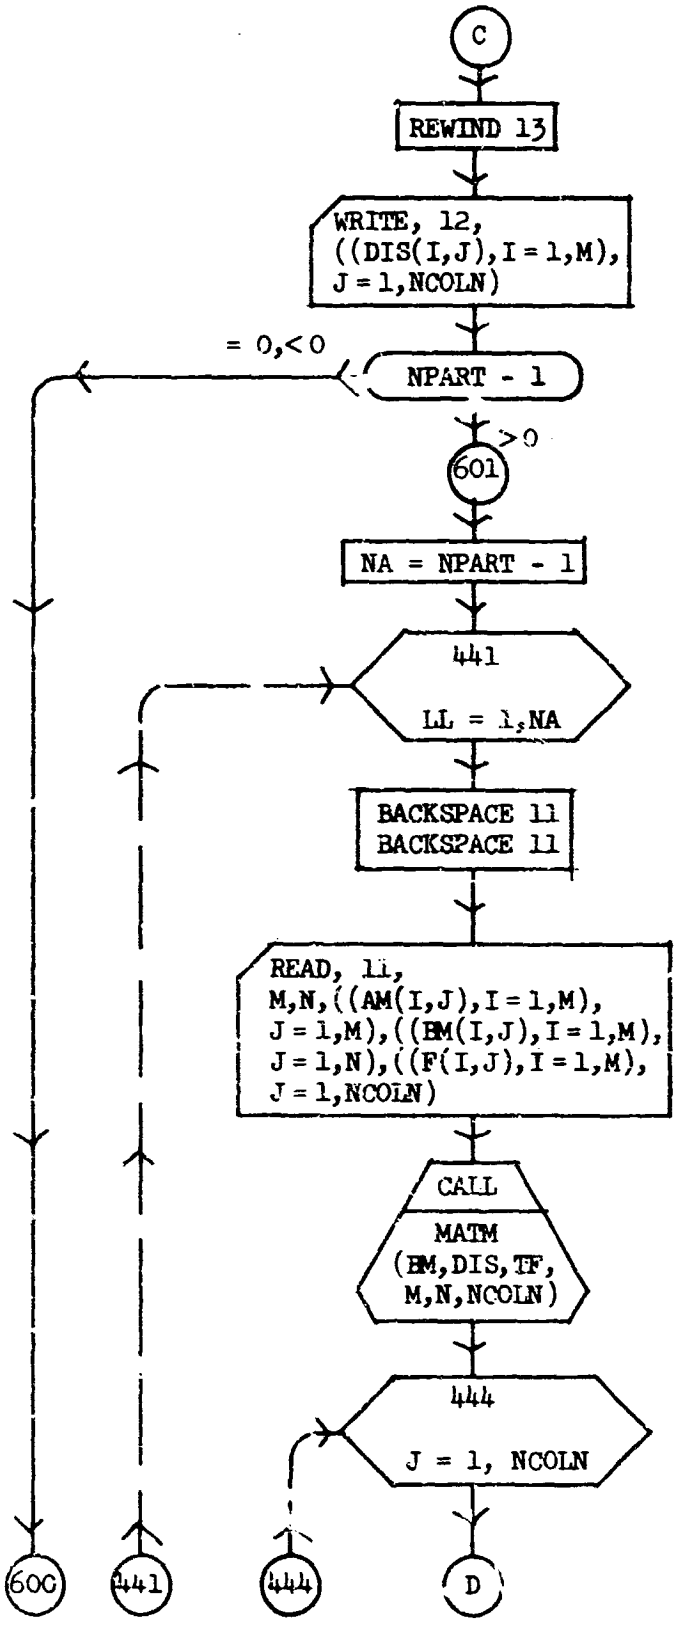

Store the inverted [K] matrix times the [P] matrix for future use.

From the second line of equation (45) which includes some of the terms in equation (46).

This subroutine multiplies [C] times {δ} to form the second term of equation (46).

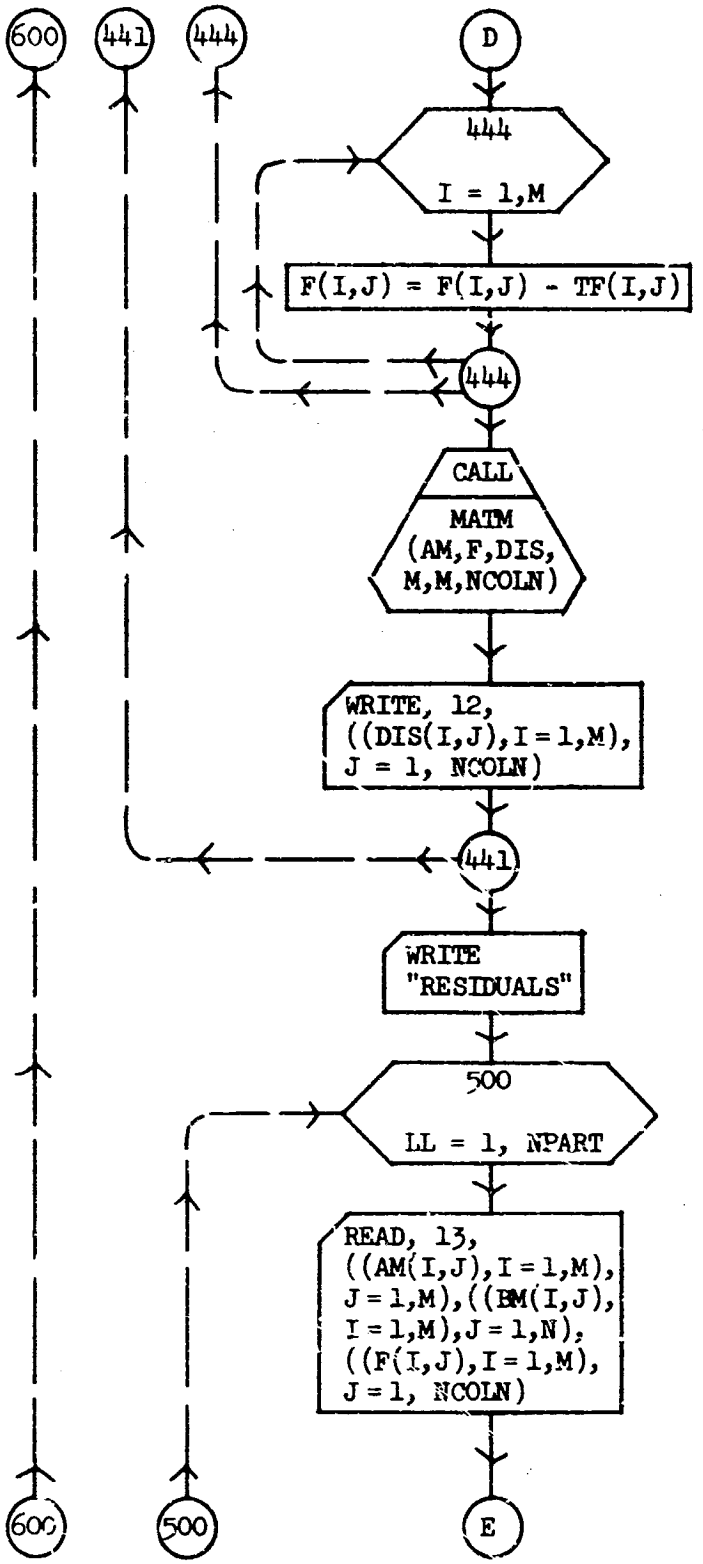

The second term of equation (46) is subtracted from the third term of equation (46) and set equal to the first term of equation (46).

Multiply the term formed above by the inverted K matrix to form $\{\delta\}$. This process is repeated until $\{\delta_N\}$ of equation (51) is calculated.

All the displacements of equation (45) are stored.

The known $\{\delta\}$ are back substituted into equation (45) to make an order of error check.

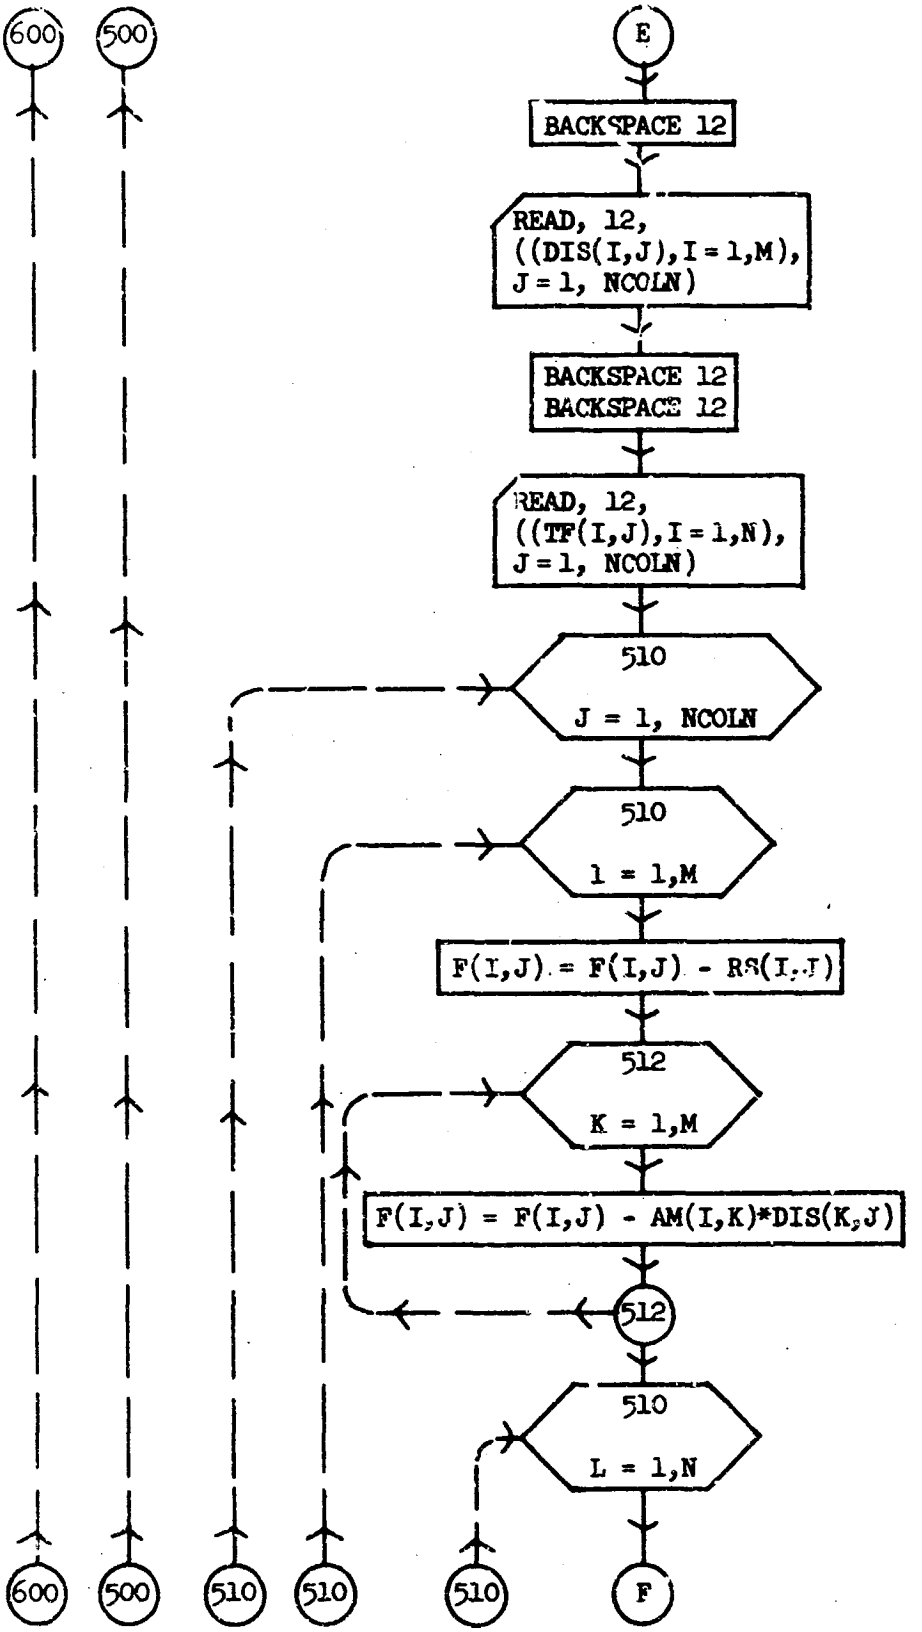
600
500
E
BACKSPACE 12
READ, 12,
((DIS(I,J),I = 1,M),
J = 1, NCOLN)
BACKSPACE 12
BACKSPACE 12
READ, 12,
((TF(I,J),I = 1,N),
J = 1, NCOLN)
510
J = 1, NCOLN
510
I = 1,M
F(I,J) = F(I,J) - RS(I,J)
512
K = 1,M
F(I,J) = F(I,J) - AM(I,K)*DIS(K,J)
512
510
L = 1,N
600
500
510
510
510
F

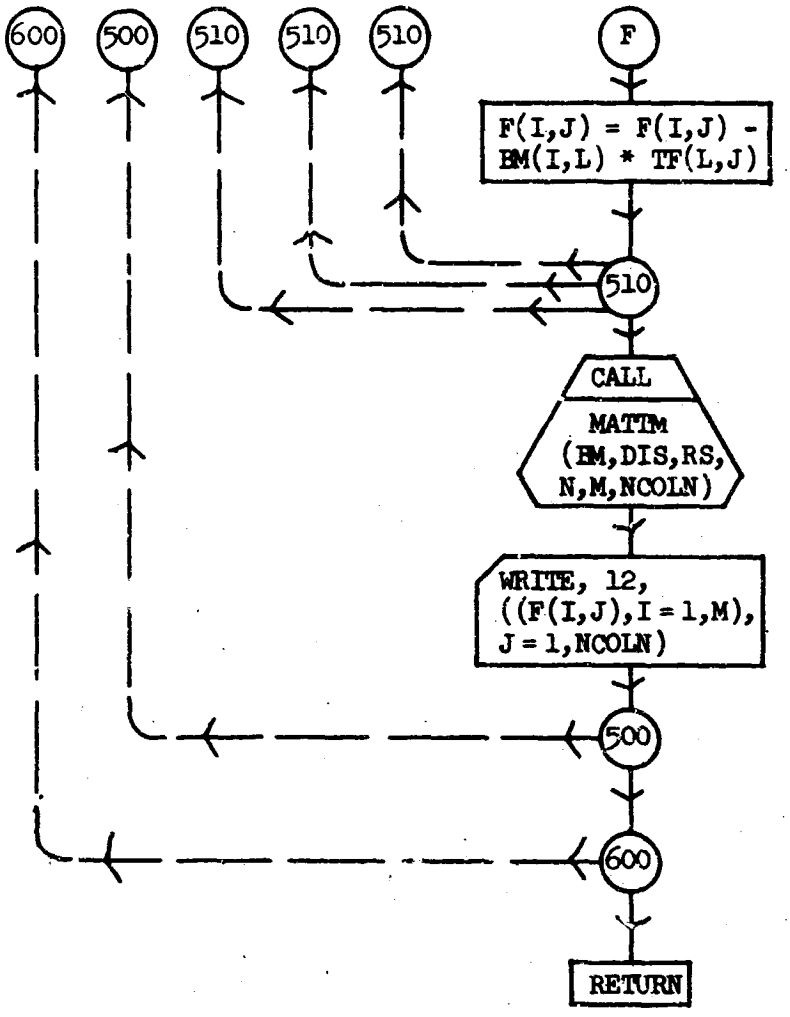

The R term of equation (52) is formed.

The residuals of equation (52) are printed out. If the magnitude of the residuals is too great they can be used as a load vector and the problem can be reworked.

SUBROUTINE STRESS

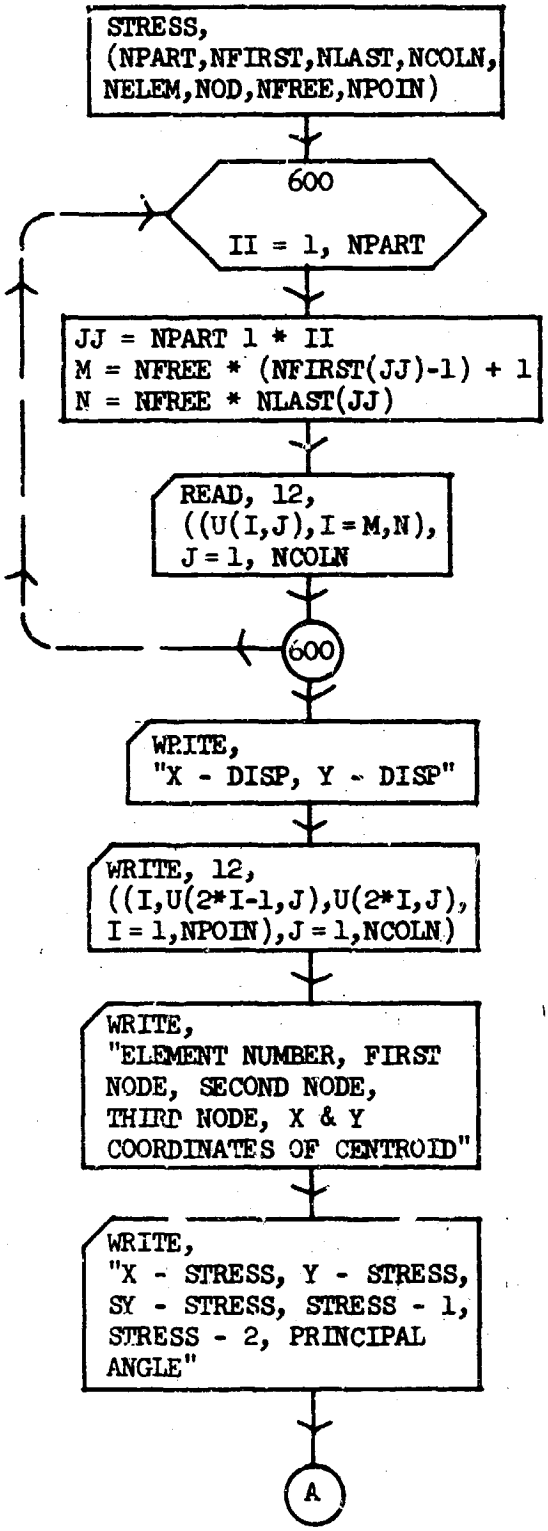

The nodal displacements are recalled from storage.

The node number and its X and Y displacements are printed out.

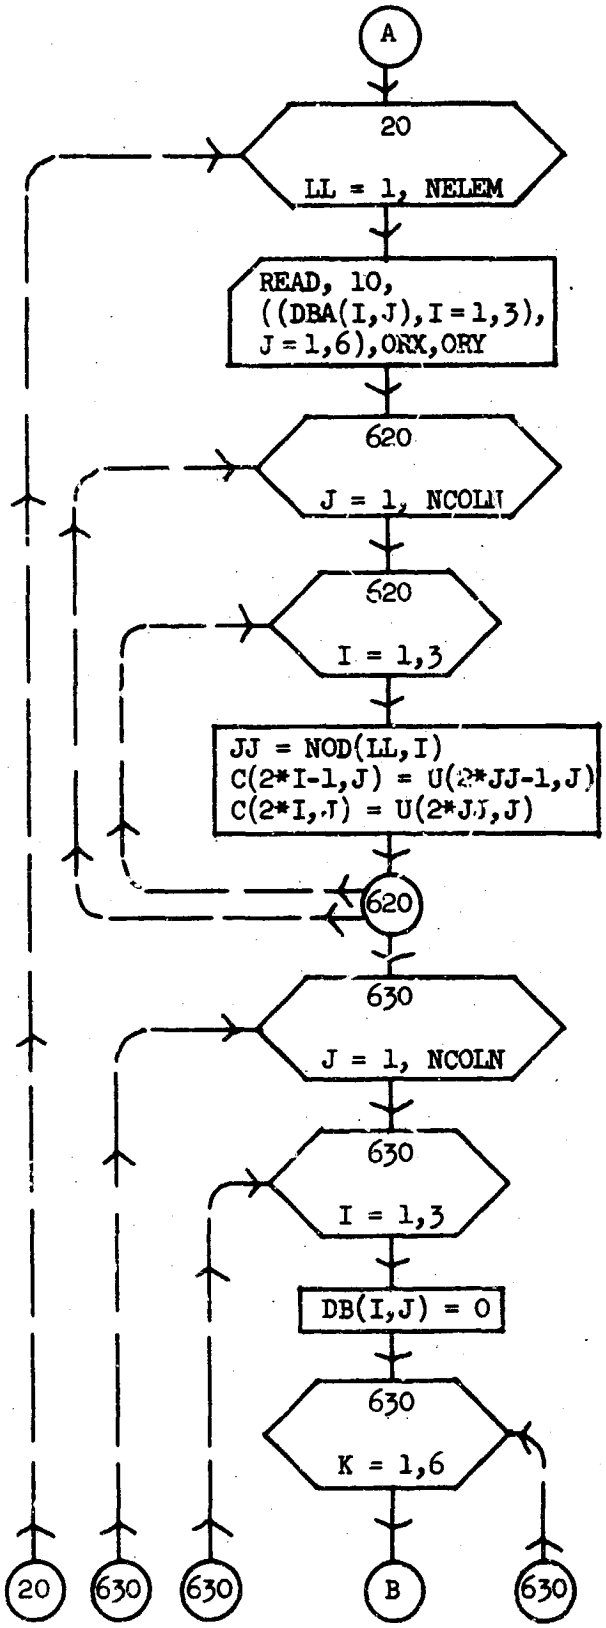

The element stress matrices are recalled from storage.

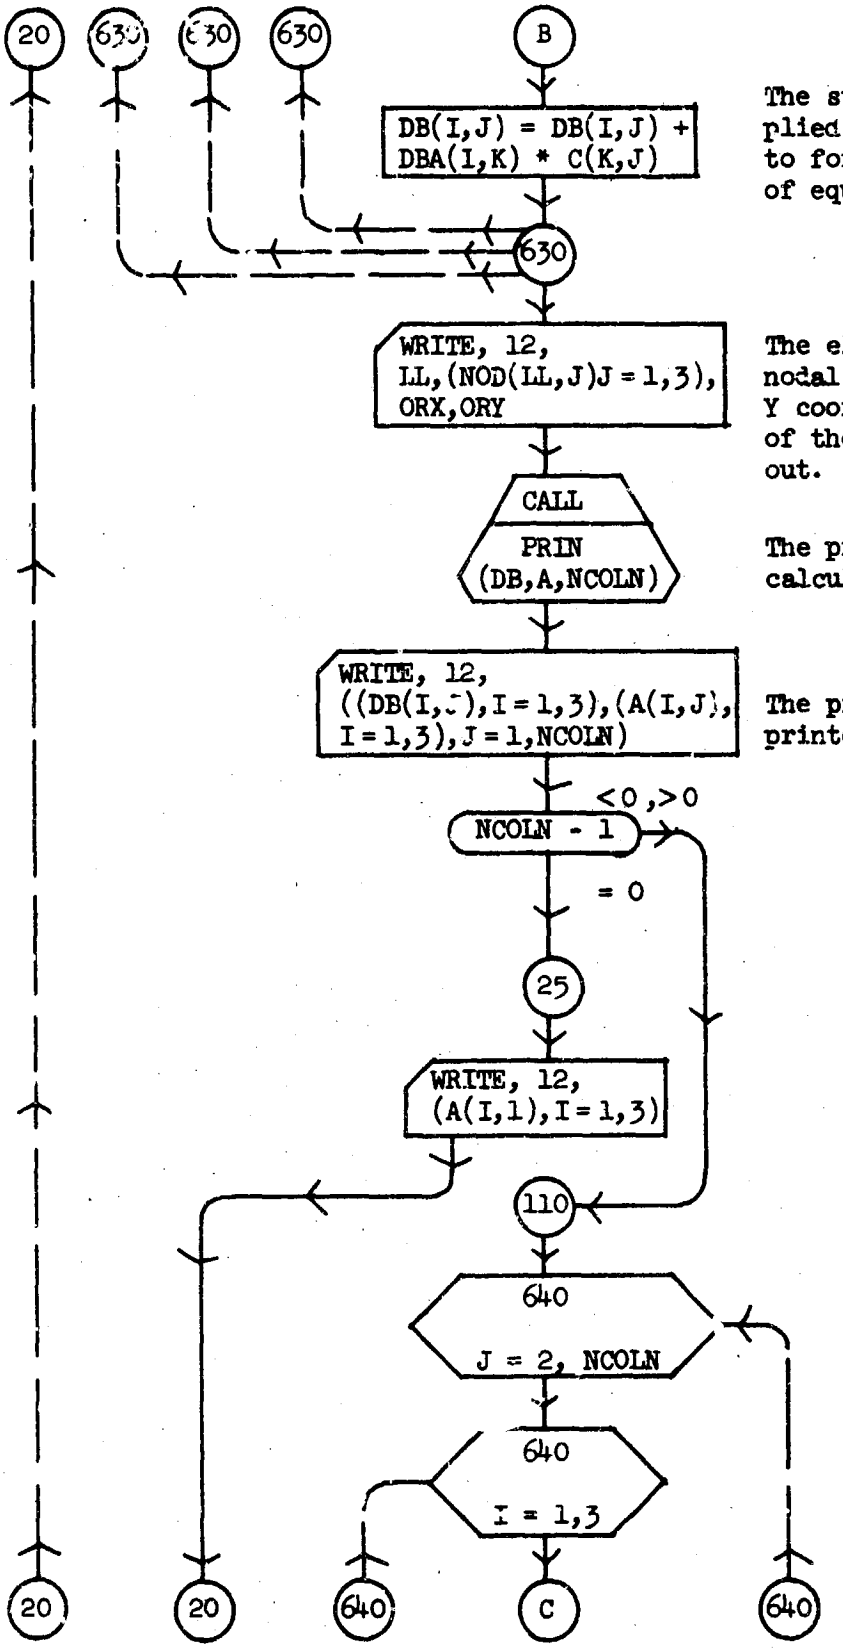

The stress matrix is multiplied by the displacement to form the stress matrix of equation (2).

The element number, its nodal points, and the X and Y coordinates of the centroid of the element are printed out.

The principal stresses are calculated.

The principal stresses are printed out.

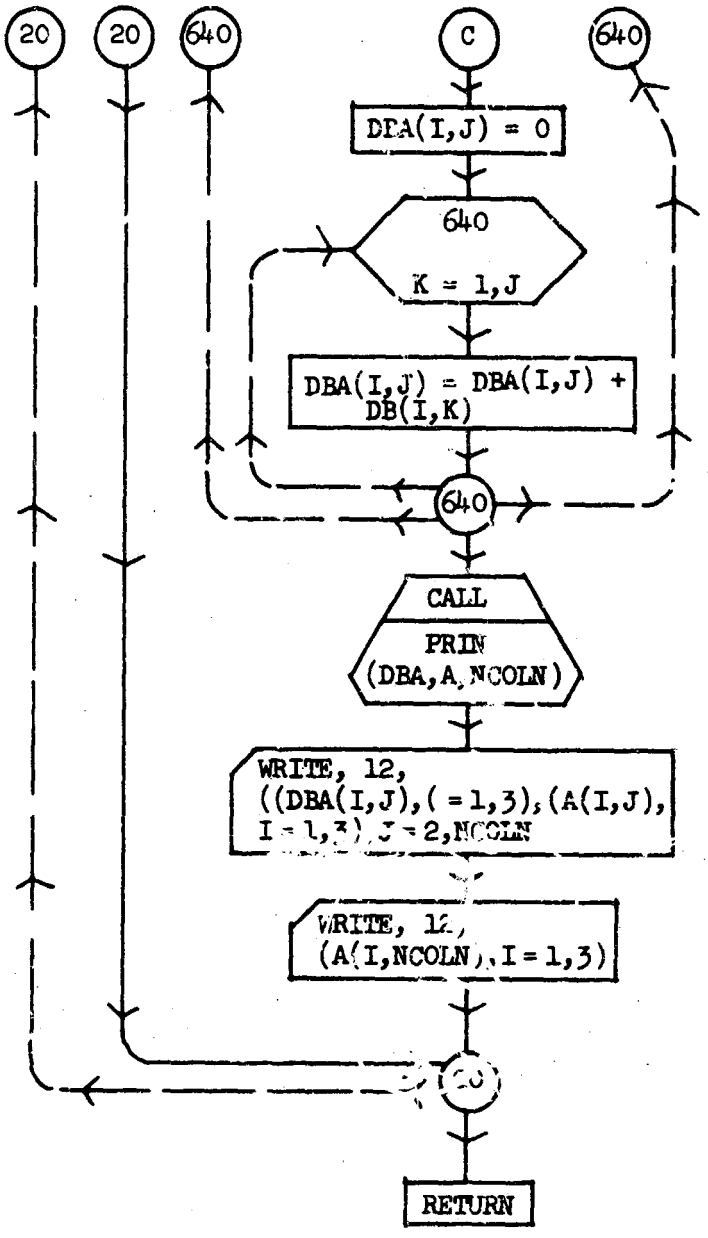
20
20
640
C
640
DBA(I,J) = 0
640
K = 1,J
DBA(I,J) = DBA(I,J) +
DB(I,K)
640
CALL
PRIN
(DBA,A,NCOLN)
WRITE, 12,
((DBA(I,J),(=1,3),(A(I,J),
I = 1,3) J = 2,NCOLN
WRITE, 12,
(A(I,NCOLN),I = 1,3)
20
RETURN

SUBROUTINE PRIN

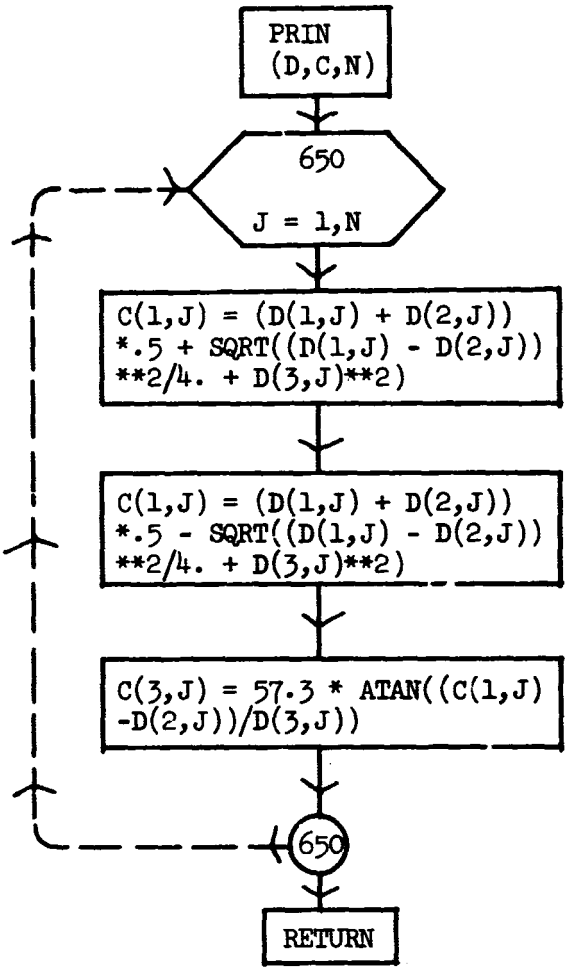

The maximum principal stress is calculated from σ_x = D(1,J), σ_y = D(2,J), and τ_{xy} = D(3,J) using Mohr's circle.

The minimum principal stress is calculated from σ_x, σ_y, and τ_{xy}.

The angle of deviation in (degrees) of the maximum principal stress from the X-axis is calculated.

SUBROUTINES MATTM, MATM, AND MATINV

SUBROUTINE MATTM (D,B,DB,L,M,N)

MATTM is a standard IBM subroutine which transposes the matrix D(L,M), multiplies it by the matrix B(M,N), and assigns the product to the matrix DB(L,N).

SUBROUTINE MATM (D,B,DB,L,M,N)

MATM is a standard IBM subroutine which multiplies the matrix D(L,M) by the matrix B(M,N) and assigns the product to the matrix DB(L,N).

SUBROUTINE MATINV (A,N,B,M)

MATINV is a standard IBM subroutine which inverts the matrix A(N,N), multiplies it by the matrix B(N,M), and assigns the product to the matrix B(N,M).

FINELEM PROGRAM LISTING

The control cards, main program, subroutines, and data location are shown in this section. The Fortran statements listed in this section in the order they are listed form the program FINELEM, which will run on the IBM 360 computer at Kansas State University.

```
C      THESE ARE CONTROL CARDS

// FINELEM JOB (OEK4026,G001,10,2,,,2),'                    ',MSGLEVEL=1
//             EXEC FTGCLGKS,PARM.FORT='MAP',PARM.LKED='LIST,LET,MAP'
//FORT.SYSIN   DD   *

C      MAIN PROGRAM

C      THESE ARE CONTROL CARDS

//GO.FT12F001 DD DSNAME=&DSKSETC,UNIT=(SYSDA,SEP=FT11F001),                X
//             DCB=(RECFM=V,LRECL=293,BLKSIZE=297),SPACE=(CYL,(10,10))
//GO.FT13F001 DD DSNAME=&DSKSETD,UNIT=(SYSDA,SEP=FT12F001),                X
//             DCB=(RECFM=V,LRECL=293,BLKSIZE=297),SPACE=(CYL,(10,10))
//GO.SYSIN     DD   *

C      DATA CARDS GO HERE
```

```
C       MAIN PROGRAM
        DIMENSION X(350,2),XE(3,2),NF(30),NB(30,2),BV(30,2),NOD(450,3),
       1NEP(450),AN(450),THICK(450),E1(10),E2(10),P1(10),P2(10),
       2GE(10),NSTART(15),NEND(15),NFIRST(15),NLAST(15)
        COMMON C(6,6),DBA(3,6),DB(3,6),A(6,6),B(3,6),ST(50,100),U(700,4)
        READ (1,15) NPROB
   10 FORMAT(8I4,2F16.8)
        DO 20 LA=1,NPROB
        REWIND 10
        REWIND 13
C       READING AND PRINTING OF DATA
        READ (1,10)NPART,NPOIN,NELEM,NBOUN,NCOLN,NYM,NP,NFREE,DENSIT,EARTH
        WRITE(3,10)NPART,NPOIN,NELEM,NBOUN,NCOLN,NYM,NP,NFREE,DENSIT,EARTH
        DO 30 I=1,NPOIN
        READ (1,35) X(I,1),X(I,2)
   30 WRITE(3,37)I,X(I,1),X(I,2)
   37 FORMAT(I4,4X,2F16.8)
   35 FORMAT(4F16.8,F8.4)
        READ (1,10) NCARD
        IF (NCARD-NPOIN) 110,111,110
  110 STOP
  111 CONTINUE
        DO 40 I=1,NELEM
        READ(1,46)NUM,(NOD(I,J),J=1,3),NEP(I),AN(I),THICK(I)
   40 WRITE(3,46)NUM,(NOD(I,J),J=1,3),NEP(I),AN(I),THICK(I)
   46 FORMAT(5I4,2F16.8)
   45 FORMAT(3I4,2F16.8,I4)
        READ (1,10) NCARD
        IF (NCARD-NELEM) 120,121,120
  120 STOP
  121 CONTINUE
        DO 50 I=1,NBOUN
        READ (1,45) NF(I),NB(I,1),NB(I,2),BV(I,1),BV(I,2)
   50 WRITE(3,45) NF(I),NB(I,1),NB(I,2),BV(I,1),BV(I,2)
        DO 60 I=1,NPART
        READ (1,10) NSTART(I),NEND(I),NFIRST(I),NLAST(I)
   60 WRITE(3,10) NSTART(I),NEND(I),NFIRST(I),NLAST(I)
        DO 64 I=1,NYM
        READ (1,36) E1(I),E2(I),P1(I),P2(I),GE(I)
   64 WRITE(3,36) E1(I),E2(I),P1(I),P2(I),GE(I)
   36 FORMAT(2F16.8,2F8.4,F16.8)
        READ(1,10)NCONC
        DO 65 J=1,NCOLN
        IF (NCONC) 6,7,6
    7 DO 66 I=1,NPOIN
```

```
      READ (1,33) U(2*I-1,J),U(2*I,J)
   66 WRITE (3,33) U(2*I-1,J),U(2*I,J)
      GO TO 65
    6 NPOIN2=NPOIN*2
      DO 68 I=1,NPOIN2
   68 U(I,1)=0.
      DO 69 I=1,NCONC
      READ (1,33) K,U(2*K-1,1),U(2*K,1)
   69 WRITE (3,33) K,U(2*K-1,1),U(2*K,1)
   33 FORMAT(I4,2E16.8)
      NCONC=0
   65 CONTINUE
C     CALCULATION OF LOADS DUE TO BODY FORCES
      IF (DENSIT) 880,882,880
  882 IF (EARTH) 880,881,880
  880 NCOLN=NCOLN+1
      CALL LOAD(X,XE,NOD,NCOLN,NPOIN,THICK,U,DENSIT,EARTH,NELEM)
  881 CONTINUE
C     FORMATION OF MATRICES
      INTER=0
      DO 70 II=1,NPART
      DO 75 I=1,50
      DO 75 J=1,100
   75 ST(I,J)=0.
      NST=NSTART(II)
      NEN=NEND(II)
      K=NFIRST(II)
      L=NLAST(II)
      MINUS=K-1
      DO 80 LK=NST,NEN
      MM=LK-INTER
      DO 85 I=1,3
      JJ=NOD(LK,I)
      XE(I,1)=X(JJ,1)
   85 XE(I,2)=X(JJ,2)
      ANG=AN(LK)
      TH=THICK(LK)
      J=NEP(LK)
      YM1=E1(J)
      YM2=E2(J)
      PR1=P1(J)
      PR2=P2(J)
      G=GE(J)
C     CALCULATION OF ELEMENT STIFFNESS AND STRESS MATRICES
      CALL FEM(XC,YM1,YM2,PR1,PR2,G,ANG,NP,TH,MM)
      DO 80 LL=1,3
      DO 80 KK=1,3
      IF (NOD(LK,KK)-K) 80,131,131
  131 IF(NOD(LK,KK)-L)132,132,80
  132 M=NFREE*(NOD(LK,KK)-K)
      N=NFREE*(NOD(LK,LL)-K)
```

```
      I=NFREE*(KK-1)
      J=NFREE*(LL-1)
      IF(N)80,900,900
  900 DO 5 NJ=1,NFREE
      DO 5 MI=1,NFREE
      MMI=M+MI
      NNJ=N+NJ
      IMI=I+MI
      JNJ=J+NJ
    5 ST(MMI,NNJ)=ST(MMI,NNJ)+C(IMI,JNJ)
   80 CONTINUE
C     INTRODUCTION OF PRESCRIBED DISPLACEMENTS
      DO 290 I=1,NBOUN
      M=NF(I)-K
      MM=NF(I)-1
      IF (M)290,242,242
  242 IF(M-24)243,243,290
  243 DO 230 J=1,NFREE
      IF(NB(I,J))230,345,230
  345 NMI=NFREE*M+J
      ST(NMI,MMI)=ST(NMI,NMI)*.1E+12
      DO 233 JJ=1,NCOLN
      JNJ=NFREE*MM+J
  233 U(JNJ,JJ)=ST(NMI,NMI)*BV(I,J)
  230 CONTINUE
  290 CONTINUE
      INTER=NBN
      MI=NFREE*MINUS+1
      NJ=NFREE*L
      M=NJ-MI+1
      IF(II-NPART)115,116,115
  115 NA=NFREE*(NLAST(II+1)-MINUS)
      GO TO 117
  116 NA=M+1
  117 N=NA-M
      MM=M+1
   70 WRITE(13)M,N,((ST(I,J),I=1,M),J=1,M),((ST(I,J),I=1,M),J=MM,NA),
     1((U(I,J),I=MI,NJ),J=1,NCOLN)
      REWIND 10
      REWIND 11
      REWIND 12
      REWIND 13
C     SOLUTION OF TRIDIAGONAL MATRICES AND CALCULATION OF RESIDUALS
      CALL SOLVE(NPART,NCOLN)
      REWIND 12
C     CALCULATION OF STRESSES
      CALL STRESS (NPART,NFIRST,NLAST,NCOLN,NELEM,NOD,NFREE,NPOIN)
   20 CONTINUE
      STOP
      END
```

```
C       SUBROUTINE FOR CALCULATION OF LOADS DUE TO BODY FORCES
        SUBROUTINE LOAD(X,XE,NOD,NCOLN,NPOIN,THICK,U,DENSIT,EARTH,NELEM)
        DIMENSION X(350,2),XE(3,2),NOD(450,3),THICK(450),U(700,4)
        NPOIN2=NPOIN*2
        DO 10 I=1,NPOIN2
   10 U(I,NCOLN)=0.
        DO 20 II=1,NELEM
        DO 85 I=1,3
        JJ=NOD(II,I)
        XE(I,1)=X(JJ,1)
   85 XE(I,2)=X(JJ,2)
        VOL=.166667*THICK(II)*(XE(2,1)*(XE(3,2)-XE(1,2))+XE(1,1)*
       1(XE(2,2)-XE(3,2))+XE(3,1)*(XE(1,2)-XE(2,2)))
        VT=VOL*DENSIT
        UT=VOL*EARTH
        DO 86 I=1,3
        JJ=NOD(II,I)
        U(2*JJ-1,NCOLN)=U(2*JJ-1,NCOLN)+UT
   86 U(2*JJ,NCOLN)=U(2*JJ,NCOLN)+VT
   20 CONTINUE
        RETURN
        END
```

```
C     SUBROUTINE FOR FORMATION OF ELEMENT STIFFNESS AND STRESS MATRICES
      SUBROUTINE FEM(XF,YM1,YM2,PR1,PR2,G,ANG,NP,TH,MM)
      DIMENSION D(3,3),BTDBA(6,6),XE(3,2),R(3,3),ZX(3),  (3),R1(3,3)
      COMMON C(6,6),DBA(3,6),DB(3,6),A(6,6),B(3,6),ST(  ,100),U(700,4)
      DO 20 J=1,6
      DO 21 I=1,3
      B(I,J)=0.
      DB(I,J)=0.
   21 DBA(I,J)=0.
      DO 20 I=1,6
      A(I,J)=0.
      BTDBA(I,J)=0.
   20 C(I,J)=0.
      DO 22 J=1,3
      DO 22 I=1,3
      R(I,J)=0.
   22 D(I,J)=0.
      ORX=(XE(1,1)+XE(2,1)+XE(3,1))*.333333
      ORY=(XE(1,2)+XE(2,2)+XE(3,2))*.333333
      DO 5 I=1,3
      XE(I,1)=XE(I,1)-ORX
    5 XE(I,2)=XE(I,2)-ORY
      ZX(1)=XE(2,2)-XE(3,2)
      ZX(2)=XE(3,2)-XE(1,2)
      ZX(3)=XE(1,2)-XE(2,2)
      ZY(1)=XE(3,1)-XE(2,1)
      ZY(2)=XE(1,1)-XE(3,1)
      ZY(3)=XE(2,1)-XE(1,1)
      ZK=XE(2,1)*XE(3,2)-XE(3,1)*XE(2,2)
      Z=3.*ZK
      A(1,1)=ZK/Z
      A(2,1)=ZX(1)/Z
      A(3,1)=ZY(1)/Z
      A(4,2)=A(1,1)
      A(5,2)=A(2,1)
      A(6,2)=A(3,1)
      A(1,3)=ZK/Z
      A(2,3)=ZX(2)/Z
      A(3,3)=ZY(2)/Z
      A(4,4)=A(1,3)
      A(5,4)=A(2,3)
      A(6,4)=A(3,3)
      A(1,5)=ZK/Z
      A(2,5)=ZX(3)/Z
      A(3,5)=ZY(3)/Z
      A(4,6)=A(1,5)
      A(5,6)=A(2,5)
      A(6,6)=A(3,5)
      B(1,2)=1.
      B(3,3)=1.
      B(3,5)=1.
```

```
      B(2,6)=1.
      IF (NP) 75,81,75
C     ELASTICITY MATRIX FOR PLANE STRAIN CASE
   81 EE=YM2/YM1
      DEN=1.-PR2-2.*EE*PR1**2
      D(1,1)=YM1*(1.-PR2)/DEN
      D(2,1)=YM2*PR1/DEN
      D(1,2)=D(2,1)
      D(2,2)=YM2*(1.-EE*PR1**2)/((1.+PR2)*DEN)
      D(3,3)=G
      GO TO 73
C     ELASTICITY MATRIX FOR PLANE STRESS CASE
   75 DEN=(1.-PR1*PR2)
      D(1,1)=YM1/DEN
      D(2,1)=PR1*YM2/DEN
      D(1,2)=D(2,1)
      D(2,2)=YM2/DEN
      D(3,3)=G
   73 IF (ANG)70,72,70
   70 CS=COS(ANG*.017453)
      SS=SIN(ANG*.017453)
      R(1,1)=CS**2
      R(2,1)=SS**2
      R(3,1)=SS*CS
      R(1,2)=R(2,1)
      R(2,2)=R(1,1)
      R(3,2)=-R(3,1)
      R(1,3)=2.*R(3,2)
      R(2,3)=2.*R(3,1)
      R(3,3)=R(1,1)-R(2,1)
      DO 100 J=1,3
      DO 100 I=1,3
      R1(I,J)=0.
      DO 100 K=1,3
  100 R1(I,J)=R1(I,J)+D(I,K)*R(J,K)
      DO 110 J=1,3
      DO 110 I=1,3
      D(I,J)=0.
      DO 110 K=1,3
  110 D(I,J)=D(I,J)+R(I,K)*R1(K,J)
   72 DO 30 J=1,6
      DO 30 I=1,3
      DO 30 K=1,3
   30 DB(I,J)=DB(I,J)+D(I,K)*B(K,J)
      DO 40 J=1,6
      DO 40 I=1,3
      DO 40 K=1,6
   40 DBA(I,J)=DBA(I,J)+DB(I,K)*A(K,J)
C     STRESS MATRIX IS FORMED
      IF (MM) 126,126,127
  127 WRITE(10)((DBA(I,J),I=1,3),J=1,6),OKX,ORY
```

```
  126 CONTINUE
      VOL=.5*TH*Z
      DO 50 J=1,6
      DO 50 I=1,6
      DO 50 K=1,3
   50 BTDBA(I,J)=BTDBA(I,J)+B(K,I)*DBA(K,J)*VOL
      DO 60 J=1,6
      DO 60 I=1,6
      DO 60 K=1,6
   60 C(I,J)=C(I,J)+A(K,I)*BTDBA(K,J)
C     STIFFNESS MATRIX C IS FORMED
      RETURN
      END
```

```
C     SUBROUTINE FOR SOLUTION OF EQUATIONS.CALCULATION AND PRINTING OF RESIDU
      SUBROUTINE SOLVE(NPART,NCOLN)
      DIMENSION AM(50,50),BM(50,50),YM(50,50),TF(50,4),RS(50,4),F(50,4),
     1DIS(50,4)
      COMMON C(6,6),DBA(3,6),DB(3,6),A(6,6),B(3,6),ST(50,100),U(700,4)
      EQUIVALENCE(AM(1,1),ST(1,1)),(BM(1,1),ST(1,51)),(TF(1,1),U(1,1)),
     1(DIS(1,1),U(1,2)),(RS(1,1),U(1,3)),(F(1,1),U(1,4))
      DO 140 I=1,50
      DO 141 J=1,NCOLN
      TF(I,J)=0.
  141 RS(I,J)=0.
      DO 140 J=1,50
  140 YM(I,J)=0.
      DO 144 LL=1,NPART
      READ(13)M,N,((AM(I,J),I=1,M),J=1,M),((BM(I,J),I=1,M),J=1,N),
     1((F(I,J),I=1,M),J=1,NCOLN)
  150 DO 424 I=1,M
      DO 425 J=1,NCOLN
      F(I,J)=F(I,J)-TF(I,J)
  425 DIS(I,J)=F(I,J)
      DO 424 J=1,M
  424 AM(I,J)=AM(I,J)-YM(I,J)
      CALL MATINV(AM,M,DIS,NCOLN)
C     MATINV ---------- STANDARD IBM INVERSION PROGRAM
      WRITE(11)M,N,((AM(I,J),I=1,M),J=1,M),((BM(I,J),I=1,M),J=1,N),
     1((F(I,J),I=1,M),J=1,NCOLN)
      IF(NPART-LL)437,437,432
  432 CALL MATM(AM,F,DIS,M,M,NCOLN)
      CALL MATTM(BM,DIS,TF,N,M,NCOLN)
      DO 110 J=1,N
      DO 110 I=1,M
      YM(I,J)=0.
      DO 110 K=1,M
  110 YM(I,J)=YM(I,J)+AM(I,K)*BM(K,J)
      DO 111 J=1,N
      DO 111 I=1,N
      AM(I,J)=0.
      DO 111 K=1,M
  111 AM(I,J)=AM(I,J)+BM(K,I)*YM(K,J)
      DO 112 I=1,N
      DO 112 J=1,N
  112 YM(I,J)=AM(I,J)
  144 CONTINUE
  437 REWIND 13
      WRITE (12)((DIS(I,J),I=1,M),J=1,NCOLN)
      IF(NPART-1)600,600,601
  601 NA=NPART-1
      DO 441 LL=1,NA
      BACKSPACE 11
      BACKSPACE 11
```

```
      READ(11)M,N,((AM(I,J),I=1,M),J=1,M),((BM(I,J),I=1,M),J=1,N),
     1((F(I,J),I=1,M),J=1,NCOLN)
      CALL MATM(BM,DIS,TF,M,N,NCOLN)
      DO 444 J=1,NCOLN
      DO 444 I=1,M
  444 F(I,J)=F(I,J)-TF(I,J)
      CALL MATM(AM,F,DIS,M,M,NCOLN)
  441 WRITE (12)((DIS(I,J),I=1,M),J=1,NCOLN)
      WRITE (3,515)
  515 FORMAT(10H RESIDUALS)
      DO 500 LL=1,NPART
      READ (13)M,N,((AM(I,J),I=1,M),J=1,M),((BM(I,J),I=1,M),J=1,N),
     1((F(I,J),I=1,M),J=1,NCOLN)
      BACKSPACE 12
      READ (12)((DIS(I,J),I=1,M),J=1,NCOLN)
      BACKSPACE 12
      BACKSPACE 12
      READ (12)((TF(I,J),I=1,N),J=1,NCOLN)
      DO 510 J=1,NCOLN
      DO 510 I=1,M
      F(I,J)=F(I,J)-RS(I,J)
      DO 512 K=1,M
  512 F(I,J)=F(I,J)-AM(I,K)*DIS(K,J)
      DO 510 L=1,N
  510 F(I,J)=F(I,J)-BM(I,L)*TF(L,J)
      CALL MATTM(BM,DIS,RS,N,M,NCOLN)
  500 WRITE (3,31) ((F(I,J),I=1,M),J=1,NCOLN)
   31 FORMAT(1H ,12E9.2)
  600 CONTINUE
      RETURN
      END
```

```
C       SUBROUTINE FOR CALCULATION OF STRESSES
        SUBROUTINE STRESS(NPART,NFIRST,NLAST,NCOLN,NELEM,NOD,NFREE,NPOIN)
        DIMENSION NOD(450,3),NFIRST(15),NLAST(15)
        COMMON C(6,6),DBA(3,6),DB(3,6),A(6,6),B(3,6),ST(50,100),U(700,4)

        DO 600 II=1,NPART
        JJ=NPART+1-II
        M=NFREE*(NFIRST(JJ)-1)+1
        N=NFREE*NLAST(JJ)
  600   READ (12)((U(I,J),I=M,N),J=1,NCOLN)
        WRITE (3,615)
  615   FORMAT(5H NODE,16H X-DISPLACEMENTS,16H Y-DISPLACEMENTS)
        WRITE (3,32) ((I,U(2*I-1,J),U(2*I,J),I=1,NPOIN),J=1,NCOLN)
   32   FORMAT(1H ,I4,2E16.8)
        WRITE(3,625)
  625   FORMAT(16H ELEMENT NUMBER ,16H FIRST NODE      ,16H SECOND NODE
     1,16H THIRD NODE      ,36H X AND Y CO-ORDINATES OF CENTROID    )
        WRITE (3,635)
C       PRINCIPLE ANGLE IS THE ANGLE BETWEEN Y AXIS AND STRESS-1
  635   FORMAT(16H   X-STRESS      ,16HY-STRESS        ,
     116H  XY-STRESS      ,16H  STRESS-1       ,16H  STRESS-2
     216H PRINCIPLE ANGLE)
        DO 20 LL=1,NELEM
        READ (10) ((DBA(I,J),I=1,3),J=1,6),ORX,ORY
        DO 620 J=1,NCOLN
        DO 620 I=1,3
        JJ=NOD(LL,I)
        C(2*I-1,J)=U(2*JJ-1,J)
  620   C(2*I,J)=U(2*JJ,J)
        DO 630 J=1,NCOLN
        DO 630 I=1,3
        DB(I,J)=0.
        DO 630 K=1,6
  630   DB(I,J)=DB(I,J)+DBA(I,K)*C(K,J)
        WRITE (3,10) LL,(NOD(LL,J),J=1,3),ORX,ORY
        CALL PRIN(DB,A,NCOLN)
        WRITE (3,31) ((DB(I,J),I=1,3),(A(I,J),I=1,3),J=1,NCOLN)
        IF (NCOLN-1)110,25,110
   25   WRITE(3,33) (A(I,1),I=1,3)
        GO TO 20
  110   DO 640 J=2,NCOLN
        DO 640 I=1,3
        DBA(I,J)=0.
        DO 640 K=1,J
  640   DBA(I,J)=DBA(I,J)+DB(I,K)
        CALL PRIN(DBA,A,NCOLN)
        WRITE (3,31) ((DBA(I,J),I=1,3),(A(I,J),I=1,3),J=2,NCOLN)
        WRITE (3,33) (A(I,NCOLN),I=1,3)
```

```
20 CONTINUE
31 FORMAT(1H ,5E16.6,F16.8)
33 FORMAT(1HP,5E12.5)
10 FORMAT(1H ,4I4,2F16.8)
   RETURN
   END
```

```
      SUBROUTINE PRIN(D,C,N)
      DIMENSION D(3,6),C(6,6)
      DO 650 J=1,N
      C(1,J) = (D(1,J)+D(2,J))*.5 + SQRT((D(1,J)-D(2,J))**2/4.
     1 + D(3,J)**2)
      C(2,J) = (D(1,J)+D(2,J))*.5 - SQRT((D(1,J)-D(2,J))**2/4.
     1 + D(3,J)**2)
  650 C(3,J) = 57.3*ATAN((C(1,J)-D(2,J))/D(3,J))
      RETURN
      END
```

```
      SUBROUTINE MATTM (D,B,DB,L,M,N)
      DIMENSION D(50,50),B(50,4),DB(50,4)
      DO 110 J=1,N
      DO 110 I=1,L
      DB(I,J)=0.
      DO 110 K=1,M
  110 DB(I,J)=DB(I,J)+D(K,I)*B(K,J)
      RETURN
      END
```

```
      SUBROUTINE MATM (D,B,DB,L,M,N)
      DIMENSION D(50,50),B(50,4),DB(50,4)
      DO 110 J=1,N
      DO 110 I=1,L
      DB(I,J)=0.
      DO 110 K=1,M
  110 DB(I,J)=DB(I,J)+D(I,K)*B(K,J)
      RETURN
      END
```

```
      SUBROUTINE MATINV(A,N,B,M)
C     MATRIX INVERSION WITH ACCOMPANYING SOLUTION OF LINEAR EQUATIONS
C     INITIALIZATION
      DIMENSION IPIVOT(50),A(50,50),B(50,4),INDEX(50,2),PIVOT(50)
   15 DO 20 J=1,N
   20 IPIVOT(J)=0
   30 DO 550 I=1,N
C     SEARCH FOR PIVOT ELEMENT
   40 AMAX=0.0
   45 DO 105 J=1,N
   50 IF (IPIVOT(J)-1) 60, 105, 60
   60 DO 100 K=1,N
   70 IF (IPIVOT(K)-1) 80,100,740
   80 IF ( ABS(AMAX)- ABS(A(J,K))) 85, 100, 100
   85 IROW=J
   90 ICOLUM=K
   95 AMAX=A(J,K)
  100 CONTINUE
  105 CONTINUE
  110 IPIVOT(ICOLUM)=IPIVOT(ICOLUM)+1
C     INTERCHANGE ROWS TO PUT PIVOT ELEMENT ON DIAGONAL
  130 IF (IROW-ICOLUM) 150, 260, 150
  150 DO 200 L=1,N
  160 SWAP=A(IROW,L)
  170 A(IROW,L)=A(ICOLUM,L)
  200 A(ICOLUM,L)=SWAP
  205 IF(M) 260, 260, 210
  210 DO 250 L=1, M
  220 SWAP=B(IROW,L)
  230 B(IROW,L)=B(ICOLUM,L)
  250 B(ICOLUM,L)=SWAP
  260 INDEX(I,1)=IROW
  270 INDEX(I,2)=ICOLUM
  310 PIVOT(I)=A(ICOLUM,ICOLUM)
C     DIVIDE PIVOT ROW BY PIVOT ELEMENT
  330 A(ICOLUM,ICOLUM)=1.0
  340 DO 350 L=1,N
  350 A(ICOLUM,L)=A(ICOLUM,L)/PIVOT(I)
  355 IF(M) 380, 380, 360
  360 DO 370 L=1,M
  370 B(ICOLUM,L)=B(ICOLUM,L)/PIVOT(I)
C     REDUCE NON-PIVOT ROWS
  380 DO 550 L1=1,N
  390 IF(L1-ICOLUM) 400, 550, 400
  400 T=A(L1,ICOLUM)
  420 A(L1,ICOLUM)=0.0
  430 DO 450 L=1,N
  450 A(L1,L)=A(L1,L)-A(ICOLUM,L)*T
  455 IF(M) 550, 550, 460
```

```
  460 DO 500 L=1,M
  500 B(L1,L)=B(L1,L)-B(ICOLUM,L)*T
  550 CONTINUE
C     INTERCHANGE COLUMNS
  600 DO 710 I=1,N
  610 L=N+1-I
  620 IF (INDEX(L,1)-INDEX(L,2)) 630, 710, 630
  630 JROW=INDEX(L,1)
  640 JCOLUM=INDEX(L,2)
  650 DO 705 K=1,N
  660 SWAP=A(K,JROW)
  670 A(K,JROW)=A(K,JCOLUM)
  700 A(K,JCOLUM)=SWAP
  705 CONTINUE
  710 CONTINUE
  740 RETURN
      END
```

DATA PREPARATION FOR FINELEM

			Format
1.	1 Card		
	Columns		
	1 - 4	Number of problems to be run in one execution of program	I4
2.	1 Card		
	Columns		
	1 - 4	Number of partitions ($\leq$ 15)	I4
	5 - 8	Number of nodal points ($\leq$ 350)	I4
	9 - 12	Number of elements ($\leq$ 450)	I4
	13 - 16	Number of nodal points with prescribed displacements ($\leq$ 45)	I4
	17 - 20	Number of load vectors ($\leq$ 4)	I4
	21 - 24	Number of different elastic properties ($\leq$ 10)	I4
	25 - 28	0: plane strain 1: plane stress	I4
	29 - 32	Number of degrees of freedom per node	I4
	33 - 48	Force per unit volume in y-direction	F 16.8
	49 - 64	Force per unit volume in x-direction	F 16.8
3.	1 Card for each nodal point (in ascending order)		
	Columns		
	1 - 16	x-coordinate of nodal point	F 16.8
	17 - 32	y-coordinate of nodal point	F 16.8
4.	1 Card		
	Columns		
	1 - 4	Number of nodal point cards to be read in	I4

		Format
5. 1 Card for each element (in ascending order)		
Columns		
1 - 4	Element number	I4
5 - 8	Nodal points in anticlockwise rotation	I4
9 - 12	Nodal points in anticlockwise rotation	I4
13 - 16	Nodal points in anticlockwise rotation	I4
17 - 20	Elastic property number	I4
21 - 36	Angle which the x-axis of orthotropy makes with the global x-axis	F 16.8
37 - 52	Thickness of element	F 16.8
6. 1 Card		
Columns		
1 - 4	Number of element cards to be read in	I4
7. 1 Card for each nodal point with prescribed displacement		
Columns		
1 - 4	Nodal point number	I4
5 - 8	Displacement in x-direction 0: fixed 1: free	I4
9 - 12	Displacement in y-direction 0: fixed 1: free	I4
13 - 28	Prescribed value of displacement in x-direction	F 16.8
29 - 44	Prescribed value of displacement in y-direction	F 16.8
8. 1 Card for each partition (in ascending order)		
Columns		
1 - 4	First element in partition	I4
5 - 8	Last element in partition	I4

		Format
9 - 12	First nodal point in partition	I4
13 - 16	Last nodal point in partition	I4

NOTE: A partition cannot contain more than 24 nodal points numbered in consecutive order.

9. 1 Card for each elastic property

Columns

1 - 16	Young's modulus in x-direction	F 16.8
17 - 32	Young's modulus in y-direction	F 16.8
33 - 40	Poisson's ratio in x-direction	F 8.4
41 - 48	Poisson's ratio in y-direction	F 8.4
49 - 64	Shear modulus	F 16.8

10. 1 Card

Columns

1 - 4	Number of nodal points with concentrated loads	I4

11. 1 Card for each nodal point with concentrated load

Columns

1 - 4	Nodal point number	I4
5 - 20	Load in x-direction	F 16.8
21 - 36	Load in y-direction	F 16.8

NOTE: If there are no points with concentrated loads, omit Set 11 cards. A blank card (or card with a zero punch in column 4) must still be included (Set 10).

If points with concentrated loads are present, they together form one load vector (regardless of the number of points) which must be included in the count in columns 17 - 20 of the second data card. (Set 2.)

Format

12. 1 Card for every point (in ascending order)

Columns		
1 - 16	Load in x-direction	F 16.8
17 - 32	Load in y-direction	F 16.8

NOTE: One card must be included for every point even if the load is zero. If only concentrated load exists, however, omit Set 12 completely.

Repeat Set 12 for every separate load vector.

Set 11 and Set 12 cards are alternatives. If only a single load vector of a relatively small number of arbitrarily specified loads is to be dealt with, use Set 11. If more than one load vector of arbitrarily specified loads is to be dealt with, then Set 12 should be used and one card must be included for every nodal point, even if the load is zero.

For a combined loading, arbitrarily specified loads, and computer output, the cards for the nodes with combined loads should be abstracted from the output deck and replaced by cards with the total load.

NUMERICAL EXAMPLES

EXAMPLE 1: DEFLECTION AND STRESSES, SIMPLY SUPPORTED BEAM

Determine the centerline deflection, the flexural stresses at sections A and B, and the horizontal shear stresses at section A of the simply supported beam shown in Fig. 3(a) on page 76. Calculate the deflection and stresses using "classical methods" of analysis and then the computer program, FINELEM. For this example, $\mu = 0.3$ and $E = 30 \times 10^3$ ksi.

Solution:

The centerline deflection or maximum vertical deflection of a simply supported beam with a concentrated load at midspan is calculated using the following formula from "classical" beam theory,

$$\Delta_{max} = \frac{PL^3}{48EI} \tag{53}$$

in which Δ_{max} represents the deflection, P represents the concentrated load, L represents the beam length, E represents Young's modulus, and I represents the moment of inertia of the section.

The moment of inertia for this section is

$$I = \frac{bh^3}{12} = \frac{5(10)^3}{12} = 416.7 \text{ in}^4.$$

Substituting the appropriate values into equation (53) gives the following:

$$\Delta_{max} = \frac{10(60)^3}{48(30 \times 10^3)416.7} = 0.0036 \text{ in.}$$

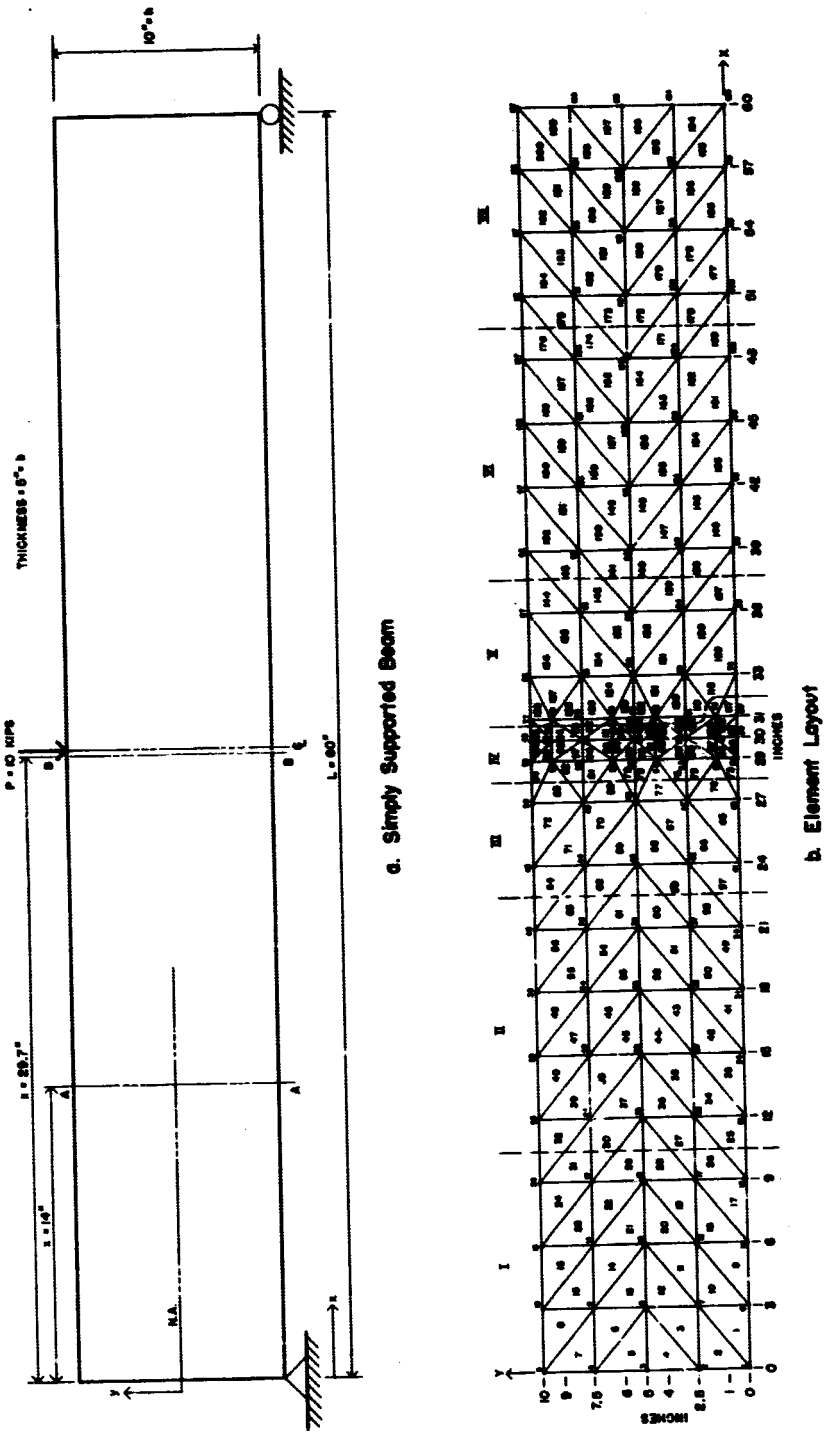

Fig. 3. Example 1: Flexural Stresses, Simply Supported Beam

The centerline deflection calculated by FINELEM is found in Appendix A as the y-displacement of nodal point 68 and equals the following:

$$\Delta_{max} = 0.0034 \text{ in.}$$

The FINELEM deflection is smaller than the "classical method" deflection by approximately 5.5 percent.

The "classical method" for calculating the flexural stresses at a given point along the beam makes use of the flexural formula

$$\sigma_x = \frac{M_x y}{I} \tag{54}$$

in which σ_x represents the flexural stress in the x-direction, M_x represents the moment at the point where the stress is to be determined, y represents the distance from the neutral axis of the section, and I represents the moment of inertia of the beam.

At section A,

$$x = 14 \text{ in.}$$

and

$$M_x = \frac{P}{2} x = \frac{(10)}{2} 14 = 70 \text{ in-kips}$$

Similarly, at section B,

$$x = 29.7 \text{ in.}$$

and

$$M_x = \frac{P}{2} x = \frac{(10)}{2} 29.7 = 148.5 \text{ in-kips}$$

The flexural stress distributions for sections A and B are linear and vary from a maximum value in compression on the top of the beam to the same maximum value in tension on the bottom of the beam and are calculated using equation (54) in which y varies from 0 inches at the neutral axis to ± 5 inches at the outer fiber of the beam.

The maximum flexural stress at section A is

$$\sigma_{14} = \frac{M_{14} y}{I} = \frac{70(5)}{416.7} = \pm 0.84 \text{ kip/in}^2$$

The maximum flexural stress at section B is

$$\sigma_{29.7} = \frac{M_{29.7} y}{I} = \frac{148.5(5)}{416.7} = \pm 1.78 \text{ kip/in}^2$$

The "classical method" flexural stress distributions for sections A and B are shown in Fig. 4(a) and Fig. 4(b), respectively.

The "classical method" used for calculating the horizontal shear stresses at a given point along the beam makes use of the horizontal shear formula

$$\tau_{xy} = \frac{VQ}{Ib} \tag{55}$$

in which τ_{xy} represents the horizontal shear stress, V represents the shear force at the point where the stress is to be determined, Q represents the area above the point where the stress is to be determined multiplied by the distance from the centroid of the area to the neutral axis, I represents

the moment of inertia of the beam, and b represents the width of the beam where the stress is being calculated.

Using equation (55), the horizontal shear stresses are calculated at the neutral axis and 2.5 inches above the neutral axis. These points are assumed to be enough to show the general shape of the shear distribution curve.

The horizontal shear stress at the neutral axis is

$$\tau_{n.a.} = \frac{5(5)5(2.5)}{416.7(5)} = 0.15 \text{ kip/in}^2$$

The horizontal shear stress 2.5 inches above the neutral axis is

$$\tau_{2.5} = \frac{5(5)2.5(3.75)}{416.7(5)} = 0.1125 \text{ kip/in}^2$$

The "classical method" horizontal shear stresses are shown in Fig. 5. The shear distribution curve is drawn through these points.

To solve the problem using the computer program, FINELEM, the beam was divided into 200 triangular elements with 127 nodal points as shown in Fig. 3(b). Smaller triangular elements were used near the center of the beam in order to place the centroids of some of the elements near the outer edge of the beam, where the flexural stresses are largest. The triangular elements were numbered with larger numerals than the nodal points in Fig. 3(b) in order to distinguish between the two. The elements and nodal points were numbered consecutively and in an orderly manner. An order similar to this should always be used in numbering the elements and nodal points for a problem.

There are only two nodal points with prescribed displacements: nodal point 1, which was fixed against displacement in the X- and Y-directions,

and nodal point 123, which was fixed against displacement in the Y-direction. These displacements correspond to a hinge at nodal point 1 and a roller at nodal point 123. In order to fix a nodal point, a displacement of 0.0 inches is assigned in the direction required.

The plane stress case is specified, which causes the strain in the Z-direction to be eliminated from the calculations.

The concentrated load of 10 kips was divided into three concentrated loads of 3.33 kips, 3.34 kips, and 3.33 kips, and applied in the negative Y-direction at nodal points 59, 68, and 77, respectively, in an attempt to distribute the concentrated load and minimize the compression effect of a point concentrated load.

The nodal points were assigned consecutively to seven partitions with no more than 24 consecutive nodal points in one partition. The partitions of the partitioning scheme were indicated in Fig. 3(b) by Roman numerals.

The form of the data required for use in the program is shown in the section entitled "Data Preparation for FINELEM" starting on page 71.

The input data and significant parts of the output information for Example 1 were included in Appendix A for reference. All of the output information used to construct the graphs of Figs. 4 and 5 has been underlined in Appendix A.

The flexural stresses for the elements are found under the heading "X-STRESS" in Appendix A. The flexural stresses at section A, $x = 14$ in., were output as the X-stresses at the centroids of elements 33, 35, 38, and 40. The flexural stresses at section B, $x = 29.7$ in., were output as the X-stresses at the centroids of elements 85, 87, 90, 91, 94, 95, 98, and 100. These stresses are shown in Fig. 4(a) and Fig. 4(b) along with the "classical method" stresses.

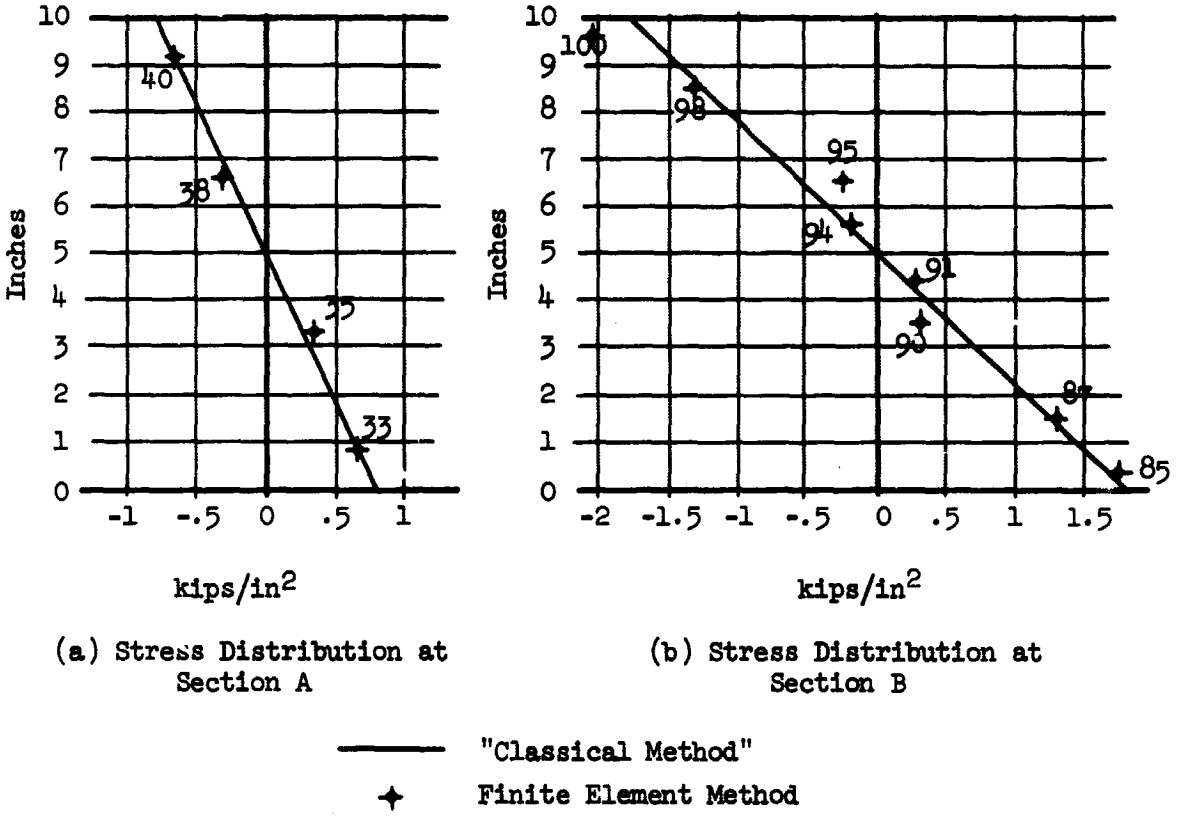

(a) Stress Distribution at Section A

(b) Stress Distribution at Section B

Fig. 4. Flexural Stress Distributions for Example 1.

In Fig. 4(a) the stresses calculated for section A using the finite element method approximate the "classical method" stresses very well. However, in Fig. 4(b) the stresses calculated for section B using the finite element method show a deviation of more than 20 percent from the "classical method" stresses near the top of the beam. This difference is attributed to the fact that the axial compression deformation due to the concentrated loading is ignored in the "classical method," but not in the finite element method. Dividing the concentrated load into three smaller loads had some effect in reducing the difference between the two methods, but the axial compression effect will always be present in the finite element method making it a more "realistic" method than the "classical method."

The horizontal shear stresses, which are also equal to the vertical shear stresses, for the elements should be found under the heading "XY-STRESS" in Appendix A. However, it was discovered that these shear stresses do not necessarily equal the expected shear stress calculated by equation (55).

For example, the FINELEM shear stress from Appendix A for element 33, whose centroid is on section A, is 0.141 ksi. The horizonal shear stress calculated using equation (55) is

$$\tau_{4.167} = \frac{VQ}{Ib} = \frac{5(5)0.833(4.583)}{416.7(5)}$$

$$\tau_{4.167} = 0.046 \text{ ksi}$$

The FINELEM shear stress is greater than the calculated horizontal shear stress by over 200 percent; therefore, this is an incorrect interpretation of the meaning of the FINELEM shear stress.

Since the "classical method" horizontal shear stress is constant at sections where V, the shear force, is constant, it was assumed that the correct interpretation of the "XY-STRESS" could be found by averaging the stresses at adjacent elements. For example, the FINELEM shear stress for element 34, which is adjacent to element 33, is 0.007 ksi. The average of the stresses of elements 33 and 34 is

$$\tau_{ave.} = \frac{0.141 + 0.007}{2} = 0.072 \text{ ksi.}$$

The horizontal shear stress calculated using equation (55) for a point midway between the centroids of elements 33 and 34 is

$$\tau_{4.75} = \frac{VQ}{Ib} = \frac{5(5)1.25(5.38)}{416.7(5)}$$

$$\tau_{4.75} = 0.080 \text{ ksi}$$

The FINELEM shear stress is smaller than the calculated shear stress by about 10 percent; therefore, this is a more correct interpretation of the meaning of the "XY-STRESS." The FINELEM shear stresses for the elements on section A, 33, 35, 38, and 40, and the elements adjacent to section A, have been shown in Fig. 5. The curve of the average of adjacent elements approximates the "classical method" shear distribution curve.

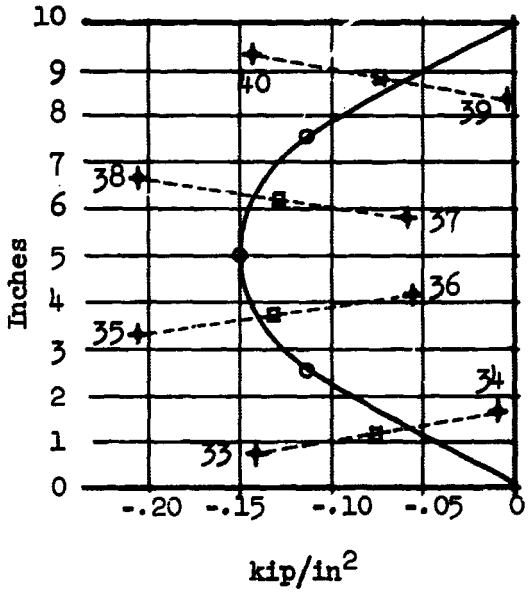

o "Classical Method" Shears

——— "Classical Method" Shear Distribution Curve

\+ Finite Element Method "XY-STRESS"

□ Average of Adjacent Element Stresses

Fig. 5. Horizontal Shear Distributions Near Section A.

The total shear force was calculated by multiplying the average shear force of adjacent elements by the height of the elements by their width and then adding the results as follows:

Adjacent elements	FINELEM stress kip/in^2	Average stress kip/in^2		Area of element in^2		Shear force kips
33 34	0.141 0.006	0.074	×	2.5(5)	=	0.93
35 36	0.204 0.053	0.129	×	2.5(5)	=	1.61
37 38	0.057 0.206	0.132	×	2.5(5)	=	1.65
39 40	0.001 0.142	0.072	×	2.5(5)	=	0.90
				Total shear force =		5.09 kips

This total shear is within less than 2 percent of the "classical method" total shear, 5 kips.

EXAMPLE 2: STRESSES NEAR RECTANGULAR HOLE, SIMPLY SUPPORTED BEAM

Determine the stresses near the rectangular hole in the simply supported 12WF45 beam, shown in Fig. 6, using the computer program, FINELEM. For this example $\mu = 0.3$ and $E = 30 \times 10^3$ ksi.

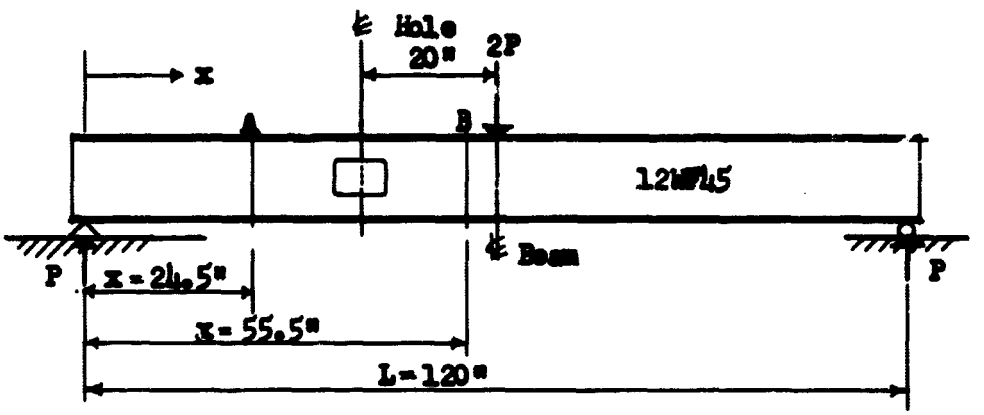

Fig. 6. Simply Supported Beam.

Solution:

A section A-B was cut out of the beam as shown in Fig. 7 with a constant cross section as shown in Fig. 8 in order to make a more accurate analysis of the section around the area of the rectangular hole. This procedure allowed a finer element mesh to be used in the area of the beam, where "classical methods" for claculating flexural and horizontal shear stresses were questionable. Section A-B was assumed to extend far enough past the hole on either side that the actual stress condition in the section as it existed in the beam would be approximated by applying the end moments and shears to the section as a free body.

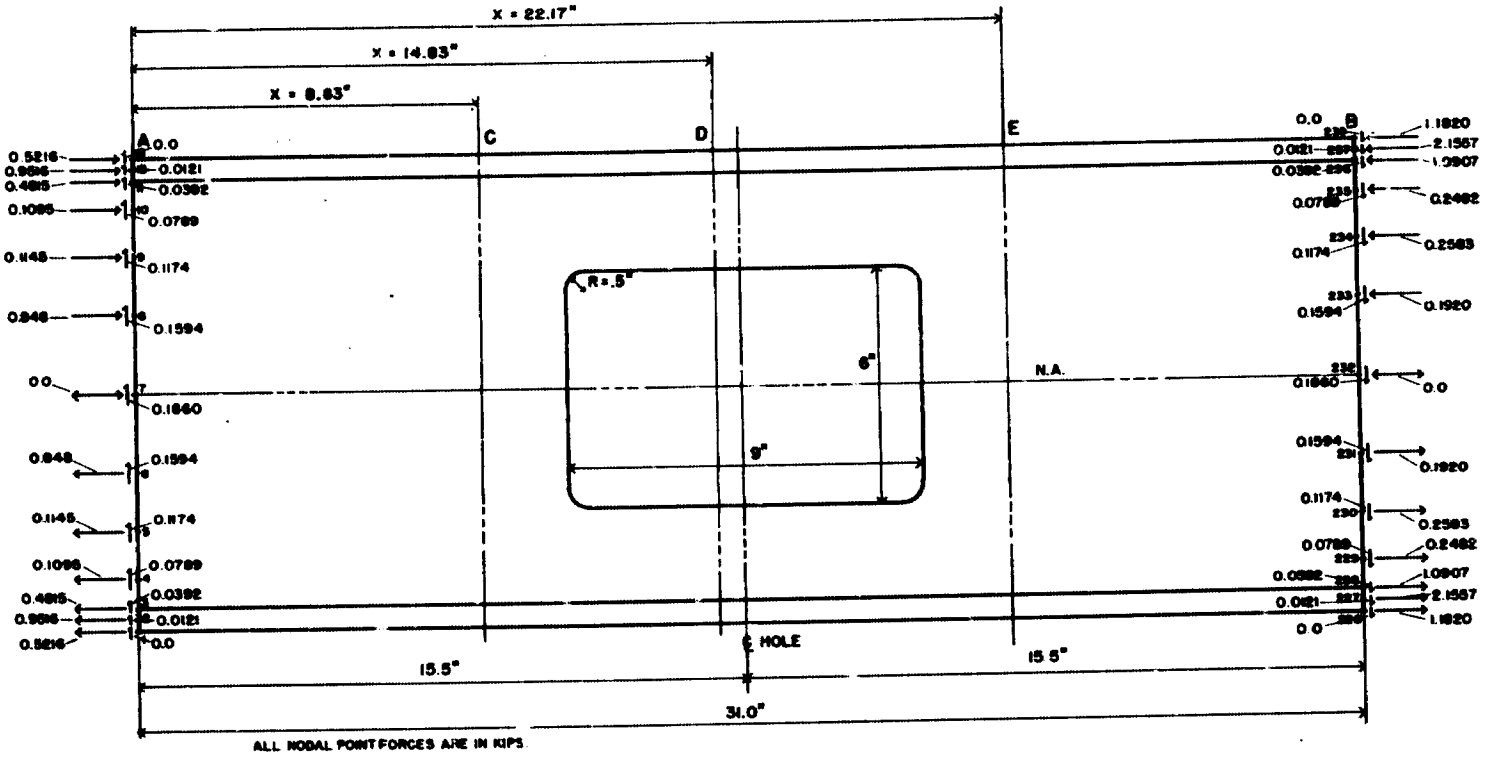

M_A = 24.5 in-kip
V_A = 1 kip

M_B = 55.5 in-kip
V_B = 1 kip

Fig. 7. Portion of Beam Used for Finite Element Method Analysis

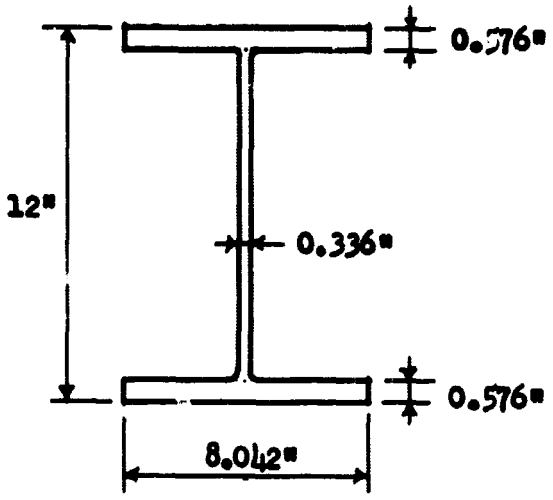

Fig. 8. Section Through 12WF45 Beam.

Section A-B shown in Fig. 9 was divided into a finite element mesh using 394 triangular elements and 238 nodal points. Smaller triangular elements were used near the perimeter of the hole in order to give a better picture of the stresses near the hole. Small triangular elements were used along both flanges in order to try to reduce the adverse effect, which might be caused by the great difference in thickness between the elements in the flange and in the web. The triangular elements were numbered with larger numerals than the nodal points in Fig. 9 in order to distinguish between the two. The elements and nodal points were again numbered consecutively and in an orderly manner as in Example 1.

The nodal points were assigned, consecutively, to 12 partitions with no more than 24 consecutive nodal points in one partition. The partitions of the partitioning scheme were indicated in Fig. 9 by Roman numerals and dashed lines, which indicate the nodal points and elements in each partition.

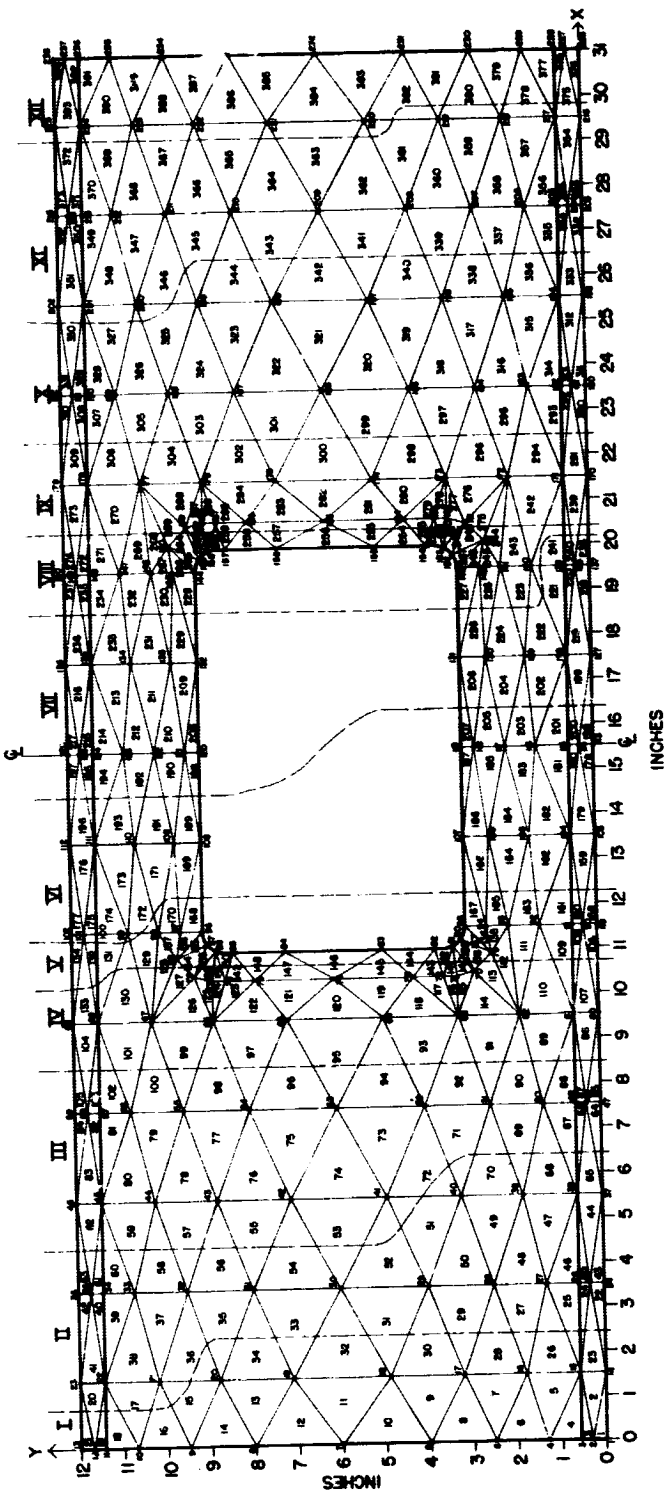

Fig. 8. Element Layout

The plane stress case was specified, which caused the strain in the Z-direction to be eliminated from the calculations. The effect of the strain in the Z-direction was not introduced into the solution of the problem because it is normally ignored in "classical method" calculations.

The moments and shears forces on the free body, section A-B, cannot be used as such. These moments and forces must be put into the form of concentrated loads to be used in the finite element method analysis.

The moments and shears on the free body, section A-B, were approximated by a series of concentrated loads applied at the nodal points on either end of the section. The series of concentrated loads were to approximate the actual stress conditions at sections A and B as closely as possible. In order to do this the flexural stress and horizontal shear stress distributions at sections A and B were calculated with P assumed to be 1 kip.

The maximum flexural stress at section A, calculated by equation (54), is

$$\sigma_{24.5} = \frac{M_{24.5}y}{I} = \frac{1(24.5)6}{350.8}$$

$$\sigma_{24.5} = \pm 0.4190 \text{ kip/in}^2$$

and the flexural stress distribution for section A is shown in Fig. 10.

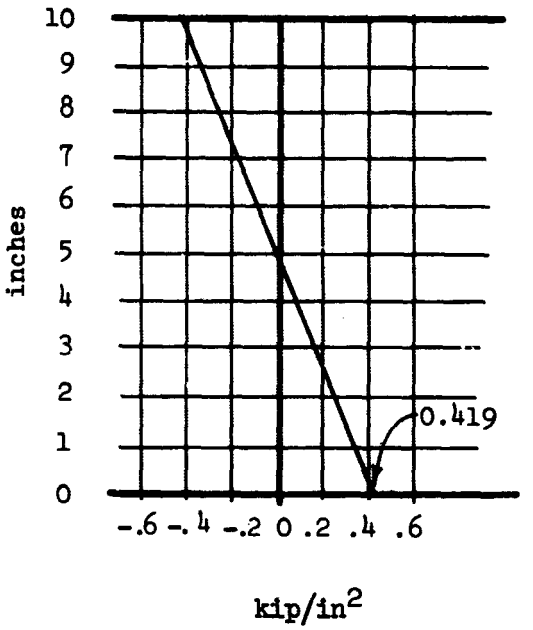

Fig. 10. Flexural Stress Distribution, Section A.

This stress distribution was resolved into a series of x-direction concentrated loads by multiplying the stress at a nodal point by the sum of half the distance between the adjacent nodal points and then multiplying this value by the flange or web thickness at the nodal point. The sum of the moments produced by these concentrated forces applied at nodal points about the neutral axis was checked to see if it equaled the statical moment at the section, which was 24.5 in-kip. The small difference between the sum of the moments and the statical moment was proportionately resolved into a series of small concentrated loads, which were then added to the previous concentrated loads making the sum of the moments produced by the concentrated loads equal to the statical moment, 24.5 in-kip. These concentrated loads are shown in Fig. 7.

The maximum flexural stress at section A calculated by equation (54) is

$$\sigma_{55.5} = \frac{M_{55.5}y}{I} = \frac{1(55.5)6}{350.8}$$

$$\sigma_{55.5} = \pm 0.9493 \text{ kip/in}^2$$

The stress distribution at section B was resolved into a series of concentrated loads by the same method used in section A. The resultant concentrated loads are shown in Fig. 7.

The horizontal shear stress distributions at sections A and B, and the stress distributions above and below the neutral axis of the sections were identical, respectively; therefore, the horizontal stresses at nodal points 1 through 7 calculated using equation (55) were used to plot the horizontal stress distribution. The horizontal shear stress for nodal point 7 on the neutral axis, using equation (55) and referring to Fig. 11, was calculated as follows:

The distance, $\bar{y}$, from the neutral axis to the centroid of the section in Fig. 11 is

$$\bar{y} = \frac{\Sigma Ay}{\Sigma A} = \frac{8.042(0.576)5.712 + 0.336(5.424)2.712}{8.042(0.576) + 0.336(5.424)} = \frac{31.402}{6.455}$$

$$\bar{y} = 4.865 \text{ in.}$$

$$\tau_{n.a.} = \frac{V(\Sigma A)\bar{y}}{Ib} = \frac{1(6.455)4.865}{350.8(0.336)}$$

$$\tau_{n.a.} = 0.2664 \text{ kip/in}^2$$

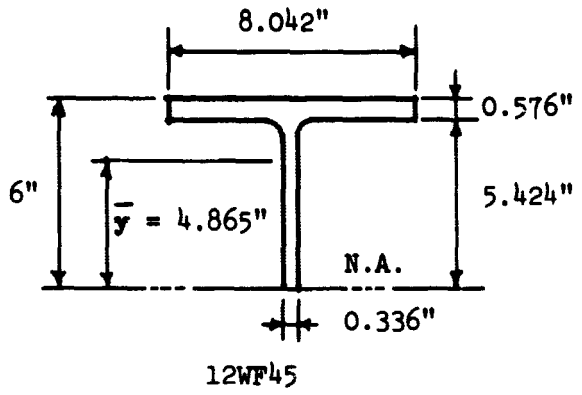

Fig. 11. Section for Calculating Horizontal Shear Stress at the Neutral Axis.

The horizontal shear stress for nodal points 1 through 6 were calculated by the same method used for nodal point 7. The horizontal shear stresses at the nodal points were resolved into a series of concentrated loads in the y-direction by multiplying them by the sum of half the distance between adjacent nodal points and then multiplying this value by the flange or web thickness at the nodal point. The small difference between the sum of the concentrated loads at section A and the shear force at section A, 1 kip, was proportionately resolved into a series of small concentrated loads which were added to the previous concentrated loads, making the sum of the new concentrated loads equal to the shear force, 1 kip. These concentrated loads are shown in Fig. 7 in the appropriate directions.

The input data and significant parts of the output information for Example 2 were included in Appendix B for reference.

The flexural and horizontal shear stresses at sections C, D, and E in Fig. 7 are shown in Figs. 12 and 13 as a sampling of the stresses in section A-B.

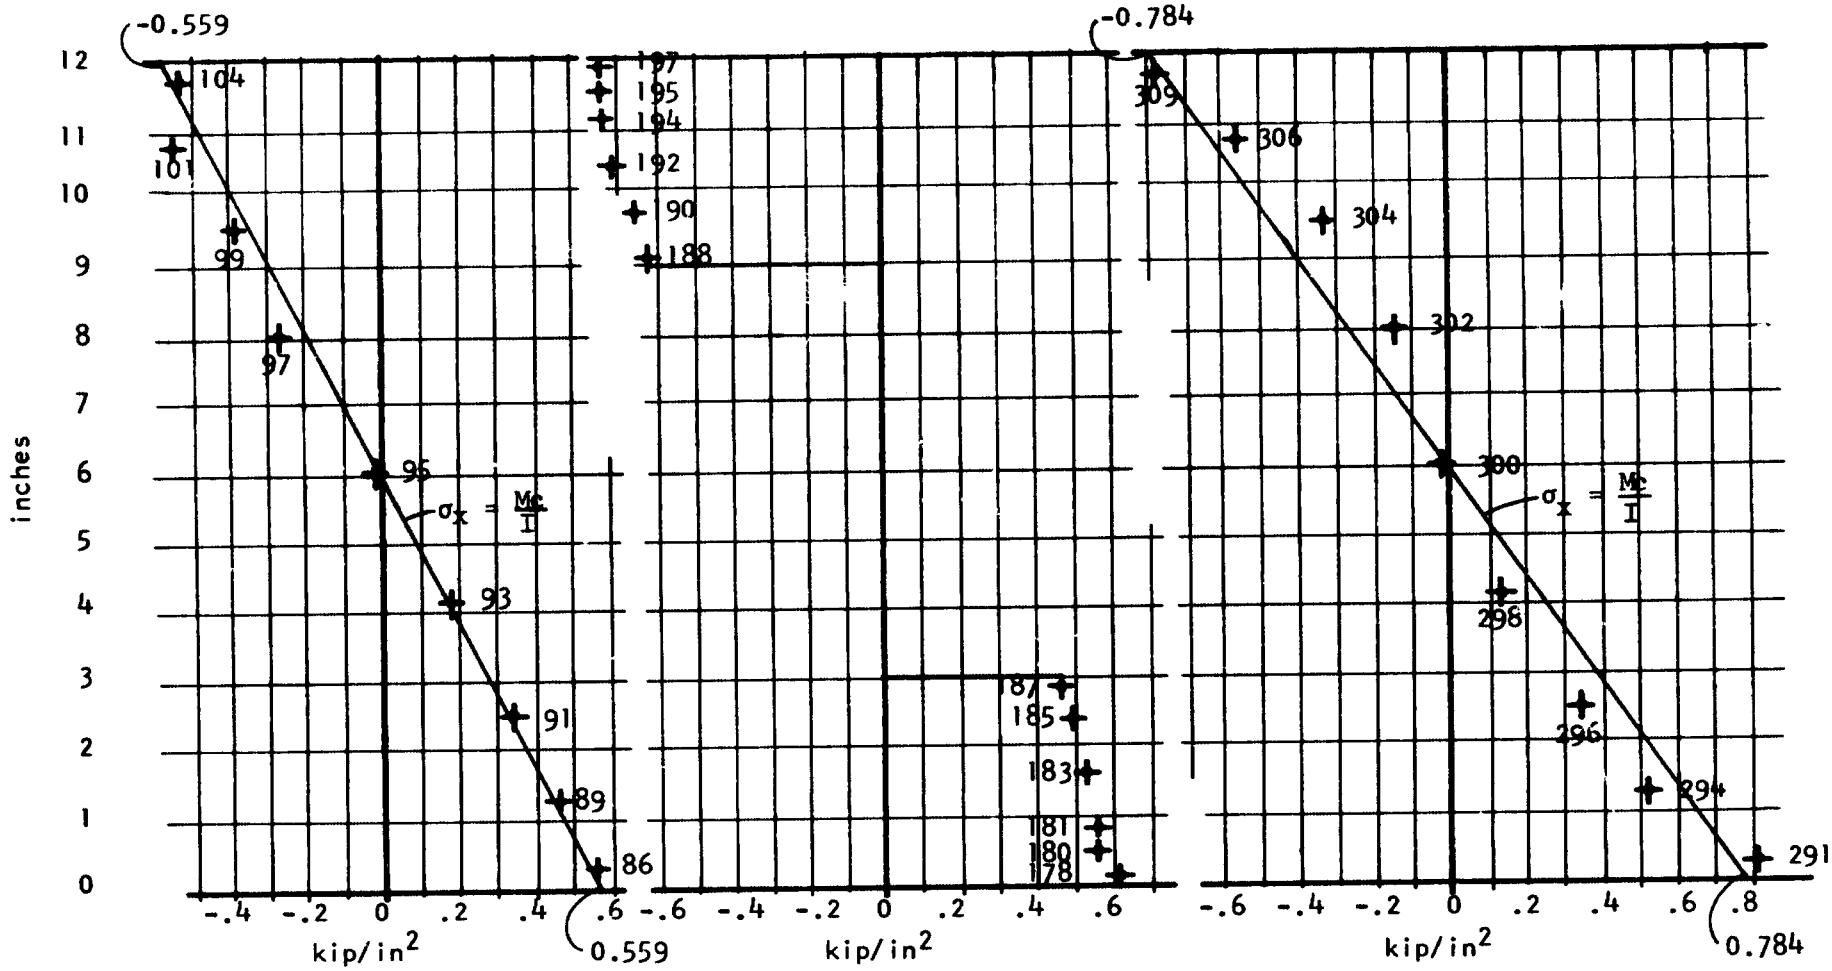

a. Section C, x = 8.83 in b. Section D, x = 14.83 in c. Section E, x = 22.17 in

Fig. 12. Flexural Stress Distributions, Example 2

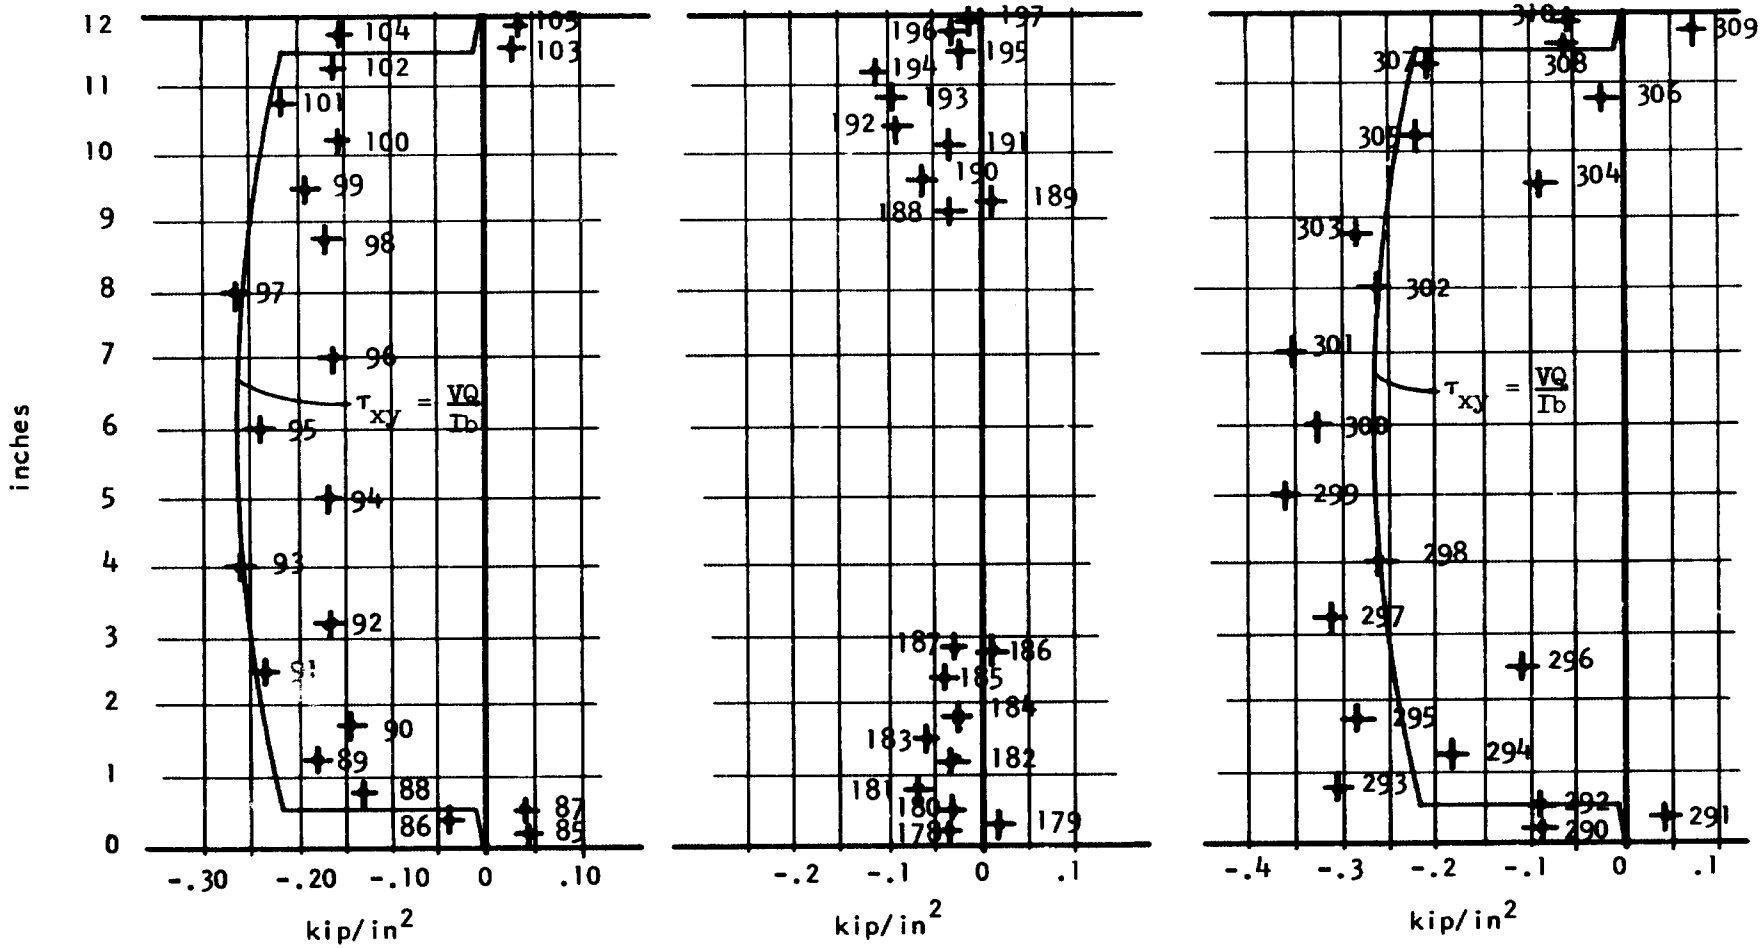

a. Section C, x = 8.83 in

b. Section D, x = 14.83 in

c. Section E, x = 22.17 in

Fig. 10. Horizontal Stress Distributions, Example 2

All of the output information used to construct the graphs of Figs. 12 and 13 were underlined in Appendix B.

The flexural stresses for the elements are found under the heading "X-STRESS" in Appendix B. The flexural stresses at section C, x = 8.83 in., were output as the X-stresses at the centroids of elements 86, 89, 91, 93, 95, 97, 99, 101, and 104. The flexural stresses at section D, x = 14.83 in., were output as the X-stresses at the centroids of elements 178, 180, 181, 183, 185, 187, 188, 190, 192, 194, 195, and 197. The flexural stresses at section E, x = 22.17 in., were output as the X-stresses at the centroids of elements 291, 294, 296, 298, 300, 302, 304, 306, and 309. The flexural stresses were shown in Fig. 12.

The maximum flexural stress on section C, x = 33.33 in., calculated using equation (54) is

$$\sigma_{33.33} = \frac{1(33.33)6}{350.8}$$

$$\sigma_{33.33} = \pm 0.559 \text{ kip/in}^2$$

The maximum flexural stress on section E, x = 46.67 in., calculated using equation (54) is

$$\sigma_{46.67} = \frac{1(46.67)6}{350.8}$$

$$\sigma_{46.67} = \pm 0.784 \text{ kip/in}^2$$

The FINELEM stresses at sections C and E vary from the stresses calculated above by less than 3 percent.

The horizontal shear stresses for the elements are found under the heading "XY-STRESS" in Appendix B. Shear stresses of elements adjacent to the elements, whose centroids are on the required section, were used to graph the horizontal shear distributions at sections C. D, and E. The shear stresses at section C were output as the XY-stresses of elements 85 through 105. The shear stresses at section D were output as the XY-stresses of elements 178 through 197. The shear stresses at section E were output as the XY-stresses of elements 290 through 310. The horizontal shear stresses were shown in Fig. 13.

CONCLUSIONS

The computer program, FINELEM, can be used as listed in the section titled "FINELEM Program Listing" on the IBM 360-50 Computer at Kansas State University. An important point to note in using the program is that control cards providing additional temporary disc storage must be used. These control cards are shown on page 56.

REFERENCES

1. The Finite Element Method in Structural and Continuum Mechanics, O. C. Zienkiewicz and Y. K. Cheung, McGraw-Hill Publishing Company Limited, Berkshire, England, 1967.

2. Elementary Structural Analysis, C. H. Norris and J. B. Wilbur, McGraw-Hill Book Company, New York, 1960.

3. Theory of Elasticity, S. Timoshenko and J. H. Goodier, McGraw-Hill Book Company, New York, 1951 (2nd ed.).

4. Computer Methods in Solid Mechanics, J. J. Gennaro, Macmillan Company, 1965.

APPENDIX B - EXAMPLE 2, DATA AND OUTPUT

DATA

```
1
7 127 200   2   1   1   1   2     0.0              0.0
  0.00          0.0
  0.00          2.5
  0.00          5.0
  0.00          7.5
  0.00          10.
  3.00          0.0
  3.00          2.5
  3.00          5.0
  3.00          7.5
  3.00          10.
  6.00          0.0
  6.00          2.5
  6.00          5.0
  6.00          7.5
  6.00          10.
  9.00          0.0
  9.00          2.5
  9.00          5.0
  9.00          7.5
  9.00          10.
  12.0          0.0
  12.0          2.5
  12.0          5.0
  12.0          7.5
  12.0          10.
  15.0          0.0
  15.0          2.5
  15.0          5.0
  15.0          7.5
  15.0          10.
  18.0          0.0
  18.0          2.5
  18.0          5.0
  18.0          7.5
  18.0          10.
  21.0          0.0
  21.0          2.5
  21.0          5.0
  21.0          7.5
  21.0          10.
  24.0          0.0
  24.0          2.5
  24.0          5.0
  24.0          7.5
  24.0          10.
  27.0          0.0
  27.0          2.5
  27.0          5.0
  27.0          7.5
  27.0          10.
  29.0          0.0
  29.0          1.0
  29.0          2.5
  29.0          4.0
  29.0          5.0
  29.0          6.0
  29.0          7.5
  29.0          9.0
```

29.0	10.
30.0	0.0
30.0	1.0
30.0	2.5
30.0	4.0
30.0	5.0
30.0	6.0
30.0	7.5
30.0	9.0
30.0	10.
31.0	0.0
31.0	1.0
31.0	2.5
31.0	4.0
31.0	5.0
31.0	6.0
31.0	7.5
31.0	9.0
31.0	10.
33.0	0.0
33.0	2.5
33.0	5.0
33.0	7.5
33.0	10.
36.0	0.0
36.0	2.5
36.0	5.0
36.0	7.5
36.0	10.
39.0	0.0
39.0	2.5
39.0	5.0
39.0	7.5
39.0	10.
42.0	0.0
42.0	2.5
42.0	5.0
42.0	7.5
42.0	10.
45.0	0.0
45.0	2.5
45.0	5.0
45.0	7.5
45.0	10.
48.0	0.0
48.0	2.5
48.0	5.0
48.0	7.5
48.0	10.
51.0	0.0
51.0	2.5
51.0	5.0
51.0	7.5
51.0	10.
54.0	0.0
54.0	2.5
54.0	5.0
54.0	7.5
54.0	10.
57.0	0.0

```
    57.0          2.5
    57.0          5.0
    57.0          7.5
    57.0          10.
    60.0          0.0
    60.0          2.5
    60.0          5.0
    60.0          7.5
    60.0          10.
127
  1   1   6   7   1   .   5.
  2   1   7   2   1   .   5.
  3   2   7   8   1   .     5.
  4   2   8   3   1   .     5.
  5   3   8   4   1   .     5.
  6   8   9   4   1   .     5.
  7   4   9   5   1   .     5.
  8   9  10   5   1   .     5.
  9   6  11  12   1   .     5.
 10   6  12   7   1   .     5.
 11  12  13   7   1   .     5.
 12   7  13   8   1   .     5.
 13   8  13   9   1   .     5.
 14   9  13  14   1   .     5.
 15  10   9  14   1   .     5.
 16  10  14  15   1   .     5.
 17  11  16  17   1   .     5.
 18  12  11  17   1   .     5.
 19  12  17  18   1   .     5.
 20  12  18  13   1   .     5.
 21  13  18  14   1   .     5.
 22  14  18  19   1   .     5.
 23  14  19  15   1   .     5.
 24  19  20  15   1   .     5.
 25  16  21  22   1   .     5.
 26  17  16  22   1   .     5.
 27  17  22  23   1   .     5.
 28  18  17  23   1   .     5.
 29  19  18  23   1   .     5.
 30  19  23  24   1   .     5.
 31  20  19  24   1   .     5.
 32  20  24  25   1   .     5.
 33  21  26  27   1   .     5.
 34  22  21  27   1   .     5.
 35  22  27  28   1   .     5.
 36  23  22  28   1   .     5.
 37  24  23  28   1   .     5.
 38  24  28  29   1   .     5.
 39  25  24  29   1   .     5.
 40  25  29  30   1   .     5.
 41  26  31  32   1   .     5.
 42  26  32  27   1   .     5.
 43  27  32  33   1   .     5.
 44  28  27  33   1   .     5.
 45  28  33  29   1   .     5.
 46  29  33  34   1   .     5.
 47  30  29  34   1   .     5.
 48  30  34  35   1   .     5.
 49  31  36  37   1   .     5.
 50  32  31  37   1   .     5.
```

51	32	37	38	1	.	5.
52	33	32	38	1	.	5.
53	34	33	38	1	.	5.
54	34	38	39	1	.	5.
55	35	34	39	1	.	5.
56	35	39	40	1	.	5.
57	36	41	42	1	.	5.
58	37	36	42	1	.	5.
59	37	42	43	1	.	5.
60	38	37	43	1	.	5.
61	38	43	39	1	.	5.
62	39	43	44	1	.	5.
63	40	39	44	1	.	5.
64	40	44	45	1	.	5.
65	41	46	47	1	.	5.
66	42	41	47	1	.	5.
67	42	47	48	1	.	5.
68	43	42	48	1	.	5.
69	44	43	48	1	.	5.
70	44	48	49	1	.	5.
71	45	44	49	1	.	5.
72	45	49	50	1	.	5.
73	46	51	52	1	.	5.
74	47	46	52	1	.	5.
75	47	52	53	1	.	5.
76	47	53	54	1	.	5.
77	48	47	54	1	.	5.
78	48	54	55	1	.	5.
79	48	55	56	1	.	5.
80	49	48	56	1	.	5.
81	49	56	57	1	.	5.
82	49	57	58	1	.	5.
83	50	49	58	1	.	5.
84	50	58	59	1	.	5.
85	51	60	61	1	.	5.
86	52	51	61	1	.	5.
87	52	61	62	1	.	5.
88	53	52	62	1	.	5.
89	54	53	62	1	.	5.
90	54	62	63	1	.	5.
91	54	63	64	1	.	5.
92	55	54	64	1	.	5.
93	56	55	64	1	.	5.
94	56	64	65	1	.	5.
95	56	65	66	1	.	5.
96	56	66	57	1	.	5.
97	58	57	66	1	.	5.
98	58	66	67	1	.	5.
99	59	58	67	1	.	5.
100	59	67	68	1	.	5.
101	61	60	69	1	.	5.
102	61	69	70	1	.	5.
103	62	61	70	1	.	5.
104	62	70	71	1	.	5.
105	62	71	72	1	.	5.
106	63	62	72	1	.	5.
107	64	63	72	1	.	5.
108	64	72	73	1	.	5.
109	64	73	74	1	.	5.
110	65	64	74	1	.	5.

111	66	65	74	1	.	5.
112	66	74	75	1	.	5.
113	76	66	75	1	.	5.
114	67	66	76	1	.	5.
115	67	76	77	1	.	5.
116	68	67	77	1	.	5.
117	70	69	78	1	.	5.
118	70	78	79	1	.	5.
119	71	70	79	1	.	5.
120	72	71	79	1	.	5.
121	72	79	80	1	.	5.
122	73	72	80	1	.	5.
123	74	73	80	1	.	5.
124	74	80	81	1	.	5.
125	75	74	81	1	.	5.
126	76	75	81	1	.	5.
127	76	81	82	1	.	5.
128	77	76	82	1	.	5.
129	78	83	79	1	.	5.
130	79	83	84	1	.	5.
131	80	79	84	1	.	5.
132	80	84	85	1	.	5.
133	80	85	86	1	.	5.
134	81	80	86	1	.	5.
135	81	86	87	1	.	5.
136	82	81	87	1	.	5.
137	83	88	84	1	.	5.
138	84	88	89	1	.	5.
139	85	84	89	1	.	5.
140	85	89	90	1	.	5.
141	85	90	91	1	.	5.
142	86	85	91	1	.	5.
143	86	91	92	1	.	5.
144	87	86	92	1	.	5.
145	89	88	93	1	.	5.
146	89	93	94	1	.	5.
147	90	89	94	1	.	5.
148	90	94	95	1	.	5.
149	90	95	96	1	.	5.
150	91	90	96	1	.	5.
151	91	96	97	1	.	5.
152	92	91	97	1	.	5.
153	94	93	98	1	.	5.
154	94	98	99	1	.	5.
155	95	94	99	1	.	5.
156	95	99	100	1	.	5.
157	95	100	101	1	.	5.
158	96	95	101	1	.	5.
159	96	101	102	1	.	5.
160	97	96	102	1	.	5.
161	98	103	99	1	.	5.
162	99	103	104	1	.	5.
163	100	99	104	1	.	5.
164	100	104	105	1	.	5.
165	100	105	106	1	.	5.
166	101	100	106	1	.	5.
167	101	106	107	1	.	5.
168	102	101	107	1	.	5.
169	103	108	104	1	.	5.
170	104	108	109	1	.	5.

```
171 105 104 109   1          .                5.
172 105 109 110   1          .                5.
173 105 110 111   1          .                5.
174 106 105 111   1          .                5.
175 106 111 112   1          .                5.
176 107 106 112   1          .                5.
177 109 108 113   1          .                5.
178 109 113 114   1          .                5.
179 110 109 114   1          .                5.
180 110 114 115   1          .                5.
181 110 115 116   1          .                5.
182 111 110 116   1          .                5.
183 111 116 117   1          .                5.
184 112 111 117   1          .                5.
185 114 113 118   1          .                5.
186 114 118 119   1          .                5.
187 115 114 119   1          .                5.
188 115 119 120   1          .                5.
189 115 120 121   1          .                5.
190 116 115 121   1          .                5.
191 116 121 122   1          .                5.
192 117 116 122   1          .                5.
193 119 118 123   1          .                5.
194 119 123 124   1          .                5.
195 120 119 124   1          .                5.
196 120 124 125   1          .                5.
197 120 125 126   1          .                5.
198 121 120 126   1          .                5.
199 121 126 127   1          .                5.
200 122 121 127   1          .                5.
200
  1   0   0      0.0              0.0
123   1   0      0.0              0.0
  1  32   1  20
 25  64  21  40
 57  84  41  50
 73 119  51  70
104 144  71  87
137 176  88 107
169 200 108 127
 30000.            30000.          .3      .3      12000.
  3
 59       0.0              -3.33
 68       0.0              -3.34
 77       0.0              -3.33
```

OUTPUT

```
  7 127 200    2    1    1    1    2       0.0                0.0
  1            0.0                 0.0
  2            0.0                 2.50000000
  3            0.0                 5.00000000
  4            0.0                 7.50000000
  5            0.0                10.00000000
                .
                .
                .

     X and Y coordinates for nodal points 6 through 124
     have been eliminated.

                .
                .
                .
125            60.00000000         5.00000000
126            60.00000000         7.50000000
127            60.00000000        10.00000000
  1    1    6    7    1       0.0                5.00000000
  2    1    7    2    1       0.0                5.00000000
  3    2    7    8    1       0.0                5.00000000
  4    2    8    3    1       0.0                5.00000000
                .
                .
                .

     Information for elements 5 through 196 has been
     eliminated.

                .
                .
                .
197  120  125  126    1       0.0                5.00000000
198  121  120  126    1       0.0                5.00000000
199  121  126  127    1       0.0                5.00000000
200  122  121  127    1       0.0                5.00000000
  1    0    0        0.0              0.0
123    1    0        0.0              0.0
  1   32    1   20
 25   64   21   40
 57   84   41   50
 73  119   51   70
104  144   71   87
137  176   88  107
169  200  108  127
 30000.00000000   30000.00000000   0.3000   0.3000   12000.00000000
 59   0.0              -0.33299999E 01
 68   0.0              -0.33399992E 01
 77   0.0              -0.33299999E 01
RESIDUALS
 0.46E-04-0.12E-03-0.29E-03-0.61E-04-0.32E-03 0.21E-03-0.81E-03 0.46E-04-0.13E-02 0.93E-04 0.31E-04-0.46E-04
 0.26E-03-0.40E-03 0.58E-03-0.44E-03 0.79E-03-0.63E-03-0.31E-04 0.53E-03-0.76E-04 0.11E-02 0.41E-03-0.63E-03
 0.39E-04-0.78E-03 0.17E-02 0.46E-04-0.34E-03 0.70E-03-0.27E-03 0.29E-03 0.20E-03-0.95E-03 0.81E-03-0.69E-03
 0.10E-02-0.14E-02 0.55E-03 0.70E-03
 0.14E-03 0.98E-03 0.43E-03-0.14E-03 0.62E-03-0.14E-03 0.16E-02-0.49E-03-0.41E-03 0.18E-02 0.31E-04 0.82E-03
 0.31E-04-0.11E-02 0.40E-03-0.19E-02 0.75E-03-0.14E-02 0.47E-03 0.12E-02 0.15E-04 0.16E-02 0.78E-03-0.11E-02
-0.18E-03-0.19E-02 0.14E-02-0.16E-02 0.11E-03 0.22E-02-0.17E-03 0.13E-02 0.11E-02-0.26E-02 0.33E-03-0.73E-03
 0.13E-02-0.79E-02 0.37E-03 0.16E-02
 0.26E-03 0.96E-03 0.90E-03-0.14E-02 0.26E-03-0.43E-03-0.11E-03-0.13E-02 0.15E-03 0.11E-02 0.12E-03 0.60E-03
 0.56E-03-0.32E-03 0.79E-03-0.25E-02 0.16E-02-0.20E-03 0.26E-03 0.92E-03
 0.76E-04 0.25E-02 0.52E-03-0.34E-02-0.57E-03-0.20E-02 0.92E-04-0.99E-03 0.59E-03-0.29E-02 0.50E-03-0.44E-03
 0.11E-02-0.34E-02-0.35E-03-0.31E-02 0.21E-03 0.36E-02 0.40E-03 0.15E-02 0.60E-03-0.22E-02 0.25E-02-0.26E-03
 0.15E-02-0.28E-02 0.76E-03-0.18E-02 0.14E-02-0.25E-02 0.76E-03-0.11E-02 0.21E-02-0.27E-02 0.46E-04 0.21E-02
-0.14E-03 0.33E-02 0.15E-02-0.67E-02
-0.18E-03 0.15E-02 0.58E-03-0.72E-03 0.54E-03-0.19E-02-0.24E-03 0.10E-02 0.49E-03-0.75E-03 0.23E-03-0.22E-02
-0.63E-03 0.28E-02-0.58E-03 0.20E-02 0.14E-02-0.12E-02 0.23E-03-0.29E-02-0.44E-03-0.99E-03 0.27E-03 0.26E-02
 0.50E-03 0.12E-02-0.46E-03-0.30E-02 0.15E-02-0.18E-02 0.17E-02-0.28E-02-0.17E-03 0.18E-02
```

```
 0.12E-03 0.20E-02 0.76E-03-0.16E-02 0.12E-02-0.79E-03 0.32E-03-0.11E-02-0.29E-03 0.28E-02 0.92E-04 0.53E-03
 0.72E-03-0.19E-02 0.27E-03-0.14E-02 0.37E-03-0.19E-02-0.46E-04 0.15E-02 0.17E-03 0.22E-02 0.20E-02-0.35E-03
 0.38E-03-0.17E-02-0.58E-03-0.76E-03-0.61E-04 0.22E-02 0.18E-03 0.13E-02 0.92E-04-0.14E-02 0.72E-03-0.10E-02
 0.12E-02-0.24E-02-0.27E-03 0.17E-02
-0.31E-04 0.13E-02 0.41E-03-0.11E-02 0.11E-02-0.34E-03 0.15E-03-0.86E-04-0.31E-04 0.11E-02 0.45E-03 0.52E-03
 0.93E-03-0.58E-03-0.21E-03-0.41E-03 0.35E-03-0.67E-03-0.26E-04 0.69E-03 0.55E-03 0.53E-03 0.73E-03-0.34E-03
 0.96E-03-0.90E-03-0.78E-04 0.61E-04 0.60E-04 0.34E-03-0.78E-03 0.17E-03-0.57E-03-0.46E-04-0.58E-03 0.17E-03
-0.23E-03-0.13E-03 0.0     -0.76E-05
NODE X-DISPLACEMENTS Y-DISPLACEMENTS
   1 -0.29423807E-17 -0.40228157E-15
   2  0.38915873E-03 -0.40890009E-04
   3  0.75649587E-03 -0.65743472E-04
   4  0.11234044E-02 -0.78853351E-04
   5  0.14938426E-02 -0.81002509E-04
   6  0.79227611E-05 -0.51768473E-03
   7  0.39947708E-03 -0.52281516E-03
   8  0.76343887E-03 -0.52951532E-03
   9  0.11214777E-02 -0.53323270E-03
  10  0.14894083E-02 -0.53292233E-03
  11  0.36253070E-04 -0.98608062E-03
  12  0.40745432E-03 -0.99141337E-03
  13  0.76251477E-03 -0.99169044E-03
  14  0.11116681E-02 -0.99108624E-03
  15  0.14720948E-02 -0.98744640E-03
  16  0.75456119E-04 -0.14298C04E-02
  17  0.42416831E-03 -0.14371402E-02
  18  0.76040486E-03 -0.14379008E-02
  19  0.10939997E-02 -0.14357055E-02
  20  0.14387334E-02 -0.14289075E-02
  21  0.12681015E-03 -0.18463540E-02
  22  0.44873706E-03 -0.18561389E-02
  23  0.75924327E-03 -0.18581909E-02
  24  0.10689320E-02 -0.18552223E-02
  25  0.13896511E-02 -0.18455309E-02
  26  0.19161095E-03 -0.22284635E-02
  27  0.48071798E-03 -0.22408471E-02
  28  0.75872126E-03 -0.22440248E-02
  29  0.10366326E-02 -0.22402806E-02
  30  0.13255933E-02 -0.22277902E-02
  31  0.27056853E-03 -0.25677332E-02
  32  0.51993341E-03 -0.25827934E-02
  33  0.75838901E-03 -0.25869242E-02
  34  0.99706301E-03 -0.25822627E-02
  35  0.12470975E-02 -0.25669569E-02
  36  0.36423653E-03 -0.28551186E-02
  37  0.56637265E-03 -0.28731928E-02
  38  0.75795478E-03 -0.28784184E-02
  39  0.95004006E-03 -0.28727890E-02
  40  0.11545876E-02 -0.28544946E-02
  41  0.47364179E-03 -0.30794898E-02
  42  0.62060030E-03 -0.31027193E-02
  43  0.75730938E-03 -0.31105822E-02
  44  0.89497189E-03 -0.31041235E-02
  45  0.10484471E-02 -0.30818814E-02
  46  0.60015148E-03 -0.32225181E-02
  47  0.68734726E-03 -0.32591512E-02
  48  0.75688679E-03 -0.32797894E-02
  49  0.82869013E-03 -0.32699381E-02
  50  0.92841033E-03 -0.32392645E-02
  51  0.70449454E-03 -0.32795703E-02
```

52	0.71977079E-03	-0.32956556E-02
53	0.73754089E-03	-0.33070145E-02
54	0.75236871E-03	-0.33244595E-02
55	0.76076877E-03	-0.33277860E-02
56	0.76785497E-03	-0.33350314E-02
57	0.78532519E-03	-0.33336496E-02
58	0.80334162E-03	-0.33406354E-02
59	0.82792062E-03	-0.33384394E-02
60	0.76327100E-03	-0.32820541E-02
61	0.76330337E-03	-0.33005660E-02
62	0.76334830E-03	-0.33198239E-02
63	0.76339766E-03	-0.33276263E-02
64	0.76342956E-03	-0.33356836E-02
65	0.76346309E-03	-0.33392250E-02
66	0.76351454E-03	-0.33502160E-02
67	0.76356856E-03	-0.33530316E-02
68	0.76361327E-03	-0.33498728E-02
69	0.82204840E-03	-0.32796431E-02
70	0.80683688E-03	-0.32847294E-02
71	0.78917085E-03	-0.33071043E-02
72	0.77443244E-03	-0.33245529E-02
73	0.76609617E-03	-0.33278826E-02
74	0.75907679E-03	-0.33351318E-02
75	0.74170437E-03	-0.33337504E-02
76	0.72379992E-03	-0.33407323E-02
77	0.69930777E-03	-0.33385316E-02
78	0.92642475E-03	-0.32227489E-02
79	0.83938730E-03	-0.32593932E-02
80	0.76999492E-03	-0.32800462E-02
81	0.69834618E-03	-0.32701979E-02
82	0.59879967E-03	-0.32395299E-02
83	0.10529992E-02	-0.30799245E-02
84	0.90618501E-03	-0.31031708E-02
85	0.76960004E-03	-0.31110465E-02
86	0.63207094E-03	-0.31045934E-02
87	0.47875103E-03	-0.30823539E-02
88	0.11625036E-02	-0.28557405E-02
89	0.96047367E-03	-0.28738372E-02
90	0.76859026E-03	-0.28790797E-02
91	0.57700579E-03	-0.28734577E-02
92	0.37258049E-03	-0.28551598E-02
93	0.12562915E-02	-0.25684710E-02
94	0.10069925E-02	-0.25835617E-02
95	0.76859817E-03	-0.25877140E-02
96	0.52998122E-03	-0.25830567E-02
97	0.28002611E-03	-0.25677413E-02
98	0.13353925E-02	-0.22292808E-02
99	0.10462988E-02	-0.22416930E-02
100	0.76830806E-03	-0.22448883E-02
101	0.49040955E-03	-0.22411472E-02
102	0.20147146E-03	-0.22286526E-02
103	0.14003566E-02	-0.18471573E-02
104	0.10783856E-02	-0.18569769E-02
105	0.76782960E-03	-0.18590461E-02
106	0.45809755E-03	-0.18560791E-02
107	0.13735513E-03	-0.18463787E-02
108	0.14518937E-02	-0.14305378E-02
109	0.11030668E-02	-0.14379127E-02
110	0.76671923E-03	-0.14386906E-02
111	0.43302565E-03	-0.14364989E-02

```
 112  0.88206260E-04 -0.14296926E-02
 113  0.14912945E-02 -0.98666037E-03
 114  0.11198989E-02 -0.99203829E-03
 115  0.76466077E-03 -0.99232700E-03
 116  0.41535380E-03 -0.99172001E-03
 117  0.54789009E-04 -0.98807411E-03
 118  0.15198698E-02 -0.51803584E-03
 119  0.11279932E-02 -0.52321656E-03
 120  0.76376903E-03 -0.52991253E-03
 121  0.40554511E-03 -0.53363340E-03
 122  0.37436606E-04 -0.53332257E-03
 123  0.15281320E-02 -0.40215790E-15
 124  0.11383833E-02 -0.40898434E-04
 125  0.77075697E-03 -0.65812492E-04
 126  0.40362729E-03 -0.78972298E-04
 127  0.32997923E-04 -0.81136051E-04
ELEMENT NUMBER  FIRST NODE       SECOND NODE      THIRD NODE       X AND Y CO-ORDINATES OF CENTROID
  X-STRESS       Y-STRESS          XY-STRESS       STRESS-1         STRESS-2         PRINCIPLE ANGLE
   1   1   6   7       1.99999714       0.83333236
 0.66746739E-01 -0.41536331E-01 -0.19127655E 00  0.21170933E 00 -0.18617892E 00    -52.90742495
0.21143E 00-0.18618E 00-0.52907E 02
   2   1   7   2       0.99999887       1.66666412
-0.48373938E-01 -0.50519145E 00 -0.59739470E-01 -0.40690899E-01 -0.51287448E 00    -82.67741394
-0.4C691E-01-0.51287E 00-0.82677E 02
   3   2   7   8       1.99999714       3.33332920
 0.86881638E-01 -0.54338455E-01 -0.18068314E 00  0.21026170E 00 -0.17771852E 00    -55.67671204
0.21026E 00-0.17772E 00-0.55677E 02
   4   2   8   3       0.99999887       4.16666126
-0.22024989E-01 -0.30484718E 00 -0.91868997E-01  0.51966310E-02 -0.33206874E 00    -73.50030518
0.51966E-02-0.33207E 00-0.73500E 02
   5   3   8   4       0.99999887       5.83332634
 0.24433136E-01 -0.14998627E 00 -0.93925476E-01  0.65393329E-01 -0.19094646E 00    -66.44316101
0.65393E-01-0.19095E 00-0.66443E 02
   6   8   9   4       1.99999714       6.66665840
-0.35877228E-01 -0.55372238E-01 -0.98930597E-01  0.53784847E-01 -0.14503431E 00    -47.81701660
0.53785E-01-0.14503E 00-0.47817E 02
   7   4   9   5       0.99999887       8.33332348
-0.29674470E-01 -0.34691811E-01 -0.39415359E-01  0.73119700E-02 -0.71678221E-01    -46.82431030
0.73120E-02-0.71678E-01-0.46824E 02
   8   9  10   5       1.99999714       9.16665554
-0.47515869E-01 -0.10524750E-01 -0.41612029E-01  0.16516998E-01 -0.74557602E-01    -33.02040100
0.16517E-01-0.74558E-01-0.33020E 02
   9   6  11  12       4.99999428       0.83333236
 0.29022312E 00  0.23073196E-01 -0.91816902E-01  0.31873637E 00 -0.54400565E-02    -72.75335693
0.31874E 00-0.54401E-02-0.72753E 02
  10   6  12   7       3.99999523       1.66666412
 0.67365646E-01 -0.41355133E-01  0.50668716E-02  0.67601264E-01 -0.41590750E-(      87.34381104
0.67601E-01-0.41591E-01 0.87344E 02
  11  12  13   7       4.99999428       3.33332920
 0.86565971E-01  0.22644997E-01 -0.17010403E 00  0.22768593E 00 -0.11847496E 00    -50.32423401
0.22769E 00-0.11847E 00-0.50324E 02
  12   7  13   8       3.99999523       4.16666126
-0.36660194E-01 -0.91399193E-01 -0.10168362E 00  0.41272879E-01 -0.16933227E 00    -52.5362:488
0.41273E-01-0.16933E 00-0.52536E 02
  13   8  13   9       3.99999523       5.83332634
-0.24860382E-01 -0.52066803E-01 -0.13011360E 00  0.92359126E-01 -0.16928631E 00    -47.98773193
0.92359E-01-0.16929E 00-0.47988E 02
  14   9  13  14       4.99999428       6.66665840
-0.10540676E 00 -0.24373055E-01 -0.15547848E 00  0.95781028E-01 -0.22556084E 00    -37.69969177
0.95781E-01-0.22556E 00-0.37700E 02
```

```
 15  10   9  14      3.99999527      8.33332348
-0.10657215E 00 -0.28246880E-01 -0.65349579E-01  0.87762475E-02 -0.14359528E 00   -29.53543091
0.87762E-02-0.14360E 00-0.29535E 02
 16  10  14  15      4.99999428      9.16665554
-0.17584705E 00 -0.90780258E-02 -0.88047028E-01  0.28802633E-01 -0.21372771E 00   -23.28062439
0.28803E-01-0.21373E 00-0.23281E 02
 17  11  16  17      7.99999046      0.83333236
 0.40176296E 00  0.32440186E-01 -0.10106087E 00  0.42760837E 00  0.65947771E-02   -75.66006470
0.42761E 00 0.65948E-02-0.75660E 02
 18  12  11  17      6.99999142      1.66666412
 0.16257286E 00 -0.15221596E-01 -0.11425018E-02  0.16258013E 00 -0.1522886AE-01   -89.63838196
0.16258E 00-0.15229E-01-0.89638E 02
 19  12  17  18      7.99999046      3.33332920
 0.18065929E 00  0.45074463E-01 -0.16897202E 00  0.29493099E 00 -0.69197237E-01   -55.93452454
0.29493E 00-0.69197E-01-0.55935E 02
 20  12  18  13      6.99999142      4.16666126
-0.24281502E-01 -0.10609627E-01 -0.80551147E-01  0.63395083E-01 -0.98286211E-01   -42.57772827
0.63395E-01-0.98286E-01-0.42578E 02
 21  13  18  14      6.99999142      5.83332634
-0.20794868E-01  0.10128021E-02 -0.10890484E 00  0.99558294E-01 -0.11934036E 00   -42.14431763
0.99558E-01-0.11934E 00-0.42144E 02
 22  14  18  19      7.99999046      6.66665840
-0.18547153E 00 -0.29312134E-01 -0.17722034E 00  0.86266279E-01 -0.30104995E 00   -33.11375427
0.86266E-01-0.30105E 00-0.33114E 02
 23  14  19  15      6.99999142      8.33332348
-0.17975521E 00 -0.10248184E-01 -0.48427582E-01  0.26117563E-02 -0.19261515E 00   -14.87275314
0.26118E-02-0.19262E 00-0.14873E 02
 24  19  20  15      7.99999046      9.16665554
-0.33970833E 00 -0.20364761E-01 -0.11112118E 00  0.14496148E-01 -0.37456924E 00   -17.41894531
0.14496E-01-0.37457E 00-0.17419E 02
 25  16  21  22     10.99998665      0.83333236
 0.52561283E 00  0.40267944E-01 -0.12096405E 00  0.55409014E 00  0.11790633E-01   -76.75820923
0.55409E 00 0.11791E-01-0.76758E 02
 26  17  16  22      9.99998856      1.66666412
 0.24094868E 00 -0.15777585E-01 -0.21772385E-02  0.24096709E 00 -0.15796006E-01   -89.52067566
0.24097E 00-0.15796E-01-0.89521E 02
 27  17  22  23     10.99998665      3.33332920
 0.26186562E 00  0.53939819E-01 -0.18556404E 00  0.37060505E 00 -0.54799616E-01   -59.63427734
0.37061E 00-0.54800E-01-0.59634E 02
 28  18  17  23      9.99998856      4.16666126
-0.15773773E-01 -0.13845444E-01 -0.67224503E-01  0.52421749E-01 -0.82040966E-01   -44.59239197
0.52422E-01-0.82041E-01-0.44592E 02
 29  19  18  23      9.99998856      5.83332634
-0.40798187E-02  0.25128365E-01 -0.79906464E-01  0.91754258E-01 -0.70705712E-01   -39.82421875
0.91754E-01-0.70706E-01-0.39824E 02
 30  19  23  24     10.99998665      6.66665840
-0.26372147E 00 -0.43518066E-01 -0.19155979E 00  0.67327C82E-01 -0.37456661E 00   -30.05781555
0.67327E-01-0.37457E 00-0.30058E 02
 31  20  19  24      9.99998856      8.33332348
-0.24856663E 00  0.70075989E-02 -0.23347855E-01  0.91229677E-02 -0.25068200E 00    -5.17737293
0.91230E-02-0.25068E 00-0.51774E 01
 32  20  24  25     10.99998665      9.16665554
-0.50102043E 00 -0.34011841E-01 -0.12704182E 00 -0.16894937E-02 -0.5333427AE 00   -14.27554607
-0.16895E-02-0.53334E 00-0.14276E 02
 33  21  26  27     13.99998379      0.83333236
 0.66309547E 00  0.50323486E-01 -0.14072323E 00  0.69386721E 00  0.19551754E-01   -77.67095947
0.69387E 00 0.19552E-01-0.77671E 02
 34  22  21  27     12.99998474      1.66666412
 0.31272411E 00 -0.23604393E-01  0.64153671E-02  0.31284642E 00 -0.23726702E-01    88.91410828
0.31285E 00-0.23727E-01 0.88914E 02
```

```
 25  22  27  28      13.99998379       3.33332920
 0.33886242E 00  0.63522339E-01 -0.20441341E 00  0.44764286E 00 -0.45258105E-01    -61.98442078
0.44764E 00-0.45258E-01-0.61984E 02
 26  23  22  28      12.99998474       4.16666126
-0.13854027E-01 -0.28789520E-01 -0.52906036E-01  0.32108702E-01 -0.74752212E-01    -49.02070618
0.32109E-01-0.74752E-01-0.49021E 02
 27  24  23  28      12.99998474       5.83332634
 0.60081482E-02  0.37430763E-01 -0.56831360E-01  0.80682516E-01 -0.37243653E-01    -37.27583313
0.80683E-01-0.37244E-01-0.37276E 02
 28  24  28  29      13.99998379       6.66665840
-0.34012127E 00 -0.57113647E-01 -0.20625496E 00  0.51511228E-01 -0.44874614E 00    -27.77571106
0.51511E-01-0.44875E 00-0.27776E 02
 29  25  24  29      12.99998474       8.33332348
-0.31659031E 00  0.21328926E-01 -0.78296661E-01  0.21330714E-01 -0.31659210E 00     -0.13086146
0.21331E-01-0.31659E 00-0.13086E 00
 30  25  29  30      13.99998379       9.16665554
-0.65450764E 00 -0.46476271E-01 -0.14202309E 00 -0.14940619E-01 -0.68604529E 00    -12.52087116
-0.14941E-01-0.68605E 00-0.12521E 02
 31  26  31  32      16.99996948       0.83333236
 0.80806255E 00  0.61706543E-01 -0.16012287E 00  0.84096467E 00  0.28804421E-01    -78.39413452
0.84096E 00 0.28804E-01-0.78394E 02
 32  26  32  27      15.99998188       1.66666412
 0.38194752E 00 -0.34042358E-01  0.19927979E-01  0.38289994E 00 -0.34994781E-01     87.26994324
0.38290E 00-0.34995E-01 0.87270E 02
 33  27  32  33      16.99996948       3.33332920
 0.41458416E 00  0.74798584E-01 -0.22319221E 00  0.52518791E 00 -0.35805166E-01     -3.64372253
0.52519E 00-0.35805E-01-0.63644E 02
 34  28  27  33      15.99998188       4.16666126
-0.16213417E-01 -0.42984009E-01 -0.37182808E-01  0.99199787E-02 -0.69117367E-01    -54.90310669
0.99200E-02-0.69117E-01-0.54903E 02
 35  28  33  29      15.99998188       5.83332634
 0.11160851E-01  0.48263550E-01 -0.37622452E-01  0.71659744E-01 -0.12235399E-01    -31.87647900
0.71660E-01-0.12235E-01-0.31878E 02
 36  29  33  34      16.99996948       6.66665840
-0.41637707E 00 -0.68984985E-01 -0.22228718E 00  0.39421499E-01 -0.52478355E 00    -25.99977112
0.39421E-01-0.52478E 00-0.26000E 02
 37  30  29  34      15.99998188       8.33332348
-0.38541889E 00  0.34264565E-01  0.19082069E-01  0.35130322E-01 -0.386    65E 00      2.59792995
0.35130E-01-0.38628E 00 0.25979E 01
 38  30  34  35      16.99996948       9.16665554
-0.80201626E 00 -0.56961060E-01 -0.15649796E 00 -0.25423825E-01 -0.      349E 00    -11.39439774
-0.25424E-01-0.83355E 00-0.11394E 02
 39  31  36  37      19.99996948       0.83333236
 0.95778751E 00  0.70449829E-01 -0.17928314E 00  0.99264161E 00       595536E-01    -79.00415039
0.99264E 00 0.35596E-01-0.79004E 02
 40  32  31  37      18.99996948       1.66666412
 0.45073032E 00 -0.45488358E-01  0.35351753E-01  0.45323616E     -0.47994196E-01     85.95167542
0.45324E 00-0.47994E-01 0.85952E 02
 41  32  37  38      19.99996948       3.33332920
 0.48963356E 00  0.84182739E-01 -0.24199677E 00  0.60259783E 00 -0.28781533E-01    -64.98150635
0.60260E 00-0.28782E-01-0.64982E 02
 42  33  32  38      18.99996948       4.16666126
-0.21110535E-01 -0.55905342E-01 -0.21390915E-01 -0.10935478E-01 -0.66080391E-01    -64.56553650
-0.10935E-01-0.66080E-01-0.64566E 02
 43  34  33  38      18.99996948       5.83332634
 0.13670921E-01  0.60050011E-01 -0.20341873E-01  0.67707598E-01  0.60133189E-02    -20.63008118
0.67708E-01 0.60133E-02-0.20630E 02
 44  34  38  39      19.99996948       6.66665840
-0.49445057E 00 -0.80795288E-01 -0.24008942E 00  0.29269159E-01 -0.60451502E 00    -24.63000488
0.29269E-01-0.60452E 00-0.24630E 02
```

```
 55  35  34  39      18.99996948       8.33332348
-0.456185346E 00  0.468301776-01  0.380992396-01  0.496933466-01 -0.459048516 00      4.30252838
0.496936-01-0.459056 00 0.430256 01
 56  35  39  40      19.99996948       9.16665554
-0.944190036 00 -0.637512216-01 -0.168317796 00 -0.326703196-01 -0.975270936 00    -10.46292686
-0.32670E-01-0.97527E 00-0.104636 02
 57  36  41  42      22.99996948       0.83333236
 0.111032496 01  0.543518076-01 -0.192077646 00  0.114417746 01  0.204989316-01    -80.01033020
0.11442E 01 0.20499E-01-0.80010E 02
 58  37  36  42      21.99996948       1.66666412
 0.924392136 00 -0.365607766-01  0.921459586-01  0.929011966 00 -0.641806136-01     84.94313049
0.92901E 00-0.64181E-01 0.84943E 02
 59  37  42  43      22.99996948       3.33332920
 0.564785C0E 00  0.750732426-01 -0.261894236 00  0.678457926 00 -0.385996706-01    -66.54196167
0.67844E 00-0.38600E-01-0.66542E 02
 60  38  37  43      21.99996948       4.16666126
-0.277585966-01 -0.710334786-01 -0.906085976-02 -0.259380386-01 -0.728539826-01    -78.64479065
-0.25938E-01-0.72854E-01-0.78645E 02
 61  38  43  39      21.99996948       5.83332634
 0.151767736-01  0.720977786-01 -0.664615636-02  0.728634606-01  0.144110666-01     -6.57236004
0.72863E-01 0.14411E-01-0.65724E 01
 62  39  43  44      22.99996948       6.66665840
-0.579576496 00 -0.963745126-01 -0.264550216 00  0.202950246-01 -0.696246036 00    -23.79974365
0.20295E-01-0.69625E 00-0.23800E 02
 63  40  39  44      21.99996948       8.33332348
-0.532763486 00  0.597114566-01  0.564899446-01  0.650494106-01 -0.538101436 00      5.39846516
0.65049E-01-0.53810E 00 0.53985E 01
 64  40  44  45      22.99996948       9.16665554
-0.107835486 01 -0.566253666-01 -0.172862056 00 -0.281726766-01 -0.110680776 01     -9.36782028
-0.28172E-01-0.11068E 01-0.93478E 01
 65  41  46  47      25.99996948       0.83333236
 0.124525556 01 -0.660247806-01 -0.153566226 00  0.126299956 01 -0.837696796-01    -83.41474915
0.12630E 01-0.83770E-01-0.83415E 02
 66  42  41  47      24.99996948       1.66666412
 0.641576776 00 -0.862722406-01  0.796699526-01  0.650195306 00 -0.948907736-01     83.83197021
0.65020E 00-0.94891E-01 0.83832E 02
 67  42  47  48      25.99996948       3.33332920
 0.651818286 00 -0.521087656-01 -0.291929246 00  0.757130926 00 -0.157420816 00    -70.16845703
0.75713E 00-0.15742E 00-0.70168E 02
 68  43  42  48      24.99996948       4.16666126
-0.357349096-01 -0.105065356 00 -0.206279756-01 -0.360663236-01 -0.110738876 00    -74.62687683
-0.36066E-01-0.11074E 00-0.74627E 02
 69  44  43  48      24.99996948       5.83332634
 0.209217076-01  0.837812426-01 -0.160484316-01  0.876414186-01  0.170615096-01     -13.52559090
0.87641E-01 0.17062E-01-0.13526E 02
 70  44  48  49      25.99996948       6.66665840
-0.689377786 00 -0.886230476-01 -0.318593036 00  0.488671066-01 -0.826867946 00    -23.34451294
0.48867E-01-0.82687E 00-0.23345E 02
 71  45  44  49      24.99996948       8.33332348
-0.640380866 00  0.747947696-01  0.734233866-0   0.822548276-01 -0.647840926 00      5.80195427
0.82255E-01-0.64784E 00 0.58020E 01
 72  45  49  50      25.99996948       9.16665554
-0.119770346 01  0.875854496-02 -0.150871286 00  0.273391606-01 -0.121628386 01     -7.02144432
0.27339E-01-0.12163E 01-0.70214E 01
 73  46  51  52      28.33329773       0.33333296
 0.156077586 01 -0.143127446-01 -0.158980376 00  0.157666216 01 -0.301990516-01    -64.29972839
0.15767E 01-0.30199E-01-0.84300E 02
 74  47  46  52      27.66662598       1.16666508
 0.125189886 01 -0.640058526-01  0.676422126-01  0.125536636 01 -0.674736506-01     87.07145691
0.12554E 01-0.67474E-01 0.87071E 02
```

```
 75  47  52  53      28.33329773       1.99999714
 0.75242615E 00 -0.14495850E-02 -0.14501953E 00  0.77936053E 00 -0.28383970E-01    -79.48414612
0.77936E 00-0.28384E-01-0.79484E 02
 76  47  53  54      28.33329773       2.99999619
 0.71229553E 00 -0.13520813E 00 -0.16855431E 00  0.74458772E 00 -0.16750032E 00    -79.16026306
0.74459E 00-0.16750E 00-0.79160E 02
 77  48  47  54      27.66662598       3.83332825
 0.30238438E 00 -0.15693283E 00  0.16250610E-01  0.30295855E 00 -0.15750700E 00     87.98268127
0.30296E 00-0.15751E 00 0.87983E 02
 78  48  54  55      28.33329773       4.66666126
 0.31082153E-01 -0.90484619E-01 -0.18717957E 00  0.16710019E 00 -0.22650266E 00    -53.99909973
0.16710E 00-0.22650E 00-0.53999E 02
 79  48  55  56      28.33329773       5.33332729
-0.76751709E-02 -0.21965027E 00 -0.20293427E 00  0.11528194E 00 -0.34260738E 00    -58.79272461
0.11528E 00-0.34261E 00-0.58793E 02
 80  49  48  56      27.66662598       6.16665936
-0.25364113E 00  0.42138100E-01 -0.10437012E-01  0.42505860E-01 -0.25400889E 00     -2.01619837
0.42506E-01-0.25401E 00-0.20182E 01
 81  49  56  57      28.33329773       6.99999142
-0.70567322E 00 -0.18408203E 00 -0.24250793E 00 -0.88753521E-01 -0.80100173E 00    -21.46107483
-0.88754E-01-0.80100E 00-0.21461E 02
 82  49  57  58      28.33329773       7.99999046
-0.76083374E 00 -0.36796570E 00 -0.23812389E 00 -0.25571012E 00 -0.87308931E 00    -25.24182129
-0.25571E 00-0.87309E 00-0.25242E 02
 83  50  49  58      27.66662598       8.83332253
-0.12826853E 01 -0.16711235E-01 -0.55953979E-01 -0.14243126E-01 -0.12851534E 01     -2.52584267
-0.14243E-01-0.12852E 01-0.25258E 01
 84  50  58  59      28.33329773       9.66665554
-0.16346130E 01 -0.42449951E 00 -0.30009460E 00 -0.35416728E 00 -0.17049446E 01    -13.19113636
-0.35417E 00-0.17049E 01-0.13191E 02
 85  51  60  61      29.66662598       0.33333296
 0.17543793E 01 -0.28976440E-01 -0.29415131E-01  0.17548637E 01 -0.29461384E-01    -99.06176758
0.17549E 01-0.29461E-01-0.89062E 02
 86  52  51  61      29.33329773       0.66666591
 0.12759399E 01 -0.99726677E-01  0.12435913E 00  0.12870913E 01 -0.11087805E 00     84.88203430
0.12871E 01-0.11088E 00 0.84882E 02
 87  52  61  62      29.66662598       1.49999809
 0.13079987E 01  0.72937012E-02 -0.58568001E-01  0.13106298E 01  0.46620369E-02    -87.43338013
0.13106E 01 0.46620E-02-0.87433E 02
 88  53  52  62      29.33329773       1.99999714
 0.77581787E 00  0.55999756E-02 -0.11566162E-01  0.77599144E 00  0.54264069E-02    -89.14636230
0.77599E 00 0.54264E-02-0.89146E 02
 89  54  53  62      29.33329773       2.99999619
 0.73577881E 00 -0.12816238E 00 -0.35095215E-01  0.73720199E 00 -0.12958556E 00    -87.68399048
0.73720E 00-0.12959E 00-0.87684E 02
 90  54  62  63      29.66662598       3.49999523
 0.31210327E 00 -0.62423706E-01 -0.37612915E-01  0.31584322E 00 -0.66163659E-01    -84.32760620
0.31584E 00-0.66164E-01-0.84328E 02
 91  54  63  64      29.66662598       4.33332825
 0.28388977E 00 -0.15653992E 00 -0.37635803E-01  0.28708267E 00 -0.15973282E 00    -85.15701294
0.28708E 00-0.15973E 00-0.85157E 02
 92  55  54  64      29.33329773       4.66666126
 0.54809570E-01 -0.83347321E-01  0.59967041E-02  0.55069327E-01 -0.83607078E-01     87.52568054
0.55069E-01-0.83607E-01 0.87526E 02
 93  56  55  64      29.33329773       5.33332729
 0.16052246E-01 -0.21253204E 00 -0.97503662E-02  0.16467333E-01 -0.21294713E 00    -87.56829834
0.16467E-01-0.21295E 00-0.87568E 02
 94  56  64  65      29.66662598       5.66665936
-0.17979431E 00 -0.16017151E 00 -0.49942017E-01 -0.11908627E 00 -0.22087955E 00    -39.44561768
-0.11909E 00-0.22088E 00-0.39446E 02
```

```
  95  56  65  66      29.66662598       6.49999237
 -0.21722412E 00 -0.28497314E 00 -0.49899101E-01 -0.19078773E 00 -0.31140947E 00    -62.09004211
-0.19079E 00-0.31141E 00-0.62090E 02
  96  56  66  57      29.33329773       6.99999142
 -0.70991516E 00 -0.18534851E 00 -0.59020996E-01 -0.17878991E 00 -0.71647376E 00     -6.34133244
-0.17879E 00-0.71647E 00-0.63413E 01
  97  58  57  66      29.33329773       7.99999046
 -0.76510620E 00 -0.36924458E 00 -0.54656982E-01 -0.36183673E 00 -0.77251405E 00     -7.71902180
-0.36184E 00-0.77251E 00-0.77190E 01
  98  58  66  67      29.66662598       8.49998951
 -0.13295898E 01 -0.45520020E 00 -0.14831543E 00 -0.43072772E 00 -0.13540621E 01     -9.37023163
-0.43073E 00-0.13541E 01-0.93702E 01
  99  59  58  67      29.33329773       9.33332253
 -0.12895355E 01 -0.32097149E 00  0.14619446E 00 -0.29938614E 00 -0.13111200E 01      8.39955330
-0.29939E 00-0.13111E 01 0.83596E 01
 100  59  67  68      29.66662598       9.66665554
 -0.20885315E 01 -0.53181458E 00 -0.13667297E 00 -0.51990640E 00 -0.21004391E 01     -4.97990799
-0.51991E 00-0.21004E 01-0.49799E 01
 101  61  60  69      30.33329773       0.33333296
  0.17546387E 01 -0.28970718E-01  0.29327393E-01  0.17551203E 01 -0.29452741E-01     89.06471252
 0.17551E 01-0.29453E-01 0.89065E 02
 102  61  69  70      30.66662598       0.66666591
  0.12759247E 01 -0.99761963E-01 -0.12449646E 00  0.12870998E 01 -0.11093771E 00    -84.87657166
 0.12871E 01-0.11094E 00-0.84877E 02
 103  62  61  70      30.33329773       1.49999809
  0.13081970E 01  0.73146820E-02  0.58395386E-01  0.13108120E 01  0.46988139E-02     87.44129944
 0.13108E 01 0.46988E-02 0.87441E 02
 104  62  70  71      30.66662598       1.99999714
  0.77619934E 00  0.53710938E-02  0.11276245E-01  0.77636421E 00  0.52062273E-02     89.16859436
 0.77636E 00 0.52062E-02 0.89169E 02
 105  62  71  72      30.66662598       2.99999619
  0.73614502E 00 -0.12808228E 00  0.34702301E-01  0.73753607E 00 -0.12947333E 00     87.71064758
 0.73754E 00-0.12947E 00 0.87711E 02
 106  63  62  72      30.33329773       3.49999523
  0.31230164E 00 -0.62326431E-01  0.37261963E-01  0.31597185E 00 -0.65996647E-01     84.38072205
 0.31597E 00-0.65997E-01 0.84381E 02
 107  64  63  72      30.33329773       4.33332825
  0.28408813E 00 -0.15649605E 00  0.37261963E-01  0.28721726E 00 -0.15962517E 00     85.20591736
 0.28722E 00-0.15963E 00 0.85206E 02
 108  64  72  73      30.66662598       4.66666126
  0.54962158E-01 -0.83419800E-01 -0.64392090E-02  0.55261075E-01 -0.83718717E-01    -87.34791565
 0.55261E-01-0.83719E-01-0.87348E 02
 109  64  73  74      30.66662598       5.33332729
  0.16204834E-01 -0.21258545E 00  0.93650818E-02  0.16587496E-01 -0.21296811E 00     87.66633606
 0.16587E-01-0.21297E 00 0.87666E 02
 110  65  64  74      30.33329773       5.66665936
 -0.17961121E 00 -0.16011620E 00  0.49499512E-01 -0.11941355E 00 -0.22031379E 00     39.43260029
-0.11941E 00-0.22031E 00 0.39433E 02
 111  66  65  74      30.33329773       6.49999237
 -0.21708679E 00 -0.28494549E 00  0.49530029E-01 -0.19097924E 00 -0.31105298E 00     62.21758655
-0.19098E 00-0.31105E 00 0.62211E 02
 112  66  74  75      30.66662598       6.99999142
 -0.70983887E 00 -0.18533325E 00  0.58593750E-01 -0.17886746E 00 -0.71630466E 00      6.29754448
-0.17887E 00-0.71630E 00 0.62975E 01
 113  76  66  75      30.66662598       7.99999046
 -0.76507568E 00 -0.36914062E 00  0.54336548E-01 -0.36181909E 00 -0.77239722E 00      7.67461872
-0.36182E 00-0.77240E 00 0.76746E 01
 114  67  66  76      30.33329773       8.49998951
 -0.13294983E 01 -0.45515347E 00  0.14797974E 00 -0.43078756E 00 -0.13538637E 01      9.35093880
-0.43079E 00-0.13539E 01 0.93509E 01
```

```
 115  67  76  77      30.66662598       9.33332253
 -0.12891388E 01 -0.32073975E 00 -0.14629841E 00 -0.29912078E 00 -0.13107576E 01     -8.40655422
-0.29912E 00-0.13108E 01-0.84066E 01
 116  68  67  77      30.33329773       9.66665554
 -0.20885620E 01 -0.53180885E 00  0.13661194E 00 -0.51991153E 00 -0.21004591E 01      4.97760963
-0.51991E 00-0.21005E 01-0.49776E 01
 117  70  69  78      31.66662598       0.33333296
  0.15613890E 01 -0.14162064E-01  0.15881348E 00  0.15772371E 01 -0.30010760E-01     84.30715942
 0.15772E 01-0.30011E-01 0.84307E 02
 118  70  78  79      32.33328247       1.16666508
  0.12522907E 01 -0.64025879E-01 -0.67854881E-01  0.12557783E 01 -0.67514360E-01    -87.06321716
 0.12558E 01-0.67514E-01-0.87063E 02
 119  71  70  79      31.66662598       1.99999714
  0.75270367E 00 -0.16660690E-02  0.14492798E 00  0.77958870E 00 -0.28551102E-01     79.49650574
 0.77959E 00-0.28551E-01 0.79497E 02
 120  72  71  79      31.66662598       2.99999619
  0.71271420E 00 -0.13516903E 00  0.16835022E 00  0.74491757E 00 -0.16737241E 00     79.17654419
 0.74492E 00-0.16737E 00 0.79177E 02
 121  72  79  80      32.33328247       3.83332825
  0.30265522E 00 -0.15702820E 00 -0.16492844E-01  0.30324614E 00 -0.15761912E 00    -87.95420837
 0.30325E 00-0.15762E 00-0.87954E 02
 122  73  72  80      31.66662598       4.66666126
  0.31342506E-01 -0.90472221E-01  0.18695068E 00  0.16705722E 00 -0.22618693E 00     54.02656555
 0.16706E 00-0.22619E 00 0.54027E 02
 123  74  73  80      31.66662598       5.33332729
 -0.74052811E-02 -0.21970272E 00  0.20277405E 00  0.11532336E 00 -0.34243137E 00     58.81988525
 0.11532E 00-0.34243E 00 0.58820E 02
 124  74  80  81      32.33328247       6.16665936
 -0.25346375E 00  0.42114258E-01  0.10223389E-01  0.42467415E-01 -0.25381690E 00      1.97858619
 0.42467E-01-0.25382E 00 0.19786E 01
 125  75  74  81      31.66662598       6.99999142
 -0.70554447E 00 -0.18403053E 00  0.24230957E 00 -0.88826716E-01 -0.80074829E 00     21.45150757
-0.88827E-01-0.80075E 00 0.21452E 02
 126  76  75  81      31.66662598       7.99999046
 -0.76073742E 00 -0.36786652E 00  0.23806763E 00 -0.25565487E 00 -0.87294906E 00     25.23838806
-0.25565E 00-0.87295E 00 0.25238E 02
 127  76  81  82      32.33328247       8.83332253
 -0.12826748E 01 -0.16830444E-01  0.55771828E-01 -0.14378011E-01 -0.12851267E 01      2.51800823
-0.14378E-01-0.12851E 01 0.25180E 01
 128  77  76  82      31.66662598       9.66665554
 -0.16349115E 01 -0.42444229E 00  0.30007935E 00 -0.35413480E 00 -0.17052174E 01     13.18730354
-0.35413E 00-0.17052E 01 0.13187E 02
 129  78  83  79      33.99995422       0.83333236
  0.12459030E 01 -0.65963745E-01  0.15350914E 00  0.12636261E 01 -0.83687186E-01     83.42010498
 0.12636E 01-0.83687E-01 0.83420E 02
 130  79  83  84      34.99995422       1.66666412
  0.64204788E 00 -0.86349487E-01 -0.79813957E-01  0.65069085E 00 -0.94992459E-01    -83.82562256
 0.65069E 00-0.94992E-01-0.83826E 02
 131  80  79  84      33.99995422       3.33332920
  0.65235233E 00 -0.52130699E-01  0.29180813E 00  0.75752306E 00 -0.15730143E 00     70.18539429
 0.75752E 00-0.15730E 00 0.70185E 02
 132  80  84  85      34.99995422       4.16666126
 -0.35493851E-01 -0.10514832E 00  0.20390511E-01 -0.29963821E-01 -0.11067832E 00     74.83146667
-0.29964E-01-0.11068E 00 0.74831E 02
 133  80  85  86      34.99995422       5.83332634
  0.21187782E-01  0.83770752E-01  0.15858650E-01  0.87559509E-01  0.17398607E-01     13.43879986
 0.87560E-01 0.17399E-01 0.13439E 02
 134  81  80  86      33.99995422       6.66665840
 -0.68930912E 00 -0.88613510E-01  0.31849289E 00  0.48813105E-01 -0.82673573E 00     23.34144592
 0.48813E-01-0.82674E 00 0.23341E 02
```

```
135  81  86  87      34.99995422       8.33332348
-0.64029026E 00  0.74768066E-01 -0.73514938E-01  0.82247734E-01 -0.64776993E 00     -5.80995505
0.82248E-01-0.64777E 00-0.58099E 01
136  82  81  87      33.99995422       9.16665554
-0.11978445E 01  0.86526871E-02  0.15087700E 00  0.27234137E-01 -0.12164259E 01      7.02149230
0.27234E-01-0.12164E 01 0.70215E 01
137  83  88  84      36.99995422       0.83333236
 0.11113300E 01  0.54443359E-01  0.19201946E 00  0.11451349E 01  0.20637929E-01     80.02104187
0.11451E 01 0.20638E-01 0.80021E 02
138  84  88  89      37.99995422       1.66666412
 0.52496243E 00 -0.59677124E-01 -0.52408218E-01  0.52962309E 00 -0.64337790E-01    -84.92405701
0.52962E 00-0.64338E-01-0.84924E 02
139  85  84  89      36.99995422       3.33332920
 0.56543255E 00  0.75132370E-01  0.26172733E 00  0.67889047E 00 -0.38325548E-01     66.56823730
0.67889E 00-0.38326E-01 0.66568E 02
140  85  89  90      37.99995422       4.16666126
-0.27438164E-01 -0.71151733E-01  0.87471008E-02 -0.25752850E-01 -0.72836995E-01     79.10009766
-0.25753E-01-0.72837E-01 0.79100E 02
141  85  90  91      37.99995422       5.83332634
 0.15539169E-01  0.72113037E-01  0.63409805E-02  0.72815001E-01  0.14837168E-01      6.31753826
0.72815E-01 0.14837E-01 0.63175E 01
142  86  85  91      36.99995422       6.66665840
-0.57955265E 00 -0.96418381E-01  0.26439381E 00  0.20146728E-01 -0.69611776E 00     23.79331970
0.20147E-01-0.69612E 00 0.23793E 02
143  86  91  92      37.99995422       8.33332348
-0.53269958E 00  0.59738159E-01 -0.56695938E-01  0.65115035E-01 -0.53807646E 00     -5.41795349
0.65115E-01-0.53808E 00-0.54180E 01
144  87  86  92      36.99995422       9.16665554
-0.10786848E 01 -0.56741714E-01  0.17283630E 00 -0.28302431E-01 -0.11071234E 01      9.34466457
-0.28302E-01-0.11071E 01 0.93447E 01
145  89  88  93      39.99995422       0.83333236
 0.95905304E 00  0.70560455E-01  0.17933464E 00  0.99388462E 00  0.35728872E-01     79.01420593
0.99388E 00 0.35729E-01 0.79014E 02
146  89  93  94      40.99993896       1.66666412
 0.45146942E 00 -0.45654297E 01 -0.35530090E-01  0.45399582E 00 -0.48180699E-01    -85.93882751
0.45400E 00-0.48181E-01-0.85939E 02
147  90  89  94      39.99995422       3.33332920
 0.49046516E 00  0.84250450E-01  0.24198341E 00  0.60328263E 00 -0.28567016E-01     65.00881958
0.60328E 00-0.28567E-01 0.65009E 02
148  90  94  95      40.99993896       4.16666126
-0.20733833E-01 -0.56060791E-01  0.21167755E-01 -0.10827906E-01 -0.65966666E-01     64.92642212
-0.10828E-01-0.65967E-01 0.64926E 02
149  90  95  96      40.99993896       5.83332634
 0.14116287E-01  0.60119629E-01  0.20099640E-01  0.67664146E-01  0.65717325E-02     20.57542419
0.67664E-01 0.65717E-02 0.20575E 02
150  91  90  96      39.99995422       6.66665840
-0.49448490E 00 -0.80891609E-01  0.24007034E 00  0.29169083E-01 -0.60454559E 00     24.63098145
0.29169E-01-0.60455E 00 0.24631E 02
151  91  96  97      40.99993896       8.33332348
-0.45613766E 00  0.46920776E-01 -0.38178444E-01  0.49801648E-01 -0.45901853E 00     -4.31556511
0.49802E-01-0.45902E 00-0.43156E 01
152  92  91  97      39.99995422       9.16665554
-0.54466205E 00 -0.63821137E-01  0.16842747E 00 -0.32714307E-01 -0.97576863E 00     10.46479511
-0.32714E-01-0.97577E 00 0.10465E 02
153  94  93  98      42.99993896       0.83333236
 0.80954456E 00  0.61787605E-01  0.16012573E 00  0.84239125E 00  0.28940916E-01     78.41337585
0.84239E 00 0.28941E-01 0.78413E 02
154  94  98  99      43.99993896       1.66666412
 0.38280964E 00 -0.34118652E-01 -0.20173073E-01  0.38378340E 00 -0.35092413E-01    -87.24272156
0.38378E 00-0.35092E-01-0.87243E 02
```

```
155  95  94  99      42.99993896       3.33332920
 0.41552067E 00  0.74824333E-01  0.22318363E 00  0.52593821E 00 -0.35593212E-01      63.68121338
0.52594E 00-0.35593E-01 0.63681E 02
156  95  99 100      43.99993896       4.16666126
-0.15828133E-01 -0.43106079E-01  0.36946297E-01  0.99162683E-02 -0.68850458E-01      55.13500977
0.99163E-02-0.68850E-01 0.55135E 02
157  95 100 101      43.99993896       5.83332634
 0.11610985E-01  0.48370361E-01  0.37387848E-01  0.71651936E-01 -0.11670627E-01      31.91304016
0.71652E-01-0.11671E-01 0.31913E 02
158  96  95 101      42.99993896       6.66665840
-0.41640377E 00 -0.69018364E-01  0.22226620E 00  0.39372861E-01 -0.52479500E 00      25.99873352
0.39373E-01-0.52479E 00 0.25999E 02
159  96 101 102      43.99993896       8.33332348
-0.38540077E 00  0.34286499E-01 -0.19262195E-01  0.35168648E-01 -0.38628292E 00      -2.62232676
0.35169E-01-0.38628E 00-0.26223E 01
160  97  96 102      42.99993896       9.16665554
-0.80261135E 00 -0.57001412E-01  0.15656376E 00 -0.25460422E-01 -0.83415228E 00      11.39105797
-0.25460E-01-0.83415E 00 0.11391E 02
161  98 103  99      45.99993896       0.83333236
 0.66474819E 00  0.50460815E-01  0.14083481E 00  0.69549739E 00  0.19711614E-01      77.68920898
0.69550E 00 0.19712E-01 0.77689E 02
162  99 103 104      46.99993896       1.66666412
 0.31373787E 00 -0.23712158E-01 -0.65956116E-02  0.31386667E 00 -0.23840964E-01     -88.88717651
0.31387E 00-0.23841E-01-0.88887E 02
163 100  99 104      45.99993896       3.33332920
 0.33997154E 00  0.63662529E-01  0.20451069E 00  0.44861913E 00 -0.44985056E-01      62.02473450
0.44862E 00-0.44985E-01 0.62025E 02
164 100 104 105      46.99993896       4.16666126
-0.13442993E-01 -0.28869623E-01  0.52698135E-01  0.3[illegible]E-01 -0.74415922E-01      49.16714478
0.32103E-01-0.74416E-01 0.49167E 02
165 100 105 106      46.99993896       5.83332634
 0.64792633E-02  0.37536621E-01  0.56652069E-01  0.80749691E-01 -0.36733832E-01      37.33840942
0.80750E-01-0.36734E-01 0.37338E 02
166 101 100 106      45.99993896       6.66665840
-0.34025955E 00 -0.57173729E-01  0.20635033E 00  0.51512837E-01 -0.4489[illegible]12E 00      27.77821350
0.51513E-01-0.44895E 00 0.27778E 02
167 101 106 107      46.99993896       8.33332348
-0.31668186E 00  0.21377563E-01  0.70935488E-03  0.2137899[illegible]-01 -0.31668329E 00       0.11555308
0.21379E-01-0.31668E 00 0.11555E 00
168 102 101 107      45.99993896       9.16665554
-0.65511417E 00 -0.46607673E-01  0.14218712E 00 -0.15022993E-01 -0.68669879E 00      12.52494240
-0.15023E-01-0.68670E 00 0.12525E 02
169 103 108 104      48.99993896       0.83333236
 0.52746105E 00  0.40405273E-01  0.12100983E 00  0.55586910E 00  0.11997223E-01      76.79411316
0.55587E 00 0.11997E-01 0.76794E 02
170 104 108 109      49.99993896       1.66666412
 0.24203110E 00 -0.15899658E-01  0.18882751E-02  0.24204487E 00 -0.15913427E-01      89.58712769
0.24204E 00-0.15913E-01 0.89587E 02
171 105 104 109      48.99993896       3.33332920
 0.26304817E 00  0.54071426E-01  0.18558884E 00  0.37154108E 00 -0.54421484E-01      59.69427490
0.37154E 00-0.54421E-01 0.59694E 02
172 105 109 110      49.99993896       4.16666126
-0.15278816E-01 -0.13931274E-01  0.66948891E-01  0.52347183E-01 -0.81557274E-01      44.71495056
0.52347E-01-0.81557E-01 0.44715E 02
173 105 110 111      49.99993896       5.83332634
-0.35314560E-02  0.25238037E-01  0.79688072E-01  0.91829181E-01 -0.70122600E-01      39.88665771
0.91829E-01-0.70123E-01 0.39887E 02
174 106 105 111      48.99993896       6.66665840
-0.26376438E 00 -0.43525696E-01  0.19159794E 00  0.67343712E-01 -0.37463379E 00      30.05830383
0.67344E-01-0.37463E 00 0.30058E 02
```

```
175 106 111 112      49.99993896       8.33332348
-0.24857426E 00  0.70953369E-02  0.23187160E-01  0.91811419E-02 -0.25066006E 00       5.14058971
0.91811E-02-0.25066E 00 0.51406E 01
176 107 106 112      48.99993896       9.16665554
-0.50169802E 00 -0.34099102E-01  0.12717533E 00 -0.17488003E-02 -0.53404832E 00      14.27300167
-0.17488E-02-0.53405E 00 0.14273E 02
177 109 108 113      51.99993896       0.83333236
 0.40379715E 00  0.32659531E-01  0.10114002E 00  0.42956948E 00  0.68871975E-02      75.70973206
0.42957E 00 0.68872E-02 0.75710E 02
178 109 113 114      52.99993896       1.66666412
 0.16368294E 00 -0.15426636E-01  0.79917908E-03  0.16368645E 00 -0.15430152E-01      89.75090027
0.16369E 00-0.15430E-01 0.89751E 02
179 110 109 114      51.99993896       3.33332920
 0.18189621E 00  0.45246124E-01  0.16903114E 00  0.29588908E 00 -0.68746746E-01      56.00874329
0.29589E 00-0.68747E-01 0.56009E 02
180 110 114 115      52.99993896       4.16666126
-0.23759842E-01 -0.10592461E-01  0.80307007E-01  0.63400209E-01 -0.97752512E-01      42.65974426
0.63400E-01-0.97753E-01 0.42660E 02
181 110 115 116      52.99993896       5.83332634
-0.20217896E-01  0.12187958E-02  0.10877514E 00  0.99802315E-01 -0.11880141E 00      42.18928526
0.99802E-01-0.11880E 00 0.42189E 02
182 111 110 116      51.99993896       6.66665840
-0.18551731E 00 -0.29348373E-01  0.17737770E 00  0.86371243E-01 -0.30123693E 00      33.12249756
0.86371E-01-0.30124E 00 0.33122E 02
183 111 116 117      52.99993896       8.33332348
-0.17976189E 00 -0.10180473E-01  0.48403025E-01  0.26623607E-02 -0.19260472E 00      14.86104870
0.26624E-02-0.19260E 00 0.14861E 02
184 112 111 117      51.99993896       9.16665554
-0.34027934E 00 -0.20420194E-01  0.11133671E 00  0.14517665E-01 -0.37521720E 00      17.42330933
0.14518E-01-0.37522E 00 0.17423E 02
185 114 113 118      54.99992371       0.83333236
 0.29273987E 00  0.23296356E-01  0.91800690E-01  0.32104355E 00 -0.50073266E-02      72.86985779
0.32104E 00-0.50073E-02 0.72870E 02
186 114 118 119      55.99992371       1.66666412
 0.68448067E-01 -0.41628836E-01 -0.57191849E-02  0.68744361E-01 -0.41925184E-01     -87.04010010
0.68744E-01-0.41925E-01-0.87040E 02
187 115 114 119      54.99992371       3.33332920
 0.87810516E-01  0.22883415E-01  0.17014503E 00  0.22856128E 00 -0.11786735E 00      50.40475464
0.22856E 00-0.11787E 00 0.50405E 02
188 115 119 120      55.99992371       4.16666126
-0.36286354E-01 -0.91231346E-01  0.10137463E 00  0.41272283E-01 -0.16878998E 00      52.58529663
0.41272E-01-0.16879E 00 0.52585E 02
189 115 120 121      55.99992371       5.83332634
-0.24518013E-01 -0.52001953E-01  0.13017368E 00  0.92637002E-01 -0.16915697E 00      48.01658630
0.92637E-01-0.16916E 00 0.48017E 02
190 116 115 121      54.99992371       6.66665840
-0.10538006E 00 -0.24330139E-01  0.15566444E 00  0.95997870E-01 -0.22570807E 00      37.70663452
0.95998E-01-0.22571E 00 0.37707E 02
191 116 121 122      55.99992371       8.33332348
-0.10655022E 00 -0.28234482E-01  0.65421283E-01  0.88524818E-02 -0.14363718E 00      29.55082703
0.88525E-02-0.14364E 00 0.29551E 02
192 117 116 122      54.99992371       9.16665554
-0.17625058E 00 -0.91273785E-02  0.88289261E-01  0.28873861E-01 -0.21425182E 00      23.26959656
0.28874E-01-0.21425E 00 0.23290E 02
193 119 118 123      57.99992371       0.83333236
 0.70312500E-01 -0.41079521E-01  0.19113541E 00  0.21370131E 00 -0.18446833E 00      53.12661580
0.21370E 00-0.18447E 00 0.53127E 02
194 119 123 124      58.99992371       1.66666412
-0.47615349E-01 -0.9C502849E 00  0.58475137E-01 -0.40258348E-01 -0.51238543E 00      82.83502197
-0.40258E-01-0.51239E 00 0.82835E 02
```

```
195 120 119 124      57.99992371       3.33332920
 0.87688446E-01 -0.54045677E-01  0.18099755E 00  0.21119791E 00 -0.17755514E 00      55.69512939
0.21120E 0C-0.17756E 00 0.55695E 02
196 120 124 125      58.99992371       4.16666126
-0.21767795E-01 -0.30547661E 00  0.91787755E-01  0.53382516E-02 -0.33258265E 00      73.55276489
0.53383E-02-0.33258E 00 0.73553E 02
197 120 125 126      58.99992371       5.83332634
 0.24728298E-01 -0.15048748E 00  0.94171524E-01  0.65741599E-01 -0.19150072E 00      66.47087097
0.65742E-01-0.19150E 00 0.66471E 02
198 121 120 126      57.99992371       6.66665840
-0.35793304E-01 -0.55384636E-01  0.99164128E-01  0.54057777E-01 -0.14523572E 00      47.82423401
0.54058E-01-0.14524E 00 0.47824E 02
199 121 126 127      58.99992371       8.33332348
-0.29632568E-01 -0.34852028E-01  0.39621055E-01  0.74646063E-02 -0.71949184E-01      46.88763428
0.74646E-02-0.71949E-01 0.46888E 02
200 122 121 127      57.99992371       9.16665554
-0.47542572E-0  -0.10533929E-01  0.41821549E-01  0.16694184E-01 -0.74770629E-01      33.06871033
0.16694E-01-0.74771E-01 0.33069E 02
```

DATA

```
1
12 238 394   2   1   1   1   2     0.0              0.0
   0.00          0.C000
   0.00          0.3000
   0.00          0.5760
   0.00          1.3000
   0.00          2.5000
   0.00          4.CC00
   0.00          6.C000
   0.00          8.C000
   0.C0          9.5000
   0.C0          10.700
   0.00          11.424
   0.00          11.700
   0.00          12.000
   1.50          0.CC00
   1.50          0.5760
   1.50          1.8000
   1.50          3.2C00
   1.50          4.9C00
   1.50          7.1
   1.50          8.8000
   1.50          10.200
   1.50          11.424
   1.50          12.000
   3.50          0.0000
   3.50          0.3C00
   3.50          0.5760
   3.50          1.3000
   3.50          2.5000
   3.50          4.CC00
   3.50          6.C000
   3.50          8.C000
   3.50          9.5000
   3.50          10.700
   3.50          11.424
   3.50          11.700
   3.50          12.000
   5.50          0.C000
   5.50          0.5760
   5.50          1.8000
   5.50          3.2000
   5.50          4.9C00
   5.50          7.1000
   5.50          8.8000
   5.50          10.200
   5.50          11.424
   5.50          12.000
   7.50          0.C000
   7.50          0.3000
   7.50          0.5760
   7.50          1.3000
   7.50          2.5000
   7.50          4.CC00
   7.50          6.C000
   7.50          8.C000
   7.50          9.5000
   7.50          10.700
   7.50          11.424
   7.50          11.700
```

7.50	12.000
9.50	0.CC00
9.50	0.5760
9.50	1.8000
9.50	3.2000
9.50	4.9C00
9.50	7.1000
9.50	8.8000
9.50	10.200
9.50	11.424
9.50	12.000
10.5	2.8
10.4	3.2C00
10.4	3.5000
10.4	4.2000
10.4	6.CC00
10.4	7.8000
10.4	8.5000
10.4	8.8C00
10.5	9.2C00
10.9	2.4000
11.2	3.1000
11.05	3.3000
11.0	3.7000
11.0	4.9000
11.0	7.1000
11.0	8.3000
11.05	8.7000
11.2	8.9C00
10.9	9.6000
11.5	0.C000
11.5	0.3C00
11.5	0.5760
11.5	1.3000
11.5	2.C000
11.5	2.5000
11.5	3.C000
11.5	9.C000
11.5	9.5000
11.5	10.000
11.5	10.700
11.5	11.424
1 .5	11.700
1..5	12.000
13.5	0.C000
13.5	0.5760
13.5	1.5000
1	2.4000
.5	3.0000
13.5	9.C000
13.5	9.6
13.5	10.500
13.5	11.424
13.5	12.000
15.5	0.CC00
15.5	0.3C00
15.5	0.5760
15.5	1.3000
15.5	2.CC00
15.5	2.7

15.5	3.C000
15.5	9.C000
15.5	9.3000
15.5	10.000
15.5	10.700
15.5	11.424
15.5	11.700
15.5	12.000
17.5	0.C000
17.5	0.5760
17.5	1.5C00
17.5	2.4000
17.5	3.C000
17.5	9.C000
17.5	9.6
17.5	10.500
17.5	11.424
17.5	12.C00
19.5	0.CC00
19.5	0.3000
19.5	0.5760
19.5	1.3000
19.5	2.CC00
19.5	2.5000
19.5	3.0000
19.5	9.CC00
19.5	9.5000
19.5	10.000
19.5	10.700
19.5	11.424
19.5	11.700
19.5	12.000
20.1	2.4000
19.8	3.1C00
19.95	3.3000
20.0	3.7000
20.0	4.9C00
20.0	7.1C00
20.0	8.3000
19.95	8.7000
19.8	8.9C00
20.1	9.6CC0
20.5	2.8
20.6	3.2000
20.6	3.5000
20.6	4.2000
20.6	6.C000
20.6	7.8000
20.6	8.5000
20.6	8.8C00
20.5	9.2000
21.5	0.C000
21.5	0.5760
21.5	1.8C00
21.5	3.2000
21.5	4.9C00
21.5	7.1000
21.5	8.8C00
21.5	10.200
21.5	11.424

21.5	12.000
23.5	0.0000
23.5	0.3000
23.5	0.5760
23.5	1.3000
23.5	2.5000
23.5	4.0000
23.5	6.0000
23.5	8.0000
23.5	9.5000
23.5	10.700
23.5	11.424
23.5	11.700
23.5	12.000
25.5	0.0000
25.5	0.5760
25.5	1.8000
25.5	3.2000
25.5	4.9000
25.5	7.1000
25.5	8.8000
25.5	10.200
25.5	11.424
25.5	12.000
27.5	0.0000
27.5	0.3000
27.5	0.5760
27.5	1.3000
27.5	2.5000
27.5	4.0000
27.5	6.0000
27.5	8.0000
27.5	9.5000
27.5	10.700
27.5	11.424
27.5	11.700
27.5	12.000
29.5	0.0000
29.5	0.5760
29.5	1.8000
29.5	3.2000
29.5	4.9000
29.5	7.1000
29.5	8.8000
29.5	10.200
29.5	11.424
29.5	12.000
31.0	0.0000
31.0	0.3000
31.0	0.5760
31.0	1.3000
31.0	2.5000
31.0	4.0000
31.0	6.0000
31.0	8.0000
31.0	9.5000
31.0	10.700
31.0	11.424
31.0	11.700
31.0	12.000

```
238
  1   1  14   2  1  .  8.042
  2   2  14  15  1  .  8.042
  3   3   2  15  1  .  8.042
  4   4   3  15  1  .  .3360
  5   4  15  16  1  .  .3360
  6   5   4  16  1  .  .3360
  7   5  16  17  1  .  .3360
  8   6   5  17  1  .  .3360
  9   6  17  18  1  .  .3360
 10   7   6  18  1  .  .3360
 11   7  18  19  1  .  .3360
 12   8   7  19  1  .  .3360
 13   8  19  20  1  .  .3360
 14   9   8  20  1  .  .3360
 15   9  20  21  1  .  .3360
 16  10   9  21  1  .  .3360
 17  10  21  22  1  .  .3360
 18  11  10  22  1  .  .3360
 19  12  11  22  1  .  8.042
 20  12  22  23  1  .  8.042
 21  13  12  23  1  .  8.042
 22  14  24  25  1  .  8.042
 23  15  14  25  1  .  8.042
 24  15  25  26     .  8.042
 25  15  26  27  1  .  .3360
 26  16  15  27  1  .  .3360
 27  16  27  28  1  .  .3360
 28  17  16  28  1  .  .3360
 29  17  28  29  1  .  .3360
 30  18  17  29  1  .  .3360
 31  18  29  30  1  .  .3360
 32  19  18  30  1  .  .3360
 33  19  30  31  1  .  .3360
 34  20  19  31  1  .  .3360
 35  20  31  32     .  .3360
 36  21  20  32  1  .  .3360
 37  21  32  33  1  .  .3360
 38  22  21  33  1  .  .3360
 39  22  33  34  1  .  .3360
 40  22  34  35  1  .  8.042
 41  23  22  35  1  .  8.042
 42  23  35  36  1  .  8.042
 43  25  24  37  1  .  8.042
 44  25  37  38  1  .  8.042
 45  26  25  38  1  .  8.042
 46  27  26  38  1  .  .3360
 47  27  38  39  1  .  .3360
 48  28  27  39  1  .  .3360
 49  28  39  40  1  .  .3360
 50  29  28  40  1  .  .3360
 51  29  40  41  1  .  .3360
 52  30  29  41  1  .  .3360
 53  30  41  42  1  .  .3360
 54  31  30  42  1  .  .3360
 55  31  42  43  1  .  .3360
 56  32  31  43  1  .  .3360
 57  32  43  44  1  .  .3360
 58  33  32  44  1  .  .3360
 59  33  44  45  1  .  .3360
```

60	34	33	45	1	.	.3360
61	35	34	45	1	.	8.042
62	35	45	46	1	.	8.042
63	36	35	46	1	.	8.042
64	37	47	48	1	.	8.042
65	38	37	48	1	.	8.042
66	38	48	49	1	.	8.042
67	38	49	50	1	.	.3360
68	39	38	50	1	.	.3360
69	39	50	51	1	.	.3360
70	40	39	51	1	.	.3360
71	40	51	52	1	.	.3360
72	41	40	52	1	.	.3360
73	41	52	53	1	.	.3360
74	42	41	53	1	.	.3360
75	42	53	54	1	.	.3360
76	43	42	54	1	.	.3360
77	43	54	55	1	.	.3360
78	44	43	55	1	.	.3360
79	44	55	56	1	.	.3360
80	45	44	56	1	.	.3360
81	45	56	57	1	.	.3360
82	45	57	58	1	.	8.042
83	46	45	58	1	.	8.042
84	46	58	59	1	.	8.042
85	48	47	60	1	.	8.042
86	48	60	61	1	.	8.042
87	49	48	61	1	.	8.042
88	50	49	61	1	.	.3360
89	50	61	62	1	.	.3360
90	51	50	62	1	.	.3360
91	51	62	63	1	.	.3360
92	52	51	63	1	.	.3360
93	52	63	64	1	.	.3360
94	53	52	64	1	.	.3360
95	53	64	65	1	.	.3360
96	54	53	65	1	.	.3360
97	54	65	66	1	.	.3360
98	55	54	66	1	.	.3360
99	55	66	67	1	.	.3360
100	56	55	67	1	.	.3360
101	56	67	68	1	.	.3360
102	57	56	68	1	.	.3360
103	58	57	68	1	.	8.042
104	58	68	69	1	.	8.042
105	59	58	69	1	.	8.042
106	60	89	90	1	.	8.042
107	61	60	90	1	.	8.042
108	61	90	91	1	.	8.042
109	61	91	92	1	.	.3360
110	62	61	92	1	.	.3360
111	62	92	93	1	.	.3360
112	62	93	79	1	.	.3360
113	62	79	70	1	.	.3360
114	63	62	70	1	.	.3360
115	63	70	71	1	.	.3360
116	63	71	72	1	.	.3360
117	63	72	73	1	.	.3360
118	63	73	64	1	.	.3360
119	64	73	74	1	.	.3360

120	65	64	74	1	.	.3360
121	65	74	75	1	.	.3360
122	66	65	75	1	.	.3360
123	66	75	76	1	.	.3360
124	66	76	77	1	.	.3360
125	66	77	78	1	.	.3360
126	66	78	67	1	.	.3360
127	67	78	88	1	.	.3360
128	67	88	98	1	.	.3360
129	67	98	99	1	.	.3360
130	68	67	99	1	.	.3360
131	68	99	100	1	.	.3360
132	68	100	101	1	.	8.042
133	69	68	101	1	.	8.042
134	69	101	102	1	.	8.042
135	79	93	94	1	.	.3360
136	79	94	95	1	.	.3360
137	79	95	80	1	.	.3360
138	70	79	80	1	.	.3360
139	70	80	81	1	.	.3360
140	71	70	81	1	.	.3360
141	72	71	81	1	.	.3360
142	72	81	82	1	.	.3360
143	73	72	82	1	.	.3360
144	73	82	83	1	.	.3360
145	74	73	83	1	.	.3360
146	74	83	84	1	.	.3360
147	75	74	84	1	.	.3360
148	75	84	85	1	.	.3360
149	76	75	85	1	.	.3360
150	76	85	86	1	.	.3360
151	77	76	86	1	.	.3360
152	78	77	86	1	.	.3360
153	78	86	87	1	.	.3360
154	78	87	88	1	.	.3360
155	88	87	96	1	.	.3360
156	88	96	97	1	.	.3360
157	88	97	98	1	.	.3360
158	90	89	103	1	.	8.042
159	90	103	104	1	.	8.042
160	91	90	104	1	.	8.042
161	92	91	104	1	.	.3360
162	92	104	105	1	.	.3360
163	93	92	105	1	.	.3360
164	93	105	106	1	.	.3360
165	94	93	106	1	.	.3360
166	94	106	107	1	.	.3360
167	95	94	107	1	.	.3360
168	97	96	108	1	.	.3360
169	97	108	109	1	.	.3360
170	98	97	109	1	.	.3360
171	98	109	110	1	.	.3360
172	99	98	110	1	.	.3360
173	99	110	111	1	.	.3360
174	100	99	111	1	.	.3360
175	101	100	111	1	.	8.042
176	101	111	112	1	.	8.042
177	102	101	112	1	.	8.042
178	103	113	114	1	.	8.042
179	103	114	104	1	.	8.042

180	104	114	115	1	.	8.042
181	104	115	116	1	.	.3360
182	105	104	116	1	.	.3360
183	105	115	117	1	.	.3360
184	106	105	117	1	.	.3360
185	106	117	118	1	.	.3360
186	107	106	118	1	.	.3360
187	107	118	119	1	.	.3360
188	108	120	121	1	.	.3360
189	109	108	121	1	.	.3360
190	109	121	122	1	.	.3360
191	110	109	122	1	.	.3360
192	110	122	123	1	.	.3360
193	111	110	123	1	.	.3360
194	111	123	124	1	.	.3360
195	111	124	125	1	.	8.042
196	112	111	125	1	.	8.042
197	112	125	126	1	.	8.042
198	114	113	127	1	.	8.042
199	114	127	128	1	.	8.042
200	115	114	128	1	.	8.042
201	116	115	128	1	.	.3360
202	116	128	129	1	.	.3360
203	117	116	129	1	.	.3360
204	117	129	130	1	.	.3360
205	118	117	130	1	.	.3360
206	118	130	131	1	.	.3360
207	119	118	131	1	.	.3360
208	121	120	132	1	.	.3360
209	121	132	133	1	.	.3360
210	122	121	133	1	.	.3360
211	122	133	134	1	.	.3360
212	123	122	134	1	.	.3360
213	123	134	135	1	.	.3360
214	124	123	135	1	.	.3360
215	125	124	135	1	.	8.042
216	125	135	136	1	.	8.042
217	126	125	136	1	.	8.042
218	127	137	138	1	.	8.042
219	128	127	138	1	.	8.042
220	128	138	139	1	.	8.042
221	128	139	140	1	.	.3360
222	129	128	140	1	.	.3360
223	129	140	141	1	.	.3360
224	130	129	141	1	.	.3360
225	130	141	142	1	.	.3360
226	131	130	142	1	.	.3360
227	131	142	143	1	.	.3360
228	132	144	145	1	.	.3360
229	133	132	145	1	.	.3360
230	133	145	146	1	.	.3360
231	134	133	146	1	.	.3360
232	134	146	147	1	.	.3360
233	135	134	147	1	.	.3360
234	135	147	148	1	.	.3360
235	135	148	149	1	.	8.042
236	136	135	149	1	.	8.042
237	136	149	150	1	.	8.042
238	138	137	170	1	.	8.042
239	138	170	171	1	.	8.042

240	139	138	171	1	.	8.042
241	140	139	171	1	.	.3360
242	140	171	172	1	.	.3360
243	171	140	172	1	.	.3360
244	141	172	151	1	.	.3360
245	142	141	151	1	.	.3360
246	143	142	151	1	.	.3360
247	143	151	152	1	.	.3360
248	152	151	161	1	.	.3360
249	152	161	153	1	.	.3360
250	153	161	162	1	.	.3360
251	153	162	163	1	.	.3360
252	154	153	163	1	.	.3360
253	154	163	164	1	.	.3360
254	155	154	164	1	.	.3360
255	155	164	165	1	.	.3360
256	156	155	165	1	.	.3360
257	156	165	166	1	.	.3360
258	157	156	166	1	.	.3360
259	157	166	167	1	.	.3360
260	158	157	167	1	.	.3360
261	158	167	168	1	.	.3360
262	158	168	169	1	.	.3360
263	159	158	169	1	.	.3360
264	159	169	160	1	.	.3360
265	144	159	160	1	.	.3360
266	145	144	160	1	.	.3360
267	146	145	160	1	.	.3360
268	146	160	177	1	.	.3360
269	147	146	177	1	.	.3360
270	147	177	178	1	.	.3360
271	148	147	178	1	.	.3360
272	149	148	178	1	.	8.042
273	149	178	179	1	.	8.042
274	150	149	179	1	.	8.042
275	151	172	161	1	.	.3360
276	161	172	173	1	.	.3360
277	162	161	173	1	.	.3360
278	163	162	173	1	.	.3360
279	164	163	173	1	.	.3360
280	164	173	174	1	.	.3360
281	165	164	174	1	.	.3360
282	165	174	175	1	.	.3360
283	166	165	175	1	.	.3360
284	166	175	176	1	.	.3360
285	167	166	176	1	.	.3360
286	168	167	176	1	.	.3360
287	169	168	176	1	.	.3360
288	169	176	177	1	.	.3360
289	160	169	177	1	.	.3360
290	170	180	181	1	.	8.042
291	171	170	181	1	.	8.042
292	171	181	182	1	.	8.042
293	171	182	183	1	.	.3360
294	172	171	183	1	.	.3360
295	172	183	184	1	.	.3360
296	173	172	184	1	.	.3360
297	173	184	185	1	.	.3360
298	173	185	174	1	.	.3360
299	174	185	186	1	.	.3360

300	175	174	186	1	.	.3360
301	175	186	187	1	.	.3360
302	176	175	187	1	.	.3360
303	176	187	188	1	.	.3360
304	177	176	188	1	.	.3360
305	177	188	189	1	.	.3360
306	178	177	189	1	.	.3360
307	178	189	190	1	.	.3360
308	178	190	191	1	.	8.042
309	179	178	191	1	.	8.042
310	179	191	192	1	.	8.042
311	181	180	193	1	.	8.042
312	181	193	194	1	.	8.042
313	182	181	194	1	.	8.042
314	183	182	194	1	.	.3360
315	183	194	195	1	.	.3360
316	184	183	195	1	.	.3360
317	184	195	196	1	.	.3360
318	185	184	196	1	.	.3360
319	185	196	197	1	.	.3360
320	186	185	197	1	.	.3360
321	186	197	198	1	.	.3360
322	187	186	198	1	.	.3360
323	187	198	199	1	.	.3360
324	188	187	199	1	.	.3360
325	188	199	200	1	.	.3360
326	189	188	200	1	.	.3360
327	189	200	201	1	.	.3360
328	190	189	201	1	.	.3360
329	191	190	201	1	.	8.042
330	191	201	202	1	.	8.042
331	192	191	202	1	.	8.042
332	193	203	204	1	.	8.042
333	194	193	204	1	.	8.042
334	194	204	205	1	.	8.042
335	194	205	206	1	.	.3360
336	195	194	206	1	.	.3360
337	195	206	207	1	.	.3360
338	196	195	207	1	.	.3360
339	196	207	208	1	.	.3360
340	197	196	208	1	.	.3360
341	197	208	209	1	.	.3360
342	198	197	209	1	.	.3360
343	198	209	210	1	.	.3360
344	199	198	210	1	.	.3360
345	199	210	211	1	.	.3360
346	200	199	211	1	.	.3360
347	200	211	212	1	.	.3360
348	201	200	212	1	.	.3360
349	201	212	213	1	.	.3360
350	201	213	214	1	.	8.042
351	202	201	214	1	.	8.042
352	202	214	215	1	.	8.042
353	204	203	216	1	.	8.042
354	204	216	217	1	.	8.042
355	205	204	217	1	.	8.042
356	206	205	217	1	.	.3360
357	206	217	218	1	.	.3360
358	207	206	218	1	.	.3360
359	207	218	219	1	.	.3360

```
360 208 207 219    1          .          .3360
361 208 219 220    1          .          .3360
362 209 208 220    1          .          .3360
363 209 220 221    1          .          .3360
364 210 209 221    1          .          .3360
365 210 221 222    1          .          .3360
366 211 210 222    1          .          .3360
367 211 222 223    1          .          .3360
368 212 211 223    1          .          .3360
369 212 223 224    1          .          .3360
370 213 212 224    1          .          .3360
371 214 213 224    1          .          8.042
372 214 224 225    1          .          8.042
373 215 214 225    1          .          8.042
374 216 226 227    1          .          8.042
375 217 216 227    1          .          8.042
376 217 227 228    1          .          8.042
377 217 228 229    1          .          .3360
378 218 217 229    1          .          .3360
379 218 229 230    1          .          .3360
380 219 218 230    1          .          .3360
381 219 230 231    1          .          .3360
382 220 219 231    1          .          .3360
383 220 231 232    1          .          .3360
384 221 220 232    1          .          .3360
385 221 232 233    1          .          .3360
386 222 221 233    1          .          .3360
387 222 233 234    1          .          .3360
388 223 222 234    1          .          .3360
389 223 234 235    1          .          .3360
390 224 223 235    1          .          .3360
391 224 235 236    1          .          .3360
392 224 236 237    1          .          8.042
393 225 224 237    1          .          8.042
394 225 237 238    1          .          8.042
394
  7   1   1      0.0              0.0
232   1   1      0.0              0.0
  1  36   1  20
 15  72  21  40
 51 105  41  59
 85 154  60  78
106 172  79  98
129 207  99 119
188 241 120 139
221 289 140 160
238 310 161 179
290 346 180 199
325 382 200 219
361 394 220 238
 30000.            3CC00.          .3       .3       12000.
 26
  1        -.5216          0.CC000
  2        -.9516          £0.01210
  3        -.48150         £0.0392
  4        -0.1095         £0.0789
  5        -0.1145         £0.1174
  6        -0.0848         £0.1594
  7        0.C0000         £0.1860
  8        £0.0848         £0.1594
```

9	£0.1145	£0.1174
10	£0.1095	£0.0789
11	£0.4815	£0.0392
12	£0.9516	£0.0121
13	£0.5216	0.00000
226	£1.1820	0.00000
227	£2.1557	-0.0121
228	£1.0907	-0.0392
229	£0.2482	-0.0789
230	£0.2583	-0.1174
231	£0.1920	-0.1594
232	0.00000	-0.1860
233	-0.1920	-0.1594
234	-0.2583	-0.1174
235	-0.2482	-0.0789
236	-1.0907	-0.0392
237	-2.1557	-0.0121
238	-1.1820	0.00000

OUTPUT

```
12 238 394   2   1   1   1   2       0.0              0.0
 1           0.0                 0.0
 2           0.0                 0.26999995
 3           0.0                 0.53999998
 4           0.0                 1.26999924
 5           0.0                 2.5000000
                .
                .
                .
```

X and Y coordinates for nodal points 6 through 234 have been eliminated.

```
                .
                .
                .
235          31.000000000      10.69999981
236          31.000000000      11.42399979
237          31.000000000      11.69999981
238          31.000000000      12.00000000
```

```
  1   1  14   2   1       0.0              8.04199982
  2   2  14  15   1       0.0              8.04199982
  3   3   2  15   1       0.0              8.04199982
  4   4   3  15   1       0.0              0.33599997
                .
                .
                .
```

Information for elements 5 through 391 has been eliminated.

```
                .
                .
                .
391 224 235 236   1       0.0              0.33599997
392 224 236 237   1       0.0              8.04199982
393 225 224 237   1       0.0              8.04199982
394 225 237 238   1       0.0              8.04199982
  7   1   1        0.0              0.0
232   1   1        0.0              0.0
  1  36   1  20
 15  72  21  40
 41 105  41  59
 85 154  60  78
106 172  79  98
129 207  99 119
188 241 120 139
221 289 140 160
238 310 161 179
290 346 180 199
325 382 200 219
361 394 220 238
 30000.000000000  30000.000000000  0.3000  0.3000  12.000.000000000
  1 -0.52155996E 00  0.0
  2 -0.95155996E 00  0.12100000E-01
  3 -0.48145997E 00  0.19199997E-01
  4 -0.10945999E 00  0.78899980E-01
  5 -0.11445999E 00  0.11735999E 00
  6 -0.84755945E-01  0.15939999E 00
  7  0.0             0.18599999E 00
  8  0.84755945E-01  0.15939999E 00
  9  0.11445999E 00  0.11739999E 00
 10  0.10945999E 00  0.78899980E-01
 11  0.48145997E 00  0.19199997E-01
```

```
 12  0.951969968 00  C.121000008-01
 13  0.521969958 00  C.0
226  0.118159928 01  C.0
227  0.215569978 01 -C.121CCCC08-01
228  0.109069928 01 -C.391999978-01
229  C.248ZCCCCE 00 -C.78R999808-01
230  0.258259958 00 -C.117399598 CC
231  0.191999978 00 -C.159399998 CC
232  C.0            -C.1R5999998 CC
233 -0.191559978 00 -C.159359995 CC
234 -0.258269958 00 -C.117399598 CC
235 -0.248ZCCCCE 00 -C.78R999808-01
236 -C.109069928 01 -C.391559978-C1
237 -0.215569978 01 -C.121CCCC08-C1
238 -0.118159928 01  C.0
RESIDUALS
-0.31E-03-0.81E-03 C.23E-03 C.11E-02-0.11E-03-0.44E-03-C.15E-04 0.0       0.57E-05 0.12E-04 0.67E-05-0.29E-04
 0.0      -0.14E-05 0.95E-06-0.10E-04 0.20E-04-0.83E-05-0.19E-05 0.45C-04 0.17E-03 0.47E-03 0.1CE-05 0.25E-03
-0.18E-03-0.52E-03 0.15E-04-0.66E-03-C.22E-03 0.75E-03-0.29E-05 0.23E-04-0.24E-04 0.22E-04 0.1AE-05 0.13E-04
-0.11E-04 0.11E-04 C.29E-05 C.52E-04
-0.19E-05-0.12E-04-0.15E-04 C.50E-03 C.31E-04-0.39E-03 0.34E-03-0.71E-03-0.92E-04 0.66E-03-0.97E-04 0.61E-03
-0.19E-05-0.89E-06-0.38E-05 0.42E-04-0.86E-05 0.13E-04-0.3EE-05 0.23E-04-0.29E-05 0.40E-04 0.45E-06 0.23E-04
-0.19E-05 0.24E-04 C.46E-04 0.19E-03-C.35F-C3 0.19E-02 0.33E-03-0.19E-02 0.0      -0.54E-03-0.6AE-04 0.61E-03
-0.29E-05-0.58E-05-0.12E-04 C.12E-04
 0.11E-05 0.15E-04 C.83E-06 0.11E-04-0.18E-05 0.17E-04 0.3EE-06 0.12E-04 0.92E-04 0.45E-03-0.43E-04-0.97E-03
 0.61E-03-C.94E-04-C.12E-02 C.43E-03 0.26E-C3 0.22E-03 0.16E-04-0.27E-05-0.14C-04 0.30E-06-0.13E-04 0.38E-05
-0.12E-04 0.24E-05-C.81E-05 C.23E-05-C.23E-C5-0.1CE-05 0.54E-06-0.33E-05 0.42E-C4 0.86E-04-0.90E-04 0.11E-03
 0.24E-C4-0.53E-03
 0.19E-03-C.94E-04-C.42E-04 C.10E-03-C.91E-05-0.13E-05 0.67E-05 0.16E-05 0.58E-05 0.60E-05 0.12E-04 0.71E-05
 0.18E-06 0.95E-C6 C.50E-06 0.39E-C5 C.43E-C4 C.46E-C4-C.35E-04-0.15E-04-0.22E-04 0.12E-04-0.44E-05 0.40E-03
-0.71E-05 0.1CE-04-0.24E-04 0.39E-05-0.34E-04 0.37E-05-0.24E-04 0.67 -05-C.54E-05 0.41E-05-0.7CE-06 0.16E-05
-0.64E-05 0.13E-05
 0.36E-C6-0.22E-05-C.60E-05 C.90E-C5 0.35E-C5 0.85E-05 C.13E-04-0.55E-05 0.4AE-06-0.86E-05 0.44E-05 0.9CE-05
 0.38E-05-0.24E-06-0.14E-05 0.21E-C5-C.47E-C5-0.83E-06-0.43E-05 0.11E-05 0.29E-04 0.31E-03 0.8E-04-0.11E-02
-0.31E-04 0.7AE-03-0.79E-05 0.11E-04-C.15E-04-0.16E-04-0.61E-05 0.11E-04-0.30E-06-0.79E-C5-0.94E-06 0.24E-05
-0.27E-C5-0.15E-05-C.23E-05-C.23E-05
-0.41E-05-0.11E-05-0.22E-04 C.50E-C4-C.1CE-C4-C.76E-C4 C.29E-05 0.32E-04-0.20E-04-0.51E-04-0.44E-04 0.62E-04
-0.21E-05-0.24E-05-0.50E-05 0.52E-05 0.38E-05-0.56E-C5 C.36E-C5 C.4AE-05-0.69E-05-0.67E-05-0.61E-05-0.25E-05
-0.58E-04 0.29E-C3-C.67E-05-C.31E-C3-C.47E-C5 0.11E-03-0.56E-04-0.14E-03 0.22E-04 0.57E-04-0.4AE-05-0.71E-05
-0.16E-05 0.32E-05-0.56E-05 C.42E-05 C.38E-05-0.64E-05
 0.32E-05 0.18E-04-0.15E-04-0.31E-04-0.45E-05 0.64E-05-0.14E-04-0.51E-05 0.24E-04-0.33E-04-0.12E-03 0.0E-05
 0.02E-04-0.45E-03-0.20E-04 C.69E-04-0.41E-04-0.7AE-C4-C.4AE-06-0.27E-05-0.27E-05 0.29E-05-0.54E-06-0.15E-05
 0.0      -C.59E-C5-C.75E-05 C.12E-05-C.74E-C5-0.51E-C5-C.63E-04 0.23E-03-0.95E-05-0.22E-03 0.9CE-05-0.78E-04
 0.14E-C4 0.14E-03 0.97E-06-0.3.E-04
-0.48E-05-0.24E-05-C.42E-05 C.35E-05-C.36E-05-0.4AE-05 C.24E-05 0.35E-05-0.54E-06 0.48E-05-0.7AE-05-0.11E-04
-0.99E-05 0.13E-04-C.57E-05-C.14E-C4-C.24E-C3 0.82E-03 C.4CE-04-0.23E-02-0.14C-03 0.97E-05 0.13E-05-0.12E-04
 0.42E-06 0.72E-06 0.24E-06-C.28E-05-0.18E-05 0.11E-05-0.12E-04-0.33E-05-0.14C-04-0.24E-05-0.57E-05-0.12E-05
-0.44E-05-0.23E-05-0.42E-05-C.33E-05-C.11E-04-0.2AE-05
 0.12E-C6 0.30E-05-C.53E-06-C.75E-05 C.19E-C5 0.23E-05-0.66E-06-0.70E-05 0.41E-05-0.83E-06-0.7 -05-0.14E-05
-0.46E-05-0.27E-05-C.33E-04-C.91E-C5-C.91E-05-0.54E-05 0.19E-04 0.61E-03 0.41E-04-0.66E-04 0.0 -05-0.3E-06
-0.6CE-C7-C.4CE-05-0.27E-05-C.36E-05-C.11E-04-0.2CE-05-0.15E-04-0.12E-04-0.72E-05 0.13E-04-0.1AE-05-0.2 -05
 0.85E-C4 0.39E-C3
-0.1CE-04 0.3CE-03 C.35E-04-C.42E-C3 C.91E-C5 0.5AE-05 C.6CE-05-0.13E-04 0.34E-06 0.76E-06 0.1 E-0 -0.76E-05
 0.13E-C5 0.25E-05-0.70E-03-0.74E-05-C.13E-04-0.22E-04-C.4CE-04 0.6 E-04-0.40E-04-0.46E-05 0.27E-04-0.11E-04
-0.96E-C4 0.22E-02 C.23E-04 C.14E-C3 C.15E-C4-0.16E-03 C.36E-05-0.19E-05 0.16E-05 0.13E-05-0.3 -05 0.14E-05
-0.77E-C5-0.83E-06-0.22E-04-C.29E-05
-0.11E-04-0.19E-04 0.85E-C4-0.13E-03-0.48E-05 0.1CE-03-0.13E-03-0.71E-03 0.35E-03 0.62E-03-0.31E-04  .0 -0.
 0.74E-C5-0.14E-04 C.53E-05 C.47E-05 C.65E-C5 0.39E-05-0.26C-05-0.20E-05 0.33E-05 0.14E-04-0.47E-04-0.12E-04
-0.4CE-06 0.23E-C5-C.61E-03-C.51E-C3 C.71E-C3-0.67E-03-C.31E-04 0.12E-12 0.18E-03 0.96E-03 0.13E-03-0.99E-03
 0.57E-05 0.33E-05 0.49E-05 0.64E-05
```

0.12E-06 0.38E-05 0.51E-05 0.77E-05 0.64E-05 0.72E-05-0.23E-04 0.51E-05 0.47E-03 0.17E-03-0.36E-03-0.14E-03
0.50E-04-0.92E-04-0.15E-03 0.61E-04 0.52E-04-0.13E-04 0.83E-05 0.48E-05-0.88E-05 0.11E-04-0.43E-05-0.18E-05
0.44E-05-0.39E-05 0.10E-04-0.38E-05 0.55E-05 0.95E-06-0.80E-05 0.13E-04 0.20E-03-0.12E-03-0.44E-03 0.35E-03
0.0 -0.11E-03

NODE	X-DISPLACEMENTS	Y-DISPLACEMENTS
1	-0.40326756E-03	0.65026153E-03
2	-0.38520386E-03	0.64896327E-03
3	-0.36863307E-03	0.64788386E-03
4	-0.33722050E-03	0.64745895E-03
5	-0.28448459E-03	0.64826687E-03
6	-0.21786233E-03	0.65103C80E-03
7	-0.12386634E-03	0.65734470E-03
8	-0.23352870E-04	0.66617131E-03
9	0.56R43361E-C4	0.672R3C04E-03
10	0.12417685E-03	0.67709689E-C3
11	0.16480914E-03	0.67896792E-03
12	0.184C9016E-03	0.680063 39E-03
13	0.205C0920E-03	0.68135210E-03
14	0.38165553E-03	0.55994163E-C3
15	-0.34805R76E-03	0.55742310E-03
16	-0.30001113E-03	0.55415905E-03
17	-0.24396028E-03	0.55226381E-03
18	-0.17339543E-03	0.55225519E-03
19	-0.75321455E-04	0.55627804E-03
20	0.67175561E-C5	0.56204596E-03
21	0.78854064E-04	0.56802970E-03
22	0.144225 39E-03	0.57413778E-03
23	0.18355776E-03	0.57664397E-03
24	-0.35041641E-03	0.44472795E-03
25	-0.334C0115E-03	0.44320757E-03
26	-0.318976R2E-03	0.442CC034E-03
27	-0.29442599E-03	0.43R27 34E-C3
28	-0.25327737E-03	0.43336069E-03
29	-0.20071173E-03	0.42885891E-03
30	-0.12674301E-03	0.42573949E-03
31	-0.45753608E-04	0.427259R3E-03
32	0.21028856E-04	0.43093006E-03
33	C.78589903E-C4	0.43534930E-03
34	0.11527604E-03	0.43R735R2E-03
35	0.13353677E-03	0.43995632E-03
36	0.15345530E-03	0.44137059E-03
37	-0.31596934E-03	0.33975672E-03
38	-0.28820150E-03	0.33684424E-03
39	-0.25252020E-03	0.32972451E-03
40	-0.21193865E-03	0.32198615E-03
41	-0.16169123E-03	0.31403126E-03
42	-0.91169612E-04	0.30746614E-03
43	-0.29120652E-04	0.30555883E-03
44	0.28178882E-04	0.30585914E-03
45	0.84588493E-04	0.30755415E-03
46	0.12150061E-03	0.31029130E-03
47	-0.27881167E-03	0.25039166E-03
48	-0.26673R93E-03	0.24961097E-03
49	-0.25568949E-03	0.24726707E-03
50	-0.23756572E-03	0.24300241E-03
51	-0.20894A30E-03	0.23315613E-03
52	-0.17442556E-03	0.22265178E-03
53	-0.12695327E-03	0.20951724E-03
54	-0.72174807E-04	0.19776875E-03
55	-0.22F44164E-04	0.19043115E-03

56	0.215239566-04	0.1842C967E-03
57	0.529708G5E-04	0.1811388BF-03
58	0.69341695E-04	0.18227301E-03
59	0.87231921E-04	0.18397474E-03
60	-0.23994155E-03	0.17899353E-03
61	-0.22135049E-03	0.17488745E-03
62	-0.19494220E-03	0.1662321CE-03
63	-0.17138662E-03	0.15482366E-03
64	-0.14423610E-03	0.14153015E-03
65	-0.1016669DE-03	0.11892036E-03
66	-0.64271502E-04	0.99872050E-04
67	-0.18771694E-04	0.87021588E-04
68	0.22563341E-04	0.66995955E-04
69	0.48067872E-04	0.69734CC0E-04
70	-0.16270096E-03	0.13173948E-03
71	-0.16097669E-03	0.1314750BE-03
72	-0.15910089E-03	0.12916903E-03
73	-0.15105432E-03	0.12426029E-03
74	-0.12068381E-03	0.10606940E-03
75	-0.88.96976E-04	0.79362942E-04
76	-0.75818665E-04	0.67788322E-04
77	-0.71412069E-04	0.63309824E-04
78	-0.65570217E-04	0.53234355E-04
79	-0.16107362E-03	0.12565772E-03
80	-0.14874751E-03	0.11591175E-03
81	-0.15280716E-03	0.11826599E-03
82	-0.15481592E-03	0.11783403E-03
83	-0.13801541E-03	0.10698714E-03
84	-0.98217148E-04	0.77816076E-04
85	-0.78CC0652E-04	0.52214251E-04
86	-0.79329402E-04	0.37849066E-04
87	-0.81548686E-04	0.25126123E-04
88	-0.62641382E-04	0.32151904E-04
89	-0.20067117E-03	0.12077233E-03
90	-0.19271916E-03	0.11896533E-03
91	-0.18542791E-03	0.1175C316E-03
92	-0.17067758E-03	0.11456879E-03
93	-0.15785727E-03	0.11194059E-03
94	-0.14939833E-03	0.11034825E-03
95	-0.14163047E-03	0.10834276E-03
96	-0.86816217E-04	0.48194779E-05
97	-0.77207762E-04	0.51648894E-05
98	-0.674C1605E-04	0.40161904E-05
99	-0.55813114E-04	0.709135865-07
100	-0.48014277E-04	-0.402490 5E-05
101	-0.45740846E-04	-0.20574 3E-05
102	-0.43721797E-04	-0.17040776E-06
103	-0.16117540E-03	0.71974442E-04
104	-0.14835123E-03	0.68670648E-04
105	-0.13165937E-03	0.65C49142E-04
106	-0.11459725E-03	0.61195300E-04
107	-0.10192001E-03	0.5835259AE-04
108	-0.13468850E-03	-0.47709473E-04
109	-0.12260540E-03	-0.43867345E-04
110	-0.10793250E-03	-0.38084836E-04
111	-0.97895586E-04	-0.31691149E-04
112	-0.88811270E-04	-0.27484886E-04
113	-0.12C95209E-03	0.31346659E-04
114	-0.11573694E-03	0.2946650AE-04
115	-0.11C94337E-03	0.27974820E-04

116	-0.10032946E-03	0.24360052E-04
117	-0.88940345E-04	0.21165833E-04
118	-0.76634809E-04	0.18045699E-04
119	-0.71150062E-04	0.16737569E-04
120	-0.17569578E-03	-0.85511187E-04
121	-0.17085274E-03	-0.83980746E-04
122	-0.16114648E-03	-0.79613921E-04
123	-0.15341441E-03	-0.74563024E-04
124	-0.14711081E-03	-0.68671550E-04
125	-0.14245471E-03	-0.66660359E-04
126	-0.13736240E-03	-0.64390464E-04
127	-0.79662990E-04	0.19992731E-05
128	-0.73858682E-04	-0.14161633E-05
129	-0.63987667E-04	-0.74928648E-05
130	-0.51489493E-04	-0.12568601E-04
131	-0.42064843E-04	-0.15472557E-04
132	-0.20853624E-03	-0.11564426E-03
133	-0.20255189E-03	-0.11268623E-03
134	-0.19746527E-03	-0.10747183E-03
135	-0.19547832E-03	-0.10095279E-03
136	-0.18882669E-03	-0.96587406E-04
137	-0.37169288E-04	-0.97172315E-05
138	-0.36854864E-04	-0.11597443E-04
139	-0.36835409E-04	-0.13230614E-04
140	-0.29394883E-04	-0.29839372E-04
141	-0.25885893E-04	-0.42534230E-04
142	-0.20762527E-04	-0.47783353E-04
143	-0.15322206E-04	-0.52544958E-04
144	-0.22874906E-03	-0.13597056E-03
145	-0.22927356E-03	-0.13327230E-03
146	-0.23108756E-03	-0.13051527E-03
147	-0.23726588E-03	-0.12415725E-03
148	-0.24361128E-03	-0.11616321E-03
149	-0.24337492E-03	-0.11421350E-03
150	-0.24307839E-03	-0.11162912E-03
151	-0.12253729E-04	-0.58152174E-04
152	-0.10819553E-04	-0.67016692E-04
153	-0.10383686E-04	-0.79281104E-04
154	-0.21088912E-04	-0.97515338E-04
155	-0.65531349E-04	-0.13525363E-03
156	-0.16028556E-03	-0.15828990E-03
157	-0.21009332E-03	-0.14945107E-03
158	-0.22455803E-03	-0.14281461E-03
159	-0.22849327E-03	-0.13935212E-03
160	-0.23601030E-03	-0.13202120E-03
161	-0.44504495E-05	-0.72656694E-04
162	-0.73065657E-05	-0.80786689E-04
163	-0.12244432E-04	-0.87401524E-04
164	-0.32529563E-04	-0.10173420E-03
165	-0.11064841E-03	-0.12877969E-03
166	-0.19091574E-03	-0.13615040E-03
167	-0.21770599E-03	-0.13446594E-03
168	-0.22623767E-03	-0.13314979E-03
169	-0.23488911E-03	-0.13301126E-03
170	0.47717840E-04	-0.17010461E-04
171	0.50202347E-04	-0.21578700E-04
172	0.26859157E-04	-0.51355615E-04
173	0.20504758E-05	-0.75360411E-04
174	-0.58164995E-04	-0.95579700E-04
175	-0.15973637E-03	-0.11261548E-03

176	-0.23010462E-03	-0.11755321E-03
177	-0.26766025E-03	-0.13514220E-03
178	-0.29228767E-03	-0.10582106E-03
179	-0.29908819E-03	-0.10126759E-03
180	0.10453019E-03	-0.17649712E-04
181	0.10234909E-03	-0.20385778E-04
182	0.10027396E-03	-0.22443404E-04
183	0.82391751E-04	-0.32268654E-04
184	0.45059529E-04	-0.46252026E-04
185	-0.11938689E-04	-0.57780213E-04
186	-0.10542486E-03	-0.68421185E-04
187	-0.20422082E-03	-0.75788004E-04
188	-0.27042534E-03	-0.77831894E-04
189	-0.3166 19E-03	-0.74574345E-04
190	-0.34211110E-03	-0.69472546E-04
191	-0.34857052E-03	-0.67452260E-04
192	-0.35554240E-03	-0.64815569E-04
193	0.16400320E-03	0.10971604E-04
194	0.15174007E-03	0.61115825E-05
195	0.10438423E-03	-0.41281601E-05
196	0.41762454E-04	-0.13315134E-04
197	-0.44718763E-04	-0.20559062E-04
198	-0.16611371E-03	-0.25137168E-04
199	-0.26011909E-03	-0.24819630E-04
200	-0.33331895E-03	-0.20603344E-04
201	-0.39388239E-03	-0.13388213E-04
202	-0.41273586E-03	-0.86169512E-05
203	0.22436243E-03	0.66605076E-04
204	0.21464231E-03	0.63793875E-04
205	0.20563279E-03	0.61563536E-04
206	0.16988655E-03	0.54942284E-04
207	0.10649337E-03	0.47298876E-04
208	0.19836822E-04	0.41317398E-04
209	-0.10505770E-03	0.37767721E-04
210	-0.23448780E-03	0.40243394E-04
211	-0.33036247E-03	0.45720270E-04
212	-0.40443009E-03	0.53350785E-04
213	-0.44801855E-03	0.59983460E-04
214	-0.45921514E-03	0.62242892E-04
215	-0.47130277E-03	0.64969368E-04
216	0.28537260E-03	0.14030033E-03
217	0.26268256E-03	0.13515374E-03
218	0.18177839E-03	0.12759044E-03
219	0.95267154E-04	0.12261E48E-03
220	-0.24882611E-04	0.12029224E-03
221	-0.18829678E-03	0.12299977E-03
222	-0.31593977E-03	0.12925468E-03
223	-0.41893660E-03	0.13709565E-03
224	-0.50507439E-03	0.14673077E-03
225	-0.53151790E-03	0.15187472E-03
226	0.33198530E-03	0.20332226E-03
227	0.31913980E-03	0.20050783E-03
228	0.30717347E-03	0.19815017E-03
229	0.25716703E-03	0.19626622E-03
230	0.16948188E-03	0.19550169E-03
231	0.55186538E-04	0.19664076E-03
232	-0.10692632E-03	0.20026519E-03
233	-0.27331011E-03	0.20672305E-03
234	-0.39647566E-03	0.21190367E-03
235	-0.49364590E-03	0.21613359E-03

```
236 -0.54958928E-03  0.21906379E-03
237 -0.56328927E-03  0.22143417E-03
238 -0.57801581E-03  0.22424260E-03
ELEMENT NUMBER   FIRST NODE      SECOND NODE      THIRD NODE      X AND Y CO-ORDINATES OF CENTROID
  X-STRESS      Y-STRESS          XY-STRESS        STRESS-1         STRESS-2          PRINCIPLE ANGLE
   1   1  14   2        0.49999940        0.09999985
 0.43218994E 00 -0.15258789E-03 -0.18119812E-04  0.43218988E 00 -0.15252829E-03    -90.00418091
0.43219E CC-0.15253E-03-0.90004E 02
   2   2  14  15        0.99999887        0.29199964
 0.41932011E 00 -0.52710938E-02 -0.22733688E-01  0.42053354E 00 -0.65845251E-02    -86.95091248
0.42053E 00-0.65845E-02-0.86951E 02
   3   3   2  15        0.49999940        0.48399931
 0.41349316E 00  0.67148209E-02 -0.32186508E-02  0.41351855E 00  0.66894293E-02    -89.55319214
0.41352E CC 0.66894E-02-0.89553E 02
   4   4   3  15        0.49999940        0.81733161
 0.44636726E 00  0.11630440E 00 -0.20303726E 00  0.54298335E 00  0.19688308E-01    -64.55702209
0.54298E CC 0.19688E-01-0.64557E 02
   5   4  15  16        0.99999887        1.22533035
 0.26004353E 00  0.28011322E-01 -0.26467609E 00  0.50646091E 00 -0.11840604E 00    -61.05325317
0.50646E CC-0.11841E CC-0.61053E 02
   6   5   4  16        0.49999940        1.86666393
 0.34151649E 00  0.12263393E 00 -0.22173500E 00  0.47934788E 00 -0.15197456E-01    -58.13894653
0.47935E CC-0.15197E-01-0.58139E 02
   7   5  16  17        0.99999887        2.49999619
 0.26131248E 00  0.37781715E-01 -0.28000641E 00  0.45103502E 00 -0.15194082E 00    -55.88383484
0.45104E CC-0.15194E CC-0.55884E 02
   8   6   5  17        0.49999940        3.23332882
 0.22556496E 00  0.12294865E 00 -0.24536896E 00  0.42493272E 00 -0.76419115E-01    -50.90905762
0.42493E CC-0.76419E-01-0.50909E 02
   9   6  17  18        0.99999887        4.01332806
 0.15619278E 00  0.46706200E-01 -0.29206276E CC  0.39859831E 00 -0.19569933E 00    -50.31172180
0.39860E CC-0.19570E 00-0.50312E 02
  10   7   6  18        0.49999940        4.96666050
 0.78887939E-01  0.11837387E 00 -0.24896049E 00  0.34837300E 00 -0.15111119E 00    -42.73605347
0.34837E 00-0.15111E 00-0.42736E 02
  11   7  18  19        0.99999887        5.99998760
 0.72708130E-02  0.57099307E-01 -0.28967476E 00  0.32289600E 00 -0.25858688E 00    -42.54820251
0.32290E 00-0.25859E 00-0.42548E 02
  12   8   7  19        0.49999940        7.03332138
-0.10443115E 00  0.10107172E CC -0.24429321E CC  0.26334286E 00 -0.26670229  00    -33.59645081
0.26334E 00-0.26670E CC-0.33596E 02
  13   8  19  20        0.99999887        7.96665478
-0.15404987E 00  0.55571556E-01 -0.27561760E 00  0.24563420E 00 -0.34411252E 00     34.59222412
0.24563E CC-0.34411E CC-0.34592E 02
  14   9   8  20        0.49999940        8.76665211
-0.23524314E 00  0.62604308E-01 -0.21984577E 00  0.17921853E 00 -0.35185730E 00    -27.94514465
0.17922E 00-0.35186E CC-0.27945E 02
  15   9  20  21        0.99999887        9.49998379
-0.26668262E 00  0.48217773E-01 -0.24402142E 00  0.18117589E 00 -0.39964074E 00    -28.58639526
0.18118E CC-0.39964E CC-0.28586E 02
  16  10   9  21        0.49999940       10.13331890
-0.34434414E 00  0.33484101E-02 -0.18498516E 00  0.83356380E-01 -0.42435205E 00    -23.39068604
0.83356E-01-0.42435E CC-0.23391E 02
  17  10  21  22        0.99999887       10.77465057
-0.35985184E 00  0.41752815E-01 -0.21168137E 00  0.13272190E 00 -0.45082092E 00    -23.25709534
0.13272E CC-0.45082E CC-0.23257E 02
  18  11  10  22        0.49999940       11.18264961
-0.42686176E 00 -0.50523996E-01 -0.16518879E 00  0.11696517E-01 -0.48908228E 00    -20.64105225
0.11697E-01-0.48908E 00-0.20641E 02
  19  12  11  22        0.49999940       11.51598263
```

```
-0.41322327E 00 -0.48802495E-02 -0.20751953E-02 -0.48696995E-02 -0.41323376E 00      -0.29130292
-0.48697E-02-0.41323E 00-0.29130E 00
 20  12  22  23       0.99999887      11.70798397
-0.41802406E 00  0.51422119E-02 -0.18374443E-01  0.59384704E-02 -0.41882032E 00      -2.48154831
0.59385E-02-0.41882E 00-0.24815E 01
 21  13  12  23       0.49999940      11.89998531
-0.42904377E 00  0.16403198E-03  0.69618225E-03  0.16510487E-03 -0.42904484E 00       0.08830470
0.16510E-03-0.42904E 00 0.88305E-01
 22  14  24  25       2.83332920       0.09999985
 0.46480560E 00 -0.12588501E-01 -0.34671783E-01  0.46731055E 00 -0.15093446E-01     -85.87390137
0.46731E 00-0.15093E-01-0.85874E 02
 23  15  14  25       2.16666412       0.29199964
 0.45383072E 00  0.49638748E-02  0.73986053E-02  0.45395255E 00  0.48420429E-02      89.06242371
0.45395E 00 0.48420E-02 0.89062E 02
 24  15  25  26       2.83332920       0.48399931
 0.43611050E 00 -0.36621094E-03 -0.39304733E-01  0.43962157E 00 -0.38772821E-02     -84.90142822
0.43962E 00-0.38773E-02-0.84901E 02
 25  15  26  27       2.83332920       0.81733197
 0.42851925E 00 -0.25680542E-01 -0.28561497E 00  0.56631690E 00 -0.16347820E 00     -64.24925232
0.56632E 00-0.16348E 00-0.64249E 02
 26  16  15  27       2.16666412       1.22533035
 0.38921738E 00  0.38761284E-01 -0.23223495E 00  0.50451869E 00 -0.78540027E-01     -63.60087585
0.50452E 00-0.78540E-01-0.63601E 02
 27  16  27  28       2.83332920       1.86666393
 0.33415031E 00 -0.22683144E-01 -0.29609203E 00  0.50142556E 00 -0.18995839E 00     -60.54034424
0.50143E 00-0.18996E 00-0.60540E 02
 28  17  16  28       2.16666412       2.49999619
 0.29459149E 00  0.47683987E-01 -0.23867130E 00  0.44019318E 00 -0.97317696E-01     -58.68896484
0.44019E 00-0.97318E-01-0.58689E 02
 29  17  28  29       2.83332920       3.23332882
 0.22108936E 00 -0.23708344E-01 -0.30549812E 00  0.42779613E 00 -0.23041511E 00     -55.92091370
0.42780E 00-0.23042E 00-0.55921E 02
 30  18  17  29       2.16666412       4.03332806
 0.16546917E 00  0.49488068E-01 -0.24230099E 00  0.35662246E 00 -0.14166522E 00     -51.73355103
0.35662E 00-0.14167E 00-0.51734E 02
 31  18  29  30       2.83332920       4.96666050
 0.82974434E-01 -0.21899223E-01 -0.30498600E 00  0.33999842E 00 -0.27892321E 00     -49.88140869
0.34000E 00-0.27892E 00-0.49881E 02
 32  19  18  30       2.16666412       5.99998760
-0.21222115E-01  0.48490107E-01 -0.23621559E 00  0.25240737E 00 -0.22513938E 00     -40.80596924
0.25241E 00-0.22514E 00-0.40806E 02
 33  19  30  31       2.83332920       7.03332138
-0.10584450E 00 -0.89464188E-02 -0.29227543E 00  0.23886824E 00 -0.35365915E 00     -40.29692078
0.23887E 00-0.35366E 00-0.40297E 02
 34  20  19  31       2.16666412       7.96665478
-0.19498515E 00  0.43292344E-01 -0.21333504E 00  0.16850144E 00 -0.32019418E 00     -30.41145325
0.16850E 00-0.32019E 00-0.30411E 02
 35  20  31  32       2.83332920       8.76665211
-0.25426865E 00 -0.48751831E-02 -0.26303101E 00  0.16151994E 00 -0.42066377E 00     -32.32006836
0.16152E 00-0.42066E 00-0.32320E 02
 36  21  20  32       2.16666412       9.49998379
-0.21637102E 00  0.23315241E-01 -0.18693924E 00  0.11443371E 00 -0.39748949E 00     -23.45916748
0.11443E 00-0.39749E 00-0.23459E 02
 37  21  32  33       2.83332920      10.13331890
-0.26244106E 00  0.42486191E-02 -0.23176765E 00  0.11642283E 00 -0.47461528E 00     -25.82861328
0.11642E 00-0.47462E 00-0.25829E 02
 38  22  21  33       2.16666412      10.77465057
-0.29519310E 00  0.31154931E-01 -0.17016315E 00  0.90742052E-01 -0.45478016E 00     -19.30046082
0.90742E-01-0.45478E 00-0.19300E 02
 39  22  33  34       2.83332920      11.18264961
```

```
-0.43092346E 00  0.11062622E-01 -0.20435238E 00  0.91064274E-01 -0.51092511E 00    -21.38134766
0.91064E-01-0.51093E CO-0.21381E 02
 40  22  34  35       2.83332920      11.51598263
-0.43344784E 00  0.26397705E-02 -0.18466949E-01  0.34203529E-02 -0.43422842E 00     -2.42058086
0.34204E-02-0.43423E CC-C.24206E C1
 41  23  22  35       2.16666412      11.70798397
-0.44384956E 00 -0.26251078E-02  0.71306229E-02 -0.25099516E-02 -0.44396472E 00      0.92528707
-0.25100E-02-0.44396E CC 0.92529E CC
 42  23  35  36       2.83332920      11.89998531
-0.44955444E 00  0.25612793E-02 -0.14899254E-01  0.70474148E-02 -0.45004058E 00     -1.86893082
0.70474E-02-0.45CC4E CO-0.18689E 01
 43  25  24  37       4.16666126       0.09999985
 0.51767921E 00  0.32482147E-02  0.26783943E-01  0.51906979E 00  0.18576384E-02     87.03392029
0.51907E 00 0.18576E-02 0.87034E 02
 44  25  37  38       4.83332729       0.29199964
 0.48560715E 00 -0.60119629E-02 -0.51308632E-01  0.49090481E 00 -0.11309624E-01    -84.11099243
0.49090E CC-0.11310E-01-0.84111E C2
 45  26  25  38       4.16666126       0.48399931
 0.46402264E 00  0.75822540E-02  0.22297859E-01  0.46511024E 00  0.68946481E-02     87.21376038
0.46511E 00 0.68946E-02 0.87214E 02
 46  27  26  38       4.16666126       0.81733161
 0.45643711E 00 -0.17326355E-01 -0.22401619E 00  0.54558629E 00 -0.10647553E 00    -68.30444336
0.54559E CC-0.10648E 00-0.68304E 02
 47  27  38  39       4.83332729       1.22533035
 0.35296341E 00 -0.56612968E-01 -0.28405094E 00  0.53041077E 00 -0.19406033E 00    -64.18313599
0.53041E 0C-0.19406E C0-0.64183E 02
 48  28  27  39       4.16666126       1.86666393
 0.36761475E 00 -0.12644768E-01 -0.22754097E 00  0.47400510E 00 -0.11903512E 00    -64.94554138
0.47401E 0C-0.11904E 00-0.64946E 02
 49  28  39  40       4.83332729       2.49999619
 0.29227543E 00 -0.78139305E-01 -0.29718560E 00  0.45724088E 00 -0.24310476E CO    -60.97007751
0.45724E CC-0.24310E 00-0.6C970E 02
 5C  29  28  40       4.16666126       3.23332882
 0.24737453E 00 -0.15823364E-01 -0.23511887E 00  0.38521779E 00 -0.15366662E 00    -59.62246704
0.38522E C0-0.15367E 00-0.59622E 02
 51  29  40  41       4.83332729       4.03332806
 0.15842819E 00 -0.92850685E-01 -0.30900568E 00  0.36635989E 00 -0.30078238E 00    -56.06724548
0.36636E CC-0.30078E C0-0.56067E C2
 52  30  29  41       4.16666126       4.96666050
 0.79059655E-01 -0.23063302E-01 -0.23673153E 00  0.27019811E 0C -0.21416175E 00    -51.09194946
0.27020E 00-0.21416E C0-0.51092E C2
 53  30  41  42       4.83332729       5.99998760
-0.24359703E-01 -0.96831322E-01 -0.30527645E 00  0.24682397E 0C -0.36801499E 00    -48.38815308
0.24682E CC-0.36801E 00-0.48388E C2
 54  31  30  42       4.16666126       7.03332138
-0.14035320E 00 -0.19300103E-01 -0.22872162E 00  0.15676796E 00 -0.31642127E 00    -37.59153748
0.15677E CC-0.31642E C0-0.37592E 02
 55  31  42  43       4.83332729       7.96665478
-0.21800041E 00 -0.58351479E-01 -0.28669488E 00  0.13469410E 00 -0.45104599E 00    -39.10948181
0.13469E 00-0.45105E C0-0.39109E 02
 56  32  31  43       4.16666126       8.76665211
-0.28939652E 00 -0.15414119E-01 -0.20713520E 00  0.95932245E-01 -0.40074289E 00    -28.26249695
0.95932E-01-0.40074E 00-0.2R262E C2
 57  32  43  44       4.83332729       9.49998379
-0.35254860E 00 -0.1C0185395 00 -0.25946373E 00  0.62151909E-01 -0.51488590E 00    -32.03511047
0.62152E-01-0.51489E C0-0.32035E 02
 58  33  32  44       4.16666126      10.13331890
-0.39838022E 00 -0.65304637E-02 -0.19093677E CC  0.70492446E-01 -0.47540313E 00    -22.06459045
0.7C492E-01-0.47540E 00-0.22065E 02
 59  33  44  45       4.8333272°      10.77465057
```

```
-0.43741798E 00 -0.856797185-01 -0.21974444E 00  0.16664982E-01 -0.54376268E 00    -25.82609403
0.16665E-01-0.54376E 00-0.25826E 02
 60  34  33  45       4.16666126      11.18264961
-0.45960522E 00  0.24418235E-02 -0.17904282E 00  0.636993C5E-01 -0.52086264E 00    -18.88919067
0.63699E-01-0.52086E 00-0.18889E 02
 61  35  34  45       4.16666126      11.51598263
-0.46218967E 00 -0.597459C8E-02  0.68559647E-02 -0.58715940E-02 -0.46229261E 00      0.86075008
-0.58716E-02-0.46229E C0 0.86075E 00
 62  35  45  46       4.83332729      11.70798397
-0.468293I9E 00  0.2C751953E-02 -0.17540693E-01  0.27283430E-02 -0.46894634E 00     -2.13264465
0.27283E-02-0.46895E 00-0.21326E C1
 63  36  35  46       4.16666126      11.89998531
-0.48016930E 00 -0.26063919E-02  0.10266304E-01 -0.23858547E-02 -0.48038983E 00      1.23070908
-0.23859E-02-0.48039E C0 0.12307E C1
 64  37  47  48       6.83332539       0.09999985
 0.55377865E 00 -0.11932373E-01 -0.53280830E-01  0.55875289E 00 -0.16906619E-01    -84.67230225
0.55875E CC-0.16907E-01-C.84672E C2
 65  38  37  48       6.16665936       0.29199964
 0.52308559E 00  0.52022934E-02  0.40723801E-01  0.52626818E 00  0.20197034E-02     85.53739929
0.52627E CC 0.20197E-02 0.85537E C2
 66  38  48  49       6.83332539       0.48399931
 0.48774910E 00  0.25939941E-03 -0.57051659E-01  0.49433684E 00 -0.63283443E-02    -83.41923523
0.49434E 00-0.63283E-02-0.83419E 02
 67  38  49  50       6.83332539       0.81733197
 0.46399212E 00 -0.78941345E-01 -0.23706627E 00  0.55293423E 00 -0.16788346E 00    -69.44003296
0.55293E CC-0.16788E C0-C.69440E 02
 68  39  38  50       6.16665936       1.22533035
 0.42923164E 00 -0.45734406E-01 -0.19396591E 00  0.49837685E 00 -0.11487961E 00    -70.38490295
0.49838E 00-0.11488E 00-0.70385E C2
 69  39  50  51       6.83332539       1.86666393
 0.37013721E 00 -0.11011887E 00 -0.26227075E 00  0.48560357E 00 -0.22558522E 00    -66.24299622
0.48560E C0-0.22559E C0-0.66243E 02
 70  40  39  51       6.16665936       2.49999619
 0.32908821E 00 -0.67096710E-01 -0.20835304E 00  0.41848755E 00 -0.15649605E 00    -66.78179932
0.41849E CC-0.15650E 00-0.66782E 02
 71  40  51  52       6.83332539       3.23332882
 0.24559021E 00 -0.13640690E 00 -0.28620636E 00  0.39867663E 00 -0.28949332E 00    -61.86299133
0.39868E 00-0.28949E 00-0.61863E 02
 72  41  40  52       6.16665936       4.03332806
 0.18230247E 00 -0.85690856E-01 -0.21885777E 00  0.3C492568E 00 -0.20831406E 00    -60.74302673
0.3C493E 00-0.20831E 00-0.60743E 02
 73  41  52  53       6.83332539       4.96666050
 0.77270865E-01 -0.17383480E 00 -0.29890257E 00  0.27591884E 00 -0.37248278E 00    -56.39643860
0.27592E 0C-0.37248E 00-0.56396E 02
 74  42  41  53       6.16665936       5.99998760
-0.38133621E-01 -0.10096562E C0 -C.22272682E 00  0.15538192E 00 -0.24448116E 00    -49.01792908
0.15538E C0-0.29448E 00-0.49018E 02
 75  42  53  54       6.83332539       7.03332138
-0.15131712E 00 -0.22161961E 00 -0.29778731E 00  0.11338627E 00 -0.48632300E 00    -48.36956787
0.11339E C0-0.48632E 00-0.48370E 02
 76  43  42  54       6.16665936       7.96665478
-0.23924160E 00 -0.10472566E 00 -0.21426201E 00  0.52586734E-01 -0.39655393E 00    -36.28898621
0.52587E-01-0.39655E C0-0.36289E C2
 77  43  54  55       6.83332539       8.76665211
-0.32438278E 00 -0.24406433E 00 -0.27581131E 00 -0.55040717E-02 -0.56294304E 00    -40.86083984
-0.55041E-02-0.56294E C0-0.40861E C2
 78  44  43  55       6.16665936       9.49998379
-0.36696416E 00 -0.10451156E 00 -0.20065403E 00  0.40169358E-02 -0.47549266E 00    -28.40986633
0.4C169E-02-0.47549E C0-0.28410E 02
 79  44  55  56       6.83332539      10.13331890
```

-0.465692S2E 00 -0.295241J6E 00 -0.27065772E 00 -0.96708357E-01 -0.66422552E 00 -36.26345825
-0.96708E-01-0.66423E 00-0.36263E 02
80 45 44 56 6.16665936 10.77465057
-0.47585058E 00 -0.10120952E 00 -0.18102074E 00 -0.28035462E-01 -0.54902464E 00 -22.01165771
-0.28035E-01-0.54902E 00-0.22012E 02
81 45 56 57 6.83332539 11.18264961
-0.56311131E 00 -0.296173I0E 00 -0.23726845E 00 -0.15741020E 00 -0.70187420E 00 -30.32281494
-0.15741E 00-0.70187E 00-0.30323E 02
82 45 57 58 6.83332539 11.51598263
-0.48052502E 00 -0.20874023E-01 -0.46713829E-01 -0.16174614E-01 -0.48522443E 00 -5.74504757
-0.16175E-01-0.48522E 00-0.57450E 01
83 46 45 58 6.16665936 11.70798397
-0.49590778E 00 -0.61963797E-02 0.94470978E-02 -0.60142875E-02 -0.49608988E 00 1.10431671
-0.60143E-02-0.49609E 00 0.11043E 01
84 46 58 59 6.83332539 11.89998531
-0.50876141E 00 0.17547607E-01 -0.42290688E-01 0.20924091E-01 -0.51213789E 00 -4.56513786
0.20924E-01-0.51214E 00-0.45651E 01
85 48 47 60 8.16665649 0.09999985
0.58201313E 00 -0.34646988E-02 0.49120903E-01 0.58610564E 00 -0.75572133E-02 85.24351501
0.58611E 00-0.75572E-02 0.85244E 02
86 48 60 61 8.83332253 0.29199964
0.54626560E 00 -0.31013489E-02 -0.45808554E-01 0.55005890E 00 -0.68946481E-02 -85.27220154
0.55006E 00-0.68946E-02-0.85272E 02
87 49 48 61 8.16665649 0.48399931
0.51786613E 00 0.92706680E-02 0.46133041E-01 0.52201670E 00 0.51200986E-02 84.86499023
0.52202E 00 0.51201E-02 0.84865E 02
88 50 49 61 8.16665649 0.81733161
0.49411583E 00 -0.65907188E-01 -0.13388443E 00 0.52428293E 00 -0.10007429E 00 -77.30767822
0.52428E 00-0.10007E 00-0.77308E 02
89 50 61 62 8.83332253 1.22533035
0.45482349E 00 -0.75692177E-01 -0.17450166E 00 0.50707549E 00 -0.12794417E 00 -73.33576965
0.50708E 00-0.12794E 00-0.73336E 02
90 51 50 62 8.16665649 1.86666393
0.43312359E 00 -0.91225147E-01 -0.14633250E 00 0.47119659E 00 -0.12929815E 00 -75.42147827
0.47120E 00-0.12930E 00-0.75421E 02
91 51 62 63 8.83332253 2.49999619
0.34441090E 00 -0.14113998E 00 -0.23385936E 00 0.43872601E 00 -0.23545510E 00 -68.04077148
0.43873E 00-0.23546E 00-0.68041E 02
92 52 51 63 8.16665649 3.23332882
0.28432846E 00 -0.12478906E 00 -0.16440058E 00 0.34220403E 00 -0.18266469E 00 -70.61097717
0.34220E 00-0.18266E 00-0.70611E 02
93 52 63 64 8.83332253 4.03332806
0.18258268E 00 -0.17981339E 00 -0.25355417E 00 0.31302923E 00 -0.31025994E 00 -62.77993774
0.31303E 00-0.31026E 00-0.62780E 02
94 53 52 64 8.16665649 4.96666050
0.78899384E-01 -0.17334950E 00 -0.16643333E 00 0.16159880E 00 -0.25604892E 00 -63.58219910
0.16160E 00-0.25605E 00-0.63582E 02
95 53 64 65 8.83332253 5.99998760
-0.36502063E-01 -0.31925964E 00 -0.24300689E 00 0.10326022E 00 -0.45902187E 00 -60.09957886
0.10326E 00-0.45902E 00-0.60100E 02
96 54 53 65 8.16665649 7.03332138
-0.13790703E 00 -0.21760315E 00 -0.17614239E 00 0.28383732E-02 -0.35834849E 00 -51.37736511
0.28384E-02-0.35835E 00-0.51377E 02
97 54 65 66 8.83332253 7.96665478
-0.27061307E 00 -0.41732502E 00 -0.26962477E 00 -0.64543784E-01 -0.62339431E 00 -52.61376953
-0.64544E-01-0.62339E 00-0.52614E 02
98 55 54 66 8.16665649 8.76665211
-0.35178852E 00 -0.25229204E 00 -0.16925830E 00 -0.12562245E 00 -0.47845811E 00 -36.81315613
-0.12562E 00-0.47846E 00-0.36813E 02
99 55 66 67 8.83332253 9.49998379

-0.29864266E 00 -0.3949546BE 00 -0.19190407E 00 -0.20488578E 00 -0.58871156E 00 -44.72801208
-0.2C489E CC-0.58871E C0-0.44728E 02
100 56 55 67 8.16665649 10.13331890
-0.41077590E 00 -0.27877402E 00 -0.15500528E 00 -0.17630315E 00 -0.51324677E 00 -33.47033691
-0.1763CE CC-0.51325E C0-0.33470E 02
101 56 67 68 8.83332253 10.77465057
-0.5476867CE 00 -0.65512276E 00 -0.22696167E 00 -0.36817259E 00 -0.83463675E 00 -51.66172791
-0.36817E CC-0.83464E C0-0.51662E 02
102 57 56 68 8.16665649 11.18264961
-0.54319966E 00 -0.29020959E 00 -0.16364700E 00 -0.20986813E 00 -0.62354106E 00 -26.15036011
-0.2C987E CC-0.62354E C0-0.26150E 02
103 58 57 68 8.16665649 11.51598263
-0.46066713E 00 -0.14897704E-01 0.26925862E-01 -0.13277233E-01 -0.46228760E 00 3.44431496
-0.13277E-01-0.46229E C0 0.34443E C1
104 58 68 69 8.83332253 11.70798397
-0.52260590E 00 -0.14177322E-01 -0.15244240E 00 0.28026164E-01 -0.56480938E 00 -15.47581100
0.28C26E-01-0.56481E C0-0.15476E C2
105 59 58 69 8.16665649 11.89998531
-0.58953661E 00 -0.66710114E-02 0.30168295E-01 -C.51138401E-02 -0.5910937BE 00 2.95498276
-0.51138E-02-0.59109E C0 0.29550E 01
106 60 89 90 10.83332062 0.09999985
0.58773232E 00 -0.43764114E-02 -0.25846481E-01 C.58885825E 0C -0.55023432E-02 -87.51162720
0.58886E 00-0.55023E-02-0.87512E 02
107 61 60 90 10.16665459 0.29199964
0.56372929E 00 0.21368861F-02 0.42563319E-01 C.56693667E 0C -0.10705590E-02 85.69657698
0.56694E 00-0.10706E-02 0.85697E 02
108 61 90 91 10.83332062 0.48399931
0.53972536E 00 0.25907227E-02 -0.27294159E-01 0.54110950E 0C 0.16065240E-02 -87.10272217
0.54111E 00 0.16065E-02-0.87103E 02
109 61 91 92 10.83332062 0.81733197
0.55203533E 00 0.44022560E-01 -0.99822044E-01 0.57094580E 00 0.25112092F-01 -79.27857971
0.57095E CC 0.25112E-01-0.79279E 02
110 62 61 92 10.16665459 1.22533035
0.50784683E 00 -0.59785843E-01 -0.72288513E-01 C.516908C5E 00 -0.68847060E-01 -82.86 29761
0.51691E 00-0.68847E-01-0.82861E 02
111 62 92 93 10.83332062 1.69999695
0.513769I5E 00 0.41496277E-01 -0.10146672E 0C C.534646C9E 00 0.20619333E-01 -78.37921143
0.53465E 00 0.20619E-01-0.78379E 02
112 62 93 79 10.63331890 2.06666374
0.495033326E 00 -0.32159805E-01 -0.11219722E 00 0 51791757E 0C -0.55044115E-01 -78.47741699
0.51792E CC-0.55044E-01-0.78477E C2
113 62 79 70 10.29998589 2.33332920
0.50558662E 00 -0.13014030E C0 -0.13214016E 00 0.53195876E 00 -0.15651244E 00 -78.71905516
0.53196E CC-0.15651E C0-0.78719E 02
114 63 62 70 9.83332157 2.59999561
0.42761135E 00 -0.11617947E 00 -0.11421776E 00 C.45062739E 00 -0.13919550E 00 -78.61254883
0.45C63E 00-0.13920E C0-0.78613E 02
115 63 70 71 10.13331890 3.06666279
0.31061745E 00 -0.12120438E 00 -0.22487450E 00 0.40645325E 0C -0.2170401BE 00 -66.92240906
0.4C645E CC-0.21704E 00-C.66922E 02
116 63 71 72 10.09998417 3.29999542
0.30527687E 00 -0.13901138E 00 -0.23626995E 00 0.40743417E 00 -0.2411686BE 00 -66.62234497
0.4C743E 00-0.24117E 00-0.66622E 02
117 63 72 73 10.09998417 3.63332844
0.25433731E 00 -0.13406181E C0 -0.17606145E 0C C.32226574E 00 -0.20199025E 00 -68.90726760
0.32227E 00-0.20199E 00-0.68907E 02
118 63 73 64 9.79998684 4.09999466
0.84571183E-01 -0.2C921230E 00 -0.11229992E 00 C.12258059E 0C -0.24722171E 00 -71.30606079
0.12258E 00-0.24722E 00-0.71306E 02
119 64 73 74 10.09998417 5.03332710

```
 0.865808736-01 -0.27719021E C0 -0.12211132E C0  0.12376952E 00 -0.31437886E 00    -73.06735229
0.12377E 00-0.31438E C0-0.73067E 02
120  65  64  74       9.79998684       5.99998760
-0.16746521E-01 -C.3133382AE 00 -0.8933639?E-01  C.80836415E-02 -0.33816844E 00    -74.47261047
0.8C836E-02-0.33817E 00-0.74473E 02
121  65  74  75      10.09998417       6.96665668
-0.11834365E 00 -0.48058987E 00 -0.17303437E 00 -C.48974335E-01 -0.549959?2E 00    -68.15913391
-0.48974E-01-0.54996E 00-0.68159E C2
122  66  65  75       9.79998684       7.89998913
-0.185110C9E 00 -0.36168060E C0 -0.15888691E 00 -0.98888397E-01 -0.47790229E 00    -61.51751709
-0.98888E-01-0.47790E 00-0.61518E C2
123  66  75  76      10.09998417       8.36665344
-0.350596C9E 00 -0.61320305E 00 -0.27999401E 00 -C.2C059371E 00 -0.80320477E 00    -55.843505H6
-0.2C059E CC-0.80320E C0-0.55844E 02
124  66  76  77      10.09998417       8.69998169
-0.40918054E 00 -0.5705804AE 00 -0.31121492E 00 -0.16837259E 00 -0.81138813E 00    -52.27229309
-0.16837E CC-0.81139E C0-0.52272E C2
125  66  77  78      10.13331890       8.93331909
-0.41021633E 00 -0.574020395 00 -0.28842926E 00 -C.19228625E CC -0.79195046E 00    -52.93003645
-0.19229E CC-0.7919SE C0-0.52930E 02
126  66  78  67       9.83332157       9.39998245
-0.562128?2E 00 -0.443986B9E 00 -0.12558752E 00 -0.364271346 00 -0.641843?2E 00    -32.40733337
-0.36427E CC-0.64184E C0-0.32407E C2
127  67  78  88      10.29998589       9.66664982
-0.74426A60E 00 -0.5C7066?3E 00 -0.19423813E 00 -0.39808327E 00 -0.85325187E 00    -29.29812622
-0.35808E CC-0.85325E C0-0.29298E C2
128  67  88  98      10.63331890       9.93331718
-0.800695?8E 00 -0.45112777E 00 -0.25007004E 00 -0.32081437E 00 -0.93100905E 00    -27.52636719
-0.32081E 00-0.9310IE C0-0.27526E 02
129  67  98  99      10.83332062      10.29998589
-0.80274165E 00 -0.4C990251F 00 -0.30612999E 00 -0.24259645E 0C -0.97004718E 00    -28.65956116
-0.24260E C0-0.97005E 00-C.28660E C2
130  68  67  99      10.16665459      10.77465057
-0.10507431E 01 -0.8C606335E 00 -0.67378461E-01 -C.788735?1E 00 -0.10680695E 01    -14.42315006
-0.78874E C0-0.10681E 01-0.14423E 02
131  68  99 100      10.83332062      11.18264961
-0.12192936E 01 -0.525501C6E C0 -C.296857CCE C0 -C.42460895E 0C -0.133C1849E 01    -20.46487654
-0.42461E CC-0.13302E 01-0.20485E 02
132  68 100 101      10.83332062      11.51598263
-0.10928450E 01 -C.11400807E 00 -0.32727528E 00 -C.14665544E-01 -0.119218?3E 01    -16.88659668
-0.14666E-01-0.11922E 01-0.16887E 02
133  69  68 101      10.16665459      11.70798397
-0.12804174E 01 -0.24150926E CC  0.10915953E 00 -0.23016351E 00 -0.129176?4E 01     5.93429565
-0.23016E CC-0.12918E 01 0.59343E C1
134  69 101 102      10.83332062      11.89998531
-0.145C7761E 01 -0.24652827E C0 -0.33865935E 00 -0.157824?6E 00 -0.15394793E 01    -14.67867279
-0.15782E 0C-0.15395E 01-0.14679E 02
135  79  93  94      11.29998493       2.29999638
 0.51701164E 00  0.555693?9E-01 -0.92799187E-01  C.535120496 00  0.41460514E-01    -78.96382141
0.53512E CC 0.41461E-01-0.78964E 02
136  79  94  95      11.29998493       2.63332939
 0.516434?7E 00  0.346117?2E-01 -0.10773194E 00  C.539425493 00  0.11620879E-01    -77.95893860
0.53943E CC 0.11621E-01-0.77559E C2
137  79  95  80      11.19998360       2.83332920
 0.829172136 00  0.174613?5E 00 -0.23450164E 00  0.90451276E 00  0.99273324E-01    -72.19410706
0.9C451E CC 0.99273E-01-C.72194E C2
138  70  79  80      10.86665058       2.76666260
 0.45238876E 00 -0.93107224E-02 -0.11319351E 00  C.47864664E 0C -0.35568595E-01    -76.94543457
0.47865E CC-0.35569E-01-0.76945E C2
139  70  80  81      10.91664886       3.06666183
```

```
 0.67546654E 00  0.84881783E-01 -0.29969120E 00  0.80092249E 00 -0.40554166E-01    -67.29312134
0.8C090E CC-0.40554E-01-C.67293E C2
140  71  70  81      10.64998150       3.C9999561
 0.223240768 00 -0.6E881035E-01 -0.14751911E 00  0.37254C30E 00 -0.11818C57E 00    -71.52601624
0.37254E CC-0.11818E C0-C.71526E 02
141  72  71  81      10.61664581       3.33332920
 0.30661201E 00 -0.13862514E 00 -0.15463R29E 00  0.3C5C50A2E 00 -0.187063758 00    -72.61270142
0.3E505E CC-0.18706E C0-0.72613E C2
142  72  81  82      10.81665325       3.49999523
 0.246304516 00 -0.25210381E-01 -0.26103497E 00  0.4C4773596 00 -0.18367946C 00    -58.74311829
0.4C477E CC-0.1836BE C0-C.58743E 02
143  73  72  82      10.59998322       3.74999542
 0.39763451E-01 -0.19R44437E 00 -0.6C737092E-01  C.5434227CE-01 -0.213023196 00    -76.55164775
0.54342E-01-0.21302E C0-0.76502E 02
144  73  82  83      10.79998493       4.26666069
 0.885378916-01 -C.244590765 00 -0.5C906599E-01  C.961435446-01 -0.252196256 00    -81.50865173
0.96144E-01-0.25220E 00-0.91509E 02
145  74  73  83      10.59998322       5.03332710
-0.32471657E-01 -C.31291676E CC -0.150680546-02  C.32463670E-01 -0.312924746 00    -89.69871521
-0.32464E-01-0.31292E 00-0.89699E C2
146  74  83  84      10.79998493       5.99998760
 0.593222C0E-02 -C.354777306 00 -C.56269586E-01  C.1761C073E-01 -0.4024550? 00    -82.23603821
0.17610E-01-0.40246E C0-0.92236E C2
147  75  74  84      10.59998322       6.96665668
 0.22C29877E-03 -0.44502831E 00 -0.22738457E-01  0.13784766E-02 -0.446186488 00    -87.C9042358
0.13785E-02-0.44619E 00-0.87C90E 02
148  75  84  85      10.79998493       7.73332310
-0.10809779E 00 -0.67242718E 00 -0.12744731E 00 -C.8065C330E-01 -0.699874646 00    -77.85188293
-0.8C65CE-01-0.69987E C0-0.77852E C2
149  76  75  85      10.59998322       8.19998169
-0.675339516-01 -0.52231884E 00 -0.16371059E 00 -C.327855946-01 -0.577067206 00    -71.51416016
-0.32786E-01-0.57707E C0-0.71514E 02
150  76  85  86      10.81664753       8.49998474
-0.46026891E 00 -0.10788546E 01 -0.46992087E 00 -0.20698899E 00 -0.133213336 01    -61.66052673
-0.2C699E CC-0.13321E 01-0.61681E C2
151  77  76  86      10.61664581       8.66665173
-0.474740036 00 -0.59031105E 00 -0.32136703E 00 -C.206C0474E 0C -0.859046346 00    -50.13040283
-0.2C60CE CC-0.85905E C0-0.5C10CE 02
152  78  77  86      10.64998150       8.89998341
-0.46204776E 00 -0.58344954E 00 -0.2?4350150E 00 -0.223035876 0C -0.822461076 00    -50.84619141
-0.22304E CC-0.82246E C0-0.50846E 02
153  78  86  87      10.91664886       8.93331909
-0.938812C8E 00 -0.10421352E 01 -0.55751729E 00 -0.43056756E 00 -0.155C37886 01    -47.65054321
-0.43057E CC-0.15504E C1-0.47651E C2
154  78  87  88      10.86665058       9.23331642
-0.541176746 00 -0.42590427E C0 -0.27375901E 00 -0.2C378C17E 00 -0.763300786 00    -39.05822754
-0.20378E 00-0.76330E C0-0.39058E 02
155  88  87  96      11.19998369       9.16665C77
-0.930436076 00 -C.717180496 00 -0.541282C7E 0C -C.3C7127696 00 -0.140048796 01    -40.97414739
-0.3C713E C0-0.14005E 01-0.40974E 02
156  88  96  97      11.29998493       9.36665249
-0.68783596E 00 -C.185509866 C0 -C.30768573E 00 -C.394911776-01 -0.833854686 00    -25.38951111
-0.39491E-01-0.83385E 00-0.25390E 02
157  88  97  98      11.29998493       9.69998550
-0.71529591E 00 -C.2E362525E C0 -C.30893248E 00 -C.122599726 00 -0.876321436 00    -27.53198242
-0.12260E CC-0.87632E 00-0.27532E C2
158  90  89 103      12.16665268       0.09999985
 0.59145832E 00 -0.32633543E-02  0.25293231E-01  0.59253198E 00 -0.43370128E-02     87.57545471
0.59253E CC-0.43370E-02 0.87575E 02
159  90 103 104      12.83331871       0.29199964
```

```
 0.573311816 00 -0.743865976-04 -0.250996356-01  0.574406296 00 -0.117087366-02    -87.50463867
0.57441E CC-0.11709E-02-0.87505E 02
160  91  90 104      12.16665268       0.48399931
 0.558756116 00  0.869655616-02  0.240155466-01  0.559797536 00  0.765013696-02     87.51113892
0.55980E CC 0.76501E-02 0.87511E C2
161  92  91 104      12.16665268       0.81733161
 0.571072586 00  0.467301226-01 -0.485138306-01  0.575548476 00  0.452541716-01    -84.73477173
0.57555E CC 0.45254E-01-0.84735E 02
162  92 104 105      12.83331871       1.12533092
 0.544827226 00  0.458698276-01 -0.756365066-01  0.556040706 00  0.346563466-01    -81.57286672
0.55604E CC 0.34656E-01-0.81573E 02
163  93  92 105      12.16665268       1.59999752
 0.545647626 00  0.510569216-01 -0.728349096-01  0.556156386 00  0.405541066-01    -81.80041504
0.55615E CC 0.40554E-01-0.81800E 02
164  93 105 106      12.83331871       1.96666336
 0.545718136 00  0.352573336-01 -0.666995646-01  0.554289406 00  0.266860136-01    -82.66321228
0.55429E CC 0.26686E-01-0.82683E 02
165  94  93 106      12.16665268       2.29999638
 0.570035936 00  0.754690176-01 -0.938138376-01  0.587233256 00  0.582717066-01    -79.61798046
0.58723E 00 0.58272E-01-0.79618E 02
166  94 106 107      12.83331871       2.63332939
 0.561602776 00  0.263500216-01 -0.442171436-01  0.565236856 00  0.227218876-01    -85.31536865
0.56523E 00 0.22722E-01-0.85315E 02
167  95  94 107      12.16665268       2.83332920
 0.614900596 00  0.641407376-01 -0.113511156 00  0.637377686 00  0.416635876-01    -76.80506897
0.63738E 00 0.41664E-01-0.78805E 02
168  97  96 108      12.16665268       9.16665554
-0.782284746 00 -0.213838826 00 -0.845761366-01 -0.201522176 00 -0.794601386 00     -8.28627532
-0.20152E 00-0.79460E 00-0.82862E 01
169  97 108 109      12.83331871       9.36665249
-0.718160876 00 -0.233469156-01 -0.563853386-01 -0.188C0974E-01 -0.722706796 00     -4.60969448
-0.18801E-01-0.72271E C0-0.46097E 01
170  98  97 109      12.16665268       9.69998550
-0.823467756 00 -0.31C087206 00 -0.574797396-01 -0.303479256 00 -0.810075706 00     -6.55849075
-0.30348E C0-0.81008E C0-0.65585E 01
171  98 109 110      12.83331871      10.03331852
-0.733899466 00 -0.289249426-01 -0.762420896-01 -0.208299166-01 -0.746993426 00     -6.06113146
-0.20830E-01-0.74699E C0-0.60611E 01
172  99  98 110      12.16665268      10.39998627
-0.866031216 00 -0.427184406 00 -0.370395786-01 -0.424039786 00 -0.863456796 00     -4.85306835
-0.42404E CC-0.86346E C0-0.48531E 01
173  99 110 111      12.83331871      10.87465191
-0.754733446 00 -0.185136806-01 -0.902423866-01 -0.761365696-02 -0.765633466 00     -6.88766861
-0.76137E-02-0.76563E CC-0.68877E 01
174 100  99 111      12.16665268      11.18264961
-0.878179736 00 -0.433178316 00 -0.366766456-01 -0.430175486 00 -0.881182016 00     -4.66087006
-0.43018E CC-0.88118E C0-0.46809E C1
175 101 100 111      12.16665268      11.51598263
-0.751826826 00 -0.116586196-01 -0.671046816-01 -0.562369826-02 -0.757861266 00     -5.13895321
-0.56237E-02-0.75786E 00-0.51390E C1
176 101 111 112      12.83331871      11.70798397
-0.715858106 00  0.379276286-02  0.215360866-01  0.456154356-02 -0.716626886 00      1.87097645
0.45615E-02-0.71663E C0 0.18710E 01
177 102 101 112      12.16665268      11.89998531
-0.681104636 00 -0.156002046-01 -0.831342346-01 -0.537240516-02 -0.691334376 00     -7.01422405
-0.53724E-02-0.69133E 00-0.70142E C1
178 103 113 114      14.83331585       0.09999985
 0.601023266 00 -0.770282756-02 -0.351610186-01  0.603C64736 00 -0.972694166-02    -86.71141052
0.6C3052 CC-0.97269E-02-0.86711E 02
179 103 114 104      14.16664982       0.29199964
```

0.582152376 00 0.257778176-02 0.224449046-01 0.583C2CC9E 00 0.171C0573E-02 87.79196167
0.58302E CC 0.17101E-02 0.87792E 02
180 1C4 114 115 14.83331585 0.48399931
0.56314564E 00 0.6E0R2809E-02 -0.35758257E-01 0.56543446E 0C 0.45194626E-02 -86.34375000
0.56543E CC 0.45195E-02-0.86344E 02
181 104 115 116 14.83331585 0.81733197
0.56721938E C0 0.2C3E6696E-01 -0.68252563E-01 0.57560939E C0 0.11996686E-01 -82.99790955
0.57561E CC 0.11997E-01-0.82998E 02
182 105 104 116 14.16664982 1.12533092
0.53721142E 00 0.43582439E-01 -0.32059371E-01 0.53928477E 00 0.41509092E-01 -86.30587769
0.53928E 0C 0.41509E-01-0.86306E 02
183 105 116 117 14.83331585 1.59999752
0.52492124E 00 0.2C585179E-01 -0.54368082E-01 0.53071541E 00 0.14790952E-01 -83.92268372
0.53072E 0C 0.14791E-01-0.83923E 02
184 1C6 105 117 14.16664982 1.96666336
0.505559926 00 0.23206592E-01 -0.22958219E-01 0.5C665015E G0 0.22116363E-01 -87.28747559
0.50665E CC 0.22116E-01-0.87287E 02
185 106 117 118 14.83331585 2.36666298
0.494726125 00 0.14701486E-01 -0.39923027E-01 0.49802375E 00 0.11403799E-01 -85.28422546
0.49802E CC 0.11404E-01-0.85284E 02
186 107 106 118 14.16664982 2.69999599
0.474417696 00 0.18757582E-03 0.31750798E-02 0.47443885E 0C 0.16635656E-03 89.62797058
0.47444E CC 0.16626E-03 0.89623E 02
187 107 118 119 14.83331585 2.89999580
0.464058526 00 0.94095001E-02 -0.30301154E-01 0.46606469E 00 0.6403327CE-02 -86.21827698
0.46606E CC 0.64033E-02-0.86218E 02
188 108 120 121 14.83331585 9.09998512
-0.622178086 00 -0.23612976E-01 -0.33087730E-01 -0.21789670E-01 -0.624C0138E 00 -3.15433693
-0.21790E-01-0.6240CE C0-0.31543E C1
189 109 108 121 14.16664982 9.29998207
-0.632415776 00 0.23969412E-02 0.13109267E-01 0.26674271E-02 -0.63268626E 00 1.18211269
0.26674E-02-0.63269E 00 0.11821E 01
190 109 121 122 14.83331585 9.63331985
-0.666414266 00 -0.17066956E-01 -0.62714934E-01 -0.11065423E-01 -0.67241579E 00 -5.46669674
-0.11065E-01-0.67242E 00-0.54667E C1
191 110 109 122 14.16664982 10.03331852
-0.679269796 00 -0.11022270E-01 -0.34261882E-01 -0.92702508E-02 -0.68102175E 00 -2.92754745
-0.92703E-02-0.68102E 00-0.29275E 01
192 110 122 123 14.83331585 10.39998627
-0.714735036 00 0.20399094E-02 -0.94976127E-01 0.14411151E-01 -0.72710627E 00 -7.42189693
0.14411E-01-0.72711E 00-0.74219E 01
193 111 110 123 14.16664982 10.87465191
-0.717C0764E 00 -0.71806312E-02 -0.96813202E-01 0.57867765E-02 -0.72997499E 00 -7.62949562
0.57868E-02-0.72997E 00-0.76295E 01
194 111 123 124 14.83331585 11.18264961
-0.73C7747CE 00 0.24882317E-01 -0.11746001E 00 0.427193C5E-01 -0.74861163E 00 -8.63536263
0.42719E-01-0.74861E C0-0.86354E C1
195 111 124 125 14.83331585 11.51598263
-0.739185335 00 -0.31538010E-02 -0.19503593E-01 -0.26374459E-02 -0.73970169E 00 -1.51665497
-0.26374E-02-0.73970E 00-0.15167E 01
196 112 111 125 14.16664982 11.70798397
-0.734260566 00 -0.17065406E-02 -0.32726586E-01 -0.24753809E-03 -0.73571950E 00 -2.55283165
-0.24754E-03-0.73572E 00-0.25528E 01
197 112 125 126 14.83331585 11.89998531
-0.725442896 00 0.93498230E-02 -0.17741382E-01 0.97777843E-02 -0.72587085E 00 -1.38193321
0.97778E-02-0.72587E C0-0.13819E C1
198 114 113 127 16.16664124 0.09999985
0.618607526 00 -0.24338365E-02 0.32522179E-01 0.62030590E 00 -0.41322708E-02 87.01681519
0.62031E CC-0.41323E-02 0.87017E 02
199 114 127 128 16.83331299 0.29199964

```
 0.58579302E 00 -0.21438003E-02 -0.54553356E-01  0.59081191E 00 -0.71627498E-02    -84.74963379
0.55081E CC-0.71627E-02-0.84750E 02
200 115 114 128      16.16664124       0.48399931
 0.55781555E 00  0.52095056E-02  0.32069732E-01  0.55967027E 00  0.33547282E-02     86.69604492
0.55967E 0C 0.33547E-02 0.86696E 02
201 116 115 128      16.16664124       0.81733161
 0.56190872E 00  0.18787682E-01 -0.42453036E-03  0.56190890E 00  0.18787444E-01    -89.96177673
0.56191E CC 0.18787E-01-0.89962E 02
202 116 128 129      16.83331299       1.12533092
 0.49876302E 00 -0.47660530E-01 -0.55028949E-01  0.50424957E 00 -0.53147078E-01    -84.31219482
0.5C425E CC-0.53147E-01-0.84312E 02
203 117 116 129      16.16664124       1.59999752
 0.5C026989E 00  0.13186932E-01  0.96013881E-02  0.5C045902E 00  0.12997806E-01     88.87767029
0.5C046E CC 0.12998E-01 0.88878E 02
204 117 129 130      16.83331299       1.96666336
 0.46996778E 00 -0.28195798E-01 -0.22228308E-01  0.47C95758E 00 -0.29185593E-01    -87.45655823
0.47096E 00-0.29186E-01-0.87457E 02
205 118 117 130      16.16664124       2.36666298
 0.45732599E 00  0.34787059E-02  0.19244015E-01  0.45814043E 00  0.26642680E-02     87.56273315
0.45814E 00 0.26643E-02 0.87583E 02
206 118 130 131      16.83331299       2.69999599
 0.44427758E 00 -0.11910081E-01 -0.39C56316E-02  0.44431C96E 00 -0.11943519E-01    -89.51603699
0.44431E 00-0.11944E-01-0.89516E 02
207 119 118 131      16.16664124       2.89999580
 0.4363C201E 00  0.76413155E-04  0.26128590E-01  0.43786138E 00 -0.14830232E-02     86.59074402
0.43786E 00-0.14830E-02 0.86591E 02
208 121 120 132      16.16664124       9.09998512
-0.48764610E 00  0.167760B5E-01  0.12925446E-01  0.17106950E-01 -0.48797697E 00      1.46644306
0.17107E-01-0.48798E CO 0.14664E 01
209 121 132 133      16.83331299       9.29998207
-0.52305984E 00 -0.9C227127E-02 -0.62018275E-01 -0.16462803E-02 -0.53043628E 00     -6.78337097
-0.16463E-02-0.53044E CO-0.67834E C1
210 122 121 133      16.16664124       9.63331509
-0.53083038E 00  0.236282355-01 -0.1741302CE-01  0.24174511E-01 -C.53137666E 00     -1.79701042
0.24175E-01-0.53138E CO-0.17970E 01
211 122 133 134      16.83331299      10.03331852
-0.58792305E 00 -0.25711060E-02 -0.11670405E 00  0.19838572E-01 -0.61033273E 00    -10.87056056
0.19839E-01-0.61033E CC-0.10871E C2
212 123 122 134      16.16664124      10.39998627
-0.61835670E 00  0.3C969083E-01 -0.56245744E-01  0.35805166E-01 -0.623192735 00     -4.91463757
0.35805E-01-0.62319E CO-0.49146E 01
213 123 134 135      16.83331299      10.87465191
-0.64922762E 00  0.16880989E-01 -0.16317838E 00  0.54707110E-01 -0.687053745 00    -13.05209064
0.54707E-01-0.68705E CO-0.13052E 02
214 124 123 135      16.16664124      11.18264961
-0.71681118E 00  0.25CA7782E-01 -0.89210749E-01  0.396090755-01 -0.72733247E 00     -6.72674084
0.39609E-01-0.72733E 00-0.67267E 01
215 125 124 135      16.16664124      11.51598263
-0.72533321E 00  0.1C488629E-02  0.87538362E-02  0.11542439E-02 -0.725438545 00      0.68975908
0.11542E-02-0.72544E CO 0.68976E 00
216 125 135 136      16.83331299      11.70758397
-0.74650002E 00  0.340557105-02 -0.54627419E-01  0.7363975CE-02 -0.750458425 00     -4.14481831
0.73640E-02-0.75046E 00-0.41448E 01
217 126 125 136      16.16664124      11.89998531
-0.77356339E 00 -C.5C553679E-02  0.1051265CE-01 -C.491160155-02 -0.773707C9E 00      0.78356645
-0.49116E-02-0.77371E 00 0.78356E 00
218 127 137 138      18.83329773       0.09999985
 0.63842601E 00  0.35161972E-02 -C.5772C184E-01  0.64363056E 00 -0.16884208E-02    -84.85366821
0.64363E CC-0.16884E-02-0.84854E 02
219 128 127 138      18.16664124       0.29199964
```

```
 0.59714216E 00  0.12585521E-02  0.50015926E-01  0.60131103E 00 -0.29103160E-02     85.24150085
0.60131E 00-0.29103E-02 0.85242E 02
220 128 138 139      18.83329773       0.48399931
 0.55172020E 00 -0.11593408E-01 -0.70037246E-01  0.56029129E 00 -0.20564556E-01    -83.02879333
0.56029E 00-0.20565E-01-0.83029E 02
221 128 139 140      18.83329773       0.81733197
 0.38337088E 00 -0.57316011E 00  0.52434266E-01  0.38623649E 00 -0.57602566E 00     86.87802124
0.38624E 00-0.57603E 00 0.86878E 02
222 129 128 140      18.16664124       1.12533092
 0.54037285E 00 -0.35178781E-01 -0.13775527E-01  0.54070216E 00 -0.35508096E-01    -88.63618489
0.54070E 00-0.35508E-01-0.88636E 02
223 129 140 141      18.83329773       1.59999752
 0.40735191E 00 -0.42183113E 00 -0.95682502E-01  0.41824967E 00 -0.43272889E 00    -83.50830076
0.41825E 00-0.43273E 00-0.83508E 02
224 130 129 141      18.16664124       1.96666336
 0.45781672E 00 -0.31844556E-01 -0.26686370E-01  0.45926672E 00 -0.33294618E-01    -86.89599609
0.45927E 00-0.33295E-01-0.86896E 02
225 130 141 142      18.83329773       2.29999638
 0.38574827E 00 -0.19920731E 00 -0.82024455E-01  0.39703220E 00 -0.21049124E 00    -82.17298889
0.39703E 00-0.21049E 00-0.82173E 02
226 131 130 142      18.16664124       2.63332939
 0.43273461E 00 -0.15379310E-01 -0.19892454E-01  0.43361592E 00 -0.16260624E-01    -87.46955872
0.43362E 00-0.16261E-01-0.87470E 02
227 131 142 143      18.83329773       2.83332920
 0.34660816E 00 -0.18169975E 00 -0.91861784E-01  0.36212522E 00 -0.19721681E 00    -80.41809082
0.36213E 00-0.19722E 00-0.80418E 02
228 132 144 145      18.83329773       9.16665554
-0.27979088E 00  0.77949524E-01 -0.13453865E 00  0.12289882E 00 -0.32474017E 00    -18.47578430
0.12290E 00-0.32474E 00-0.18476E 02
229 133 132 145      18.16664124       9.36665249
-0.37528324E 00  0.35324097E-01 -0.87034702E-03  0.35325885E-01 -0.37528503E 00     -0.11772341
0.35326E-01-0.37529E 00-0.11772E 00
230 133 145 146      18.83329773       9.69998550
-0.39189243E 00  0.47843933E-01 -0.16373694E 00  0.10211390E 00 -0.44616240E 00    -18.33891296
0.10211E 00-0.44616E 00-0.18339E 02
231 134 133 146      18.16664124      10.03331852
-0.45034599E 00  0.38716316E-01 -0.53058565E-01  0.44406414E-01 -0.45603609E 00     -6.12155533
0.44406E-01-0.45604E 00-0.61216E 01
232 134 146 147      18.83329773      10.39998627
-0.53709602E 00  0.11134148E 00 -0.21691507E 00  0.17721236E 00 -0.60296690E 00    -16.89326477
0.17721E 00-0.60297E 00-0.16893E 02
233 135 134 147      18.16664124      10.87465191
-0.59339046E 00  0.33649445E-01 -0.82776904E-01  0.44392765E-01 -0.60413378E 00     -7.39542103
0.44393E-01-0.60413E 00-0.73954E 01
234 135 147 148      18.83329773      11.18264961
-0.68416309E 00  0.12597847E 00 -0.19642460E 00  0.17109084E 00 -0.72927547E 00    -12.93562412
0.17109E 00-0.72928E 00-0.12936E 02
235 135 148 149      18.83329773      11.51598263
-0.72349739E 00 -0.51345825E-02 -0.80982208E-01  0.38813949E-02 -0.73251337E 00     -6.35320091
0.38814E-02-0.73252E 00-0.63532E 01
236 136 135 149      18.16664124      11.70798397
-0.76713753E 00 -0.27599335E-02  0.46464741E-01  0.54121017E-04 -0.76995158E 00      3.46603775
0.54121E-04-0.76995E 00 0.34660E 01
237 136 149 150      18.83329773      11.89998531
-0.80901718E 00  0.15719414E-01 -0.78386486E-01  0.23103356E-01 -0.81640112E 00     -5.38172626
0.23103E-01-0.81640E 00-0.53817E 01
238 138 137 170      20.16664124       0.09999985
 0.13372545E 01  0.21315461E 00 -0.31182408E-01  0.13381176E 01  0.21229023E 00    -88.41870117
0.13381E 01 0.21229E 00-0.88419E 02
239 138 170 171      20.83329773       0.29199964
```

```
 0.13368750E 01  0.16314602E 00  0.50058365E-02  0.13368959E 01  0.16312492E 00     89.76220703
0.13365E 01 0.16312E 00 0.89762E 02
240 139 138 171      20.16664124       0.48399931
 0.13761225E 01  0.23532397E 00 -0.49240291E-01  0.13782425E 01  0.23320317E 00    -87.53944397
0.13782E 01 0.23320E 00-0.87539E 02
241 140 139 171      20.16664124       0.81733161
 0.12078133E 01 -0.32586789E 00  0.73235631E-01  0.12113018E 01 -0.32935685E 00     87.27868652
0.12113E 01-0.32936E 00 0.87279E 02
242 140 171 172      20.83329773       1.22533035
 0.84418756E 00 -0.47653157E 00 -0.28456241E 00  0.90289003E 00 -0.53523403E 00    -78.34959412
0.90289E 00-0.53523E 00-0.78350E 02
243 141 140 172      20.16664124       1.69999695
 0.70723546E 00 -0.33188456E 00 -0.14536679E-01  0.7C743841E 00 -0.33208758E 00    -89.20515442
0.7C744E 00-0.33209E 00-0.89205E 02
244 141 172 151      20.36663818       2.06666374
 0.57536411E 00 -0.67331314E 00 -0.14423102E 00  0.59180719E 00 -0.68975621E 00    -83.50212097
0.59181E 00-0.68976E 00-0.83502E 02
245 142 141 151      19.69996643       2.29999638
 0.41595376E 00 -0.18892747E 00 -0.10540485E 00  0.43768412E 00 -0.20665783E 00    -80.45727539
0.43768E 00-0.20666E 00-0.80457E 02
246 143 142 151      19.62996643       2.63332939
 0.43214493E 00 -0.15576696E 00 -0.9586525CE-01  0.44835716E 00 -0.17097920E 00    -80.98915100
0.44836E 00-0.17098E 00-0.80989E 02
247 143 151 152      19.79995728       2.83332920
 0.12471485E 00 -0.83743668E 00 -0.37302971E 00  0.25239569E 00 -0.96511781E 00    -71.11004639
0.25240E 00-0.96512E 00-0.71110E 02
248 152 151 161      20.13330078       2.76666260
 0.20762712E 00 -0.52995872E 00 -0.11077023E 00  0.22390336E 00 -0.54623491E 00    -81.64691162
0.22390E 00-0.54623E 00-0.81647E 02
249 152 161 153      20.08329773       3.06666183
-0.16339207E 00 -0.13036289E 01 -0.35389996E 00 -0.62481463E-01 -0.14045391E 01    -74.09046936
-0.62481E-01-0.14045E 01-0.74090E 02
250 153 161 162      20.34996033       3.09999561
-0.72630882E-01 -0.59214020E 00 -0.15906334E 00 -0.27798057E-01 -0.63697302E 00    -74.26457214
-0.27798E-01-0.63697E 00-0.74265E 02
251 153 162 163      20.38330078       3.33332920
-0.14546776E 00 -0.70504665E 00 -0.26598710E 00 -0.39211631E-01 -0.81130278E 00    -68.22930908
-0.39212E-01-0.81130E 00-0.68229E 02
252 154 153 163      20.18330383       3.49999523
-0.26962043E 00 -0.14540939E 01 -0.31039333E 00 -0.19226730E 00 -0.15304461E 01    -76.18591309
-0.19227E 00-0.15304E 01-0.76186E 02
253 154 163 164      20.39996338       3.79999542
-0.50679207E-01 -0.62936878E 00 -0.24447352E 00  0.38773596E-01 -0.71882159E 00    -69.90751648
0.38774E-01-0.71882E 00-0.69908E 02
254 155 154 164      20.19996643       4.26666069
 0.22877693E-01 -0.93654722E 00 -0.21430111E 00  0.68568826E-01 -0.98223829E 00    -77.96981812
0.68569E-01-0.98224E 00-0.77970E 02
255 155 164 165      20.39996338       5.03332710
-0.38094044E-01 -0.46211910E 00 -0.54C7691CE-01 -0.313C62C7E-01 -0.46890694E 00    -82.85151672
-0.31306E-01-0.46891E 00-0.82852E 02
256 156 155 165      20.19996643       5.99998760
 0.206213C0E-01 -0.3C792522E 00 -0.15698528E 00  0.83570540E-01 -0.37087446E 00    -68.15476990
0.83571E-01-0.37087E 00-0.68155E 02
257 156 165 166      20.39996338       6.96665668
-0.83614588E-02 -0.125335695 00 -0.34985542E-01  0.13036728E-02 -0.135CC082E 00    -74.56201172
0.13037E-02-0.13500E 00-0.74562E 02
258 157 156 166      20.19996643       7.73332310
-0.13723373E-01  0.21683979E 00 -0.15839195E 00  0.29746085E 00 -0.94344437E-01    -26.97793579
0.29746E 00-0.94344E-01-0.26978E 02
259 157 166 167      20.39996338       8.19998741
```

```
 0.26031494E-01  0.79817772E-01 -0.16921043E 00  0.22425878E 00 -0.11840951E 00    -40.48762512
0.22426E CC-0.11841E C0-0.4C488E C2
260 158 157 167      20.18330383       8.49998474
 0.16710788E 00  0.61787438E 00 -0.21093365E C0  0.70118284E 00  0.83799362E-01    -21.55316162
0.7C118E CC 0.83799E-01-0.21553E C2
261 158 167 168      20.38330078       8.66665173
 0.10255814E 00  0.16275692E 00 -0.17094421E 00  0.30623138E 00 -0.40916324E-01    -40.00985716
0.3C622E CC-0.40916E-01-0.4C010E 02
262 158 168 169      20.34996033       8.89998341
 0.62280655E-01  0.13604927E 00 -0.86179912E-01  0.19290620E 00  0.54237247E-02    -33.41716303
0.19291E CC 0.54237E-02-0.33417E C2
263 159 158 169      20.08329773       8.93331909
 0.16281796E 00  0.55605503E 00 -0.22599983E 00  0.69248509E 00  0.66387892E-01    -23.10876465
0.69245E CC 0.66388E-01-0.23109E C2
264 159 169 160      20.13330078       9.23331642
-0.10326290E 00  0.21119499E 00 -0.33114433E-01  0.21464425E 00 -0.10671216E 00     -5.94702516
0.21464E CC-0.10671E CC-0.59470E C1
265 144 159 160      19.79995728       9.16665077
 0.53752899E-01  0.41775131E 00 -0.19823986E 00  0.50486684E 00 -0.33362627E-01    -23.72459412
0.5C487E CC-0.33363E-01-0.23725E 02
266 145 144 160      19.69996643       9.36665249
-0.31099319E 00  0.6858348BE-01  0.16412735E-02  0.68590522E-01 -0.31100023E 00      0.24554604
0.68591E-01-0.31100E CC 0.24555E 00
267 146 145 160      19.69996643       9.69998550
-0.29570293E 00  0.76721191E-01 -0.29542923E-01  0.75050124E-01 -0.29803187E 00     -4.50775719
0.75050E-01-0.29803E 00-0.45078E 01
268 146 160 177      20.36663818       9.93331718
-0.42797005E 00  0.27060413E CO -0.81518173E-01  0.27999049E 00 -0.43735641E C0     -6.56883907
0.27999E 00-0.43736E 00-0.65688E 01
269 147 146 177      20.16664124      10.29998589
-0.48394394E 00  0.12731934E CO -0.24576962E-01  0.12830573E 00 -0.48493034E 00     -2.29850292
0.12831E 00-0.48493E 00-0.22985E 01
270 147 177 178      20.83329773      10.77465057
-0.59148699E C0  0.50599641E-01 -0.16450101E 00  0.9C668797E-01 -0.63115609E 00    -13.55892467
0.9C669E-01-0.63116E C0-0.13559E C2
271 148 147 178      20.16664124      11.18264961
-0.69317818E 00  0.12330246E C0 -0.43120146E-01  0.12557334E 00 -0.69544905E 00     -3.01465825
0.12557E CC-0.69545E 00-C.30149E 01
272 149 148 178      20.16664124      11.51598263
-0.73262978E 00 -0.78248978E-02  0.72343171E-01 -0.67490339E-03 -0.73977977E 00      5.64487553
-0.67490E-03-0.73978E G0 0.56449E 01
273 149 178 179      20.83329773      11.70798397
-0.78173923E 00  0.26226044E-02 -0.78229547E-01  0.10348797E-01 -0.78946543E 00     -5.64082813
0.10349E-01-0.78947E C0-0.56408E 01
274 150 149 179      20.16664124      11.89998531
-0.83812904E 00  0.70257187E-02  0.74038506E-01  0.13462663E-01 -0.84456599E C0      4.96919060
0.13463E-01-0.84457E C0 0.49692E 01
275 151 172 161      20.69996643       2.33332920
 0.55358505E 00 -0.69725037E 00 -0.16079217E 00  0.57392365E 00 -0.71758896E 00    -82.79692078
0.57392E 00-0.71759E C0-0.82797E 02
276 161 172 173      21.16664124       2.59999561
 0.27877027E 00 -0.43071938E 00 -0.16311836E 00  0.31447577E 00 -0.46642482E 00    -77.65872192
0.31448E CC-0.46642E C0-0.77659E 02
277 162 161 173      20.86663818       3.06666279
 0.12681741E 00 -0.61688173E 00 -0.44518113E-01  0.12947273E 00 -0.61953700E 00    -86.59281921
0.12947E CC-0.61954E C0-0.86593E C2
278 163 162 173      20.89996338       3.29999542
 0.12468064E 00 -0.62410921E 00 -0.12516999E 00  0.145C5023E 00 -0.64447874E 00    -80.76280212
0.14505E CC-0.64448E 00-0.80763E 02
279 164 163 173      20.89996338       3.63332844
```

-0.13028443E-01 -0.61820459E 00 -0.28625876E 00 0.1C0921C9E 00 -0.73215407E 00 -68.29919434
0.1C092E 00-0.73215E 00-0.68299E 02
280 164 173 174 21.19996643 4.09999466
-0.11178917E 00 -0.39031315E 00 -0.23196250E 00 0.19504666F-01 -0.52160692E 00 -60.49395752
0.19505E-01-0.52161E 00-0.60494E 02
281 165 164 174 20.89996338 5.03332710
0.47556877E-01 -0.42647671E 00 -0.29182249E 00 0.18466067E 00 -0.57358050E 00 -64.83964539
0.18466E 00-0.57358E 00-0.64840E 02
282 165 174 175 21.19996643 5.99998760
-0.14398694E-01 -0.23660374E 00 -0.22491330E 00 0.12535679E 00 -0.37635922E 00 -58.14840698
0.12536E 00-0.37636E 00-0.58148E 02
283 166 165 175 20.89996338 6.96665668
-0.41801453E-01 -0.13537979E 00 -0.25952625E 00 0.17511952E 00 -0.35230076E 00 -50.11358643
0.17512E 00-0.35230E 00-0.50114E 02
284 166 175 176 21.19996643 7.89998913
0.52004755E-01 -0.71526527E-01 -0.21CC1047E 00 0.2C9144C0E 00 -0.22866577E 00 -53.19837952
0.2C914E 00-0.22867E 00-0.53198E 02
285 167 166 176 20.89996338 8.36664867
-0.58485947E-02 0.69060326E-01 -0.24329185E 00 0.276076C8E 00 -0.21686435E 00 -40.39724731
0.27608E CC-0.21686E C0-0.4C397E 02
286 168 167 176 20.89996338 8.69998169
-0.58132133E-01 0.1C258579E 00 -0.13332653E 00 0.16910362E 00 -0.16464996E 00 -26.51696777
0.16910E 00-0.16465E C0-0.26517E C2
287 169 168 176 20.86663818 8.93331337
-0.95390201E-01 0.11174870E 00 -0.64489365E-01 0.13018537E 00 -0.11382687E 00 -15.95571423
0.13019E 00-0.11383E C0-0.15956E 02
288 169 176 177 21.16664124 9.39998245
-0.17896539E 00 -0.20294189E-02 -0.12813258E 00 0.65209150E-01 -0.24620390E 00 -27.690[illegible]1279
0.65209E-01-0.24620E C0-0.[illegible]7691E 02
289 160 169 177 20.69996643 9.66664982
-0.39335525E 00 0.18714619E 00 -0.12107694E 00 0.21138716E 00 -0.41759622E 00 -11.32240200
0.21139E 00-0.41760E C0-0.11322E 02
290 170 180 181 22.83329773 0.09999985
0.84622145E 00 -0.19725800E-01 -0.91073990E-01 0.855696[illegible]E 00 -0.29200554E-01 -84.06677246
0.85570E 00-0.29201E-01-0.84067E C2
291 171 170 181 22.16664124 0.29199964
0.8C073291E 00 0.229704[illegible]E-02 0.45782506E-01 0.8C334944E 00 -0.31954050E-03 86.73522949
0.8C335E C0-0.31954E-03 0.86735E 02
292 171 181 182 22.83329773 0.48399931
0.75158334E 00 0.18310547E-02 -0.95405698E-01 0.76353312E 00 -0.10118723E-01 -82.86671448
0.76353E 00-0.10119E-01-0.82867E 02
293 171 182 183 22.83329773 0.81733197
0.69110137E 00 -0.1[illegible]977188E C0 -0.30156136E 00 0.78358C66E 0C -0.29225063E 00 -72.95625305
0.78358E 00-0.29225E 00-0.72956E 02
294 172 171 183 22.16664124 1.22533035
0.51719171E 00 -0.57465583E 00 -0.18692046E 00 0.54830498E 0C -0.60576910E 00 -80.55541992
0.54830E CC-0.60577E 00-0.80555E 02
295 172 183 184 22.83329773 1.86666393
0.94330850E 00 -0.186573C3E C0 -0.29334295E 00 0.64658964E 00 -0.28985417E 00 -70.60879517
0.64659E CC-0.28985E 00-0.7C609E C2
296 173 172 184 22.16664124 2.49999619
0.33522087E 00 -0.41381544E 00 -0.11035138E 00 0.35113990E 00 -0.42973447E 00 -81.79718018
0.35114E CC-0.42973E C0-0.81797E C2
297 173 184 185 22.83329773 3.23332882
0.194824C4E C0 -0.172104P4E 00 -0.31391776E 00 0.3749575CE 0C -0.3522383CE 00 -60.19614319
0.37496E CC-0.35224E C0-0.6C156E C2
298 173 185 174 22.16664124 4.C3332806
0.11886466E 00 -0.32114410E 00 -0.26247185E 00 0.24134141E 00 -0.443620B6E 0C -64.98963928
0.24134E CC-0.44362E C0-0.64990E C2
299 174 185 186 22.83329773 4.96666C5C

```
 0.15910447E-01 -0.15483367E 00 -0.36283147E 00  0.30327821E 00 -0.44220138E 00    -51.62400818
0.3C328E CC-0.44220E C0-0.51624E 02
300 175 174 186      22.16664124       5.99998760
-0.18467903E-01 -0.23744554E 00 -0.33996660E 00  0.229C6715E 00 -0.4853RC59E 00    -53.94497681
0.229C7E CC-0.48538E C0-0.53945E 02
301 175 186 187      22.83329773       7.03332138
-0.36859334E-01 -0.12155533E 00 -0.35190225E 00  0.27523375E 00 -0.43364835E 00    -48.43450928
0.27523E CC-0.43365E C0-0.48435E 02
302 176 175 187      22.16664124       7.96665478
-0.14791489E 00 -0.13150883E 00 -0.26006722E 00  0.12048453E 00 -0.39990824E 00    -44.09989929
0.12049E CC-0.39991E 00-0.44100E 02
303 176 187 188      22.83329773       8.76665211
-0.16882676E 00 -0.91526031E-01 -0.28557156E 00  0.15799868E 00 -0.41835141E 00    -41.14709363
0.158C0E CC-0.41835E 00-0.41149E 02
304 177 176 188      22.16664124       9.49998379
-0.33807755E 00 -0.49756050E-01 -0.90811253E-01 -0.23537874E-01 -0.36429572E 00    -16.10516357
-0.23538E-01-0.36430E 00-0.16105E 02
305 177 188 189      22.83329773      10.13331890
-0.46355802E 00 -0.57635307E-01 -0.22737348E 00  0.44185221E-01 -0.56537849E 00    -24.12516785
0.44185E-01-0.5653RE 00-0.24125E 02
306 178 177 189      22.16664124      10.77465057
-0.56705666E 00  0.5E349609E-01 -0.20883560E-01  0.59045970E-01 -0.56775302E 00     -1.90395693
0.59046E-01-0.56775E 00-0.19100E 01
307 178 189 190      22.83329773      11.18264961
-0.75153267E 00 -0.14070511E-01 -0.2C323884E 00  0.38231194E-01 -0.80383438E 00    -14.43248081
0.38231E-01-0.80383E C0-0.14432E 02
308 178 190 191      22.83329773      11.51598263
-0.7488308CE 00 -0.5C649643E-02 -0.62750816E-01  0.19210577E-03 -0.754087875 00     -4.78922939
0.19211E-03-0.75409E 00-0.47892E 01
309 179 178 191      22.16664124      11.70798397
-0.79589462E 00 -0.15897751E-02  0.75449566E-01  0.55134256E-02 -0.80299783E 00     5.37d65257
0.55134E-02-0.803CCE C0 0.53787E 01
310 179 191 192      22.83329773      11.89998531
-0.84359550E 00  0.1C5762486-01 -0.6C160160E-01  0.14792442E-01 -0.84781170E 00     -4.00918484
0.14792E-01-0.84781E C0-0.4CC92E C1
311 181 180 193      24.16662598       0.09999985
 0.89012623E 00 -0.65700412E-02  0.84484041E-01  C.89801651E 00 -0.14460385E-01     84.67050171
0.85802E CC-0.1446CE-01 0.84671E 02
312 181 193 194      24.83329773       0.29199964
 0.82750320E 00 -0.486171255-02 -0.82520127E-01  0.83560526E 00 -0.12963772E-01    -84.39859009
0.83561E CC-0.12964E-01-0.84399E 02
313 182 181 194      24.16662598       0.48399931
 0.77456951E 00  0.872A6234E-02  0.81102014E-01  0.78306383E 00  0.23430586E-03     84.02688599
0.78306E CC 0.23431E-03 0.84027E 02
314 183 182 194      24.16662598       0.81733161
 0.71413136E 00 -0.19288611E 00 -0.12506151E 00  0.731059C7E 00 -0.20981383E 00    -82.29751587
0.73106E 00-0.20981E 00-0.82298E 02
315 183 194 195      24.83329773       1.22533035
 0.59861165E 00 -0.71377337E-01 -0.27031779E 00  0.69407380E 00 -0.16683948E 00    -70.55451965
0.69407E CC-0.16684E 00-0.70555E 02
316 184 183 195      24.16662598       1.86666393
 0.50338459E 00 -0.19856066E 00 -0.16911727E 00  C.542C0453E 00 -0.23718065E 0     -77.14198303
0.54200E 0C-0.23718E 00-0.77142E 02
317 184 195 196      24.83329773       2.49999619
 0.39618534E 00 -0.775975659-01 -C.31155908E 00  0.55060542E 00 -0.23241770E 00    -63.63989258
0.55061E CC-0.23242E C0-0.63640E 02
318 185 184 196      24.16662598       3.23332882
 0.30773288E 00 -0.13823897E 00 -0.22640097E 00  C.40252060E 00 -0.23302668E 00    -67.28715515
0.40252E 0C-0.23303E C0-0.67287E 02
319 185 196 197      24.83329773       4.03332806
```

```
 0.1722C08CE 00 -0.16167107E-01 -0.364099J2E 00  0.432711J2E 00 -0.33667773E 00    -54.42050171
0.43271E 00-0.33668E 00-0.54421E 02
320 186 185 197      24.16662598       4.96666050
 0.1C048801E 00 -0.12946457E 00 -0.30885381E 00  0.31507224E 00 -0.34404880E 00    -55.21336365
0.31507E 00-0.34405E 00-0.55213E 02
321 186 197 198      24.83329773       5.99998760
-0.20438313E-01 -0.68557084E-01 -0.38869506E 00  0.34494114E 00 -0.43393654E 00    -46.77438354
0.34494E 00-0.43394E 00-0.46774E 02
322 187 186 198      24.16662598       7.03332138
-0.14111710E 00 -0.15283448E 00 -0.30875623E 00  0.16183585E 00 -0.45578736E 00    -45.54684448
0.16184E 00-0.45579E 00-0.45547E 02
323 187 198 199      24.83329773       7.96665478
-0.19C34702E 00 -0.51502466E-01 -0.35863602E 00  0.24436855E 00 -0.48621798E 00    -39.52517700
0.24437E 00-0.48622E 00-0.39525E 02
324 188 187 199      24.16662598       8.76665211
-0.35285950E 00 -0.14673519E 00 -0.21728432E 00 -0.9309?667E-02 -0.49028492E 00    -32.31442261
-0.93098E-02-0.49028E 00-0.32314E 02
325 188 199 200      24.83329773       9.49998379
-0.40360671E 00 -0.3C739427E-01 -0.29669005E 00  0.17323021E 00 -0.56757629E 00    -28.92991638
0.13323E 00-0.56758E 00-0.28930E 02
326 189 188 200      24.16662598      10.13331890
-0.56500816E 00 -0.88061333E-01 -0.13067752E 00 -0.54604292E-01 -0.59846520E 00    -14.36186504
-0.54604E-01-0.59847E 00-0.14362E 02
327 189 200 201      24.83329773      10.77465057
-0.623570C2E 00 -0.10240316E-01 -0.25223577E 00  0.8C166817E-01 -0.71397710E 00    -19.7?C?9.14
0.8C167E-01-0.71398E 00-0.19720E 02
328 190 189 201      24.16662598      11.18264961
-0.78368855E 00 -0.23703575E-01 -0.84835112E-01 -C.14348865E-01 -0.79304326E 00     -6.29300594
-0.14349E-01-0.79304E 00-0.62930E 01
329 191 190 201      24.16662598      11.51598263
-0.78112411E 00 -C.14698982E-01  0.55671751E-01 -C.1C676265E-01 -0.7b514683E 00      4.13316253
-0.1C676E-01-0.78515E 00 0.41332E 01
330 191 201 202      24.83329773      11.70798397
-0.8138423CE 00  0.423534386-02 -0.54676779E-01  C.79780153E-02 -0.81747991E 00     -3.80657959
0.79730E-02-0.81748E 00-0.38066E 01
331 192 191 202      24.16662598      11.69998531
-0.855C579CE C0  C.6S227219E-02  0.5R321234E-01  C.108469725-01 -0.859822155 C0      3.84372954
0.1C847E-01-0.85982E C0 C.38497E C1
332 193 203 204      26.83329773       0.09999985
 0.60240479E 00 -C.S7837448E-02 -0.55C0C3C5E-01  0.9C5708C7E 00 -0.13087928E-01    -86.56828308
0.9C571E 00-0.13088E-01-0.86568E 02
333 194 193 204      26.16662598       0.29199964
 0.8565197CE 00  0.38366318E-02  0.76672971E-01  C.86335909E 00 -0.30027628E-02     84.90864963
0.86336E CC-0.3C028E-C2 C.84909E C2
334 194 204 205      26.83329773       0.48399931
 0.80816174E 00 -0.61893463E-03 -0.59002340E-01  0.81244338E 00 -0.49C05747E-02    -85.65571289
0.81244E CC-0.49CC6E-02-C.85856E C2
335 194 205 206      26.83329773       0.81733197
 0.79785025E 00 -0.3499221AE-01 -0.2597?523E 00  C.872222486 00 -0.10936445E 00    -74.02795410
0.87222E CC-0.10936E CO-C.74028E 02
336 195 194 206      26.16662598       1.27533035
 0.67808247E 00 -0.47543287E-01 -0.13494408E 00  0.7C236522E 0C -0.71826041E-01    -79.80476379
0.7C237E CC-0.71826E-C1-0.75805E C2
337 195 206 207      26.83329773       1.86666393
 0.5A128947E 00 -0.16686440E-01 -0.29860073E 00  C.704860516 0C -0.14025754E C0    -67.52345276
0.7C486E CC-0.14026E C0-0.67523E C2
338 196 195 207      26.16662598       2.49999619
 0.48596954E 00 -0.51068544E-01 -0.20063013E 00  C.55264425E 00 -0.11774325E 00    -71.62219238
0.55264E 0C-0.11774E C0-0.71622E 02
339 196 207 208      26.83329773       3.23332882
```

```
 0.36094695E 00 -0.11338353E-01 -0.34629834E 00  0.56796C20E 00 -0.21835166E 00    -59.13377380
0.56756E CC-0.21835E C0-C.59134E 02
340 197 196 208      26.16662598       4.C3332806
 0.26727068E 00 -0.47650456E-01 -0.2622C238E CC  C.41565949E 0C -0.19603902E 00    -60.49745178
0.41566E CC-0.19604E 00-0.60497E 02
341 197 208 209      26.83329773       4.96666050
 0.12012863E 00 -0.17203987E-01 -0.387672I3E 0C  C.445168E1E CC -0.34224397F 00    -50.02578735
0.44517E CC-0.34224E 00-0.50026E 02
342 198 197 209      26.16662598       5.99998760
-0.146722I9E-01 -0.66828668E-01 -C.29845494E 00  C.25884145E 0C -0.34034240E 00    -47.5CC28772
0.25884E 00-0.34034E 00-0.47500E 02
343 198 2C9 210      26.83329773       7.03332138
-0.15473706E CC -C.52875957E-02 -C.39096C28E CC  C.31565434E 0C -0.47967893E 00    -39.73416158
0.31565E CC-0.47968E 00-0.39734E 02
344 199 198 210      26.16662598       7.96665478
-0.30485344E 00 -0.858516G9E-01 -C.27228928E 0C  C.98129749E-01 -0.48883486E 00    -34.04873657
0.98130E-01-0.48883E C0-0.34049E C2
345 199 210 211      26.83329773       8.76665211
-0.3842260AE CO -0.57373C47E-02 -0.35907501E 00  C.21091020E 00 -0.60087359F 0C    -3..10690308
0.21091E 00-0.60087E C0-C.31107E C2
346 200 199 211      26.16662598       9.49998379
-0.52478123E 00 -C.67083359E-01 -0.21683693E 0C  C.19329548E-01 -0.61119413E 00    -21.72964478
0.19330E-01-0.61119E 00-0.21730E C2
347 200 211 212      26.83329773      10.13331890
-0.600533I3E 00  0.1C592461E-01 -C.31601167E CC  C.14461118E 0C -C.73455185E 00    -22.98320C07
0.14461E CC-0.73455E C0-C.229B3E 02
348 201 200 212      26.16662598      10.77465057
-0.706071B5E 00 -0.34977913E-01 -0.167721J9E 0C  0.46046376E-02 -0.74565440E 00    -13.27990723
0.46046E-02-0.74565E C0-C.13280E 02
349 201 212 213      26.83329773      11.18264961
-0.801707B6E 00  0.34308434E-01 -0.29221667E 00  0.12065828E 0C -0.86805771E 0C    -17.01377869
0.12066E CC-0.88806E C0-C.17014E 02
350 201 213 214      26.83329773      11.51598263
-0.81134701E 00  0.21734238E-02 -0.46569824E-01  0.4P3C5392E-02 -0.814CC412E 00     -3.26580143
0.4E305E-02-0.81400E 00-0.32658E C1
351 202 201 214      26.16662598      11.70798397
-0.84612656E 00 -0.53215027E-02  0.47291934E-01 -C.266999C1E-02 -0.84877807E 00      3.20927238
-0.26700E-02-0.84878E C0 C.32093E 01
352 202 214 215      26.83329773      11.89998531
-0.875458?2E 00  0.559641425-02 -0.41982591E-01  C.11982441E-01 -0.87744474E 00     -2.70861149
0.11982E-01-0.87744E C0-0.27086E C1
353 204 203 216      28.16662598       0.09999985
 0.91318417E 00 -0.65660477E-02  C.53365707E-01  C.91627CC8E 0C -0.96519589E-02     86.69670105
0.91627E CC-0.96520E-02 0.86697E 02
354 204 216 217      28.83329773       C.29199964
 0.88266945E 00 -C.32358170E-02 -0.29786766E-01  C.88366973E 0C -0.42361021E-02    -88.08283997
0.88367E 0C-0.42361E-02-0.88083E 02
355 205 204 217      28.16662598       0.48399931
 0.86019802E 00  0.14991760E-01  0.49819767E-01  C.86312443E 00  0.12065351E-01     86.64457753
0.86312E CC 0.12065E-01 C.86645E 02
356 206 205 217      28.16662598       0.81733161
 0.84593744E 00 -0.19381523E-01 -0.15093875E 00  C.87539893E 00 -0.44843018E-01    -80.43087769
0.87540E CC-0.44843E-01-0.80431E C2
357 206 217 218      28.83329773       1.22533035
 0.73813343E 00  0.36C7463AE-01 -0.27991229E 00  C.83607227E 00 -0.61864197E-01    -70.72064209
0.83607E CC-0.61864E-01-0.7C721E 02
358 207 206 218      28.16662598       1.86666393
 0.667306B0E 00  0.91102123E-07 -0.17893070E 00  0.712804I4E 00 -0.36387026E-01    -75.73901367
0.71280E CC-0.36387E-01-0.75739E 02
359 207 218 219      28.83329773       2.49999619
```

```
 0.542254578 00  0.561418538-01 -0.326100598 00  0.7C591420E 00 -0.10751778E 00    -63.35394287
0.7C591E CC-0.10752E 00-0.6[illegible]54E 02
360 208 207 219      28.16662598       3.23332882
 0.4420948CE 00  0.12000786E-01 -0.224582318 00  0.538140128 0C -0.83044589E-0[illegible]    -66.85026550
0.53814E CC-0.83045E-01-0.6685CE 02
361 208 219 220      28.83329773       4.C3332806
 0.29781187E 00  0.48295021E-01 -0.366858248 00  0.580544858 00 -0.21443796E 0C    -54.39483643
0.56054E CC-0.21444E C0-0.54395E 02
362 209 208 220      28.16662598       4.96666C5C
 0.17172498E C0 -0.17267466E-02 -0.26592916E 00  0.364712548 00 -0.19471437E 0C    -54.03512573
0.36471E 0C-0.19471E C0-0.54035E 02
363 209 220 221      28.83329773       5.99998760
-0.130803598-01  0.32995224E-01 -0.3P805866E 0C  0.398699228 00 -0.37878436E 00    -43.30442610
0.3987CE 0C-0.37878E C0-0.43304E 02
364 21C 2C9 221      28.16662598       7.C3332138
-0.18642521E 00 -0.18792987E-01 -0.27335304E 00  0.183305208 00 -0.38852340E 00    -36.47930908
0.1E331E CC-0.38852E C0-0.36479E 02
365 210 221 222      28.83329773       7.96665478
-0.31608820E 00  0.15548706E-01 -0.38458335E 0C  0.268538188 0C -0.569C7767E 00    -33.34045410
0.26854E 0C-0.56908E 00-0.33340E 02
366 211 210 222      28.16662598       8.76665211
-0.46365070E 00 -0.29558182E-01 -0.25C45305E 0C  0.848103178-01 -0.57801920E 00    -24.54544067
0.84810E-01-0.57802E 00-0.24545E 02
367 211 222 223      28.83329773       9.49998379
-0.555718C6E 00  0.12560434E-02 -0.358080C2E CC  0.176427668 0C -0.73084968E 00    -26.06442261
0.17643E 00-0.73085E 00-0.26064E 02
368 212 211 223      28.16662598      10.13331890
-0.684938438 00 -0.14717102E-01 -0.21913034E 00  0.5C568581E-01 -0.75022411E 00    -16.59162903
0.5C569E-01-0.75022E 00-0.16592E 02
369 212 223 224      28.83329773      10.77465057
-0.741230018 00  0.13773919E-01 -0.31838727E 00  0.130112118 00 -0.857568208 00    -20.67368469
0.13011E CC-0.85757E C0-0.2C074E C2
370 213 212 224      28.16662598      11.18264961
-0.649884998 00  0.15872665E-01 -0.20197719E 0C  0.644876368-01 -0.89449996E 00    -12.45702076
0.64488E-01-0.89450E 00-0.12457E 02
371 214 213 224      28.16662598      11.51598263
-0.859677318 00 -0.12267113E-01  0.33688426E-01 -0.1C93C061E-01 -0.861014378 00     2.27297115
-0.1C930E-01-0.861C1E C0 C.22730E C1
372 214 224 225      28.83329773      11.70798397
-0.87641048E 00  0.49753189E-02 -0.29188573E-01  0.594C7949E-02 -0.87737596E 00    -1.69463139
0.59408E-02-0.87738E C0-0.18946E 01
373 215 214 225      28.16662598      11.89998531
-0.902750028 00  0.18463135E-02  0.37927568E-01  0.343364488-02 -0.90433735E 00     2.3966999.
0.34336E-02-0.90434E 00 0.23967E 01
374 216 226 227      30.49995422       0.C9999985
 0.931586278 00 -0.19378662E-02 -0.96435547E-02  0.931685818 00 -0.20374060E-02    -89.41471863
0.93169E CC-0.20374E-02-0.89415E 02
375 217 216 227      29.99995422       0.29199964
 0.913455968 00  0.59957504E-02  0.3C393600E-01  0.914472708 0C  0.49790144E-02     88.09027100
0.91447E CC 0.49790E-02 0.88090E C2
376 217 227 228      30.49995422       0.48399931
 0.893257148 00  0.11749268E-01 -0.16302109E-01  0.893558388 00  0.11448026E-01    -89.94738770
0.89356E 0C 0.11448E-01-0.88947E C2
377 217 228 229      30.49995422       0.81733197
 0.951999668 00  0.2C756242E 00 -0.32483578E CC  0.1C738C778 01  0.8573424BE-01    -69.44781494
0.1C73BE 01 0.85734E-01-C.69450E 02
378 218 217 229      29.99995422       1.22533035
 0.7913E851E 00  0.52047779E-01 -0.20965576E CC  0.846702408 00 -0.32661557E-02    -75.22578430
0.84670E CC-0.32662E-02-0.75226E 02
379 218 229 230      30.49995422       1.86666393
```

```
 0.715681C8E 00  C.165593B3F CC -0.329962555E 0C  C.875754CCE 00  0.355203111C-01     44.12547302
0.87575E 0C C.35521E-01-0.A4125E 02
380 219 218 230      29.99995422       2.49999619
 0.5793438CE 00  C.6726265CC-01 -0.229765896 0C  C.667322226 CC -0.207157736-01     -69.05291748
0.66732E 00-0.20716E-01-0.690536 C2
381 219 230 231      30.49995422       3.23332882
 0.466301C2E C0  C.16267014E 0C -0.327014C9E 00  C.675021416 0C -0.460503106-01     -57.45565796
0.67502E CC-0.46050E-01-0.57456E C2
382 22C 219 231      29.99995422       4.03332806
 0.248224166 C0  C.63415647E-01 -C.2471714CE 0C  C.491078736 00 -0.794389256-01     -59.97821045
0.49108E CC-0.79439E-01-0.59978E C2
383 220 231 232      30.49995422       4.96666050
 C.174355396 C0  0.1C6668476 00 -0.346807516 00  C.490957386 0C -0.2C0933526 00     -47.77439880
0.49096E CC-0.20993E C0-0.47774C C2
384 221 220 232      29.99995422       5.99998760
 0.477218636-02  0.3835043E-01 -0.262387286 00  0.284485046 0C -0.241362456 00     -43.17257690
0.28449E CC-0.24136E C0-C.431736 C2
385 221 232 233      30.49995422       7.03332138
-0.190917976 00  0.395846106-01 -0.351731306 00  0.294465C1E 0C -0.445798816 00     -35.93145752
0.29447E CC-0.44580E C0-0.35991E C2
386 222 221 233      29.99995422       7.96665478
-0.346846586 00  0.6324768 1E-02 -0.25770664E 00  C.142141296 00 -0.482663C9E 00     -27.79214476
0.14214E CC-0.48266E C0-0.27792E 02
387 222 233 234      30.49995422       8.76665211
-0.472574C5E 00 -0.38171768E-01 -0.343441436 00  0.150985596 0C -0.661735776 00     -28.84683228
0.15059E CC-0.66174E C0-C.28F47F C2
388 223 222 234      29.99995422       9.49998379
-0.5R278942E 00 -0.681781776-02 -0.252998356 00  C.885290506-01 -0.678136296 00     -20.65130615
0.88529E-01-0.67814E C0-0.20651E 02
389 223 234 235      30.49995422      10.13331890
-0.717193606 00 -0.1C941982E C0 -0.353466956 0C  C.528328426-01 -0.879446276 00     -24.65344727
0.52833E-01-C.87945E C0-0.2465RE 02
390 224 223 235      29.99995422      10.77465057
-0.79C772446 00 -C.1C747910E-02 -0.243672376 C0  C.6R06C994E-01 -0.859908226 00     -15.84109592
0.68061E-01-0.85991E C0-C.158416 02
391 224 235 236      30.49995422      11.18264961
-0.538235286 0C -C.1EC06470E CC -C.346542216 0C -C.267813FCE-01 -0.107151796 01     -20.92649731
-0.26781E-01-0.10715E 01-0.20928E 02
392 224 236 237      30.49995422      11.51598263
-0.899327716 00 -0.103607186-01 -C.1499829 1E-01 -C.1C033667E-01 -0.893454766 00      -1.10232735
-0.1C034E-01-0.89365E C0-0.11023E C1
393 225 224 237      29.99995422      11.70798397
-0.512682536 00 -0.5E794022E-02  C.27C03288E-01 -0.5C7605C8E-02 -0.913485886 00      1.70417891
-0.50761E-C2-0.91349E 00 0.17C42E C1
394 225 237 238      30.49995422      11.89998531
-C.929262166 00  0.2C5993656-02 -0.1C117531E-01  C.216978796-02 -0.929372016 00     -0.62211156
0.21698E-02-C.92937E C0-0.62211E C0
```